


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Lockhart Central School (2418)  
**Region :** Riverina  
**State Electorate :** Wagga Wagga  
**Local Government Area :** Lockhart

**Initial Survey :** Noel Arnold & Associates : 23 - Feb - 2008  
**Reviewed By :** Parsons Brinckerhoff : 07 - Feb - 2017

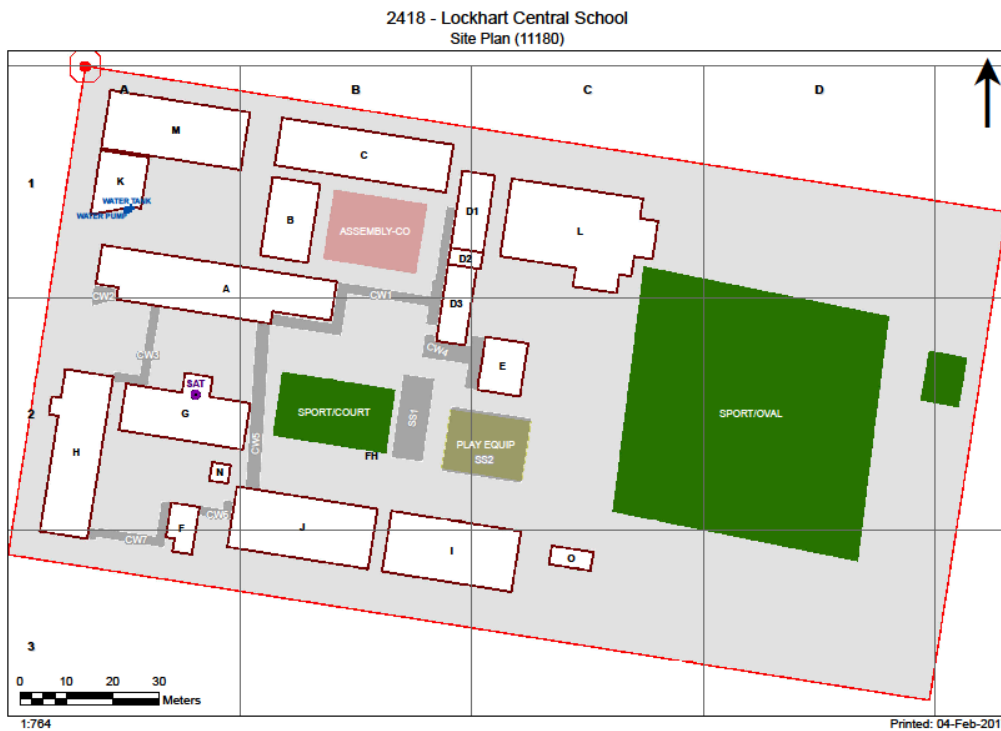

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration/General Learning - 1964 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	60m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B0D3/R0010/Ceiling Structures/Linings/S6			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Gable Ends	Flat AC Sheeting	6m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00A/Gable Ends/S8			<b>Chrysotile (white asbestos)</b>		
Gable verge lining	Flat AC Sheeting	36m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00A/Gable verge lining/S9			<b>Chrysotile (white asbestos)</b>		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00A - R0002 - Clerical Office/Workroom**

No Asbestos

**B00A - R0003 - Staff Toilet**

Wall Linings Internal	Flat AC Sheeting	10m2	South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00A/R0003/Wall Linings Internal/S10			<b>Chrysotile (white asbestos)</b>		

**B00A - R0005 - Staff Room**

Repair panel to wall	Flat AC Sheeting	2m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00A/R0005/Repair panel to wall/S11			<b>Chrysotile (white asbestos)</b>		

**B00A - R0006 - General Learning Space**

No Asbestos

**B00A - R0007 - General Storeroom**

No Asbestos

**B00A - R0008 - General Storeroom**

No Asbestos

**B00A - R0009 - General Learning Space**

No Asbestos

**B00A - R0010 - Staff Room Annexe**

No Asbestos

**B00A - R0011 - Staff Room Annexe**

No Asbestos

**B00A - R0012 - Food Technology L.S.**

No Asbestos

**B00A - R0013 - Laundry**

No Asbestos

**B00A - R0014 - Food/Research Space**

No Asbestos

**B00A - R0015 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	99m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00B/R0002/Ceiling Structures/Linings/S1			<b>Chrysotile (white asbestos)</b>		

**B00A - R0017 - Movement**

No Asbestos

**B00A - R0018 - Movement**

No Asbestos

**B00A - R0019 - General Storeroom**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R0020 - No Access</b>						
No Asbestos						
<b>B00A - R0021 - Movement</b>						
No Asbestos						
<b>B00A - R0022 - Movement</b>						
No Asbestos						
<b>B00A - R0026 - Movement</b>						
No Asbestos						
<b>B00A - R0027 - Staff - Toilet</b>						
No Asbestos						
<b>B00A - R0028 - Entry Vestibule</b>						
No Asbestos						
<b>B00A - R0029 - Principal</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Art - 1970 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00B/R0002/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos)</b>	
Infill panels to window	Flat AC Sheeting	7m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00B/Infill panels to window/S13				<b>Chrysotile (white asbestos)</b>	
Gable verge lining	Flat AC Sheeting	32m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00B/Gable verge lining/S12				<b>Chrysotile (white asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00B - R0002 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	32m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00B/R0002/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos)</b>	
Infill panels to window	Flat AC Sheeting	7m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00B/Infill panels to window/S13				<b>Chrysotile (white asbestos)</b>	

**B00B - R0003 - Materials Store**

No Asbestos

**B00B - R0004 - Welding Area**

Floor Coverings Res/Textile	Compressed AC Sheet					
	2418/B00B/R0004/Floor Coverings Res/Textile/S14				<b>No Asbestos Detected</b>	

**B00B - R0005 - General Learning Space**

No Asbestos

**B00B - R0006 - General Learning Space**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Science - 1970 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Infill panels to window	Flat AC Sheeting	30m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2418/B00C/Infill panels to window/S16					<b>Chrysotile (white asbestos)</b>	
Eaves Linings	Flat AC Sheeting	22m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2418/B00B/R0002/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>	
Gable verge lining	Flat AC Sheeting	30m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2418/B00C/Gable verge lining/S15					<b>Chrysotile (white asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00C - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	68m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2418/B00B/R0002/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>	

**B00C - R0007 - General Storeroom**

No Asbestos

**B00C - R0008 - Interview**

No Asbestos

**B00C - R0009 - Staff Room Annexe**

No Asbestos

**B00C - R0010 - Special Programs Room**

No Asbestos

**B00C - R0011 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00C - R0012 - Laboratory L.S.**

No Asbestos

**B00C - R0013 - Staff Study**

No Asbestos

**B00C - R0014 - Chemical Store**

No Asbestos

**B00C - R0015 - Laboratory L.S.**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Pupil Facilities - 1964 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	7m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00B/R0002/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos)</b>	
Gable verge lining	Flat AC Sheeting	20m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00E/Gable verge lining/S17				<b>Chrysotile (white asbestos)</b>	
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

**Interior**

**B00E - R0001 - Shower/Change**

Ceiling Structures/Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00B/R0002/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos)</b>	
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00F/R0003/Partition Walls (Cubicles)/S3				<b>Chrysotile (white asbestos)</b>	

**B00E - R0002 - No Access**

Non Accessible

**B00E - R0003 - Shower/Change**

Ceiling Structures/Linings	Flat AC Sheeting	38m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00B/R0002/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos)</b>	

**B00E - R0004 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00B/R0002/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Pupil Facilities - 1970 - Brick/Block (Brick/Block)**

**Exterior**

Gable verge lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00F/Gable verge lining/S18				<b>Chrysotile (white asbestos)</b>	
Eaves Linings	Flat AC Sheeting	6m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00B/R0002/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00F - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00B/R0002/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos)</b>	

**B00F - R0002 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00F/R0003/Partition Walls (Cubicles)/S3				<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00F/R0002/Ceiling Structures/Linings/S19				<b>Chrysotile (white asbestos)</b>	

**B00F - R0003 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00F/R0003/Partition Walls (Cubicles)/S3				<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00F/R0002/Ceiling Structures/Linings/S19				<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - General Learning - 1903 - Brick/Block (Brick/Block)**

**Exterior**

Infill panel to wall	Flat AC Sheeting	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00G/Infill panel to wall/S20					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00G - R0002 - Interview**

Floor Coverings Res/Textile	Vinyl Tiles					
	2418/B00G/R0002/Floor Coverings Res/Textile/S7					<b>No Asbestos Detected</b>

**B00G - R0003 - General Learning Space**

No Asbestos

**B00G - R0004 - Movement**

No Asbestos

**B00G - R0005 - Darkroom Space**

No Asbestos

**B00G - R0006 - Home Base**

No Asbestos

**B00G - R0007 - Music Learning Space**

No Asbestos

**B00G - R0008 - Home Base**

No Asbestos

**B00G - R0012 - Movement**

No Asbestos

**B00G - R0013 - Staff Room**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - General Learning/Administration - 1970 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Gable verge lining	Flat AC Sheeting	30m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00H/Gable verge lining/S21				<b>Chrysotile (white asbestos)</b>	
Eaves Linings	Flat AC Sheeting	15m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00B/R0002/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos)</b>	
Infill panels to window	Flat AC Sheeting	22m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00H/Infill panels to window/S22				<b>Chrysotile (white asbestos)</b>	
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

**Interior**

**B00H - R0001 - Staff Room Annexe**

No Asbestos

**B00H - R0002 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	65m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00B/R0002/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos)</b>	
Infill panels to window	Flat AC Sheeting	20m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00H/Infill panels to window/S22				<b>Chrysotile (white asbestos)</b>	

**B00H - R0003 - Sick Bay**

No Asbestos

**B00H - R0004 - No Access**

No Asbestos

**B00H - R0005 - Movement**

No Asbestos

**B00H - R0006 - Staff Room Annexe**

No Asbestos

**B00H - R0007 - Personal Effects Storage**

No Asbestos

**B00H - R0008 - Home Base**

No Asbestos

**B00H - R0009 - Home Base**

No Asbestos

**B00H - R0010 - Personal Effects Storage**

No Asbestos

**B00H - R0011 - General Storeroom**

No Asbestos

**B00H - R0013 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
	2418/B00H/R0013/Floor Coverings Res/Textile/S2					

**B00H - R0015 - Duplicating Workroom**

No Asbestos

**B00H - R0016 - Movement**

Infill panels to window	Flat AC Sheeting	1m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00H/Infill panels to window/S22				<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00B/R0002/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00H - R0017 - General Storeroom</b>						
No Asbestos						
<b>B00H - R0018 - Distribution Board</b>						
					Note: No inspection of live electrical installation.	
Wall Linings Internal	Flat AC Sheeting	3m2	North facing, South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2418/B00H/R0018/Wall Linings Internal/S23					Chrysotile (white asbestos)	
<b>B00H - R0019 - Movement</b>						
No Asbestos						
<b>B00H - R0020 - Staff - Toilet</b>						
No Asbestos						
<b>B00H - R0021 - Movement</b>						
No Asbestos						
<b>B00H - R0022 - Toilets-Unisex</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00I - General Learning - 1997 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00I - R0001 - General Learning Space**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00I - R0002 - General Learning Space**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00I - R0003 - General Learning Space**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00I - R0004 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00I - R0005 - Movement**

No Asbestos

**B00I - R0006 - Movement**

No Asbestos

**B00I - R0007 - Movement**

No Asbestos

**B00I - R0008 - Movement**

No Asbestos

**B00I - R001A - General Storeroom**

No Asbestos

**B00I - R001B - Withdrawal Space - 1hb**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00I - R002A - General Storeroom**

No Asbestos

**B00I - R003A - General Storeroom**

No Asbestos

**B00I - R003B - Clerical Office/Workroom**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Library - 1997 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00J - R0001 - Reading Area**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00J - R0002 - Seminar/Study**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00J - R0003 - Seminar/Study**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00J - R0004 - Library Office/Workroom**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00J - R0005 - Communications Room**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00J - R0006 - General Learning Space**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00J - R0007 - Home Base Store**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00J - R0008 - Home Base Store**

No Asbestos

**B00J - R0009 - Plant**

No Asbestos

**B00J - R0010 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00J - R0011 - Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Music - 1997 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00K - R0001 - Music Learning Space**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00K - R0002 - Music Store**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00K - R0003 - Practice/Seminar**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00K - R0004 - Cleaning Distributed Store**

No Asbestos

**B00K - R0005 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00K - R0006 - Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Communal Facilities - 1997 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00L - R0001 - Sports Store**

No Asbestos

**B00L - R0002 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00L - R0003 - Multi-Purpose Space**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - Technological & Applied Studies - 1997 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00M - R0001 - Metal Technology Bay**

No Asbestos

**B00M - R0002 - Materials Store**

No Asbestos

**B00M - R0003 - Dust Extraction Space**

No Asbestos

**B00M - R0004 - No Access**

No Asbestos

**B00M - R0005 - Movement**

No Asbestos

**B00M - R0006 - Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00N - Other/Storage - 2000 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior**

**B00N - R0001 - Sports Store**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B000 - Storage - 2013 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior**

**B000 - R0001 - Garage/Carport**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B0D1 - Pupil Facilities - 1964 - Brick/Block (Brick/Block)</b>						
<b>Exterior</b>						
Eaves Linings	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00B/R0002/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos)</b>	
Gable verge lining	Flat AC Sheeting	26m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B0D1/Gable verge lining/S24				<b>Chrysotile (white asbestos)</b>	
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
<b>Interior</b>						
<b>B0D1 - R0001 - Canteen</b>						
Ceiling Structures/Linings	Flat AC Sheeting	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B0D1/R0005/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos)</b>	
Infill panel above door	Flat AC Sheeting	1m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B0D1/R0005/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos)</b>	
<b>B0D1 - R0002 - General Storeroom</b>						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B0D1/R0005/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos)</b>	
<b>B0D1 - R0003 - Staff Shower/Change</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B0D1/R0005/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos)</b>	
<b>B0D1 - R0004 - Staff Toilet</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B0D1/R0005/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos)</b>	
<b>B0D1 - R0005 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B0D1/R0005/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos)</b>	
Upper wall infill panel	Flat AC Sheeting	5m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B0D1/R0005/Upper wall infill panel/S5				<b>Chrysotile (white asbestos)</b>	
<b>B0D1 - R0006 - Kiln Room</b>						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B0D1/R0005/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos)</b>	
Upper wall infill panel	Flat AC Sheeting	1m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B0D1/R0005/Upper wall infill panel/S5				<b>Chrysotile (white asbestos)</b>	
<b>B0D1 - R0007 - General Storeroom</b>						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B0D1/R0005/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos)</b>	
<b>B0D1 - R0008 - General Assistant/Bulk Store</b>						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B0D1/R0005/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B0D2 - Building Services - 1972 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B0D2 - R0007 - Garden Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B0D3 - Pupil Facilities - 1964 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B0D3/R0010/Ceiling Structures/Linings/S6			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Gable Ends	Flat AC Sheeting	6m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B0D3/Gable Ends/S25			<b>Chrysotile (white asbestos)</b>		
Gable verge lining	Flat AC Sheeting	16m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B0D3/Gable verge lining/S26			<b>Chrysotile (white asbestos)</b>		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B0D3 - R0008 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B0D1/R0005/Ceiling Structures/Linings/S4			<b>Chrysotile (white asbestos)</b>		
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00F/R0003/Partition Walls (Cubicles)/S3			<b>Chrysotile (white asbestos)</b>		

**B0D3 - R0009 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B0D1/R0005/Ceiling Structures/Linings/S4			<b>Chrysotile (white asbestos)</b>		
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B00F/R0003/Partition Walls (Cubicles)/S3			<b>Chrysotile (white asbestos)</b>		

**B0D3 - R0013 - Cleaning Distributed Store**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B0D3/R0013/Ceiling Structures/Linings/S27			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B0D3 - R0014 - Cleaning Distributed Store**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B0D3/R0013/Ceiling Structures/Linings/S27			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B0D3 - R0015 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B0D3/R0013/Ceiling Structures/Linings/S27			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B0D3 - R0016 - Toilets-Girls**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B0D3/R0013/Ceiling Structures/Linings/S27			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B0D3 - R0017 - Toilets-Girls**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B0D3/R0013/Ceiling Structures/Linings/S27			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B0D3 - R0018 - Toilets-Girls**

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2418/B0D3/R0013/Ceiling Structures/Linings/S27			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
<b>B0D3 - R0019 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2418/B0D3/R0013/Ceiling Structures/Linings/S27				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B0D3 - R0020 - Toilets-Boys</b>						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2418/B0D3/R0013/Ceiling Structures/Linings/S27				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B0D3 - R0021 - Toilets-Boys</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2418/B0D3/R0013/Ceiling Structures/Linings/S27				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017