


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Lowanna Public School (2428)
Region : North Coast
State Electorate : Coffs Harbour
Local Government Area : Coffs Harbour

Initial Survey : Noel Arnold & Associates : 20 - May - 2008
Reviewed By : Grencap-NAA : 05 - May - 2016

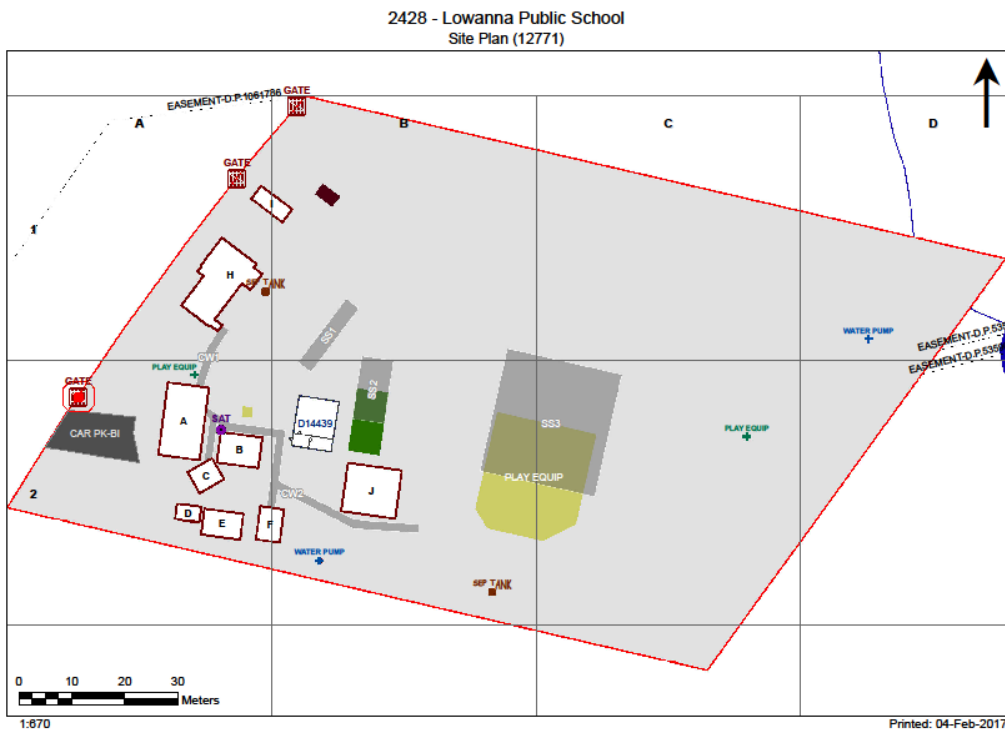

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1922 - Timber (Timber)

Exterior

Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

Interior

B00A - R0001 - Staff Kitchen

Floor Coverings Res/Textile	Vinyl Tiles					
	2428/B00A/R0001/Floor Coverings Res/Textile/S9					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
	2428/B00A/R0001/Floor Coverings Res/Textile/S10					No Asbestos Detected

B00A - R0002 - Staff Room

Wall Linings Internal	Flat AC Sheeting	60m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2428/B00A/R0002/Wall Linings Internal/S13					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Height Restriction

Floor Coverings Res/Textile	Adhesive					
	2428/B00A/R0002/Floor Coverings Res/Textile/S12					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	2428/B00A/R0002/Floor Coverings Res/Textile/S11					No Asbestos Detected

B00A - R0003 - Principal

Floor Coverings Res/Textile	Adhesive					
	2428/B00A/R0002/Floor Coverings Res/Textile/S12					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	2428/B00A/R0002/Floor Coverings Res/Textile/S11					No Asbestos Detected

B00A - R0004 - Clerical Office

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	2428/B00A/R0002/Floor Coverings Res/Textile/S11					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
	2428/B00A/R0002/Floor Coverings Res/Textile/S12					No Asbestos Detected

B00A - R0005 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library - 1922 - Timber (Timber)

Exterior

Ceiling Voids	Non Accessible Area - Height Restriction 4m height
Underfloor Voids	No Asbestos Found

Interior

B00B - R0001 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	2428/B00B/R0001/Floor Coverings Res/Textile/S1	No Asbestos Detected
Floor Coverings Res/Textile	Adhesive	2428/B00B/R0001/Floor Coverings Res/Textile/S2	No Asbestos Detected

B00B - R0002 - Reading Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1984 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible
Underfloor Voids	No Asbestos Found

Interior

B00C - R0001 - Canteen

No Asbestos

B00C - R0002 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Shed - 1982 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00D - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1977 - Timber (Timber)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting 2428/B00E/Eaves Linings/S15					No Asbestos Detected
Underfloor Voids	No Asbestos Found					

Interior

B00E - R0001 - Withdrawal Space - 1hb

No Asbestos

B00E - R0002 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities - 1922 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting 2428/B00F/Eaves Linings/S18	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	Non Accessible Area - Area inaccessible					

Interior

B00F - R0001 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting 2428/B00F/Eaves Linings/S18	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0002 - Toilets - Boys

No Asbestos

B00F - R0003 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet 2428/B00F/R0003/Partition Walls (Cubicles)/S17	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Flue	Fibre Cement Pipe 2428/B00F/R0003/Flue/S16	1m	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Crocidolite (blue asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Administration - 1962 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2428/B00H/Eaves Linings/S7					Chrysotile (white asbestos)
Wall Cladding	Flat AC Sheeting	500m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2428/B00H/Wall Cladding/S6					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Downpipes	Fibre Cement Pipe	4m	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2428/B00H/Downpipes/S8					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Electrical Hazard

Interior**B00H - R0001 - Entry Vestibule**

No Asbestos

B00H - R0002 - Clerical Office

No Asbestos

B00H - R0003 - Sick Bay

No Asbestos

B00H - R0007 - General Storeroom

Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2428/B00H/R0008/Wall Linings Internal/S3					Chrysotile (white asbestos)

B00H - R0008 - Movement

Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2428/B00H/R0008/Wall Linings Internal/S3					Chrysotile (white asbestos)

B00H - R0009 - Staff Toilet

Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2428/B00H/R0009/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)

Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	2428/B00H/R0009/Floor Coverings Res/Textile/S5					

B00H - R0011 - Staff Shower/Change

No Asbestos

B00H - R0012 - Movement

No Asbestos

B00H - R0013 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2428/B00H/Eaves Linings/S7					Chrysotile (white asbestos)

B00H - R0014 - Movement

No Asbestos

B00H - R0015 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2428/B00H/Eaves Linings/S7					Chrysotile (white asbestos)

B00H - R0016 - Principal

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - R0017 - Staff Room

Wall Linings Internal	Flat AC Sheeting	14m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
2428/B00H/R0008/Wall Linings Internal/S3					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Building Services - 1962 - Timber Shed (Timber Shed)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2428/B001/Wall Cladding/S14			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Cladding	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2428/B001/Wall Cladding/S14			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					

Interior

B001 - R0001 - General Assistant/Bulk Store

Wall Linings Internal	Flat AC Sheeting	100m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2428/B001/Wall Cladding/S14			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00J - R0001 - Home Base

No Asbestos

B00J - R0002 - Home Base Store

No Asbestos

B00J - R0003 - Practical Activities - 1hb

No Asbestos

B00J - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D14439 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos		10 m2
---------	---------------	------------------	--	-------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017