


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Lowesdale Public School (2429)
Region : Riverina
State Electorate : Albury
Local Government Area : Corowa

Initial Survey : Noel Arnold & Associates : 04 - Apr - 2008
Reviewed By : Greencap-NAA : 07 - Jul - 2016

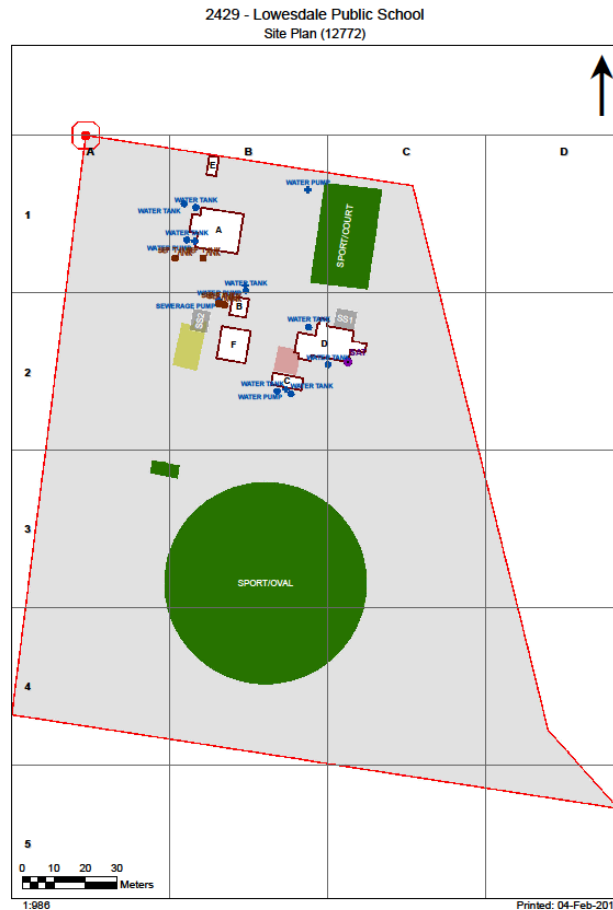

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Library - 1980 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2429/B00A/Eaves Linings/S5					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Under Floor Void	Debris					No Asbestos Detected
	2429/B00A/Under Floor Void/S7					

Interior

B00A - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	32m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2429/B00A/Eaves Linings/S5					Chrysotile (white asbestos)

B00A - R0002 - General Storeroom

Floor Coverings Res/Textile	Vinyl sheet under carpet					
	2429/B00A/R0002/Floor Coverings Res/Textile/S8					No Asbestos Detected

B00A - R0003 - Reading Area

No Asbestos

B00A - R0004 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2429/B00D/R0004/Wall Linings Internal/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0005 - Movement

No Asbestos

B00A - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2429/B00A/Eaves Linings/S5					Chrysotile (white asbestos)

B00A - R0007 - Staff Kitchen

Ceiling Structures/Linings	Flat AC Sheeting	0.5m2	In cupboard	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	2429/B00A/R0007/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)

B00A - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2429/B00A/Eaves Linings/S5					Chrysotile (white asbestos)

B00A - R0009 - Withdrawal Space - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2429/B00D/R0004/Wall Linings Internal/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	16m2	North facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2429/B00D/R0004/Wall Linings Internal/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0010 - Principal

No Asbestos

B00A - R0011 - Movement

No Asbestos

B00A - R0012 - Reading Area

No Asbestos

B00A - R0013 - General Storeroom

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2429/B00A/Eaves Linings/S5					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2429/B00A/Eaves Linings/S5					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities - 1970 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible

Interior**B00B - R0001 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2429/B00B/R0002/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	

B00B - R0002 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2429/B00B/R0002/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	

B00B - R0003 - Cleaning Supplies

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2429/B00B/R0002/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	

B00B - R0004 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2429/B00B/R0002/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Communal Facilities - 1980 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Wall Cladding	Flat AC Sheeting 2429/B00C/Wall Cladding/S2					No Asbestos Detected
Eaves Linings	Flat AC Sheeting 2429/B00C/Eaves Linings/S6					No Asbestos Detected

Interior

B00C - R0001 - Sports Store

No Asbestos

B00C - R0002 - Shelter

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1903 - Timber (Timber)

Exterior

Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

Interior

B00D - R0001 - Withdrawal Space - 1hb

No Asbestos

B00D - R0003 - General Storeroom

No Asbestos

B00D - R0004 - Practical Activities - 1hb

Wall Linings Internal	Flat AC Sheeting	4m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2429/B00D/R0004/Wall Linings Internal/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00D - R0005 - Staff Kitchen

Wall Linings Internal	Flat AC Sheeting	2m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2429/B00D/R0004/Wall Linings Internal/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)		

Electrical Mounting Board	Resinous Board	1Unit	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

B00D - R0006 - Movement

Wall Linings Internal	Flat AC Sheeting	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2429/B00D/R0004/Wall Linings Internal/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00D - R0007 - External Movement

No Asbestos

B00D - R0008 - Home Base

No Asbestos

B00D - R0009 - Home Base Store

No Asbestos

B00D - R0010 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Building Services - 2009 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00E - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00F - R0001 - Reading Area

No Asbestos

B00F - R0002 - K.L.A. Store

No Asbestos

B00F - R0003 - Practical Activities

No Asbestos

B00F - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017