


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Luddenham Public School (2431)
Region : Western Sydney
State Electorate : Camden
Local Government Area : Liverpool

Initial Survey : Noel Arnold & Associates : 12 - Jun - 2008
Reviewed By : Parsons Brinckerhoff : 25 - Nov - 2016

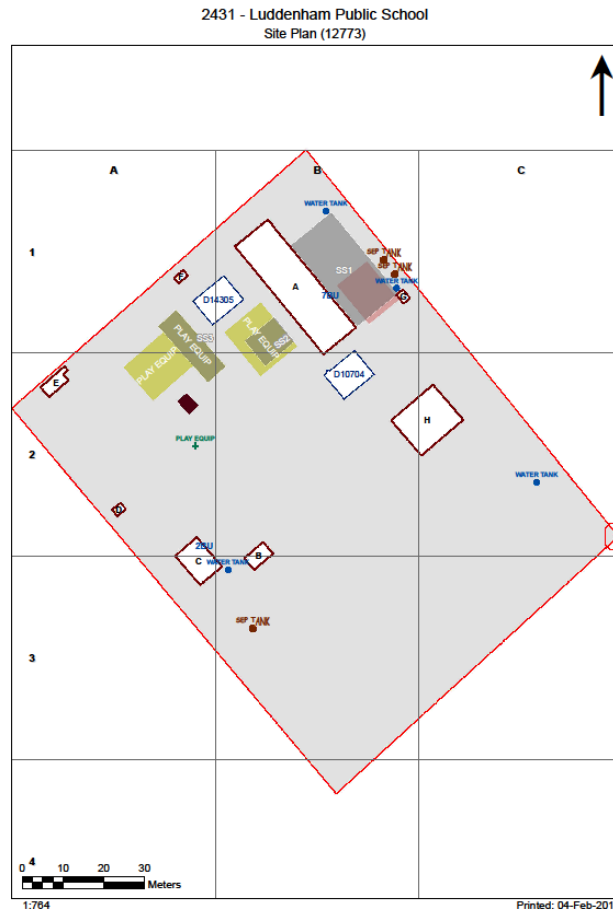

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Pupil Facilities - 1969 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2431/B00A/R0001/Ceiling Structures/Linings/S2				Chrysotile (White asbestos)	
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2431/B00A/Gable Verge Lining/S6				Chrysotile (white asbestos)	
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00A - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2431/B00A/R0001/Ceiling Structures/Linings/S2				Chrysotile (White asbestos)	

B00A - R0002 - Toilets - Girls

No Asbestos

B00A - R0003 - Cleaning Distributed Store

No Asbestos

B00A - R0004 - Staff Toilet

No Asbestos

B00A - R0005 - Staff Toilet

No Asbestos

B00A - R0006 - General Storeroom

No Asbestos

B00A - R0007 - Toilets - Boys

No Asbestos

B00A - R0008 - Home Base

No Asbestos

B00A - R0009 - Practical Activities - 1hb

No Asbestos

B00A - R0010 - Toilets - Boys/Girls

No Asbestos

B00A - R0011 - Home Base Store

No Asbestos

B00A - R0012 - Personal Effects Storage

No Asbestos

B00A - R0013 - Staff Room Annexe

Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2431/B00A/R0013/Floor Coverings Res/Textile/S3				Chrysotile (White asbestos)	

B00A - R0014 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2431/B00A/R0013/Floor Coverings Res/Textile/S3				Chrysotile (White asbestos)	

B00A - R0015 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2431/B00A/R0013/Floor Coverings Res/Textile/S3				Chrysotile (White asbestos)	

B00A - R0016 - Home Base

No Asbestos

B00A - R0017 - Practical Activities - 1hb

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - R0018 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2431/B00A/R0001/Ceiling Structures/Linings/S2					Chrysotile (White asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities - 1947 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	4m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2431/B00B/Eaves Linings/S4				Chrysotile (white asbestos)	
Underfloor Voids	No Asbestos Found					

Interior

B00B - R0001 - Canteen

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1914 - Timber (Timber)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00C - R0001 - Reading Area

No Asbestos

B00C - R0002 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Electrical Services - 1969 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	2m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2431/B00D/Eaves Linings/S5				Chrysotile (white asbestos)	
Underfloor Voids	No Asbestos Found					

Interior

B00D - R0001 - Main Switch Board

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2431/B00D/R0001/Ceiling Structures/Linings/S7				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Communal Facilities - 1950 - Fibre Cement Clad (Fibre Cement Clad)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Wall Cladding	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2431/B00E/R0001/Wall Linings Internal/S1			Chrysotile (White asbestos) , Amosite (Brown asbestos)		
Ceiling Void	No Asbestos Found					

Interior**B00E - R0001 - Sports Store**

Wall Linings Internal	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2431/B00E/R0001/Wall Linings Internal/S1			Chrysotile (White asbestos) , Amosite (Brown asbestos)		

B00E - R0002 - General Storeroom

Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2431/B00E/R0001/Wall Linings Internal/S1			Chrysotile (White asbestos) , Amosite (Brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Building Services - 1969 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Void No Asbestos Found

Interior

B00F - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Building Services - 1969 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	No Asbestos Found

Interior

B00G - R0001 - Plant

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Administration - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00H - R0001 - External Movement	No Asbestos
B00H - R0002 - Principal	No Asbestos
B00H - R0003 - Main Switch Board	No Asbestos
B00H - R0004 - General Storeroom	No Asbestos
B00H - R0005 - Staff Room	No Asbestos
B00H - R0006 - Movement	No Asbestos
B00H - R0007 - Disabled Shower/Toilet	No Asbestos
B00H - R0008 - Security Store	No Asbestos
B00H - R0009 - Sick Bay	No Asbestos
B00H - R0010 - Toilets-Unisex	No Asbestos
B00H - R0011 - Clerical Office	No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D10704 - Learning Unit - Standard With P.A.A. : Placement Date - 9/05/2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 601 - D14305 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017