


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Lue Public School (2432)  
**Region :** Western NSW  
**State Electorate :** Dubbo  
**Local Government Area :** Mid-Western

**Initial Survey :** Noel Arnold & Associates : 20 - May - 2008  
**Reviewed By :** Greencap-NAA : 15 - Jun - 2016

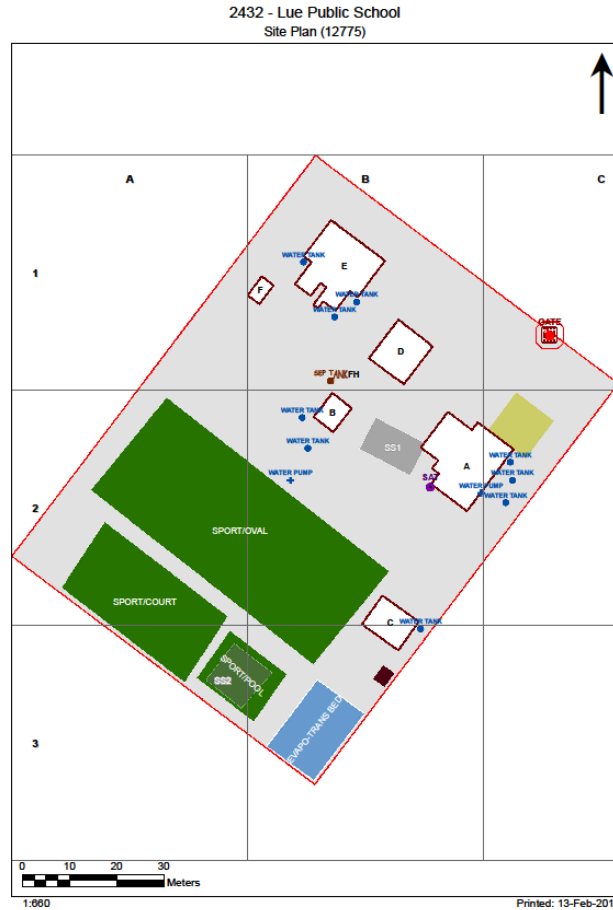

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning/Library - 1912 - Timber (Timber)**

**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Pitched Roof -Flat ceiling.	No Asbestos Found

**Interior**

**B00A - R0001 - Duplicating Workroom**

No Asbestos

**B00A - R0002 - Reading Area**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					<b>No Asbestos Detected</b>
	2432/B00A/R0003/Floor Coverings Res/Textile/S5					
Floor Coverings Res/Textile	Adhesive	44.06m2	Under vinyl tile (tan coloured brown flora pattern).Tile under carpet area 44.06	Good Condition (1)	Low (1)	Low Priority (2-3)
	2432/B00A/R0003/Floor Coverings Res/Textile/S6					<b>Chrysotile (white asbestos)</b>

**B00A - R0003 - Home Base**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	2432/B00A/R0003/Wall Linings Internal/S3					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					<b>No Asbestos Detected</b>
	2432/B00A/R0003/Floor Coverings Res/Textile/S5					
Floor Coverings Res/Textile	Adhesive	42.9m2	Under vinyl tiles (tan with brown floral pattern).Tiles under carpet.	Good Condition (1)	Low (1)	Low Priority (2-3)
	2432/B00A/R0003/Floor Coverings Res/Textile/S6					<b>Chrysotile (white asbestos)</b>

**B00A - R0004 - Staff Room**

No Asbestos

**B00A - R0005 - Movement**

Electrical Mounting Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Assumed Asbestos - presumed live.</b>
Window beading	Caulking Material					<b>No Asbestos Detected</b>
	2432/B00A/R0005/Window beading/S4					

**B00A - R0006 - Principal**

No Asbestos

**B00A - R0007 - Movement**

No Asbestos

**B00A - R0008 - Drinking Facilities**

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Special Purpose - 1972 - Brick/Veneer (Brick/Veneer)****Exterior**

Electrical Backing Board	Resinous Board	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Presumed lived at time of inspection.</b>						
Eaves Linings	Flat AC Sheeting	4m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
2432/B00B/R0002/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>	
Ceiling Voids - Flat Roof	Non Accessible Area - No manhole					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior****B00B - R0002 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2432/B00B/R0002/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>	

**B00B - R0003 - Cleaning Supplies**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2432/B00B/R0002/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>	

**B00B - R0004 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2432/B00B/R0002/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>	
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
2432/B00B/R0004/Partition Walls (Cubicles)/S2					<b>Chrysotile (white asbestos)</b>	

**B00B - R0005 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2432/B00B/R0002/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Pupil Facilities/Staff Facilities - 1912 - Timber (Timber)**

**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - No manhole.					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					

**Interior**

**B00C - R0001 - Craft Store**

No Asbestos

**B00C - R0003 - Special Programs Room**

No Asbestos

**B00C - R0004 - General Storeroom**

Wall Linings Internal	Flat AC Sheeting 2432/B00C/R0004/Wall Linings Internal/S7					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting 2432/B00C/R0004/Wall Linings Internal/S7					<b>No Asbestos Detected</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

**Interior**

**B00D - R0001 - Reading Area**

No Asbestos

**B00D - R0002 - K.L.A. Store**

No Asbestos

**B00D - R0003 - Practical Activities**

No Asbestos

**B00D - R0004 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Listing of Electronic Attachments as of 22/03/2017***

**There are no asbestos related file attachment(s) for this school.**

2017