


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Lyndhurst Public School (2436)
Region : Western NSW
State Electorate : Bathurst
Local Government Area : Blayney

Initial Survey : Noel Arnold & Associates : 30 - May - 2008
Reviewed By : Greencap-NAA : 08 - Dec - 2016

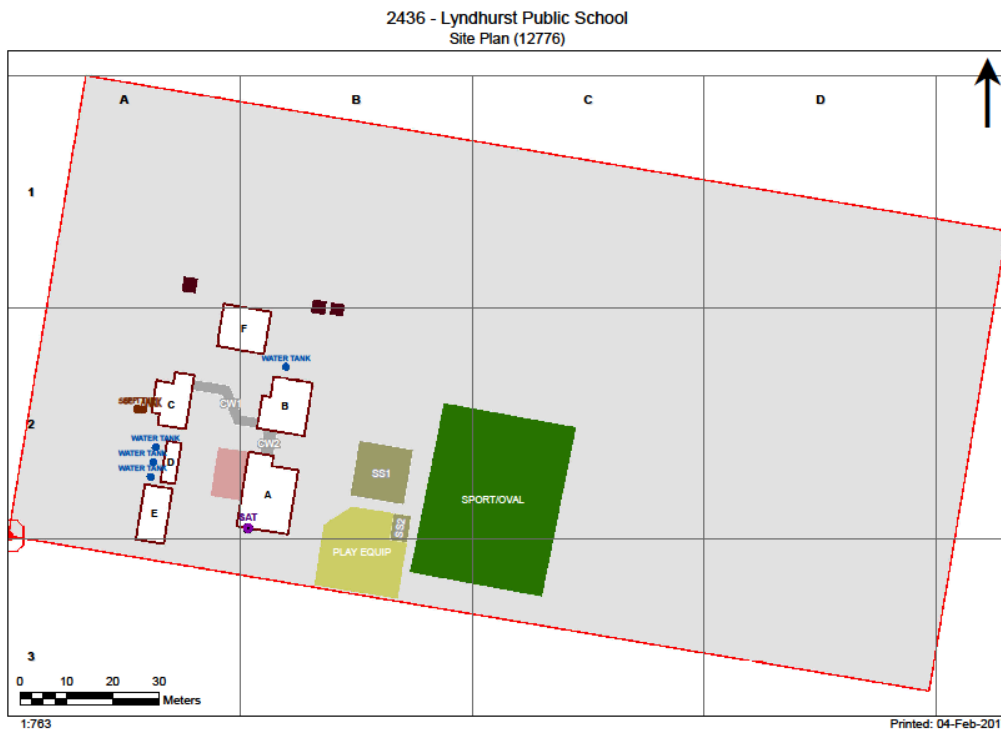

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1899 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Packing to Floor Joists	Non Accessible Area - No sub-floor access.					
Pitched Roof - Flat Ceiling - Void	Non Accessible Area - Ceiling height 3.5-4m. 3 manholes none against a wall.					
Window beading	Caulking Material 2436/B00B/Window Beading/S4					No Asbestos Detected

Interior

B00A - R0001 - Home Base

Floor Coverings Res/Textile	Adhesive under brown tile under carpet 2436/B00A/R0002/Floor Coverings Res/Textile/S6					No Asbestos Detected
Floor Coverings Res/Textile	Brown vinyl floor tiles under carpet 2436/B00A/R0002/Floor Coverings Res/Textile/S5					No Asbestos Detected

B00A - R0002 - Reading Area

Floor Coverings Res/Textile	Brown vinyl floor tiles under carpet 2436/B00A/R0002/Floor Coverings Res/Textile/S5					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive under brown tile under carpet 2436/B00A/R0002/Floor Coverings Res/Textile/S6					No Asbestos Detected

B00A - R0003 - Personal Effects Storage

Floor Coverings Res/Textile	Adhesive under brown tile under carpet 2436/B00A/R0002/Floor Coverings Res/Textile/S6					No Asbestos Detected
Floor Coverings Res/Textile	Brown vinyl floor tiles under carpet 2436/B00A/R0002/Floor Coverings Res/Textile/S5					No Asbestos Detected

Electrical Mounting Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------------------	----------------	-------	------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard

B00A - R0004 - Staff Room Annexe

No Asbestos

B00A - R0005 - Clerical Office

No Asbestos

B00A - R0006 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Special Purpose - 1900 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists	Packing	1m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Cannot sample. Confined space.						
Window Beading	Caulking Material					No Asbestos Detected
Pitched Roof - Flat Ceiling - Void	Non Accessible Area					
- Height restricted mid room approx 5m high.						

Interior

B00B - R0001 - Home Base

No Asbestos

B00B - R0002 - Movement

No Asbestos

B00B - R0003 - Staff Kitchen

No Asbestos

B00B - R0004 - Practical Activities - 1hb

No Asbestos

B00B - R0005 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1998 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 2436/B00D/Eaves Linings/S2	20m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00C - R0001 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting 2436/B00D/Eaves Linings/S2	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0003 - Toilets - Girls

Wall Linings Internal	Flat AC Sheeting 2436/B00C/R0003/Wall Linings Internal/S3					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 2436/B00D/Eaves Linings/S2	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0004 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting 2436/B00C/R0003/Wall Linings Internal/S3					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 2436/B00D/Eaves Linings/S2	2.39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0005 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Building Services/Pupil Facilities - 1950 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	14m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2436/B00D/Eaves Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					

Interior

B00D - R0001 - Cleaning Distributed Store

Wall Linings Internal	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2436/B00D/R0002/Wall Linings Internal/S1				Chrysotile (white asbestos)	
Ceiling Structures/Linings	No Asbestos Found					

B00D - R0002 - Sports Store

Wall Linings Internal	Flat AC Sheeting	10m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	2436/B00D/R0002/Wall Linings Internal/S1				Chrysotile (white asbestos)	

B00D - R0003 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 2008 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00E - R0001 - Covered Outdoor Learning Area

No Asbestos

B00E - R0002 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

Interior

B00F - R0001 - Reading Area

No Asbestos

B00F - R0002 - K.L.A. Store

No Asbestos

B00F - R0003 - Practical Activities

No Asbestos

B00F - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017