


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Leppington Public School (2926)  
**Region :** South Western Sydney  
**State Electorate :** Camden  
**Local Government Area :** Camden

**Initial Survey :** Noel Arnold & Associates : 14 - May - 2008  
**Reviewed By :** Parsons Brinckerhoff : 28 - Aug - 2015

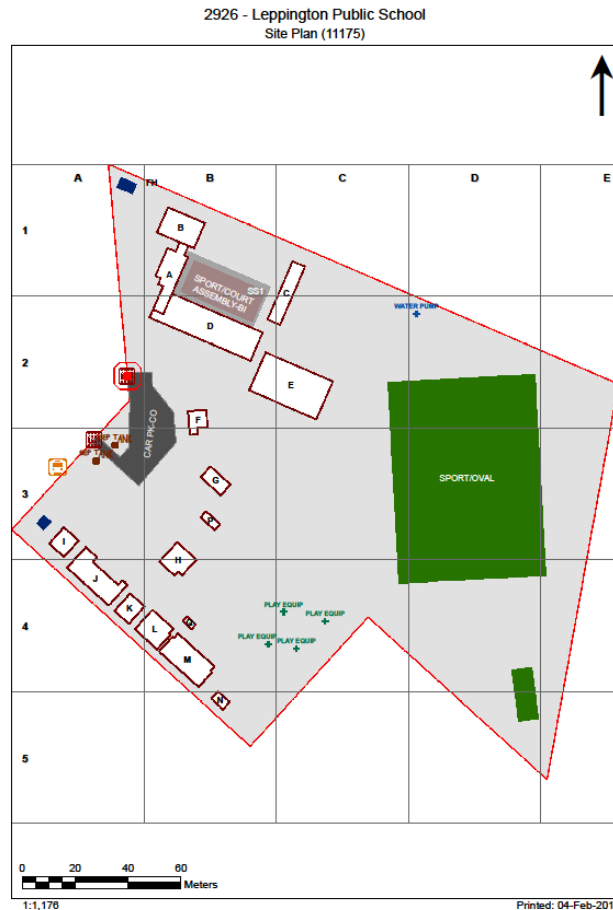

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration - 1967 - Brick/Veneer (Brick/Veneer)****Exterior**

Eaves Linings	Flat AC Sheeting	15m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00G/Eaves Linings/S14					<b>Chrysotile (white asbestos)</b>
Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00B/Gable Verge Lining/S17					<b>Chrysotile (white asbestos)</b>
Underfloor Voids	AC Fragments/Debris	1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Low Priority (2-3)
	2926/B00A/Underfloor Voids/S23					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting					
	2926/B00H/Underfloor Voids - Packing to Floor Joists/S18					<b>No Asbestos Detected</b>

**Interior****B00A - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00B/R0004/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>

**B00A - R0002 - Duplicating Workroom**

No Asbestos

**B00A - R0003 - Sick Bay**

No Asbestos

**B00A - R0004 - Clerical Office**

No Asbestos

**B00A - R0005 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00B/R0004/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>

**B00A - R0006 - Entry Vestibule**

No Asbestos

**B00A - R0007 - General Storeroom**

No Asbestos

**B00A - R0008 - Handwashing Facilities**

Wall Linings Internal	Flat AC Sheeting	1m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00A/R0015/Wall Linings Internal/S3					<b>Chrysotile (white asbestos)</b>

**B00A - R0009 - Principal**

No Asbestos

**B00A - R0010 - Movement**

No Asbestos

**B00A - R0011 - General Storeroom**

No Asbestos

**B00A - R0012 - Cleaning Distributed Store**

Wall Linings Internal	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00A/R0015/Wall Linings Internal/S3					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00A/R0015/Wall Linings Internal/S3					<b>Chrysotile (white asbestos)</b>

**B00A - R0013 - Staff Toilet**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2926/B00A/R0015/Wall Linings Internal/S3					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2926/B00A/R0015/Wall Linings Internal/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0014 - Craft Store</b>						
No Asbestos						
<b>B00A - R0015 - Staff Toilet</b>						
Wall Linings Internal	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2926/B00A/R0015/Wall Linings Internal/S3					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2926/B00A/R0015/Wall Linings Internal/S3					<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning - 1968 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00G/Eaves Linings/S14					<b>Chrysotile (white asbestos)</b>
Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00B/Gable Verge Lining/S17					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting					
	2926/B00H/Underfloor Voids - Packing to Floor Joists/S18					<b>No Asbestos Detected</b>

**Interior**

**B00B - R0001 - Home Base**

No Asbestos

**B00B - R0002 - Staff Room Annexe**

No Asbestos

**B00B - R0003 - Home Base Store**

No Asbestos

**B00B - R0004 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00B/R0004/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Pupil Facilities - 1966 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	18m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00G/Eaves Linings/S14					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior**

**B00C - R0001 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00C/R0001/Partition Walls (Cubicles)/S4					<b>Chrysotile (white asbestos)</b>

**B00C - R0002 - Drinking Facilities**

No Asbestos

**B00C - R0003 - Kiln Room**

No Asbestos

**B00C - R0004 - P.E. Store**

No Asbestos

**B00C - R0005 - Drinking Facilities**

No Asbestos

**B00C - R0006 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00C/R0001/Partition Walls (Cubicles)/S4					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning - 1966 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00G/Eaves Linings/S14				<b>Chrysotile (white asbestos)</b>	
Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00B/Gable Verge Lining/S17				<b>Chrysotile (white asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting					
	2926/B00H/Underfloor Voids - Packing to Floor Joists/S18				<b>No Asbestos Detected</b>	

**Interior**

**B00D - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00B/R0004/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos)</b>	

**B00D - R0002 - Movement**

No Asbestos

**B00D - R0003 - Uniform Shop**

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00D/R0003/Floor Coverings Res/Textile/S5				<b>Chrysotile (white asbestos)</b>	

**B00D - R0004 - Home Base Store**

No Asbestos

**B00D - R0005 - Home Base**

No Asbestos

**B00D - R0006 - Home Base**

No Asbestos

**B00D - R0007 - Home Base Store**

No Asbestos

**B00D - R0008 - Personal Effects Storage**

No Asbestos

**B00D - R0009 - Movement**

No Asbestos

**B00D - R0010 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00B/R0004/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos)</b>	

**B00D - R0011 - Home Base**

No Asbestos

**B00D - R0012 - Home Base Store**

No Asbestos

**B00D - R0015 - General Storeroom**

No Asbestos

**B00D - R0016 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00B/R0004/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos)</b>	

**B00D - R0017 - General Storeroom**

No Asbestos

**B00D - R0018 - Home Base Store**

No Asbestos

**B00D - R0019 - Home Base**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00D - R0020 - Movement**

No Asbestos

**B00D - R0021 - Practical Activities/Movement - 2hb**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Library/Tiered Learning - 1981 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B00E - R0001 - Plant**

No Asbestos

**B00E - R0002 - Special Programs Store**

No Asbestos

**B00E - R0003 - Special Programs Room**

No Asbestos

**B00E - R0004 - Movement**

No Asbestos

**B00E - R0005 - Staff Toilet**

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---------------------	-----	------------	--------------------	---------	--------------------

2926/B00E/R0006/Partition Walls (Cubicles)/S8

**Chrysotile (white asbestos)**

**B00E - R0006 - Staff Toilet**

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---------------------	-----	------------	--------------------	---------	--------------------

2926/B00E/R0006/Partition Walls (Cubicles)/S8

**Chrysotile (white asbestos)**

**B00E - R0007 - Movement**

No Asbestos

**B00E - R0008 - Distribution Board**

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------	------------------	-----	-------	--------------------	---------	--------------------

2926/B00E/R0008/Wall Linings Internal/S7

**Chrysotile (white asbestos)**

**B00E - R0009 - Movement**

No Asbestos

**B00E - R0010 - Library Office/Workroom**

No Asbestos

**B00E - R0011 - Communications Room**

No Asbestos

**B00E - R0012 - Reading Area**

No Asbestos

**B00E - R0013 - Movement**

No Asbestos

**B00E - R0014 - Movement**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Pupil Facilities - 1968 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00G/Eaves Linings/S14					<b>Chrysotile (white asbestos)</b>
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior**

**B00F - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00F/R0001/Ceiling Structures/Linings/S21					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00F - R0002 - Canteen**

Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00F/R0001/Ceiling Structures/Linings/S21					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00F - R0003 - Canteen Office/Store**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00F/R0001/Ceiling Structures/Linings/S21					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00F - R0004 - Canteen Office/Store**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00F/R0001/Ceiling Structures/Linings/S21					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00F - R0005 - Cleaning Distributed Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Pupil Facilities - 1968 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	12m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00G/Eaves Linings/S14					<b>Chrysotile (white asbestos)</b>
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior****B00G - R0001 - Drinking Facilities**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00B/R0004/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>

**B00G - R0002 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00B/R0004/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>

**B00G - R0003 - Cleaning Distributed Store**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00B/R0004/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>

**B00G - R0004 - Garden Store**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00B/R0004/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>

**B00G - R0005 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00B/R0004/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>

**B00G - R0006 - Drinking Facilities**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00B/R0004/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Staff Facilities - 1923 - Timber (Timber)**

**Exterior**

Ceiling Voids	Non Accessible Area - No Manhole in Building to access ceiling space					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting 2926/B00H/Underfloor Voids - Packing to Floor Joists/S18					<b>No Asbestos Detected</b>
Underfloor Voids	AC Fragments/Debris 2926/B00H/Underfloor Voids/S19					<b>No Asbestos Detected</b>

**Interior**

**B00H - R0001 - Staff Room**

No Asbestos

**B00H - R0002 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2926/B00H/R0002/Floor Coverings Res/Textile/S12					<b>Chrysotile (white asbestos)</b>	

**B00H - R0003 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2926/B00H/R0003/Ceiling Structures/Linings/S22					<b>Chrysotile (white asbestos)</b>	

**B00H - R0004 - General Storeroom**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00I - General Learning - 1913 - Timber (Timber)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00I - R0001 - Home Base**

No Asbestos

**B00I - R0002 - Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - General Learning - 1959 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00L/Eaves Linings/S15				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B00J - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00J/R0001/Ceiling Structures/Linings/S9				<b>Chrysotile (white asbestos)</b>	

**B00J - R0002 - Movement**

Floor Coverings Res/Textile	Vinyl Tiles					
	2926/B00J/R0002/Floor Coverings Res/Textile/S10				<b>No Asbestos Detected</b>	

**B00J - R0003 - Personal Effects Storage**

Floor Coverings Res/Textile	Vinyl Tiles					
	2926/B00J/R0002/Floor Coverings Res/Textile/S10				<b>No Asbestos Detected</b>	

**B00J - R0004 - Home Base**

Wall Linings Internal	Flat AC Sheeting					
	2926/B00J/R0005/Wall Linings Internal/S11				<b>No Asbestos Detected</b>	

**B00J - R0005 - Home Base**

Wall Linings Internal	Flat AC Sheeting					
	2926/B00J/R0005/Wall Linings Internal/S11				<b>No Asbestos Detected</b>	

**B00J - R0006 - Practical Activities - 1hb**

Floor Coverings Res/Textile	Vinyl Tiles					
	2926/B00J/R0002/Floor Coverings Res/Textile/S10				<b>No Asbestos Detected</b>	

**B00J - R0007 - Personal Effects Storage**

Floor Coverings Res/Textile	Vinyl Tiles					
	2926/B00J/R0002/Floor Coverings Res/Textile/S10				<b>No Asbestos Detected</b>	

**B00J - R0008 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Tiles					
	2926/B00J/R0002/Floor Coverings Res/Textile/S10				<b>No Asbestos Detected</b>	

**B00J - R0009 - Movement**

Floor Coverings Res/Textile	Vinyl Tiles					
	2926/B00J/R0002/Floor Coverings Res/Textile/S10				<b>No Asbestos Detected</b>	

**B00J - R0010 - Toilets - Boys/Girls**

Wall Linings Internal	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00J/R0001/Ceiling Structures/Linings/S9				<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00A/R0015/Wall Linings Internal/S3				<b>Chrysotile (white asbestos)</b>	

**B00J - R0011 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00J/R0001/Ceiling Structures/Linings/S9				<b>Chrysotile (white asbestos)</b>	

**B00J - R9001 - General Assistant/Bulk Store**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - General Learning - 1915 - Timber (Timber)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00K - R0001 - Home Base**

Ceiling Structures/Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2926/B00J/R0001/Ceiling Structures/Linings/S9					<b>Chrysotile (white asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting	30m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
2926/B00J/R0001/Ceiling Structures/Linings/S9					<b>Chrysotile (white asbestos)</b>	

**B00K - R0002 - Withdrawal Space - 1hb**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2926/B00J/R0001/Ceiling Structures/Linings/S9					<b>Chrysotile (white asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting	6m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
2926/B00J/R0001/Ceiling Structures/Linings/S9					<b>Chrysotile (white asbestos)</b>	

**B00K - R0003 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2926/B00J/R0001/Ceiling Structures/Linings/S9					<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - General Learning - 1955 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	15m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00L/Eaves Linings/S15				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00L - R0001 - Home Base**

Wall Linings Internal	Flat AC Sheeting					
	2926/B00J/R0005/Wall Linings Internal/S11				<b>No Asbestos Detected</b>	
Floor Coverings Res/Textile	Vinyl Tiles					
	2926/B00J/R0002/Floor Coverings Res/Textile/S10				<b>No Asbestos Detected</b>	

**B00L - R0002 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00J/R0001/Ceiling Structures/Linings/S9				<b>Chrysotile (white asbestos)</b>	

**B00L - R0003 - Communal/Performance Store**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00J/R0001/Ceiling Structures/Linings/S9				<b>Chrysotile (white asbestos)</b>	

**B00L - R0004 - Staff Room Annexe**

No Asbestos

**B00L - R0005 - Special Programs Room**

No Asbestos

**B00L - R0006 - Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - General Learning - 1955 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	35m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00L/Eaves Linings/S15					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00M - R0001 - Home Base**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	2926/B00J/R0005/Wall Linings Internal/S11					

**B00M - R0004 - No Access**

Ceiling Structures/Linings	Flat AC Sheeting	43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2926/B00J/R0001/Ceiling Structures/Linings/S9					<b>Chrysotile (white asbestos)</b>

**B00M - R0005 - Sports Store**

No Asbestos

**B00M - R0006 - Home Base Store**

No Asbestos

**B00M - R0007 - Practical Activities - 1hb**

No Asbestos

**B00M - R0008 - Practical Activities - 1hb**

No Asbestos

**B00M - R0009 - Home Base Store**

No Asbestos

**B00M - R0010 - Home Base**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00N - Administration - 1955 - Timber Shed (Timber Shed)**

**Exterior**

Eaves Linings	Flat AC Sheeting 2926/B00N/Eaves Linings/S16					<b>No Asbestos Detected</b>
Wall Cladding	Flat AC Sheeting 2926/B00N/Wall Cladding/S1	13m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris 2926/B00N/Underfloor Voids/S20					<b>No Asbestos Detected</b>

**Interior**

**B00N - R0001 - Sports Store**

Wall Linings Internal	Flat AC Sheeting 2926/B00N/R0001/Ceiling Structures/Linings/S13					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting 2926/B00N/R0001/Ceiling Structures/Linings/S13					<b>No Asbestos Detected</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00P - Administration - 1991 - Steel (Steel)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00P - R0001 - Movement**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
-------------------------------------------	-------------------

**B00P - R0002 - Staff Toilet**

No Asbestos

**B00P - R0003 - Community Clinic**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
-------------------------------------------	-------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00Q - Pupil Facilities - 1955 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B00Q - R0001 - Drinking Facilities**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017