


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Lake Illawarra South Public School (3867)
Region : Illawarra and South East
State Electorate : Shellharbour
Local Government Area : Shellharbour

Initial Survey : Noel Arnold & Associates : 06 - May - 2008
Reviewed By : Grencap-NAA : 02 - Aug - 2016

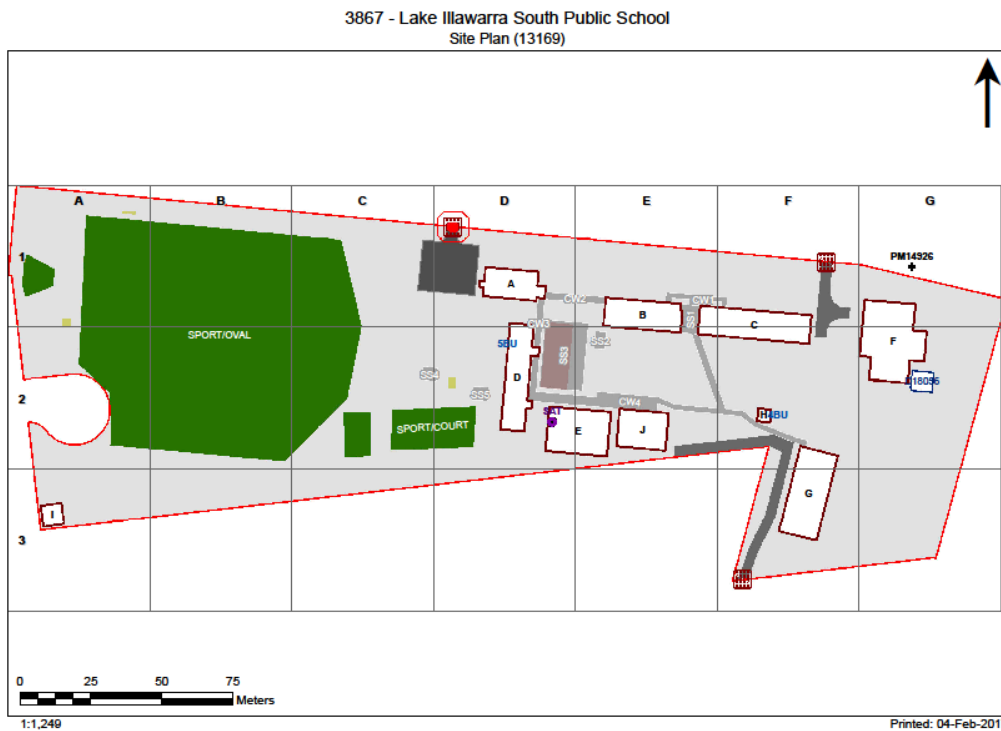

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - Administration/Staff Facilities - 1980 - Brick/Veneer (Brick/Veneer)**Exterior**

Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00A/Gable Verge Lining/S17					Chrysotile (white asbestos) , Crocidolite (blue asbestos)
Eaves Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00A/Eaves Linings/S16					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	Encapsulated Insulation material within unit					No Asbestos Detected
	3867/B00A/Ceiling Voids/S15					
Underfloor Voids	Fibre Cement Pipe	5m	southwest adjacent access door	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00A/Underfloor Voids/S18					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

Interior**B00A - R0001 - Principal**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18.51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00A/R0008/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)

B00A - R0002 - Main Switch Board

Wall Linings Internal	Flat AC Sheeting	8m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	3867/B00A/R0002/Wall Linings Internal/S7					Chrysotile (white asbestos)

B00A - R0003 - Deputy Principal

Floor Coverings Res/Textile	Vinyl Tiles	14.79m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00A/R0008/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)

B00A - R0004 - Staff Room

Floor Coverings Res/Textile	Vinyl Tiles	36.03m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00A/R0008/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)

B00A - R0005 - Duplicating Workroom

Floor Coverings Res/Textile	Vinyl Tiles	17.14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00A/R0008/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)

B00A - R0006 - Entry Vestibule

No Asbestos

B00A - R0007 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	22.25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00A/R0008/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)

B00A - R0008 - Security Store

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00A/R0008/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)

B00A - R0009 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00A/R0010/Wall Linings Internal/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0010 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00A/R0010/Wall Linings Internal/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00A - R0011 - Staff Toilet						
Wall Linings Internal	Flat AC Sheeting	8.m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3867/B00A/R0010/Wall Linings Internal/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0012 - Cleaning Distributed Store						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3867/B00A/R0008/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)		
B00A - R0013 - General Storeroom						
No Asbestos						
B00A - R0014 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3867/B00A/R0008/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)		
B00A - R0015 - Clerical Office						
Floor Coverings Res/Textile	Vinyl Tiles	10.64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3867/B00A/R0008/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)		
B00A - R0016 - Clerical Office						
Floor Coverings Res/Textile	Vinyl Tiles	9.04m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3867/B00A/R0008/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)		
B00A - R0017 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3867/B00A/R0017/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0018 - Movement						
In-fill-panel	Flat AC Sheeting	1m	Above door	Good Condition (1)	Low (1)	Low Priority (2-3)
3867/B00A/R0018/In-fill-panel/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1964 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00B/Eaves Linings/S19			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00B - R0001 - Toilets - Boys/Girls

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00B/R0002/Ceiling Structures/Linings/S11			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00B/R0002/Ceiling Structures/Linings/S11			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0003 - Home Base

No Asbestos

B00B - R0004 - Home Base

No Asbestos

B00B - R0005 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles				
	3867/B00B/R0005/Floor Coverings Res/Textile/S12			No Asbestos Detected	

B00B - R0006 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles				
	3867/B00B/R0005/Floor Coverings Res/Textile/S12			No Asbestos Detected	

B00B - R0007 - Home Base

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00C - General Learning - 1964 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00B/Eaves Linings/S19			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	Fibre Cement Pipe	4m	South	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3867/B00C/Ceiling Voids/S20			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Underfloor Voids	Flat AC Sheeting	1Unit	East	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible					
Ceiling Voids - Flat Roof	AC Fragments/Debris	5Unit	Middle portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3867/B00C/Ceiling Voids - Flat Roof/S21			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

Interior**B00C - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	91m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00C/R0001/Ceiling Structures/Linings/S13			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0002 - Withdrawal Space - 1hb

Wall Linings Internal	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00C/R0009/Wall Linings Internal/S14			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00C/R0001/Ceiling Structures/Linings/S13			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	3867/B00B/R0005/Floor Coverings Res/Textile/S12					

B00C - R0003 - Home Base

Wall Linings Internal	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00C/R0009/Wall Linings Internal/S14			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00C/R0001/Ceiling Structures/Linings/S13			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	3867/B00B/R0005/Floor Coverings Res/Textile/S12					

B00C - R0004 - Home Base

Wall Linings Internal	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00C/R0009/Wall Linings Internal/S14			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00C/R0001/Ceiling Structures/Linings/S13			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	3867/B00B/R0005/Floor Coverings Res/Textile/S12					

B00C - R0005 - Staff Room Annexe

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Wall Linings Internal	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00C/R0009/Wall Linings Internal/S14			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00C/R0001/Ceiling Structures/Linings/S13			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles					
	3867/B00B/R0005/Floor Coverings Res/Textile/S12			No Asbestos Detected		
B00C - R0006 - General Storeroom						
Wall Linings Internal	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00C/R0009/Wall Linings Internal/S14			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00C/R0001/Ceiling Structures/Linings/S13			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles					
	3867/B00B/R0005/Floor Coverings Res/Textile/S12			No Asbestos Detected		
B00C - R0007 - Home Base						
Wall Linings Internal	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00C/R0009/Wall Linings Internal/S14			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00C/R0001/Ceiling Structures/Linings/S13			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles					
	3867/B00B/R0005/Floor Coverings Res/Textile/S12			No Asbestos Detected		
B00C - R0008 - Home Base						
Wall Linings Internal	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00C/R0009/Wall Linings Internal/S14			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00C/R0001/Ceiling Structures/Linings/S13			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0009 - Home Base Store						
Wall Linings Internal	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00C/R0009/Wall Linings Internal/S14			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00C/R0001/Ceiling Structures/Linings/S13			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1964 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00D/Eaves Linings/S22			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

Interior

B00D - R0001 - Home Base

No Asbestos

B00D - R0002 - Home Base Store

No Asbestos

B00D - R0003 - Sports Store

No Asbestos

B00D - R0004 - Personal Effects Storage

No Asbestos

B00D - R0005 - Home Base Store

No Asbestos

B00D - R0006 - Home Base

No Asbestos

B00D - R0007 - Home Base

No Asbestos

B00D - R0008 - Home Base Store

No Asbestos

B00D - R0009 - Special Programs Room

No Asbestos

B00D - R0010 - Personal Effects Storage

No Asbestos

B00D - R0011 - Home Base Store

No Asbestos

B00D - R0012 - Home Base

No Asbestos

B00D - R0013 - Movement

In-fill-panel	Flat AC Sheeting	1m	Above door	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00D/R0013/In-fill-panel/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00D - R0014 - Movement

In-fill-panel	Flat AC Sheeting	1m	Above door	Good Condition (1)	Low (1)	Low Priority (2-3)
	3867/B00D/R0013/In-fill-panel/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Library - 1954 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids - Raked Ceiling No Asbestos Found

Interior

B00E - R0001 - Reading Area

No Asbestos

B00E - R0002 - Library Office/Workroom

Floor Coverings Res/Textile	Vinyl Tiles	4m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)
3867/B00E/R0002/Floor Coverings Res/Textile/S4						Chrysotile (white asbestos)

B00E - R0003 - Security Store

No Asbestos

B00E - R0004 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00E - R0005 - Movement

No Asbestos

B00E - R0006 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3867/B00E/R0006/Partition Walls (Cubicles)/S3						Chrysotile (white asbestos)

B00E - R0007 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3867/B00E/R0006/Partition Walls (Cubicles)/S3						Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities/Multi Purpose Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area

- Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00F - R0001 - Communal Space

No Asbestos

B00F - R0002 - Raised Platform

No Asbestos

B00F - R0003 - Communal/Performance Store

No Asbestos

B00F - R0004 - Chair Storeroom

No Asbestos

B00F - R0005 - Movement

No Asbestos

B00F - R0006 - P.E. Store

No Asbestos

B00F - R0007 - Toilet - Lobby

No Asbestos

B00F - R0008 - Toilets - Boys

No Asbestos

B00F - R0009 - Cleaning Distributed Store

No Asbestos

B00F - R0010 - Toilet - Lobby

No Asbestos

B00F - R0011 - Toilets - Girls

No Asbestos

B00F - R0012 - Sound Cupboard

No Asbestos

B00F - R0013 - Access Shower/Toilet/Change

No Asbestos

B00F - R0014 - Main Switch Board

No Asbestos

B00F - R0015 - Covered Outdoor Learning Area

No Asbestos

B00F - R0016 - Movement

No Asbestos

B00F - R0017 - Movement

No Asbestos

B00F - R0018 - Ramp

No Asbestos

B00F - R0019 - External Movement

No Asbestos

B00F - R0020 - External Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00G - Pupil Facilities/Building Services - 1964 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior**B00G - R0001 - General Assistant/Bulk Store**

Ceiling Structures/Linings	Flat AC Sheeting	69m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3867/B00G/R0011/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00G - R0002 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3867/B00G/R0011/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)		

Partition Walls (Cubicles)	Compressed AC Sheet	3867/B00G/R0008/Partition Walls (Cubicles)/S2				No Asbestos Detected
----------------------------	---------------------	---	--	--	--	-----------------------------

B00G - R0003 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3867/B00G/R0011/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00G - R0004 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3867/B00G/R0011/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00G - R0005 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3867/B00G/R0011/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00G - R0006 - Sports Store

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3867/B00G/R0011/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00G - R0007 - Cleaning Supplies

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3867/B00G/R0011/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00G - R0008 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3867/B00G/R0011/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)		

Partition Walls (Cubicles)	Compressed AC Sheet	3867/B00G/R0008/Partition Walls (Cubicles)/S2				No Asbestos Detected
----------------------------	---------------------	---	--	--	--	-----------------------------

B00G - R0009 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3867/B00G/R0011/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00G - R0010 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3867/B00G/R0011/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00G - R0011 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3867/B00G/R0011/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Special Purpose - 1954 - Timber (Timber)

Exterior

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Interior

B00H - R0001 - Kiln Room

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Building Services - 1977 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Interior

B00I - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning - 2004 - Fibre Cement Clad (Fibre Cement Clad)**Exterior**

Underfloor Voids - Packing to Floor Joists No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00J - R0001 - Movement**

No Asbestos

B00J - R0002 - Practical Activities - 1hb

No Asbestos

B00J - R0003 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0004 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0005 - Withdrawal Space - 2hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0006 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0007 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0008 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 801 - D18056 - FSU : Placement Date - 5/12/2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Canteen

No Asbestos Found.

R2 - Covered Area

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017