


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Lane Cove West Public School (3908)
Region : Northern Sydney
State Electorate : Lane Cove
Local Government Area : Lane Cove

Initial Survey : Noel Arnold & Associates : 30 - May - 2008
Reviewed By : AECOM : 28 - Jun - 2016

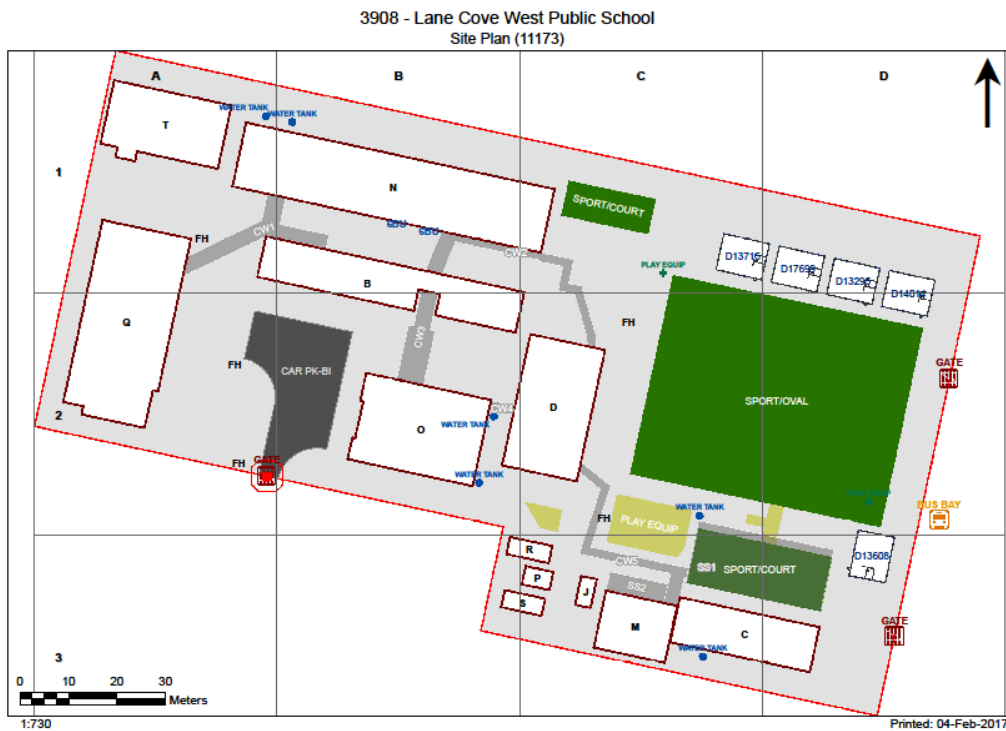

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00B - General Learning - 1951 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible no void hatch located					
Eaves Linings	Flat AC Sheeting	80m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3908/B00B/Eaves Linings/S12			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Gable Ends	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3908/B00B/Gable Ends/S14			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

Interior**B00B - R0001 - General Storeroom**

Ceiling Structures/Linings	Compressed AC Sheet	NA	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3908/B00B/R0005/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles					
	3908/B00B/R0001/Floor Coverings Res/Textile/S13			No Asbestos Detected		

B00B - R0002 - Staff Room Annexe

Ceiling Structures/Linings	Compressed AC Sheet	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3908/B00B/R0005/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	4m2	North facing, South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3908/B00B/R0005/Wall Linings Internal/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0003 - General Storeroom

Ceiling Structures/Linings	Compressed AC Sheet	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3908/B00B/R0005/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	4m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3908/B00B/R0005/Wall Linings Internal/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0004 - Home Base

Ceiling Structures/Linings	Compressed AC Sheet	47m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3908/B00B/R0005/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	12m2	North facing, South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3908/B00B/R0005/Wall Linings Internal/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0005 - General Storeroom

Ceiling Structures/Linings	Compressed AC Sheet	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3908/B00B/R0005/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	16m2	South facing, West facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3908/B00B/R0005/Wall Linings Internal/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00B - R0006 - Home Base						
Ceiling Structures/Linings	Compressed AC Sheet	47m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3908/B00B/R0005/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Linings Internal	Flat AC Sheeting	12m2	North facing, South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3908/B00B/R0005/Wall Linings Internal/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00B - R0007 - Home Base						
Ceiling Structures/Linings	Compressed AC Sheet	47m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3908/B00B/R0005/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Linings Internal	Flat AC Sheeting	12m2	North facing, South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3908/B00B/R0005/Wall Linings Internal/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00B - R0008 - Home Base						
Ceiling Structures/Linings	Compressed AC Sheet	47m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3908/B00B/R0005/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Linings Internal	Flat AC Sheeting	12m2	North facing, South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3908/B00B/R0005/Wall Linings Internal/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00B - R0009 - Home Base						
Ceiling Structures/Linings	Compressed AC Sheet	47m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3908/B00B/R0005/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Linings Internal	Flat AC Sheeting	20m2	North facing, South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3908/B00B/R0005/Wall Linings Internal/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00B - R0010 - Home Base						
Ceiling Structures/Linings	Compressed AC Sheet	47m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3908/B00B/R0005/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Linings Internal	Flat AC Sheeting	20m2	North facing, South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3908/B00B/R0005/Wall Linings Internal/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00B - R0011 - Practical Activities - 1hb						
Ceiling Structures/Linings	Compressed AC Sheet	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3908/B00B/R0005/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Linings Internal	Flat AC Sheeting	64m2	South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3908/B00B/R0005/Wall Linings Internal/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
	3908/B00B/R0012/Floor Coverings Res/Textile/S3					
B00B - R0012 - General Storeroom						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Compressed AC Sheet	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3908/B00B/R0005/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Sheet					
	3908/B00B/R0012/Floor Coverings Res/Textile/S3			No Asbestos Detected		
B00B - R0013 - Movement						
Ceiling Structures/Linings	Compressed AC Sheet	180m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3908/B00B/R0005/Ceiling Structures/Linings/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	88m2	South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3908/B00B/R0005/Wall Linings Internal/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1951 - Concrete (Concrete)

Exterior

Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible no void hatch located
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible

Interior

B00C - R0002 - Home Base

No Asbestos

B00C - R0003 - Practical Activities - 1hb

No Asbestos

B00C - R0004 - Practical Activities - 1hb

No Asbestos

B00C - R0005 - Home Base

No Asbestos

B00C - R0006 - Home Base

No Asbestos

B00C - R0007 - General Storeroom

Floor Coverings Res/Textile	Vinyl Sheet	3908/B00C/R0008/Floor Coverings Res/Textile/S10	No Asbestos Detected
-----------------------------	-------------	---	-----------------------------

B00C - R0008 - Interview

Floor Coverings Res/Textile	Vinyl Sheet	3908/B00C/R0008/Floor Coverings Res/Textile/S10	No Asbestos Detected
-----------------------------	-------------	---	-----------------------------

B00C - R0009 - Sports Store

No Asbestos

B00C - R0010 - Craft Store

No Asbestos

B00C - R0011 - General Storeroom

No Asbestos

B00C - R0013 - Personal Effects Storage

No Asbestos

B00C - R0015 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	42m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
		3908/B00C/R0015/Ceiling Structures/Linings/S11		Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0016 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5.75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
		3908/B00C/R0015/Ceiling Structures/Linings/S11		Chrysotile (white asbestos) , Amosite (brown asbestos)		

Wall Linings Internal	Flat AC Sheeting	8m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
		3908/B00C/R0015/Ceiling Structures/Linings/S11		Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0017 - Toilets - Boys/Girls

Ceiling Structures/Linings	Flat AC Sheeting	2.02m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
		3908/B00C/R0015/Ceiling Structures/Linings/S11		Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	2.2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
3908/B00C/R0015/Ceiling Structures/Linings/S11				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Library - 1961 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Panels Beneath Windows	Flat AC Sheeting 3908/B00D/Panels Beneath Windows/S6					No Asbestos Detected

Interior

B00D - R0001 - Reading Area

No Asbestos

B00D - R0004 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00D - R0005 - Movement

No Asbestos

B00D - R0006 - Special Programs Room

No Asbestos

B00D - R0007 - K.L.A. Store

No Asbestos

B00D - R0008 - Plant

Non Accessible	Resinous Board	1m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------	----------------	-----	----------------	--------------------	---------	--------------------

B00D - R0009 - Toilets - Boys

Partition Walls (Cubicles)	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3908/B00D/R0009/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)	

B00D - R0010 - Toilets - Girls

Partition Walls (Cubicles)	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3908/B00D/R0009/Partition Walls (Cubicles)/S5					Chrysotile (white asbestos)	

B00D - R0011 - Movement

No Asbestos

B00D - R0012 - Special Programs Room

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00J - Pupil Facilities - 1951 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible no void hatch located					
Gable Ends	Flat AC Sheeting	6m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3908/B00B/Gable Ends/S14			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

Interior

B00J - R0001 - Handwashing Facilities

Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3908/B00K/R0001/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00J - R0002 - Handwashing Facilities

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3908/B00K/R0001/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Other-After School Care - 2002 - Steel (Steel)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00M - R0001 - Out Of School Hours Care Centre

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00M - R0002 - Out Of School Hours Care Centre

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00M - R0003 - Out Of School Hours Care Centre

No Asbestos

B00M - R0004 - Out Of School Hours Care Centre

No Asbestos

B00M - R0005 - Out Of School Hours Care Centre

No Asbestos

B00M - R0006 - Out Of School Hours Care Centre

No Asbestos

B00M - R0007 - Out Of School Hours Care Centre

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Pupil Facilities - 2008 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00N - R0001 - Home Base	No Asbestos
B00N - R0002 - Practical Activities	No Asbestos
B00N - R0003 - Home Base Store	No Asbestos
B00N - R0004 - Withdrawal Space - 2hb	No Asbestos
B00N - R0005 - Home Base	No Asbestos
B00N - R0006 - Practical Activities	No Asbestos
B00N - R0007 - Home Base Store	No Asbestos
B00N - R0008 - Home Base Store	No Asbestos
B00N - R0009 - Home Base	No Asbestos
B00N - R0010 - Practical Activities	No Asbestos
B00N - R0011 - Withdrawal Space - 2hb	No Asbestos
B00N - R0012 - Home Base	No Asbestos
B00N - R0013 - Practical Activities	No Asbestos
B00N - R0014 - Home Base Store	No Asbestos
B00N - R0015 - Home Base Store	No Asbestos
B00N - R0016 - Home Base	No Asbestos
B00N - R0017 - Practical Activities	No Asbestos
B00N - R0018 - Withdrawal Space - 2hb	No Asbestos
B00N - R0019 - Home Base	No Asbestos
B00N - R0020 - Practical Activities	No Asbestos
B00N - R0021 - Home Base Store	No Asbestos
B00N - R0022 - Laundry - Type 2	No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00N - R0025 - Toilets - Girls						
No Asbestos						
B00N - R0026 - Kiln Room						
No Asbestos						
B00N - R0027 - Toilets - Boys						
No Asbestos						
B00N - R0028 - External Movement						
No Asbestos						
B00N - R0029 - Distribution Board					Note: No inspection of live electrical installation.	
No Asbestos						
B00N - R0030 - Distribution Board					Note: No inspection of live electrical installation.	
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - Administration - 2008 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B000 - R0001 - Entry Vestibule

No Asbestos

B000 - R0002 - Clerical Office

No Asbestos

B000 - R0003 - Clerical/Printing

No Asbestos

B000 - R0004 - Sick Bay

No Asbestos

B000 - R0005 - Access Shower/Toilet

No Asbestos

B000 - R0006 - Deputy Principal

No Asbestos

B000 - R0007 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B000 - R0008 - Cleaning Distributed Store

No Asbestos

B000 - R0009 - Staff Room

No Asbestos

B000 - R0010 - Staff Room

No Asbestos

B000 - R0011 - Deputy Principal

No Asbestos

B000 - R0012 - Staff Toilet

No Asbestos

B000 - R0013 - Staff Toilet

No Asbestos

B000 - R0014 - Staff Toilet

No Asbestos

B000 - R0015 - Movement

No Asbestos

B000 - R0016 - Security Store

No Asbestos

B000 - R0017 - Principal

No Asbestos

B000 - R0018 - Interview

No Asbestos

B000 - R0019 - External Movement

No Asbestos

B000 - R0020 - External Movement

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Building Services - 2008 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00P - R0001 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Q - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00Q - R0001 - Covered Outdoor Learning Area

No Asbestos

B00Q - R0002 - Communal Space

No Asbestos

B00Q - R0003 - Raised Platform

No Asbestos

B00Q - R0004 - Hall Chair Store

No Asbestos

B00Q - R0005 - Communal/Performance Store

No Asbestos

B00Q - R0006 - P.E. Store

No Asbestos

B00Q - R0007 - Toilet - Lobby

No Asbestos

B00Q - R0008 - Toilets - Girls

No Asbestos

B00Q - R0009 - Sound Cupboard

No Asbestos

B00Q - R0010 - Toilet - Lobby

No Asbestos

B00Q - R0011 - Toilets - Boys

No Asbestos

B00Q - R0012 - Cleaning Distributed Store

No Asbestos

B00Q - R0013 - Plant

No Asbestos

B00Q - R0014 - Main Switch Board

No Asbestos

B00Q - R0015 - Disabled Shower/Toilet

No Asbestos

B00Q - R0016 - External Movement

No Asbestos

B00Q - R0017 - Movement

No Asbestos

B00Q - R0018 - Movement

No Asbestos

B00Q - R0019 - Ramp

No Asbestos

B00Q - R0020 - Canteen

No Asbestos

B00Q - R0021 - Canteen Office/Store

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00R - Storage - 2014 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00R - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00S - Administration - 2014 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00S - R0001 - Uniform Shop

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00T - General Learning/Building Services - 2014 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00T - R0001 - Practical Activities - 1hb	No Asbestos
B00T - R0002 - Practical Activities - 1hb	No Asbestos
B00T - R0003 - Home Base	No Asbestos
B00T - R0004 - Home Base Store	No Asbestos
B00T - R0005 - Home Base Store	No Asbestos
B00T - R0006 - Home Base	No Asbestos
B00T - R0007 - Withdrawal Space - 2hb	No Asbestos
B00T - R0008 - General Storeroom	No Asbestos
B00T - R0009 - Garden Store	No Asbestos
B00T - R0010 - General Storeroom	No Asbestos
B00T - R0011 - General Storeroom	No Asbestos
B00T - R0012 - Stairs	No Asbestos
B00T - R0013 - Stairs	No Asbestos
B00T - R0014 - Distribution Board	Note: No inspection of live electrical installation. No Asbestos
B00T - R0015 - Lift	No Asbestos
B00T - R0016 - External Movement	No Asbestos
B00T - R1001 - Practical Activities - 1hb	No Asbestos
B00T - R1002 - Practical Activities - 1hb	No Asbestos
B00T - R1003 - Home Base	No Asbestos
B00T - R1004 - Home Base Store	No Asbestos
B00T - R1005 - Home Base Store	No Asbestos
B00T - R1006 - Home Base	No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00T - R1007 - Withdrawal Space - 2hb						
No Asbestos						
B00T - R1008 - Distribution Board					Note: No inspection of live electrical installation.	
No Asbestos						
B00T - R1009 - External Movement						
No Asbestos						
B00T - R1010 - Stairs						
No Asbestos						
B00T - R1011 - Stairs						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D13295 - Learning Unit - Standard With P.A.A. : Placement Date - 17/11/2010

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 603 - D13608 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 25/10/2007

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 603 - D13715 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 25/11/2008

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D14014 - Learning Unit - Standard With P.A.A. : Placement Date - 17/11/2010

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D17699 - Learning Unit - Standard With P.A.A. : Placement Date - 16/12/2009

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017