


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Lindsay Park Public School (4042)
Region : Illawarra and South East
State Electorate : Keira
Local Government Area : Wollongong

Initial Survey : Noel Arnold & Associates : 21 - Mar - 2008
Reviewed By : AECOM : 18 - Jun - 2015

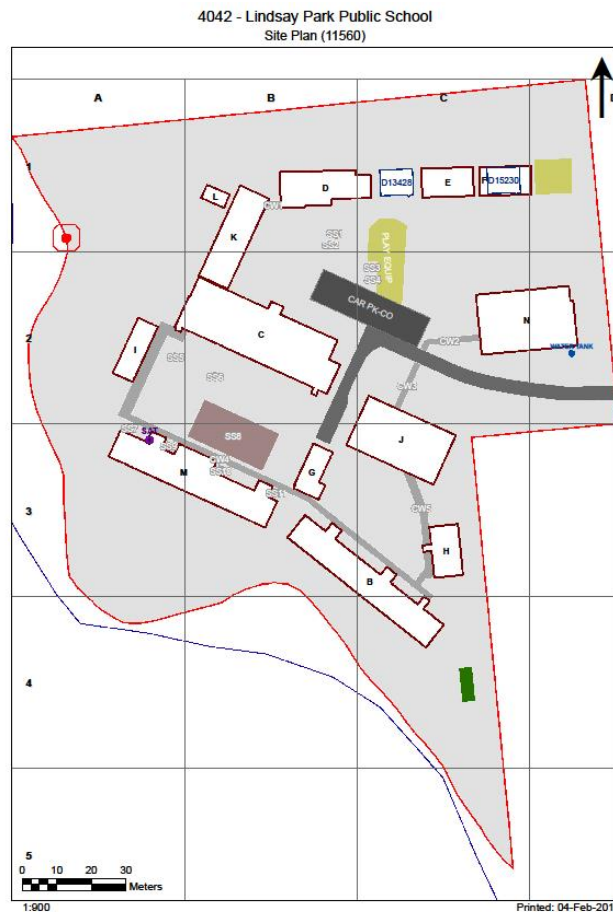

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1975 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00B/Gable Verge Lining/S33				Chrysotile (white asbestos)	
Gable Verge Lining	Flat AC Sheeting	50m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00B/Gable Verge Lining/S33				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible - limited access gained due to low clearance.					

Interior

B00B - R0001 - Home Base

No Asbestos

B00B - R0002 - Home Base Store

No Asbestos

B00B - R0003 - Personal Effects Storage

No Asbestos

B00B - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting					
	4042/B00B/R0019/Ceiling Structures/Linings/S27				No Asbestos Detected	

B00B - R0005 - Home Base

No Asbestos

B00B - R0006 - Home Base Store

No Asbestos

B00B - R0007 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00B/R0009/Floor Coverings Res/Textile/S7				Chrysotile (white asbestos)	

B00B - R0008 - Movement

No Asbestos

B00B - R0009 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00B/R0009/Floor Coverings Res/Textile/S7				Chrysotile (white asbestos)	

B00B - R0010 - General Storeroom

No Asbestos

B00B - R0011 - Distribution Board

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	7m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00B/R0011/Wall Linings Internal/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00B - R0012 - Movement

Ceiling Structures/Linings	Flat AC Sheeting					
	4042/B00B/R0019/Ceiling Structures/Linings/S27				No Asbestos Detected	

B00B - R0013 - Personal Effects Storage

No Asbestos

B00B - R0014 - Home Base

No Asbestos

B00B - R0015 - Home Base Store

No Asbestos

B00B - R0016 - Home Base

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0017 - Home Base Store						
No Asbestos						
B00B - R0018 - Personal Effects Storage						
No Asbestos						
B00B - R0019 - Movement						
Ceiling Structures/Linings		Flat AC Sheeting	4042/B00B/R0019/Ceiling Structures/Linings/S27		No Asbestos Detected	
B00B - R0020 - Home Base						
No Asbestos						
B00B - R0021 - Home Base Store						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Staff Facilities - 1975 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	55m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Gable Verge Lining	Flat AC Sheeting	16m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Upstand Panels	Flat AC Sheeting 4042/B00C/Upstand Panels/S34					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00C - R0001 - Deputy Principal

No Asbestos

B00C - R0002 - General Storeroom

No Asbestos

B00C - R0003 - Main Switch Board

Wall Linings Internal	Flat AC Sheeting	5m2	North, South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
4042/B00C/R0003/Ceiling Structures/Linings/S18						Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4042/B00C/R0003/Ceiling Structures/Linings/S18						Chrysotile (white asbestos)

B00C - R0004 - Staff Room Annexe

Wall Linings Internal	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4042/B00C/R0009/Wall Linings Internal/S17						Chrysotile (white asbestos)

B00C - R0005 - Movement

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
4042/B00C/R0022/Wall Linings Internal/S13						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
4042/B00C/R0022/Ceiling Structures/Linings/S14						

B00C - R0006 - Withdrawal Space - 1hb

Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4042/B00C/R0009/Wall Linings Internal/S17						Chrysotile (white asbestos)

B00C - R0007 - Movement

No Asbestos

B00C - R0008 - Personal Effects Storage

Wall Linings Internal	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4042/B00C/R0009/Wall Linings Internal/S17						Chrysotile (white asbestos)

B00C - R0009 - Home Base

Wall Linings Internal	Flat AC Sheeting	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4042/B00C/R0009/Wall Linings Internal/S17						Chrysotile (white asbestos)

B00C - R0010 - Home Base Store

No Asbestos

B00C - R0011 - Home Base

No Asbestos

B00C - R0012 - Home Base Store

No Asbestos

B00C - R0013 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	4042/B00C/R0013/Floor Coverings Res/Textile/S16					No Asbestos Detected
B00C - R0014 - Staff Toilet						
No Asbestos						
B00C - R0015 - Personal Effects Storage						
No Asbestos						
B00C - R0016 - Personal Effects Storage						
No Asbestos						
B00C - R0017 - Home Base						
No Asbestos						
B00C - R0018 - Home Base Store						
No Asbestos						
B00C - R0019 - Home Base						
No Asbestos						
B00C - R0021 - Staff Toilet						
Wall Linings Internal	Flat AC Sheeting					
	4042/B00C/R0021/Wall Linings Internal/S15					No Asbestos Detected
B00C - R0022 - Movement						
Wall Linings Internal	Flat AC Sheeting					
	4042/B00C/R0022/Wall Linings Internal/S13					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting					
	4042/B00C/R0022/Ceiling Structures/Linings/S14					No Asbestos Detected
B00C - R0025 - Covered Outdoor Learning Area						
Ceiling Structures/Linings	Flat AC Sheeting					
	4042/B00C/Upstand Panels/S34					No Asbestos Detected
B00C - R0026 - Staff Room Annexe						
No Asbestos						
B00C - R0027 - Staff Kitchen						
No Asbestos						
B00C - R0028 - Staff Room						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Administration - 1975 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00D/Eaves Linings/S29					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids	Non Accessible Area - Area inaccessible - due to low clearance.					
Ceiling Voids	No Asbestos Found					

Interior

B00D - R0001 - Principal

No Asbestos

B00D - R0002 - Interview

No Asbestos

B00D - R0003 - Movement

No Asbestos

B00D - R0004 - Cleaning Distributed Store

No Asbestos

B00D - R0005 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	4042/B00D/R0005/Wall Linings Internal/S12					

B00D - R0006 - Entry Vestibule

No Asbestos

B00D - R0007 - General Storeroom

No Asbestos

B00D - R0008 - Sick Bay

No Asbestos

B00D - R0009 - Sick Bay - Shower/Toilet

No Asbestos

B00D - R0010 - Movement

No Asbestos

B00D - R0011 - Duplicating Workroom

No Asbestos

B00D - R0012 - Clerical Office

No Asbestos

B00D - R0014 - Practical Activities

No Asbestos

B00D - R0015 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning/Other-Community Use - 1975 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00E - R0001 - Other-Community Use

Floor Coverings Res/Textile	Vinyl Tiles					
	4042/B00E/R0001/Floor Coverings Res/Textile/S28					No Asbestos Detected

B00E - R0002 - Movement

No Asbestos

B00E - R0003 - Special Programs Room

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Other-Community Use - 1975 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	8m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00F/Eaves Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00F - R0001 - Other-Community Use

Floor Coverings Res/Textile	Vinyl Tiles	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00F/R0001/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	

B00F - R0002 - Other-Community Use

Floor Coverings Res/Textile	Vinyl Tiles	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00F/R0001/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	

B00F - R0003 - Other-Community Use

No Asbestos

B00F - R0004 - Other-Community Use

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Pupil Facilities/Building Services - 1975 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	24m2	North, South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00F/Eaves Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00G - R0001 - Cleaning Supplies**

Wall Linings Internal	Flat AC Sheeting	6m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00G/R0003/Wall Linings Internal/S19				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00G/R0003/Ceiling Structures/Linings/S20				Chrysotile (white asbestos)	

B00G - R0002 - Movement

No Asbestos

B00G - R0003 - Canteen

Wall Linings Internal	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00G/R0003/Wall Linings Internal/S19				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00G/R0003/Ceiling Structures/Linings/S20				Chrysotile (white asbestos)	

B00G - R0004 - Canteen Office/Store

Wall Linings Internal	Flat AC Sheeting	6m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00G/R0003/Wall Linings Internal/S19				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00G/R0003/Ceiling Structures/Linings/S20				Chrysotile (white asbestos)	

B00G - R0006 - Garden Store

Wall Linings Internal	Flat AC Sheeting	10m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00G/R0003/Wall Linings Internal/S19				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00G/R0003/Ceiling Structures/Linings/S20				Chrysotile (white asbestos)	

B00G - R0007 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00G/R0003/Ceiling Structures/Linings/S20				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00G/R0007/Floor Coverings Res/Textile/S22				Chrysotile (white asbestos)	

B00G - R0008 - Cleaning Distributed Store

Wall Linings Internal	Flat AC Sheeting	3m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00G/R0003/Wall Linings Internal/S19				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00G/R0003/Ceiling Structures/Linings/S20				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00G/R0008/Floor Coverings Res/Textile/S21				Chrysotile (white asbestos)	

B00G - R0009 - External Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00H - General Learning - 1975 - Timber (Timber)

Exterior

In-fill-panel	Flat AC Sheeting	8m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00H/In-fill-panel/S3				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Cladding	Flat AC Sheeting	62m2	West, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00H/Wall Cladding/S4				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible - due to low clearance					

Interior

B00H - R0001 - Sports Store

Floor Coverings Res/Textile	Vinyl Tiles					
	4042/B00H/R0004/Floor Coverings Res/Textile/S25				No Asbestos Detected	

B00H - R0002 - Home Base Store

Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00H/R0004/Wall Linings Internal/S23				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00H/R0004/Ceiling Structures/Linings/S24				Chrysotile (white asbestos)	

B00H - R0003 - Withdrawal Space - 1hb

Wall Linings Internal	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00H/R0004/Wall Linings Internal/S23				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00H/R0004/Ceiling Structures/Linings/S24				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					
	4042/B00H/R0004/Floor Coverings Res/Textile/S25				No Asbestos Detected	

B00H - R0004 - Movement

Wall Linings Internal	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00H/R0004/Wall Linings Internal/S23				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00H/R0004/Ceiling Structures/Linings/S24				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					
	4042/B00H/R0004/Floor Coverings Res/Textile/S25				No Asbestos Detected	

B00H - R0005 - Withdrawal Space - 1hb

Floor Coverings Res/Textile	Vinyl Tiles					
	4042/B00H/R0004/Floor Coverings Res/Textile/S25				No Asbestos Detected	

B00H - R0006 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles					
	4042/B00H/R0004/Floor Coverings Res/Textile/S25				No Asbestos Detected	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00H/R0004/Ceiling Structures/Linings/S24				Chrysotile (white asbestos)	

B00H - R0007 - Practical Activities - 1hb

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4042/B00H/R0004/Wall Linings Internal/S23					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4042/B00H/R0004/Ceiling Structures/Linings/S24					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					
4042/B00H/R0004/Floor Coverings Res/Textile/S25					No Asbestos Detected	
B00H - R0008 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4042/B00H/R0004/Ceiling Structures/Linings/S24					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Pupil Facilities/Building Services - 1975 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 4042/B001/Eaves Linings/S32					No Asbestos Detected
Gable Verge Lining	Flat AC Sheeting 4042/B001/Gable Verge Lining/S30	16m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

Interior

B001 - R0002 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting 4042/B001/R0003/Ceiling Structures/Linings/S31	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	--	-----	------------	--------------------	---------	---

B001 - R0003 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting 4042/B001/R0003/Ceiling Structures/Linings/S31	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	--	------	------------	--------------------	---------	---

B001 - R0004 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting 4042/B001/R0003/Ceiling Structures/Linings/S31	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	--	-----	------------	--------------------	---------	---

B001 - R0005 - Kiln Room

Ceiling Structures/Linings	Flat AC Sheeting 4042/B001/R0003/Ceiling Structures/Linings/S31	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	--	-----	------------	--------------------	---------	---

B001 - R0006 - General Assistant/Bulk Store


Ceiling Structures/Linings	Flat AC Sheeting 4042/B001/R0003/Ceiling Structures/Linings/S31	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	--	-----	------------	--------------------	---------	---

B001 - R0007 - Sports Store

Ceiling Structures/Linings	Flat AC Sheeting 4042/B001/R0003/Ceiling Structures/Linings/S31	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	--	------	------------	--------------------	---------	---

B001 - R0008 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting 4042/B001/R0003/Ceiling Structures/Linings/S31	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	--	------	------------	--------------------	---------	---

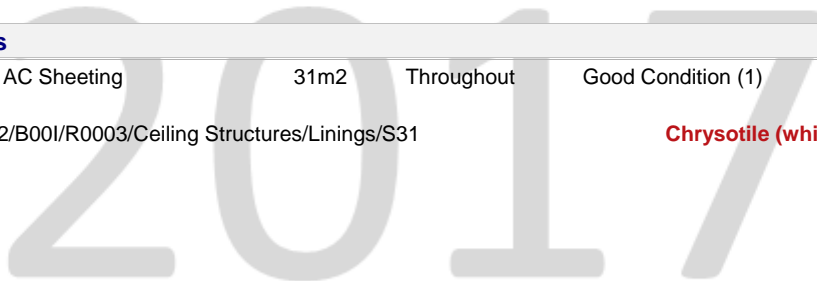

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Library - 1981 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00J - R0001 - Reading Area

No Asbestos

B00J - R0002 - Library Office/Workroom

Floor Coverings Res/Textile	Vinyl Tiles					
	4042/B00J/R0002/Floor Coverings Res/Textile/S5					No Asbestos Detected

B00J - R0003 - Distribution Board

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	8m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00J/R0003/Wall Linings Internal/S6					Chrysotile (white asbestos)

B00J - R0004 - External Movement

No Asbestos

B00J - R0005 - Security Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Pupil Facilities/Building Services - 1975 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	14m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00J/R0003/Wall Linings Internal/S6					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	50m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00K/Gable Verge Lining/S35					Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior

B00K - R0001 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
	4042/B00K/R0001/Partition Walls (Cubicles)/S9					
Ceiling Structures/Linings	Flat AC Sheeting	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00K/R0001/Ceiling Structures/Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	2m2	East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00K/R0001/Wall Linings Internal/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00K - R0002 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00K/R0001/Ceiling Structures/Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00K - R0003 - General Assistant/Bulk Store

Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00K/R0001/Ceiling Structures/Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	1m2	West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00K/R0001/Wall Linings Internal/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00K - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00K/R0001/Ceiling Structures/Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	5m2	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00K/R0001/Wall Linings Internal/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00K - R0005 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00K/R0001/Ceiling Structures/Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	1m2	West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4042/B00K/R0001/Wall Linings Internal/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00K - R0006 - Toilets - Girls

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Wall Linings Internal	Flat AC Sheeting	2m2	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
4042/B00K/R0001/Wall Linings Internal/S11				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4042/B00K/R0001/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00K - R0007 - Cleaning Distributed Store						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4042/B00K/R0001/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	1m2	West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
4042/B00K/R0001/Wall Linings Internal/S11				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00K - R0008 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4042/B00K/R0001/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00K - R0009 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4042/B00K/R0001/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00K - R0010 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4042/B00K/R0001/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00K - R0011 - External Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Building Services - 1975 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00L - R0001 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - General Learning - 2006 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00M - R0001 - Deputy Principal

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00M - R0002 - Home Base Store

No Asbestos

B00M - R0003 - Practical Activities - 1hb

No Asbestos

B00M - R0004 - Movement

No Asbestos

B00M - R0005 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00M - R0006 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00M - R0007 - Practical Activities - 1hb

No Asbestos

B00M - R0008 - Home Base Store

No Asbestos

B00M - R0009 - Sports Store

No Asbestos

B00M - R0010 - General Storeroom

No Asbestos

B00M - R0011 - Disabled Toilet

No Asbestos

B00M - R0012 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00M - R0013 - Movement

No Asbestos

B00M - R0014 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00M - R0015 - Home Base Store

No Asbestos

B00M - R0016 - Practical Activities - 1hb

No Asbestos

B00M - R0017 - Movement

No Asbestos

B00M - R0018 - Special Programs Room

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00M - R0019 - Communications Room

No Asbestos

B00M - R0020 - External Movement

No Asbestos

B00M - R0021 - External Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - R0022 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00N - R0001 - Communal Space

No Asbestos

B00N - R0002 - Raised Platform

No Asbestos

B00N - R0003 - Hall Chair Store

No Asbestos

B00N - R0004 - Communal/Performance Store

No Asbestos

B00N - R0005 - P.E. Store

No Asbestos

B00N - R0006 - Toilet - Lobby

No Asbestos

B00N - R0007 - Toilets - Girls

No Asbestos

B00N - R0008 - Sound Cupboard

No Asbestos

B00N - R0009 - Toilet - Lobby

No Asbestos

B00N - R0010 - Toilets - Boys

No Asbestos

B00N - R0011 - Cleaning Distributed Store

No Asbestos

B00N - R0012 - General Storeroom

No Asbestos

B00N - R0013 - Main Switch Board

No Asbestos

B00N - R0014 - Access Shower/Toilet/Change

No Asbestos

B00N - R0015 - Covered Outdoor Learning Area

No Asbestos

B00N - R0016 - Movement

No Asbestos

B00N - R0017 - Movement

No Asbestos

B00N - R0018 - Ramp

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D13117 - Learning Unit - Standard With P.A.A. : Placement Date - 7/10/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D13428 - Learning Unit - Standard With P.A.A. : Placement Date - 4/11/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D15230 - Learning Unit - Standard With P.A.A. : Placement Date - 1/12/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017