


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Lilli Pilli Public School (4084)
Region : Sydney
State Electorate : Cronulla
Local Government Area : Sutherland

Initial Survey : Noel Arnold & Associates : 25 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 28 - Aug - 2015

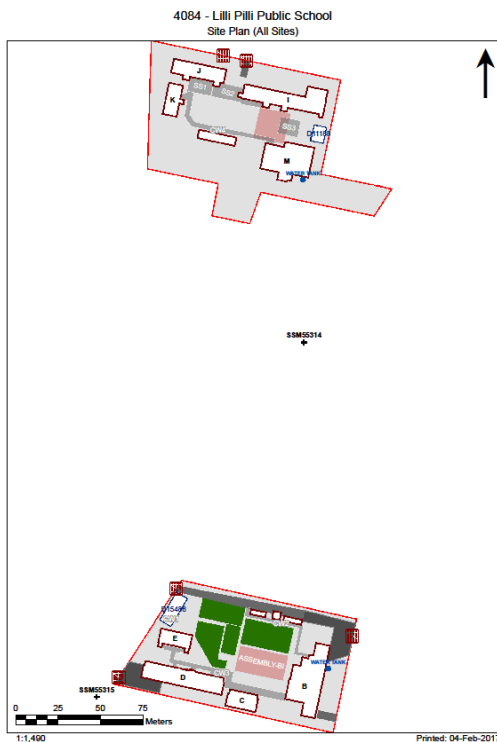

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library/Pupil Facilities - 1950 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 4084/B00B/Eaves Linings/S8					No Asbestos Detected
Gable verge lining	Flat AC Sheeting 4084/B00B/Gable verge lining/S12					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00B - R0001 - Reading Area

No Asbestos

B00B - R0002 - Library Office/Workroom

No Asbestos

B00B - R0003 - K.L.A. Store

No Asbestos

B00B - R0004 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00E/R0004/Ceiling Structures/Linings/S17					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0005 - Home Base

No Asbestos

B00B - R0006 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00B/R0006/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00B - R0007 - Cleaning Distributed Store

Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00B/R0006/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00B - R0008 - Personal Effects Storage

No Asbestos

B00B - R0009 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00E/R0004/Ceiling Structures/Linings/S17					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0010 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00E/R0004/Ceiling Structures/Linings/S17					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0011 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00B/R0006/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00B - R0012 - Home Base

No Asbestos

B00B - R0013 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00B/R0006/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00B - R0015 - General Storeroom

No Asbestos

B00B - R0016 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00B - R0017 - Special Programs Room

No Asbestos

B00B - R0018 - Covered Outdoor Learning Area

No Asbestos

B00B - R9001 - General Storeroom

No Asbestos

B00B - R9002 - Movement

Ceiling Structures/Linings Flat AC Sheeting 26m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)

4084/B00E/R0004/Ceiling Structures/Linings/S17

Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R9003 - Canteen

No Asbestos

B00B - R9004 - Canteen Office/Store

No Asbestos

B00B - R9005 - Canteen Office/Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1956 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 4084/B00B/Eaves Linings/S8					No Asbestos Detected
Gable verge lining	Flat AC Sheeting 4084/B00B/Gable verge lining/S12					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00C - R0001 - Personal Effects Storage

Ceiling Structures/Linings	Flat AC Sheeting	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00C/R0001/Ceiling Structures/Linings/S15					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0002 - General Storeroom

No Asbestos

B00C - R0003 - General Storeroom

No Asbestos

B00C - R0004 - Home Base

No Asbestos

B00C - R0005 - Home Base

No Asbestos

B00C - R0006 - Personal Effects Storage

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning/Communal Facilities - 1957 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00D/Eaves Linings/S9					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Gable verge lining	Flat AC Sheeting					No Asbestos Detected
	4084/B00B/Gable verge lining/S12					
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00D - R0001 - Sports Store

Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00D/R0016/Ceiling Structures/Linings/S16					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00D - R0002 - Cleaning Distributed Store

No Asbestos

B00D - R0003 - Home Base Store

No Asbestos

B00D - R0004 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	4m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00D/R0011/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00D - R0005 - Home Base

Wall Linings Internal	Flat AC Sheeting	3m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00D/R0011/Wall Linings Internal/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00D - R0006 - Home Base

Wall Linings Internal	Flat AC Sheeting	3m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00D/R0011/Wall Linings Internal/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00D - R0007 - Staff Room Annexe

No Asbestos

B00D - R0008 - Craft Store

No Asbestos

B00D - R0009 - Special Programs Room

Floor Coverings Res/Textile	Vinyl Tiles	9m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00D/R0011/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	3m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00D/R0011/Wall Linings Internal/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00D - R0010 - Raised Platform

No Asbestos

B00D - R0011 - Communal Space

Wall Linings Internal	Flat AC Sheeting	6m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00D/R0011/Wall Linings Internal/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00D - R0012 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	4m2	Partition	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00D/R0013/Wall Linings Internal/S4					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R0013 - Staff Toilet						
Wall Linings Internal	Flat AC Sheeting	4m2	Partition	Good Condition (1)	Low (1)	Low Priority (2-3)
4084/B00D/R0013/Wall Linings Internal/S4					Chrysotile (white asbestos)	
B00D - R0014 - General Storeroom						
No Asbestos						
B00D - R0015 - Main Switch Board						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4084/B00D/R0016/Ceiling Structures/Linings/S16					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00D - R0016 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	95m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4084/B00D/R0016/Ceiling Structures/Linings/S16					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00D - R9001 - General Assistant/Bulk Store						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1950 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 4084/B00B/Eaves Linings/S8					No Asbestos Detected
Gable verge lining	Flat AC Sheeting 4084/B00B/Gable verge lining/S12					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00E - R0001 - Home Base Store

No Asbestos

B00E - R0002 - Practical Activities - 1hb

No Asbestos

B00E - R0003 - Withdrawal Space - 1hb

No Asbestos

B00E - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00E/R0004/Ceiling Structures/Linings/S17					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00E - R0005 - Home Base

Wall Linings Internal	Flat AC Sheeting	1m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00D/R0011/Wall Linings Internal/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00E - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00E/R0004/Ceiling Structures/Linings/S17					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00E - R0007 - Withdrawal Space - 1hb

No Asbestos

B00E - R0008 - Home Base Store

No Asbestos

B00E - R0009 - Home Base

Wall Linings Internal	Flat AC Sheeting	2m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00D/R0011/Wall Linings Internal/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00E - R0010 - Practical Activities - 1hb

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities - 1957 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	6m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00F/Eaves Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00F - R0001 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00F/R0001/Ceiling Structures/Linings/S18				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00F - R0002 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00F/R0001/Ceiling Structures/Linings/S18				Chrysotile (white asbestos) , Amosite (brown asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Pupil Facilities - 1957 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00G - R0001 - Drinking Facilities

No Asbestos

B00G - R0002 - Drinking Facilities

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Pupil Facilities - 1957 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	6m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00F/Eaves Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00H - R0001 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00F/R0001/Ceiling Structures/Linings/S18				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00H - R0002 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00F/R0001/Ceiling Structures/Linings/S18				Chrysotile (white asbestos) , Amosite (brown asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - General Learning - 1961 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 4084/B00J/Eaves Linings/S11	40m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Gable verge lining	Flat AC Sheeting 4084/B00K/Gable verge lining/S13					No Asbestos Detected
infill panel above doors	Flat AC Sheeting 4084/B00J/infill panel above doors/S14	5Unit(s)	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00I - R0002 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles 4084/B00I/R0002/Floor Coverings Res/Textile/S5	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	-----	--------------	--------------------	---------	--

B00I - R0008 - Personal Effects Storage

No Asbestos

B00I - R0009 - Movement

Floor Coverings Res/Textile	Vinyl Tiles 4084/B00I/R0002/Floor Coverings Res/Textile/S5	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	-----	--------------	--------------------	---------	--

B00I - R0010 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4084/B00J/R0012/Ceiling Structures/Linings/S19	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-----	--------------	--------------------	---------	--

B00I - R0011 - General Storeroom

No Asbestos

B00I - R0012 - Staff Room Annexe

No Asbestos

B00I - R0013 - Practical Activities - 1hb

No Asbestos

B00I - R0014 - Home Base

Wall Linings Internal	Flat AC Sheeting 4084/B00I/R0006/Wall Linings Internal/S6	2m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles 4084/B00I/R0002/Floor Coverings Res/Textile/S5	10m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00I - R0015 - Personal Effects Storage

No Asbestos

B00I - R0017 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4084/B00J/R0012/Ceiling Structures/Linings/S19	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-----	--------------	--------------------	---------	--

B00I - R0025 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4084/B00J/R0012/Ceiling Structures/Linings/S19	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-----	--------------	--------------------	---------	--

B00I - R0026 - Entry Vestibule

No Asbestos

B00I - R0027 - Principal

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00I - R0028 - General Storeroom						
No Asbestos						
B00I - R0029 - Sick Bay						
No Asbestos						
B00I - R0030 - Staff Room						
No Asbestos						
B00I - R0031 - Clerical Office						
No Asbestos						
B00I - R0032 - Staff Toilet						
Wall Linings Internal	Flat AC Sheeting					
	4084/B00I/R0032/Wall Linings Internal/S20					No Asbestos Detected
B00I - R0033 - Movement						
Wall Linings Internal	Flat AC Sheeting					
	4084/B00I/R0032/Wall Linings Internal/S20					No Asbestos Detected
B00I - R0034 - Movement						
No Asbestos						
B00I - R0035 - Movement						
No Asbestos						
B00I - R0036 - Home Base						
Infill Panel behind Heater	Compressed AC Sheet	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00I/R0039/Infill Panel behind Heater/S21					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00I - R0037 - Home Base Store						
No Asbestos						
B00I - R0038 - Home Base Store						
No Asbestos						
B00I - R0039 - Home Base						
Infill Panel behind Heater	Compressed AC Sheet	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00I/R0039/Infill Panel behind Heater/S21					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00I - R0040 - Movement						
No Asbestos						
B00I - R0041 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00J/R0012/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)
B00I - R0042 - General Storeroom						
No Asbestos						
B00I - R0043 - Communal Space						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning/Library - 1965 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 4084/B00J/Eaves Linings/S11	40m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Gable verge lining	Flat AC Sheeting 4084/B00K/Gable verge lining/S13					No Asbestos Detected
infill panel above doors	Flat AC Sheeting 4084/B00J/infill panel above doors/S14	4Unit(s)	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00J - R0001 - Staff Room

No Asbestos

B00J - R0002 - Staff Toilet

Partition Walls (Cubicles)	Compressed AC Sheet 4084/B00J/R0002/Partition Walls (Cubicles)/S7					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00J - R0003 - Movement

Floor Coverings Res/Textile	Vinyl Tiles 4084/B00I/R0002/Floor Coverings Res/Textile/S5	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	-----	--------------	--------------------	---------	--

B00J - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4084/B00J/R0012/Ceiling Structures/Linings/S19	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-----	--------------	--------------------	---------	--

B00J - R0005 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles 4084/B00I/R0002/Floor Coverings Res/Textile/S5	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	-----	--------------	--------------------	---------	--

B00J - R0006 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles 4084/B00I/R0002/Floor Coverings Res/Textile/S5	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	-----	--------------	--------------------	---------	--

B00J - R0007 - Home Base

No Asbestos

B00J - R0008 - Practical Activities - 1hb

No Asbestos

B00J - R0009 - Home Base

No Asbestos

B00J - R0010 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles 4084/B00I/R0002/Floor Coverings Res/Textile/S5	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	------	--------------	--------------------	---------	--

B00J - R0011 - Movement

Floor Coverings Res/Textile	Vinyl Tiles 4084/B00I/R0002/Floor Coverings Res/Textile/S5	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	-----	--------------	--------------------	---------	--

B00J - R0012 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4084/B00J/R0012/Ceiling Structures/Linings/S19	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	------	--------------	--------------------	---------	--

B00J - R0013 - Personal Effects Storage

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4084/B001/R0002/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
B00J - R0014 - Practical Activities - 1hb						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4084/B001/R0002/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
B00J - R0015 - Home Base						
No Asbestos						
B00J - R0016 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4084/B001/R0002/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Other-After School Care/General Learning - 1957 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 4084/B00J/Eaves Linings/S11	40m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Gable verge lining	Flat AC Sheeting 4084/B00K/Gable verge lining/S13					No Asbestos Detected
infill panel above doors	Flat AC Sheeting 4084/B00J/infill panel above doors/S14	1Unit(s)	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00K - R0001 - Out Of School Hours Care Centre

No Asbestos

B00K - R0002 - Personal Effects Storage

Wall Linings Internal	Flat AC Sheeting 4084/B00I/R0006/Wall Linings Internal/S6	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles 4084/B00I/R0002/Floor Coverings Res/Textile/S5	11m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00K - R0003 - Movement

Floor Coverings Res/Textile	Vinyl Tiles 4084/B00I/R0002/Floor Coverings Res/Textile/S5	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	-----	--------------	--------------------	---------	--

B00K - R0004 - Movement

No Asbestos

B00K - R0005 - Uniform Shop

No Asbestos

B00K - R0006 - Home Base

No Asbestos

B00K - R9001 - Sports Store

Ceiling Structures/Linings	Flat AC Sheeting 4084/B00J/R0012/Ceiling Structures/Linings/S19	55m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	------	--------------	--------------------	---------	--

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Pupil Facilities - 1957 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	4m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4084/B00J/Eaves Linings/S11					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Grass Area 20 South-East of Building (20m)	AC Fragments/Debris					
	4084/B00L/Grass Area 20 South-East of Building (20m)/S22					No Asbestos Detected

Interior

B00L - R0001 - Drinking Facilities

No Asbestos

B00L - R0002 - Toilets - Girls

No Asbestos

B00L - R0003 - Cleaning Distributed Store

No Asbestos

B00L - R0004 - Toilets - Boys

No Asbestos

B00L - R0005 - Drinking Facilities

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00M - Pupil Facilities/Communal Facilities - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00M - R0001 - Communal Space

No Asbestos

B00M - R0002 - Raised Platform

No Asbestos

B00M - R0003 - Communal/Performance Store

No Asbestos

B00M - R0004 - Hall Chair Store

No Asbestos

B00M - R0005 - P.E. Store

No Asbestos

B00M - R0006 - Toilets - Boys

No Asbestos

B00M - R0007 - Toilet - Lobby

No Asbestos

B00M - R0008 - Sound Cupboard

No Asbestos

B00M - R0009 - Disabled Shower/Toilet

No Asbestos

B00M - R0010 - Toilet - Lobby

No Asbestos

B00M - R0011 - Toilets - Girls

No Asbestos

B00M - R0012 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00M - R0013 - Cleaning Distributed Store

No Asbestos

B00M - R0014 - Covered Outdoor Learning Area

No Asbestos

B00M - R0015 - Plant

No Asbestos

B00M - R0016 - Movement

No Asbestos

B00M - R0017 - Movement

No Asbestos

B00M - R0018 - Movement

No Asbestos

B00M - R0019 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D11188 - Learning Unit - Standard/Withdrawal : Placement Date - 18/01/2003

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 502 - D15488 - Admin Staff/Principal/Clerk/Dup/Clinic : Placement Date - 18/01/2003

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Clerical Office

No Asbestos Found.

R10 - Store

No Asbestos Found.

R2 - Security Store

No Asbestos Found.

R3 - Duplicating Wookroom

No Asbestos Found.

R4 - Clinic-Waiting

No Asbestos Found.

R5 - Staff Room

No Asbestos Found.

R6 - Principal

No Asbestos Found.

R7 - Staff Toilet

No Asbestos Found.

R8 - Staff Toilet

No Asbestos Found.

R9 - Entry

No Asbestos Found.



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017