

Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Liverpool West Public School (4161)
Region : South Western Sydney
State Electorate : Liverpool
Local Government Area : Liverpool

Initial Survey : Noel Arnold & Associates : 03 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 11 - Sep - 2015



2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning - 1959 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 4161/B00A/Eaves Linings/S34	60m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	
Gable Verge Lining	Flat AC Sheeting 4161/B00A/Gable Verge Lining/S35	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	Deblis 4161/B00A/Ceiling Voids/S33					No Asbestos Detected
Underfloor Voids	Debris 4161/B00A/Underfloor Voids/S36	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	

Interior

B00A - R0003 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4161/B00A/R0011/Ceiling Structures/Linings/S26	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Panel above Door	Flat AC Sheeting 4161/B00A/R0011/Panel above Door/S27	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00A - R0010 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4161/B00A/R0011/Ceiling Structures/Linings/S26	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Panel above Door	Flat AC Sheeting 4161/B00A/R0011/Panel above Door/S27	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00A - R0011 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4161/B00A/R0011/Ceiling Structures/Linings/S26	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Panel above Door	Flat AC Sheeting 4161/B00A/R0011/Panel above Door/S27	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00A - R0014 - Staff Kitchen

Wall Linings Internal	Flat AC Sheeting 4161/B00A/R0014/Wall Linings Internal/S62	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	

B00A - R0015 - Staff Toilet

No Asbestos

B00A - R0016 - Movement

Floor Coverings Res/Textile	Flat AC Sheeting under Vinyl sheeting 4161/B00A/R0022/Floor Coverings Res/Textile/S29					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Sheet 4161/B00A/R0022/Floor Coverings Res/Textile/S28					No Asbestos Detected

B00A - R0017 - Home Base

No Asbestos

B00A - R0018 - Home Base Store

No Asbestos

B00A - R0019 - General Storeroom

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Flat AC Sheeting under Vinyl sheeting					No Asbestos Detected
		4161/B00A/R0022/Floor Coverings Res/Textile/S29				
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
		4161/B00A/R0022/Floor Coverings Res/Textile/S28				
B00A - R0020 - General Storeroom						
No Asbestos						
B00A - R0021 - Personal Effects Storage						
Floor Coverings Res/Textile	Flat AC Sheeting under Vinyl sheeting					No Asbestos Detected
		4161/B00A/R0022/Floor Coverings Res/Textile/S29				
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
		4161/B00A/R0022/Floor Coverings Res/Textile/S28				
B00A - R0022 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
		4161/B00A/R0022/Floor Coverings Res/Textile/S28				
Floor Coverings Res/Textile	Flat AC Sheeting under Vinyl sheeting					No Asbestos Detected
		4161/B00A/R0022/Floor Coverings Res/Textile/S29				
B00A - R0023 - Other-Commercial						
Floor Coverings Res/Textile	Flat AC Sheeting under Vinyl sheeting					No Asbestos Detected
		4161/B00A/R0022/Floor Coverings Res/Textile/S29				
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
		4161/B00A/R0022/Floor Coverings Res/Textile/S28				
B00A - R0024 - Disabled Toilet						
No Asbestos						
B00A - R0025 - Home Base Store						
No Asbestos						
B00A - R0026 - Home Base						
No Asbestos						
B00A - R0027 - Main Switch Board						
No Asbestos						
B00A - R0028 - Security Store						
No Asbestos						
B00A - R0029 - Clerical Office/Workroom						
No Asbestos						
B00A - R0030 - Sick Bay						
No Asbestos						
B00A - R0031 - Principal						
No Asbestos						
B00A - R0032 - Staff Room						
No Asbestos						
B00A - R0033 - Deputy Principal						
No Asbestos						
B00A - R0034 - Interview						
No Asbestos						
B00A - R0035 - Movement						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1960 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 4161/B00B/Eaves Linings/S37	60m2	North facing, South facing	Good Condition (1) Chrysotile (white asbestos) , Amosite (brown asbestos)	Low (1)	Low Priority (2-3)
Gable Verge Lining	Flat AC Sheeting 4161/B00B/Gable Verge Lining/S38	20m	East facing, West facing	Good Condition (1) Chrysotile (white asbestos) , Amosite (brown asbestos)	Low (1)	Low Priority (2-3)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Debris 4161/B00B/Underfloor Voids/S39	1m2	Throughout	Good Condition (1) Chrysotile (white asbestos)	Low (1)	Low Priority (2-3)

Interior

B00B - R0001 - Home Base

No Asbestos

B00B - R0002 - Home Base Store

No Asbestos

B00B - R0003 - Personal Effects Storage

No Asbestos

B00B - R0004 - Movement

No Asbestos

B00B - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4161/B00B/R0013/Ceiling Structures/Linings/S24	5m2	All surfaces	Good Condition (1) Chrysotile (white asbestos) , Amosite (brown asbestos)	Low (1)	Low Priority (2-3)
Panel above Door	Flat AC Sheeting 4161/B00B/R0013/Panel above Door/S25	1m2	Upper portion	Good Condition (1) Chrysotile (white asbestos) , Amosite (brown asbestos)	Low (1)	Low Priority (2-3)

B00B - R0006 - Home Base Store

No Asbestos

B00B - R0007 - Home Base

No Asbestos

B00B - R0008 - Home Base

No Asbestos

B00B - R0009 - Practical Activities - 1hb

No Asbestos

B00B - R0010 - Home Base Store

No Asbestos

B00B - R0011 - Personal Effects Storage

No Asbestos

B00B - R0012 - Movement

No Asbestos

B00B - R0013 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4161/B00B/R0013/Ceiling Structures/Linings/S24	9m2	All surfaces	Good Condition (1) Chrysotile (white asbestos) , Amosite (brown asbestos)	Low (1)	Low Priority (2-3)
Panel above Door	Flat AC Sheeting 4161/B00B/R0013/Panel above Door/S25	1m2	Upper portion	Good Condition (1) Chrysotile (white asbestos) , Amosite (brown asbestos)	Low (1)	Low Priority (2-3)

B00B - R0014 - Cleaning Distributed Store

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00B - R0015 - Store

No Asbestos

B00B - R0016 - Community Clinic

No Asbestos

B00B - R0017 - Personal Effects Storage

No Asbestos

B00B - R0018 - Home Base Store

No Asbestos

B00B - R0019 - Home Base

No Asbestos

B00B - R0020 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Administration - 1959 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00C/Eaves Linings/S40				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Gable Verge Lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00C/Gable Verge Lining/S41				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Debris	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00C/Underfloor Voids/S42				Chrysotile (white asbestos)	

Interior**B00C - M0001 - General Assistant/Bulk Store**

Wall Linings Internal	Flat AC Sheeting	10m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00C/M0001/Wall Linings Internal/S32				Chrysotile (white asbestos)	

B00C - M0002 - Stairs

No Asbestos

B00C - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00C/R0011/Ceiling Structures/Linings/S21				Chrysotile (white asbestos)	
Panel above Door	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00C/R0011/Panel above Door/S23				Chrysotile (white asbestos)	

B00C - R0002 - General Storeroom

Non Accessible

B00C - R0003 - Movement

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	4161/B00C/R0003/Floor Coverings Res/Textile/S30					
Floor Coverings Res/Textile	AC sheeting under vinyl tiles					No Asbestos Detected
	4161/B00C/R0003/Floor Coverings Res/Textile/S31					

B00C - R0004 - Store

No Asbestos

B00C - R0008 - General Storeroom

No Asbestos

B00C - R0009 - General Storeroom

No Asbestos

B00C - R0010 - Movement

Floor Coverings Res/Textile	AC sheeting under vinyl tiles					No Asbestos Detected
	4161/B00C/R0003/Floor Coverings Res/Textile/S31					
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	4161/B00C/R0003/Floor Coverings Res/Textile/S30					

B00C - R0011 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00C/R0011/Ceiling Structures/Linings/S21				Chrysotile (white asbestos)	
Panel above Door	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00C/R0011/Panel above Door/S23				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0012 - Home Base						
No Asbestos						
B00C - R0014 - Home Base						
No Asbestos						
B00C - R0015 - Movement						
No Asbestos						
B00C - R0016 - General Assistant/Bulk Store						
No Asbestos						
B00C - R0017 - Stairs						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning/Administration - 1960 - Brick/Veneer (Brick/Veneer)

Exterior

Gable Verge Lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00D/Gable Verge Lining/S44			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Eaves Linings	Flat AC Sheeting	40m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00D/Eaves Linings/S43			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Debris					No Asbestos Detected
	4161/B00D/Underfloor Voids/S45					
Underfloor Voids	Packing					No Asbestos Detected
	4161/B00D/Underfloor Voids/S63					

Interior

B00D - R0001 - Home Base

No Asbestos

B00D - R0002 - Home Base Store

No Asbestos

B00D - R0003 - General Storeroom

No Asbestos

B00D - R0004 - Movement

No Asbestos

B00D - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00D/R0005/Ceiling Structures/Linings/S17			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Panel above Door	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00D/R0005/Panel above Door/S18			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00D - R0006 - Entry Vestibule

No Asbestos

B00D - R0007 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00D/R0007/Ceiling Structures/Linings/S19			Chrysotile (white asbestos)		

B00D - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	4161/B00E/R0016/Ceiling Structures/Linings/S13					
Panel above Door	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00I/R0011/Panel above Door/S7			Chrysotile (white asbestos)		

B00D - R0009 - Home Base

No Asbestos

B00D - R0010 - Home Base Store

No Asbestos

B00D - R0011 - Personal Effects Storage

No Asbestos

B00D - R0012 - Withdrawal Space - 2hb

No Asbestos

B00D - R0013 - General Storeroom

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R0014 - General Storeroom						
No Asbestos						
B00D - R0015 - Distribution Board					Note: No inspection of live electrical installation.	
No Asbestos						
B00D - R0018 - Withdrawal Space - 1hb						
No Asbestos						
B00D - R0019 - General Storeroom						
No Asbestos						
B00D - R0020 - General Storeroom						
No Asbestos						
B00D - R0021 - Withdrawal Space - 1hb						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning/Library - 1960 - Brick/Veneer (Brick/Veneer)

Exterior

Gable Verge Lining	Flat AC Sheeting	30m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00E/Gable Verge Lining/S47				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Eaves Linings	Flat AC Sheeting	80m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00E/Eaves Linings/S46				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Debris	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00E/Underfloor Voids/S48				Chrysotile (white asbestos)	

Interior

B00E - R0001 - Staff Room Annexe

No Asbestos

B00E - R0002 - General Storeroom

No Asbestos

B00E - R0003 - Movement

Floor Coverings Res/Textile	Vinyl Tiles					
	4161/B00C/R0003/Floor Coverings Res/Textile/S30				No Asbestos Detected	
Floor Coverings Res/Textile	Flat AC sheeting under vinyl tiles					
	4161/B00A/R0022/Floor Coverings Res/Textile/S29				No Asbestos Detected	

B00E - R0004 - General Storeroom

No Asbestos

B00E - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting					
	4161/B00E/R0016/Ceiling Structures/Linings/S13				No Asbestos Detected	
Panel above Door	Flat AC Sheeting					
	4161/B00E/R0016/Panel above Door/S14				No Asbestos Detected	

B00E - R0006 - Home Base Store

No Asbestos

B00E - R0007 - Home Base

No Asbestos

B00E - R0008 - Practical Activities - 1hb

No Asbestos

B00E - R0009 - Home Base

No Asbestos

B00E - R0010 - Practical Activities - 1hb

No Asbestos

B00E - R0011 - Home Base Store

No Asbestos

B00E - R0012 - General Storeroom

No Asbestos

B00E - R0013 - Movement

Floor Coverings Res/Textile	Flat AC sheeting under vinyl tiles					
	4161/B00A/R0022/Floor Coverings Res/Textile/S29				No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Tiles					
	4161/B00C/R0003/Floor Coverings Res/Textile/S30				No Asbestos Detected	

B00E - R0014 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting 4161/B00E/R0016/Ceiling Structures/Linings/S13					No Asbestos Detected
Panel above Door	Flat AC Sheeting 4161/B00E/R0016/Panel above Door/S14					No Asbestos Detected
B00E - R0015 - Home Base						
No Asbestos						
B00E - R0016 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting 4161/B00E/R0016/Ceiling Structures/Linings/S13					No Asbestos Detected
Panel above Door	Flat AC Sheeting 4161/B00E/R0016/Panel above Door/S14					No Asbestos Detected
B00E - R0018 - Movement						
No Asbestos						
B00E - R0019 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles 4161/B00C/R0003/Floor Coverings Res/Textile/S30					No Asbestos Detected
Floor Coverings Res/Textile	Flat AC sheeting under vinyl tiles 4161/B00A/R0022/Floor Coverings Res/Textile/S29					No Asbestos Detected
B00E - R0020 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles 4161/B00E/R0020/Floor Coverings Res/Textile/S15	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0021 - Staff Toilet						
Wall Linings Internal	Flat AC Sheeting 4161/B00E/R0021/Wall Linings Internal/S16	8m2	All surfaces, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0022 - Staff Toilet						
Wall Linings Internal	Flat AC Sheeting 4161/B00E/R0021/Wall Linings Internal/S16	25m2	All surfaces, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0023 - General Storeroom						
No Asbestos						
B00E - R0024 - General Storeroom						
No Asbestos						
B00E - R0025 - General Storeroom						
No Asbestos						
B00E - R0026 - Special Programs Room						
No Asbestos						
B00E - R0027 - Withdrawal Space - 2hb						
No Asbestos						
B00E - R0028 - Movement						
No Asbestos						
B00E - R0029 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting 4161/B00E/R0016/Ceiling Structures/Linings/S13					No Asbestos Detected
Panel above Door	Flat AC Sheeting 4161/B00E/R0016/Panel above Door/S14					No Asbestos Detected
B00E - R0030 - Home Base						
No Asbestos						
B00E - R0031 - Movement						
No Asbestos						
B00E - R0032 - Practical Activities - 1hb						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00E - R0033 - Home Base Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1958 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 4161/B00F/Eaves Linings/S49	30m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting 4161/B00F/Gable Verge Lining/S50	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Debris 4161/B00F/Underfloor Voids/S51	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

Interior

B00F - R0011 - General Storeroom

No Asbestos

B00F - R0012 - Staff Room Annexe

No Asbestos

B00F - R0013 - Staff Toilet

No Asbestos

B00F - R0014 - Movement

No Asbestos

B00F - R0015 - Home Base Store

No Asbestos

B00F - R0016 - Home Base

No Asbestos

B00F - R0017 - Practical Activities

No Asbestos

B00F - R0018 - Home Base

No Asbestos

B00F - R0019 - Practical Activities

No Asbestos

B00F - R0020 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1960 - Brick/Veneer (Brick/Veneer)

Exterior

Gable Verge Lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00G/Gable Verge Lining/S53			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Eaves Linings	Flat AC Sheeting	30m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00G/Eaves Linings/S52			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Debris	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00G/Underfloor Voids/S54			Chrysotile (white asbestos)		

Interior

B00G - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00G/R0001/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Panel above Door	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00G/R0001/Panel above Door/S5			Chrysotile (white asbestos)		

B00G - R0002 - Movement

No Asbestos

B00G - R0003 - Personal Effects Storage

No Asbestos

B00G - R0004 - Home Base Store

No Asbestos

B00G - R0005 - Home Base

No Asbestos

B00G - R0006 - Home Base

No Asbestos

B00G - R0007 - Home Base Store

No Asbestos

B00G - R0008 - Personal Effects Storage

No Asbestos

B00G - R0009 - Movement

No Asbestos

B00G - R0010 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00F/R0008/Ceiling Structures/Linings/S2			Chrysotile (white asbestos)		
Panel above Door	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00G/R0001/Panel above Door/S5			Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning/Communal Facilities - 1960 - Brick/Veneer (Brick/Veneer)

Exterior

Gable Verge Lining	Flat AC Sheeting	30m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00I/Gable Verge Lining/S59					Chrysotile (white asbestos) , Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting	40m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00H/Eaves Linings/S55					Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	Debris	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00H/Underfloor Voids/S56					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					

Interior

B00H - R0001 - Movement

No Asbestos

B00H - R0002 - Movement

Panel above Door	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00H/R0002/Panel above Door/S8					Chrysotile (white asbestos)

B00H - R0003 - Craft Store

No Asbestos

B00H - R0004 - Home Base Store

No Asbestos

B00H - R0005 - Home Base

No Asbestos

B00H - R0006 - Practical Activities - 1hb

No Asbestos

B00H - R0007 - Home Base

No Asbestos

B00H - R0008 - Practical Activities - 1hb

No Asbestos

B00H - R0009 - Movement

Panel above Door	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B00H/R0002/Panel above Door/S8					Chrysotile (white asbestos)

B00H - R0010 - General Storeroom

No Asbestos

B00H - R0011 - Staff Toilet

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - General Learning - 1960 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B001/Eaves Linings/S58			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Lining	Flat AC Sheeting	30m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B001/Gable Verge Lining/S59			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Debris	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B001/Underfloor Voids/S57			Chrysotile (white asbestos)		

Interior

B001 - R0001 - Movement

No Asbestos

B001 - R0002 - Movement

Panel above Door	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B001/R0011/Panel above Door/S7			Chrysotile (white asbestos)		

B001 - R0003 - Personal Effects Storage

Electrical Mounting Board	Flat AC Sheeting	1Unit	East facing	Poor Condition (4)	Medium (2)	Low Priority (2-3)
	4161/B001/R0003/Electrical Mounting Board/S6			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B001 - R0004 - Home Base Store

No Asbestos

B001 - R0005 - Practical Activities - 1hb

No Asbestos

B001 - R0006 - Home Base

No Asbestos

B001 - R0007 - Home Base

No Asbestos

B001 - R0008 - Practical Activities - 1hb

No Asbestos

B001 - R0009 - Home Base Store

No Asbestos

B001 - R0010 - Personal Effects Storage

No Asbestos

B001 - R0011 - Movement

Panel above Door	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4161/B001/R0011/Panel above Door/S7			Chrysotile (white asbestos)		

B001 - R0012 - General Storeroom

No Asbestos

B001 - R0013 - Staff Toilet

No Asbestos

B001 - R0014 - Cleaning Distributed Store

No Asbestos

B001 - R0015 - General Storeroom

No Asbestos

B001 - R0016 - Withdrawal Space - 1hb

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Pre-School Facilities - 1960 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 4161/B00J/Eaves Linings/S64	30m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Lining	Flat AC Sheeting 4161/B00J/Gable Verge Lining/S60	20m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Debris 4161/B00J/Underfloor Voids/S61	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos)		

Interior

B00J - R0001 - Clerical Office - Pre

No Asbestos

B00J - R0002 - Kitchen - Pre

No Asbestos

B00J - R0003 - Covered Outdoor Learning Area - Pre

Ceiling Structures/Linings	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00J - R0004 - Staff Toilet - Pre

No Asbestos

B00J - R0005 - Practical Activities - Pre

No Asbestos

B00J - R0006 - Personal Effects - Pre

No Asbestos

B00J - R0007 - Toilets - Boys/Girls - Pre

No Asbestos

B00J - R0008 - Home Base - Pre


No Asbestos

B00J - R0009 - General Storeroom - Pre

No Asbestos

B00J - R0010 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4161/B00J/R0010/Ceiling Structures/Linings/S9	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Panel above Door	Flat AC Sheeting 4161/B00J/R0010/Panel above Door/S10	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos)		

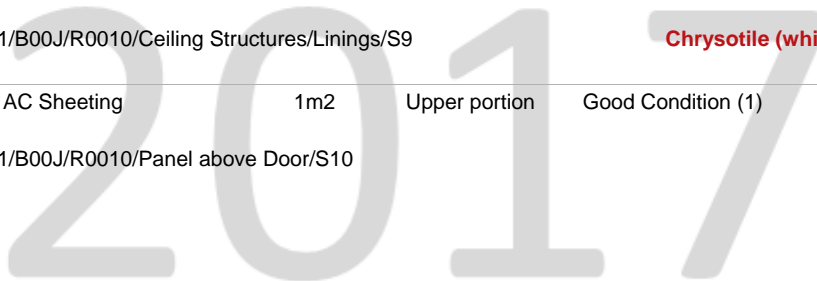

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - General Learning - 1960 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - No Asbestos Found						
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00K - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4161/B00K/R0001/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)	
Panel above Door	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
4161/B00K/R0001/Panel above Door/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00K - R0002 - Movement

No Asbestos

B00K - R0003 - Personal Effects Storage

No Asbestos

B00K - R0004 - Home Base Store

No Asbestos

B00K - R0005 - Toilets - Boys/Girls

No Asbestos

B00K - R0006 - Home Base

No Asbestos

B00K - R0007 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Pupil Facilities - 1960 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00M - R0001 - Canteen Office/Store

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	--------------	--------------------	---------	--------------------

Assumed Asbestos - No Asbestos Found

B00M - R0002 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	--------------	--------------------	---------	--------------------

Assumed Asbestos - No Asbestos Found

B00M - R0003 - Canteen Office/Store

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	--------------	--------------------	---------	--------------------

Assumed Asbestos - No Asbestos Found

B00M - R0004 - No Access

Ceiling Structures/Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	--------------	--------------------	---------	--------------------

Assumed Asbestos - No Asbestos Found

B00M - R0005 - Movement

No Asbestos

B00M - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	20m2	All surfaces	Some Damage / Unsealed (3)	Medium (2)	Low Priority (2-3)
----------------------------	------------------	------	--------------	----------------------------	------------	--------------------

Assumed Asbestos - No Asbestos Found

Wall Linings Internal	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------	------------------	-----	---------------	--------------------	---------	--------------------

Assumed Asbestos - No Asbestos Found

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Pupil Facilities - 1960 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00N - R0001 - Drinking Facilities

No Asbestos

B00N - R0002 - Toilets - Girls

No Asbestos

B00N - R0003 - Toilets - Boys

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - Pupil Facilities - 1960 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	10m2	South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	--	--------------------	---------	--------------------

Assumed Asbestos - No Asbestos Found

Ceiling Voids	No Asbestos Found					
---------------	-------------------	--	--	--	--	--

Underfloor Voids	No Asbestos Found					
------------------	-------------------	--	--	--	--	--

Interior

B000 - R0001 - Drinking Facilities

No Asbestos

B000 - R0002 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---------------------	------	-------------------------------	--------------------	---------	--------------------

4161/B000/R0002/Partition Walls (Cubicles)/S1 **Chrysotile (white asbestos)**

B000 - R0003 - Toilets - Boys

No Asbestos

B000 - R0004 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Building Services - 2007 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00P - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00Q - Communal Facilities - 2009 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00Q - R0001 - Communal Space**

No Asbestos

B00Q - R0002 - Raised Platform

No Asbestos

B00Q - R0003 - Movement

No Asbestos

B00Q - R0004 - Movement

No Asbestos

B00Q - R0005 - Hall Chair Store

No Asbestos

B00Q - R0006 - Communal/Performance Store

No Asbestos

B00Q - R0007 - P.E. Store

No Asbestos

B00Q - R0008 - Toilets - Girls

No Asbestos

B00Q - R0009 - Toilet - Lobby

No Asbestos

B00Q - R0010 - Sound Cupboard

No Asbestos

B00Q - R0011 - Toilet - Lobby

No Asbestos

B00Q - R0012 - Toilets - Boys

No Asbestos

B00Q - R0013 - Plant

No Asbestos

B00Q - R0014 - Cleaning Distributed Store

No Asbestos

B00Q - R0015 - Main Switch Board

No Asbestos

B00Q - R0016 - Access Shower/Toilet

No Asbestos

B00Q - R0017 - Covered Outdoor Learning Area

No Asbestos

B00Q - R0018 - External Movement

No Asbestos

B00Q - R0019 - External Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00R - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00R - R0001 - External Movement

No Asbestos

B00R - R0002 - Practical Activities

No Asbestos

B00R - R0003 - Home Base Store

No Asbestos

B00R - R0004 - Home Base

No Asbestos

B00R - R0005 - Withdrawal Space - 2hb

No Asbestos

B00R - R0006 - Home Base

No Asbestos

B00R - R0007 - Home Base Store

No Asbestos

B00R - R0008 - Practical Activities

No Asbestos

B00R - R0009 - Main Switch Board

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00S - Library - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00S - R0001 - Reading Area

No Asbestos

B00S - R0002 - Special Programs Room

No Asbestos

B00S - R0003 - Special Programs Store

No Asbestos

B00S - R0004 - Cleaning Distributed Store

No Asbestos

B00S - R0005 - Library Office/Workroom

No Asbestos

B00S - R0006 - Communications Room

No Asbestos

B00S - R0007 - Security Store

No Asbestos

B00S - R0008 - Staff Toilet

No Asbestos

B00S - R0009 - Toilet - Lobby

No Asbestos

B00S - R0010 - Cleaning Distributed Store

No Asbestos

B00S - R0011 - Main Switch Board

No Asbestos

B00S - R0012 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

NS 101 - D11483 - Learning Unit - Double Primary/PAA : Placement Date - 16/01/2008

Exterior

No Asbestos Found.

Interior

R1 - Home Base

No Asbestos Found.

R2 - Home Base

No Asbestos Found.

R3 - Entry

No Asbestos Found.

R4 - Practical Activity Area

No Asbestos Found.

R5 - Home Base Store

No Asbestos Found.

R6 - Practical Activity Area

No Asbestos Found.

R7 - Entry

No Asbestos Found.

OS 750 - D11959 - Learning Unit - ESL : Placement Date - 7/04/2003

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	5.76 m2

Interior

R1 - Esl

End wall panel	Flat AC Sheet	Assumed Asbestos	50 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	36 m2

OS 602 - D15789 - Learning Unit - Standard With P.A.A. : Placement Date - 8/12/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D16173 - Learning Unit - Standard With P.A.A. : Placement Date - 27/11/2014

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Learning space/withdrawal/entry						
Ceiling	Flat AC Sheet	Assumed Asbestos				70 m2
R2 - Home Base Store						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				3 m2
OS 750 - D18177 - Learning Unit - ESL : Placement Date - 16/01/2014						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Esl						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017