


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Lennox Head Public School (4184)
Region : North Coast
State Electorate : Ballina
Local Government Area : Ballina

Initial Survey : Noel Arnold & Associates : 11 - Jun - 2008
Reviewed By : Greencap-NAA : 04 - May - 2016

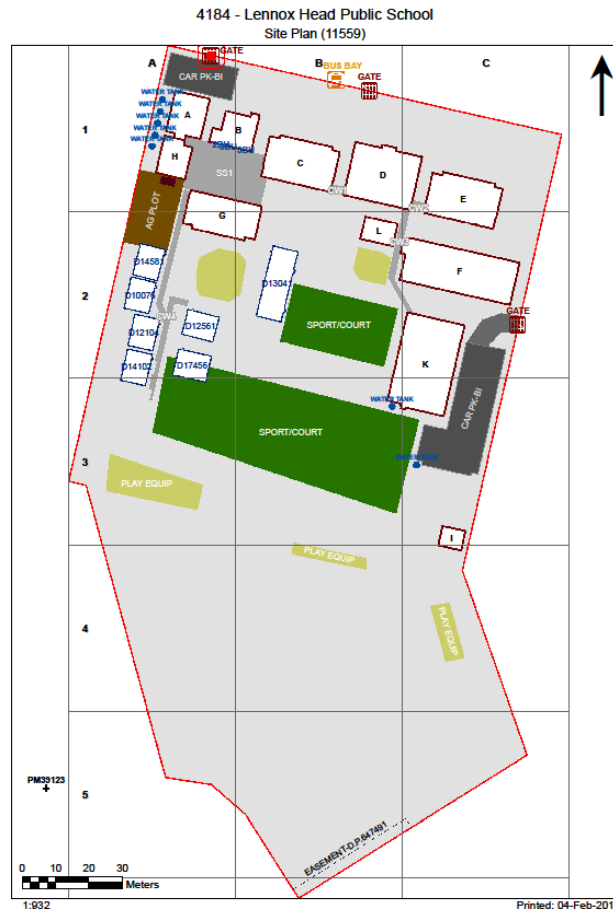

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00A - Administration - 1961 - Timber (Timber)

Exterior

| | | | | | | |
|--|---|------|------------|--------------------|---------|--------------------|
| Ceiling Voids - Raked Ceiling | Non Accessible Area - Height Restricted, greater than 4m | | | | | |
| Underfloor Voids - Packing to Floor Joists | No Asbestos Found | | | | | |
| Eaves Linings | Flat AC Sheeting | 40m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |

Assumed Asbestos - Height Restricted

Interior

B00A - R0001 - Movement

| | | | | | | |
|----------------------------|---|--|--|--|--|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting 4184/B00A/R0001/Ceiling Structures/Linings/S2 | | | | | No Asbestos Detected |
|----------------------------|---|--|--|--|--|-----------------------------|

B00A - R0002 - Clerical Office

No Asbestos

B00A - R0003 - Sick Bay

No Asbestos

B00A - R0004 - Duplicating Workroom

No Asbestos

B00A - R0005 - Movement

No Asbestos

B00A - R0006 - Clerical Office

No Asbestos

B00A - R0007 - Principal

No Asbestos

B00A - R0008 - Entry Vestibule

No Asbestos

B00A - R0009 - Movement

| | | | | | | |
|----------------------------|---|--|--|--|--|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting 4184/B00A/R0001/Ceiling Structures/Linings/S2 | | | | | No Asbestos Detected |
|----------------------------|---|--|--|--|--|-----------------------------|

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | Test Result | | |

B00B - General Learning/Pupil Facilities - 1961 - Timber (Timber)

Exterior

| | | | | | | |
|---|---|-------|---------------------|---|---------|--------------------|
| Underfloor Voids - Packing to Floor Joists | No Asbestos Found | | | | | |
| Eaves Linings | Flat AC Sheeting | 28m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| Assumed Asbestos - Eaves to Level 1. Height Restricted 4 | | | | | | |
| Wall Cladding | Flat AC Sheeting | 200m2 | Throughout Level 1 | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4184/B00B/Wall Cladding/S5 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | | |
| Wall Cladding | Flat AC Sheeting | 2m2 | East, below Windows | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4184/B00B/Wall Cladding/S5 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | | |
| Ceiling Voids - Raked Ceiling | Non Accessible Area - Height Restricted 4 metres | | | | | |

Interior

B00B - R0001 - Movement

| | | | | | | |
|----------------------------|---|-----|------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 2m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4184/B00B/R0002/Ceiling Structures/Linings/S4 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |

B00B - R0002 - General Storeroom

| | | | | | | |
|----------------------------|---|------|------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 53m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4184/B00B/R0002/Ceiling Structures/Linings/S4 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |

B00B - R0003 - No Access

| | | | | | | |
|----------------------------|---|-----|------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 8m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4184/B00B/R0002/Ceiling Structures/Linings/S4 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |

B00B - R0004 - Craft Store

| | | | | | | |
|----------------------------|---|-----|------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 4m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4184/B00B/R0002/Ceiling Structures/Linings/S4 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |

| | | | | | | |
|-----------------------------|---|-----|------------|------------------------------------|---------|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles | | | | | No Asbestos Detected |
| | 4184/B00B/R0004/Floor Coverings Res/Textile/S3 | | | | | |
| Floor Coverings Res/Textile | Adhesive | 4m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4184/B00B/R0004/Floor Coverings Res/Textile/S20 | | | Chrysotile (white asbestos) | | |

B00B - R0005 - General Storeroom

| | | | | | | |
|----------------------------|---|------|------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 16m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4184/B00B/R0002/Ceiling Structures/Linings/S4 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |

B00B - R0006 - No Access

| | | | | | | |
|----------------------------|---|-----|------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 8m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4184/B00B/R0002/Ceiling Structures/Linings/S4 | | | Chrysotile (white asbestos) , Amosite (brown asbestos) | | |

B00B - R0008 - Stairs

No Asbestos

B00B - R1001 - General Storeroom

No Asbestos

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|--|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |
| B00B - R1002 - Withdrawal Space - 1hb | | | | | | |
| No Asbestos | | | | | | |
| B00B - R1003 - General Storeroom | | | | | | |
| No Asbestos | | | | | | |
| B00B - R1004 - Staff Room Annexe | | | | | | |
| No Asbestos | | | | | | |
| B00B - R1005 - Seminar/Study | | | | | | |
| No Asbestos | | | | | | |
| B00B - R1006 - Movement | | | | | | |
| No Asbestos | | | | | | |
| B00B - R1007 - Stairs | | | | | | |
| No Asbestos | | | | | | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00C - General Learning - 1990 - Brick/Veneer (Brick/Veneer)

Exterior

| | | | | | | |
|--|-----------------------------|--|--|--|--|-----------------------------|
| Underfloor Voids - Packing to Floor Joists | No Asbestos Found | | | | | |
| Ceiling Voids | No Asbestos Found | | | | | |
| Eaves Linings | Flat AC Sheeting | | | | | |
| | 4184/B00C/Eaves Linings/S11 | | | | | No Asbestos Detected |

Interior

B00C - R0001 - Withdrawal Space - 1hb

No Asbestos

B00C - R0002 - Home Base Store

No Asbestos

B00C - R0003 - Home Base

| | | | | | | |
|-----------------------|---|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting | | | | | |
| | 4184/B00C/R0003/Wall Linings Internal/S13 | | | | | No Asbestos Detected |

B00C - R0004 - Practical Activities - 1hb

No Asbestos

B00C - R0005 - Movement

No Asbestos

B00C - R0006 - Home Base

| | | | | | | |
|-----------------------|---|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting | | | | | |
| | 4184/B00C/R0003/Wall Linings Internal/S13 | | | | | No Asbestos Detected |

B00C - R0007 - Practical Activities - 1hb

No Asbestos

B00C - R0008 - Withdrawal Space - 1hb

No Asbestos

B00C - R0009 - Home Base Store

No Asbestos

B00C - R0010 - Toilets - Girls

| | | | | | | |
|----------------------------|--|--|--|--|--|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | | | | | |
| | 4184/B00G/R0002/Ceiling Structures/Linings/S10 | | | | | No Asbestos Detected |

| | | | | | | |
|-----------------------|--|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting | | | | | |
| | 4184/B00G/R0002/Wall Linings Internal/S9 | | | | | No Asbestos Detected |

B00C - R0011 - Kiln Room

| | | | | | | |
|----------------------------|--|--|--|--|--|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | | | | | |
| | 4184/B00G/R0002/Ceiling Structures/Linings/S10 | | | | | No Asbestos Detected |

| | | | | | | |
|-----------------------|--|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting | | | | | |
| | 4184/B00G/R0002/Wall Linings Internal/S9 | | | | | No Asbestos Detected |

B00C - R0012 - Distribution Board Note: No inspection of live electrical installation.

| | | | | | | |
|-----------------------|---|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting | | | | | |
| | 4184/B00C/R0012/Wall Linings Internal/S19 | | | | | No Asbestos Detected |

| | | | | | | |
|----------------------------|---|--|--|--|--|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | | | | | |
| | 4184/B00C/R0012/Wall Linings Internal/S19 | | | | | No Asbestos Detected |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00D - General Learning - 1991 - Brick/Veneer (Brick/Veneer)

Exterior

| | | | | | | |
|--|---|--|--|--|--|----------------------|
| Underfloor Voids - Packing to Floor Joists | No Asbestos Found | | | | | |
| Ceiling Voids | No Asbestos Found | | | | | |
| Eaves Linings | Flat AC Sheeting 4184/B00D/Eaves Linings/S16 | | | | | No Asbestos Detected |
| Wall Cladding | Flat AC Sheeting 4184/B00D/Wall Cladding/S17 | | | | | No Asbestos Detected |

Interior

B00D - R0001 - Movement

| | | | | | | |
|-----------------------|---|--|--|--|--|----------------------|
| Wall Linings Internal | Flat AC Sheeting 4184/B00D/Eaves Linings/S16 | | | | | No Asbestos Detected |
|-----------------------|---|--|--|--|--|----------------------|

B00D - R0002 - Home Base

No Asbestos

B00D - R0003 - Home Base Store

No Asbestos

B00D - R0004 - Home Base Store

No Asbestos

B00D - R0005 - Practical Activities - 1hb

No Asbestos

B00D - R0006 - Withdrawal Space - 1hb

No Asbestos

B00D - R0007 - Home Base

No Asbestos

B00D - R0008 - Home Base Store

No Asbestos

B00D - R0009 - Toilets - Boys

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00E - General Learning - 1990 - Brick/Veneer (Brick/Veneer)

Exterior

| | | | | | | |
|--|-----------------------------|--|--|--|--|-----------------------------|
| Underfloor Voids - Packing to Floor Joists | No Asbestos Found | | | | | |
| Ceiling Voids | No Asbestos Found | | | | | |
| Eaves Linings | Flat AC Sheeting | | | | | |
| | 4184/B00D/Eaves Linings/S16 | | | | | No Asbestos Detected |

Interior

B00E - R0001 - Distribution Board Note: No inspection of live electrical installation.

| | | | | | | |
|----------------------------|---|--|--|--|--|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | | | | | |
| | 4184/B00C/R0012/Wall Linings Internal/S19 | | | | | No Asbestos Detected |
| Wall Linings Internal | Flat AC Sheeting | | | | | |
| | 4184/B00C/R0012/Wall Linings Internal/S19 | | | | | No Asbestos Detected |

B00E - R0002 - No Access

No Asbestos

B00E - R0003 - Movement

No Asbestos

B00E - R0004 - Withdrawal Space - 1hb

No Asbestos

B00E - R0005 - Home Base Store

No Asbestos

B00E - R0006 - Home Base

No Asbestos

B00E - R0007 - Practical Activities - 1hb

| | | | | | | |
|-----------------------|---|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting | | | | | |
| | 4184/B00C/R0003/Wall Linings Internal/S13 | | | | | No Asbestos Detected |

B00E - R0008 - Home Base

No Asbestos

B00E - R0009 - Practical Activities - 1hb

| | | | | | | |
|-----------------------|---|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting | | | | | |
| | 4184/B00C/R0003/Wall Linings Internal/S13 | | | | | No Asbestos Detected |

B00E - R0010 - Withdrawal Space - 1hb

No Asbestos

B00E - R0011 - Home Base Store

No Asbestos

B00E - R0012 - Toilets - Boys

| | | | | | | |
|-----------------------|---|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting | | | | | |
| | 4184/B00C/R0003/Wall Linings Internal/S13 | | | | | No Asbestos Detected |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00F - Library - 1961 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Raked Ceiling
 Non Accessible Area
 - Ceiling is roof, no ceiling space

Underfloor Voids - Packing to Floor Joists
 No Asbestos Found

Interior

B00F - R0001 - Movement

No Asbestos

B00F - R0002 - Library Office/Workroom

No Asbestos

B00F - R0005 - Disabled Toilet

Ceiling Structures/Linings Flat AC Sheeting
 4184/B00F/R0005/Ceiling Structures/Linings/S14 **No Asbestos Detected**

Partition Walls (Cubicles) Compressed AC Sheet
 4184/B00F/R0005/Partition Walls (Cubicles)/S15 **No Asbestos Detected**

B00F - R0006 - Disabled Toilet

Ceiling Structures/Linings Flat AC Sheeting
 4184/B00F/R0005/Ceiling Structures/Linings/S14 **No Asbestos Detected**

Partition Walls (Cubicles) Compressed AC Sheet
 4184/B00F/R0005/Partition Walls (Cubicles)/S15 **No Asbestos Detected**

B00F - R0007 - Movement

No Asbestos

B00F - R0008 - Distribution Board

Note: No inspection of live electrical installation.

Ceiling Structures/Linings Flat AC Sheeting
 4184/B00C/R0012/Wall Linings Internal/S19 **No Asbestos Detected**

B00F - R0009 - Reading Area

No Asbestos

B00F - R0010 - Library Office/Workroom

No Asbestos

B00F - R0011 - Communications Room

No Asbestos

B00F - R0012 - Movement

No Asbestos

B00F - R0013 - Special Programs Room

No Asbestos

B00F - R0014 - Special Education Support Centre

No Asbestos



| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00G - General Learning - 1961 - Brick/Veneer (Brick/Veneer)

Exterior

| | | | | | | |
|--|---|--|--|--|--|-----------------------------|
| Ceiling Voids - Raked Ceiling | Non Accessible Area - No manhole | | | | | |
| Underfloor Voids - Packing to Floor Joists | Non Accessible Area - Area inaccessible - to low | | | | | |
| Eaves Linings | Flat AC Sheeting 4184/B00G/Eaves Linings/S8 | | | | | No Asbestos Detected |

Interior

B00G - R0002 - Toilets - Girls

| | | | | | | |
|----------------------------|--|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting 4184/B00G/R0002/Wall Linings Internal/S9 | | | | | No Asbestos Detected |
| Ceiling Structures/Linings | Flat AC Sheeting 4184/B00G/R0002/Ceiling Structures/Linings/S10 | | | | | No Asbestos Detected |

B00G - R0003 - Home Base Store

No Asbestos

B00G - R0004 - Staff Room Annexe

No Asbestos

B00G - R0005 - Home Base

No Asbestos

B00G - R0006 - Practical Activities - 1hb

| | | | | | | |
|-----------------------|---|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting 4184/B00G/R0008/Wall Linings Internal/S12 | | | | | No Asbestos Detected |
|-----------------------|---|--|--|--|--|-----------------------------|

B00G - R0007 - Home Base

No Asbestos

B00G - R0008 - Practical Activities - 1hb

| | | | | | | |
|-----------------------|---|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting 4184/B00G/R0008/Wall Linings Internal/S12 | | | | | No Asbestos Detected |
|-----------------------|---|--|--|--|--|-----------------------------|

B00G - R0009 - Withdrawal Space - 1hb

No Asbestos

B00G - R0010 - Home Base Store

No Asbestos

B00G - R0011 - Toilets - Boys

| | | | | | | |
|----------------------------|--|--|--|--|--|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting 4184/B00G/R0002/Ceiling Structures/Linings/S10 | | | | | No Asbestos Detected |
| Wall Linings Internal | Flat AC Sheeting 4184/B00G/R0002/Wall Linings Internal/S9 | | | | | No Asbestos Detected |

B00G - R0012 - Distribution Board

Note: No inspection of live electrical installation.

| | | | | | | |
|-----------------------|---|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting 4184/B00G/R0012/Wall Linings Internal/S18 | | | | | No Asbestos Detected |
|-----------------------|---|--|--|--|--|-----------------------------|

B00G - R0013 - Movement

No Asbestos

B00G - R0014 - Movement

No Asbestos

B00G - Room+1 - Added Room

No Asbestos

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00H - Staff Facilities - 1961 - Timber (Timber)

Exterior

| | | | | | | |
|--|---|------|------------|--------------------|---------|------------------------------------|
| Ceiling Voids - Raked Ceiling | No Asbestos Found | | | | | |
| Underfloor Voids - Packing to Floor Joists | No Asbestos Found | | | | | |
| Eaves Linings | Flat AC Sheeting | 20m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4184/B00H/R0002/Ceiling Structures/Linings/S7 | | | | | Chrysotile (white asbestos) |

Interior

B00H - R0001 - Staff Room Annexe

No Asbestos

B00H - R0002 - Movement

| | | | | | | |
|----------------------------|---|-----|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 4m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4184/B00H/R0002/Ceiling Structures/Linings/S7 | | | | | Chrysotile (white asbestos) |

B00H - R0004 - Movement

| | | | | | | |
|-----------------------|--|-----|------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting | 6m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4184/B00H/R0005/Wall Linings Internal/S6 | | | | | Chrysotile (white asbestos) |

B00H - R0005 - Staff Toilet

| | | | | | | |
|-----------------------|--|------|------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting | 10m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4184/B00H/R0005/Wall Linings Internal/S6 | | | | | Chrysotile (white asbestos) |

B00H - R0006 - Staff Toilet

| | | | | | | |
|-----------------------|--|------|------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting | 15m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4184/B00H/R0005/Wall Linings Internal/S6 | | | | | Chrysotile (white asbestos) |

B00H - R0007 - Movement

| | | | | | | |
|----------------------------|---|-----|------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 9m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4184/B00H/R0002/Ceiling Structures/Linings/S7 | | | | | Chrysotile (white asbestos) |

B00H - R0008 - Staff Room

| | | | | | | |
|-----------------------|--|------|------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting | 80m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4184/B00H/R0005/Wall Linings Internal/S6 | | | | | Chrysotile (white asbestos) |

B00H - R0009 - Staff Kitchen

| | | | | | | |
|-----------------------|--|------|------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting | 15m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 4184/B00H/R0005/Wall Linings Internal/S6 | | | | | Chrysotile (white asbestos) |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B001 - Shed - 1961 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids - Raked Ceiling No Asbestos Found

Interior

B001 - R0001 - Garden Store

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| | Sample No | | | | | Test Result |

B00K - Multi Purpose Facilities - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00K - R0001 - Communal Space**

No Asbestos

B00K - R0002 - Raised Platform

No Asbestos

B00K - R0003 - Hall Chair Store

No Asbestos

B00K - R0004 - Communal/Performance Store

No Asbestos

B00K - R0005 - P.E. Store

No Asbestos

B00K - R0006 - Movement

No Asbestos

B00K - R0007 - Toilets - Girls

No Asbestos

B00K - R0008 - Sound Cupboard

No Asbestos

B00K - R0009 - Movement

No Asbestos

B00K - R0010 - Toilets - Boys

No Asbestos

B00K - R0011 - Cleaning Distributed Store

No Asbestos

B00K - R0012 - Plant

No Asbestos

B00K - R0013 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00K - R0014 - Access Shower/Toilet

No Asbestos

B00K - R0015 - Other

No Asbestos

B00K - R0016 - Movement

No Asbestos

B00K - R0017 - Movement

No Asbestos

B00K - R0018 - Movement

No Asbestos

B00K - R0019 - External Movement

No Asbestos

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00L - Pupil Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

| | |
|-----------------------------------|-------------------|
| Underfloor Voids - Slab on Ground | No Asbestos Found |
| Ceiling Voids | No Asbestos Found |

Interior

B00L - R0001 - External Movement

No Asbestos

B00L - R0002 - Toilets - Boys

No Asbestos

B00L - R0003 - Laundry - S

No Asbestos

B00L - R0004 - Toilets - Girls

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 603 - D10076 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 28/04/2008

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 601 - D12104 - Learning Unit - Standard/Withdrawal : Placement Date - 27/08/2003

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Entry

No Asbestos Found.

R2 - General Learning Space

No Asbestos Found.

R3 - Store

No Asbestos Found.

OS 603 - D12561 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 2/01/2006

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.


R2 - Home Base Store

No Asbestos Found.

OS 810 - D13041 - FSU/Shelter/Stores : Placement Date - 14/07/2008

Exterior

| | | | |
|-------------|---------------------|------------------|----------|
| Step Treads | Compressed AC Sheet | Assumed Asbestos | 1.08 m2 |
| Landing | Compressed AC Sheet | Assumed Asbestos | 1.2 m2 |
| Eave Lining | Flat AC Sheet | Assumed Asbestos | 25.92 m2 |

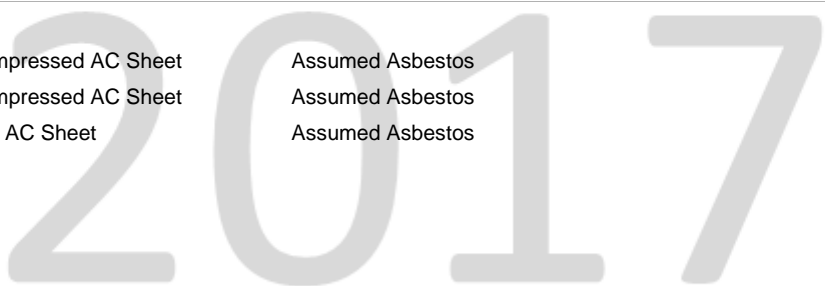

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|--|----------------------|------------------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |
| Interior | | | | | | |
| R1 - Canteen | | | | | | |
| End wall panel | Flat AC Sheet | Assumed Asbestos | | | | 18 m2 |
| Ceiling | Flat AC Sheet | Assumed Asbestos | | | | 28 m2 |
| R2 - Covered Area | | | | | | |
| End wall panel | Flat AC Sheet | Assumed Asbestos | | | | 18 m2 |
| Ceiling | Flat AC Sheet | Assumed Asbestos | | | | 109 m2 |
| R3 - Store | | | | | | |
| Ceiling | Flat AC Sheet | Assumed Asbestos | | | | 4 m2 |
| R4 - Sports Store | | | | | | |
| Ceiling | Flat AC Sheet | Assumed Asbestos | | | | 10 m2 |
| R5 - Garden Store | | | | | | |
| Ceiling | Flat AC Sheet | Assumed Asbestos | | | | 8 m2 |
| R6 - Change Room | | | | | | |
| Ceiling | Flat AC Sheet | Assumed Asbestos | | | | 3 m2 |
| R7 - Store | | | | | | |
| Ceiling | Flat AC Sheet | Assumed Asbestos | | | | 2 m2 |
| OS 601 - D14102 - Learning Unit - Standard/Withdrawal : Placement Date - 25/01/2007 | | | | | | |
| Exterior | | | | | | |
| Step Treads | Compressed AC Sheet | Assumed Asbestos | | | | 1.08 m2 |
| Landing | Compressed AC Sheet | Assumed Asbestos | | | | 1.2 m2 |
| Eave Lining | Flat AC Sheet | Assumed Asbestos | | | | 11.52 m2 |
| Interior | | | | | | |
| R1 - Entry | | | | | | |
| End wall panel | Flat AC Sheet | Assumed Asbestos | | | | 18 m2 |
| Ceiling | Flat AC Sheet | Assumed Asbestos | | | | 8 m2 |
| R2 - General Learning Space | | | | | | |
| End wall panel | Flat AC Sheet | Assumed Asbestos | | | | 18 m2 |
| Ceiling | Flat AC Sheet | Assumed Asbestos | | | | 55 m2 |
| R3 - Store | | | | | | |
| Ceiling | Flat AC Sheet | Assumed Asbestos | | | | 10 m2 |
| OS 603 - D14581 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 28/04/2008 | | | | | | |
| Note: This refurbished demountable may have asbestos present in remnant mastic in window frames. | | | | | | |
| Exterior | | | | | | |
| No Asbestos Found. | | | | | | |
| Interior | | | | | | |
| R1 - Learning space/withdrawal/entry | | | | | | |
| No Asbestos Found. | | | | | | |
| R2 - Home Base Store | | | | | | |
| No Asbestos Found. | | | | | | |
| OS 603 - D17456 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 3/09/2015 | | | | | | |
| Note: This refurbished demountable may have asbestos present in remnant mastic in window frames. | | | | | | |
| Exterior | | | | | | |
| No Asbestos Found. | | | | | | |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|--|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |
| Interior | | | | | | |
| R1 - Learning space/withdrawal/entry | | | | | | |
| No Asbestos Found. | | | | | | |
| R2 - Home Base Store | | | | | | |
| No Asbestos Found. | | | | | | |
| OS 602 - D18204 - Learning Unit - Standard With P.A.A. : Placement Date - 9/01/2017 | | | | | | |
| Note: This refurbished demountable may have asbestos present in remnant mastic in window frames. | | | | | | |
| Exterior | | | | | | |
| No Asbestos Found. | | | | | | |
| Interior | | | | | | |
| R1 - Learning space/withdrawal/entry | | | | | | |
| No Asbestos Found. | | | | | | |
| R2 - Home Base Store | | | | | | |
| No Asbestos Found. | | | | | | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017