


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Laguna Street Public School (4230)  
**Region :** Sydney  
**State Electorate :** Cronulla  
**Local Government Area :** Sutherland

**Initial Survey :** Noel Arnold & Associates : 25 - Mar - 2008  
**Reviewed By :** AECOM : 29 - Oct - 2014

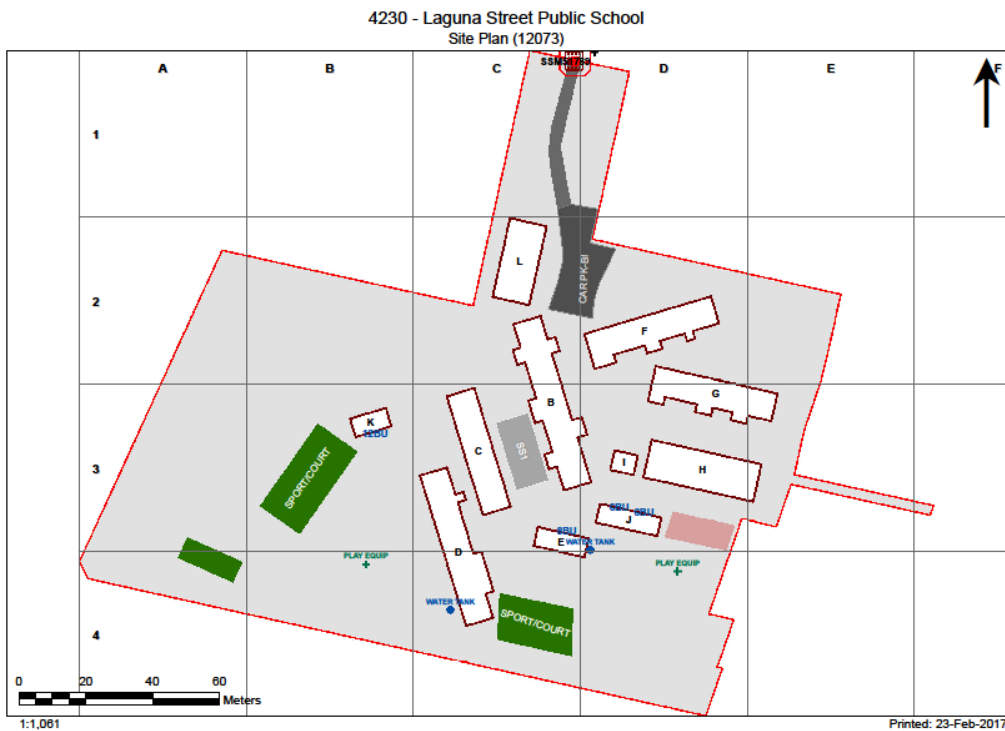

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Communal Facilities/Administration - 1961 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	50m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3				Chrysotile (white asbestos)	
Gable verge lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00B - R0001 - Communal Space**

No Asbestos

**B00B - R0002 - Raised Platform**

No Asbestos

**B00B - R0003 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3				Chrysotile (white asbestos)	

**B00B - R0004 - General Storeroom**

No Asbestos

**B00B - R0005 - Movement**

No Asbestos

**B00B - R0006 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3				Chrysotile (white asbestos)	

**B00B - R0007 - Staff Room**

No Asbestos

**B00B - R0008 - Staff Toilet**

Incinerette	Encapsulated Insulation material within unit	1Unit(s)	East facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Sealed unit					

Wall Linings Internal	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3				Chrysotile (white asbestos)	

**B00B - R0009 - Staff Toilet**

Wall Linings Internal	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3				Chrysotile (white asbestos)	

**B00B - R0010 - Sick Bay**

No Asbestos

**B00B - R0011 - Interview**

No Asbestos

**B00B - R0012 - Deputy Principal**

No Asbestos

**B00B - R0013 - Main Switch Board**

No Asbestos

**B00B - R0014 - General Storeroom**

No Asbestos

**B00B - R0015 - General Storeroom**

No Asbestos

**B00B - R0016 - Movement**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - R0017 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4230/B00B/R0008/Wall Linings Internal/S3					Chrysotile (white asbestos)	
<b>B00B - R0018 - Duplicating Workroom</b>						
No Asbestos						
<b>B00B - R0019 - Movement</b>						
No Asbestos						
<b>B00B - R0020 - Clerical Office/Workroom</b>						
No Asbestos						
<b>B00B - R0021 - Principal</b>						
No Asbestos						
<b>B00B - R0022 - Staff Toilet</b>						
No Asbestos						
<b>B00B - R0023 - General Storeroom</b>						
No Asbestos						
<b>B00B - R0024 - External Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4230/B00B/R0008/Wall Linings Internal/S3					Chrysotile (white asbestos)	
<b>B00B - R0025 - External Movement</b>						
Ceiling Structures/Linings	Compressed AC Sheet	16.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4230/B00B/R0008/Wall Linings Internal/S3					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning - 1961 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	50m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3				<b>Chrysotile (white asbestos)</b>	
Gable verge lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3				<b>Chrysotile (white asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00C - R0001 - Home Base**

No Asbestos

**B00C - R0002 - Home Base Store**

No Asbestos

**B00C - R0003 - Personal Effects Storage**

No Asbestos

**B00C - R0004 - Movement**

No Asbestos

**B00C - R0005 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3				<b>Chrysotile (white asbestos)</b>	

**B00C - R0006 - Home Base**

No Asbestos

**B00C - R0007 - Home Base Store**

No Asbestos

**B00C - R0008 - Home Base**

No Asbestos

**B00C - R0009 - Home Base Store**

No Asbestos

**B00C - R0010 - Personal Effects Storage**

No Asbestos

**B00C - R0011 - Movement**

No Asbestos

**B00C - R0012 - Movement**


Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3				<b>Chrysotile (white asbestos)</b>	

**B00C - R0013 - Home Base**

No Asbestos

**B00C - R0014 - Home Base Store**

No Asbestos

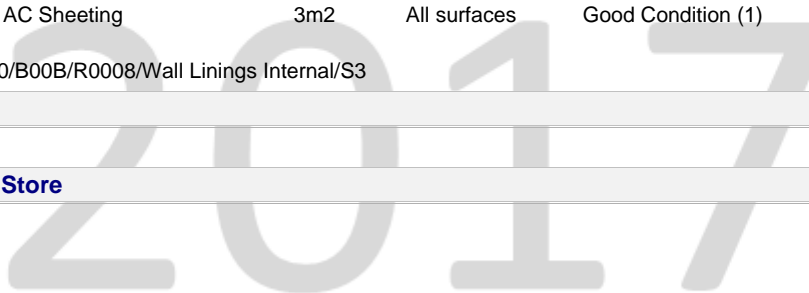

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning - 1961 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	60m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3				Chrysotile (white asbestos)	
Gable verge lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3				Chrysotile (white asbestos)	
Infill panel	Flat AC Sheeting	3Unit(s)	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00D - R0001 - Home Base**

No Asbestos

**B00D - R0002 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3				Chrysotile (white asbestos)	

**B00D - R0003 - Personal Effects Storage**

No Asbestos

**B00D - R0004 - Home Base Store**

No Asbestos

**B00D - R0005 - Home Base Store**

No Asbestos

**B00D - R0006 - Home Base**

No Asbestos

**B00D - R0007 - Home Base**

No Asbestos

**B00D - R0008 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3				Chrysotile (white asbestos)	

**B00D - R0009 - Personal Effects Storage**

No Asbestos

**B00D - R0010 - Home Base Store**

No Asbestos

**B00D - R0011 - Home Base Store**

No Asbestos

**B00D - R0012 - Home Base**

No Asbestos

**B00D - R0013 - Movement**

No Asbestos

**B00D - R0014 - Personal Effects Storage**

No Asbestos

**B00D - R0015 - Home Base Store**

No Asbestos

**B00D - R0016 - Home Base**

No Asbestos

**B00D - R9001 - Movement**

No Asbestos

**B00D - R9002 - Movement**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00D - R9003 - Home Base**

Ceiling Structures/Linings	Flat AC Sheeting	54m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	--------------	--------------------	---------	--------------------

4230/B00B/R0008/Wall Linings Internal/S3

**Chrysotile (white asbestos)**

**B00D - R9004 - Personal Effects Storage**

No Asbestos

**B00D - R9005 - Home Base Store**

No Asbestos

**B00D - R9006 - Home Base**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Pupil Facilities/Communal Facilities - 1961 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00K/R0001/Partition Walls (Cubicles)/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible.					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior**

**B00E - R0001 - Sports Store**

Ceiling Structures/Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00K/R0001/Partition Walls (Cubicles)/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00E - R0003 - Disabled Toilet**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00K/R0001/Partition Walls (Cubicles)/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00E - R0004 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00K/R0001/Partition Walls (Cubicles)/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	43m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00K/R0001/Partition Walls (Cubicles)/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Incinerette	Encapsulated Insulation material within unit	1Unit(s)	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Sealed unit</b>					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - General Learning - 1961 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3				<b>Chrysotile (white asbestos)</b>	
Infill panel above door	Flat AC Sheeting	4Unit(s)	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3				<b>Chrysotile (white asbestos)</b>	
Infill panel below windows	Flat AC Sheeting	18Unit(s)	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00F/Infill panel below windows/S2				<b>Chrysotile (white asbestos)</b>	
Gable verge lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3				<b>Chrysotile (white asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00F - R0001 - Home Base**

No Asbestos

**B00F - R0002 - Home Base Store**

No Asbestos

**B00F - R0003 - Personal Effects Storage**

No Asbestos

**B00F - R0004 - Movement**

No Asbestos

**B00F - R0005 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3				<b>Chrysotile (white asbestos)</b>	

**B00F - R0006 - General Storeroom**

No Asbestos

**B00F - R0007 - Home Base**

No Asbestos

**B00F - R0009 - Movement**

No Asbestos

**B00F - R0010 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3				<b>Chrysotile (white asbestos)</b>	

**B00F - R0011 - Movement**

No Asbestos

**B00F - R0013 - Practical Activities - 1hb**

No Asbestos

**B00F - R0014 - Withdrawal Space - 1hb**

No Asbestos

**B00F - R0015 - Home Base**

No Asbestos

**B00F - R0017 - Movement**

No Asbestos

**B00F - R0018 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3				<b>Chrysotile (white asbestos)</b>	

**B00F - R0019 - Personal Effects Storage**



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
No Asbestos						
<b>B00F - R0020 - General Storeroom</b>						
No Asbestos						
<b>B00F - R0021 - General Storeroom</b>						
No Asbestos						
<b>B00F - R0022 - Personal Effects Storage</b>						
No Asbestos						
<b>B00F - R0023 - General Storeroom</b>						
No Asbestos						
<b>B00F - R0024 - Personal Effects Storage</b>						
No Asbestos						
<b>B00F - R9001 - Uniform Shop</b>						
Ceiling Structures/Linings	Flat AC Sheeting	41m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4230/B00B/R0008/Wall Linings Internal/S3						<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - General Learning - 1961 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3				<b>Chrysotile (white asbestos)</b>	
Gable verge lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3				<b>Chrysotile (white asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris	NA	Lower portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)

**Assumed Asbestos - Small number of AC fragments in**

**Interior**

**B00G - R0001 - Home Base**

No Asbestos

**B00G - R0003 - Movement**

No Asbestos

**B00G - R0004 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3				<b>Chrysotile (white asbestos)</b>	

**B00G - R0006 - Home Base**

No Asbestos

**B00G - R0007 - Staff Room Annexe**

No Asbestos

**B00G - R0008 - Movement**

No Asbestos

**B00G - R0009 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3				<b>Chrysotile (white asbestos)</b>	

**B00G - R0010 - General Storeroom**

No Asbestos

**B00G - R0012 - Home Base**

No Asbestos

**B00G - R0013 - Deputy Principal**

No Asbestos

**B00G - R0014 - Movement**

No Asbestos

**B00G - R0015 - Staff Toilet**

No Asbestos

**B00G - R0016 - Movement**

No Asbestos

**B00G - R0017 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3				<b>Chrysotile (white asbestos)</b>	

**B00G - R0018 - Personal Effects Storage**

No Asbestos

**B00G - R0019 - General Storeroom**

No Asbestos

**B00G - R0020 - Personal Effects Storage**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00G - R0021 - General Storeroom</b>						
No Asbestos						
<b>B00G - R0022 - General Storeroom</b>						
No Asbestos						
<b>B00G - R0023 - Personal Effects Storage</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - General Learning - 1961 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	60m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3					<b>Chrysotile (white asbestos)</b>
Gable verge lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00H - R0002 - Movement**

No Asbestos

**B00H - R0004 - Toilets - Boys/Girls**

No Asbestos

**B00H - R0005 - Practical Activities - 1hb**

No Asbestos

**B00H - R0006 - Home Base**

No Asbestos

**B00H - R0007 - Personal Effects Storage**

No Asbestos

**B00H - R0008 - General Storeroom**

No Asbestos

**B00H - R0009 - Personal Effects Storage**

No Asbestos

**B00H - R0010 - Movement**

No Asbestos

**B00H - R0012 - Home Base**

No Asbestos

**B00H - R0013 - General Storeroom**

No Asbestos

**B00H - R0014 - General Storeroom**


No Asbestos

**B00H - R0015 - External Movement**

No Asbestos

**B00H - Room+1 - ROO13**

Ceiling Structures/Linings	Flat AC Sheeting	80m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00F/Infill panel below windows/S2					<b>Chrysotile (white asbestos)</b>

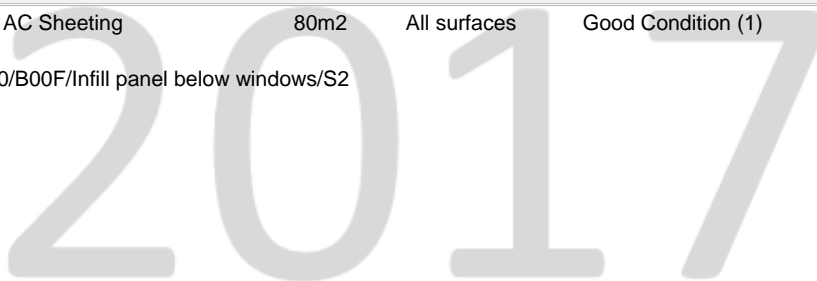

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00I - Pupil Facilities - 1961 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	6m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3					<b>Chrysotile (white asbestos)</b>
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior**

**B00I - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3					<b>Chrysotile (white asbestos)</b>

**B00I - R0002 - Canteen**

Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3					<b>Chrysotile (white asbestos)</b>
Wall Linings Internal	Flat AC Sheeting	4m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3					<b>Chrysotile (white asbestos)</b>

**B00I - R0003 - Canteen Office/Store**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3					<b>Chrysotile (white asbestos)</b>

**B00I - R0004 - Canteen Office/Store**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00J - Pupil Facilities - 1961 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00K/R0001/Partition Walls (Cubicles)/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior**

**B00J - R0001 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00K/R0001/Partition Walls (Cubicles)/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	44m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00K/R0001/Partition Walls (Cubicles)/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00J - R0002 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00K/R0001/Partition Walls (Cubicles)/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00K/R0001/Partition Walls (Cubicles)/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Pupil Facilities - 1961 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00B/R0008/Wall Linings Internal/S3				<b>Chrysotile (white asbestos)</b>	
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior**

**B00K - R0002 - Toilets - Boys**

Ceiling Structures/Linings	Compressed AC Sheet	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00K/R0001/Partition Walls (Cubicles)/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00K/R0001/Partition Walls (Cubicles)/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00K - R0003 - Toilets - Girls**

Ceiling Structures/Linings	Compressed AC Sheet	25.7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00K/R0001/Partition Walls (Cubicles)/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4230/B00K/R0001/Partition Walls (Cubicles)/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Library - 2011 - Brick/Veneer (Brick/Veneer)**

**Exterior**

No Asbestos

**Interior**

**B00L - R0001 - Movement**

No Asbestos

**B00L - R0002 - Staff Toilet**

No Asbestos

**B00L - R0003 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00L - R0004 - Cleaning Distributed Store**

No Asbestos

**B00L - R0005 - K.L.A. Store**

No Asbestos

**B00L - R0006 - Communications Room**

No Asbestos

**B00L - R0007 - Library Office/Workroom**

No Asbestos

**B00L - R0008 - Reading Area**

No Asbestos

**B00L - R0009 - External Movement**

No Asbestos

**B00L - R9001 - Special Programs Room**

No Asbestos

**B00L - R9002 - Special Programs Room**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Listing of Electronic Attachments as of 22/03/2017***

**Available Asbestos Related Electronic Files**

4230\_ASB\_231112\_AMP.pdf

\* Note : Refer to AMS for details of the attachment(s).

2017