


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Lakelands Public School (4266)
Region : Illawarra and South East
State Electorate : Shellharbour
Local Government Area : Wollongong

Initial Survey : Noel Arnold & Associates : 04 - May - 2008
Reviewed By : AECOM : 18 - Jun - 2015

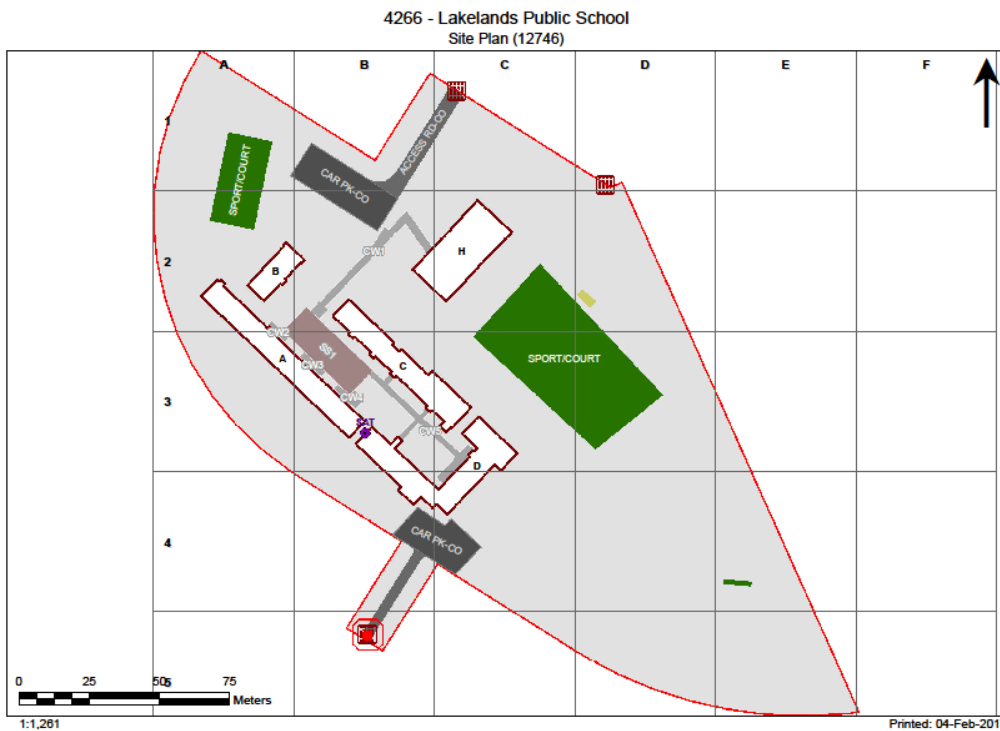

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning - 1960 - Concrete Framed (Concrete Framed)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4266/B00C/Eaves Linings/S8					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	24m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4266/B00C/Eaves Linings/S8					Chrysotile (white asbestos)
Underfloor Voids	Non Accessible Area - Area inaccessible - due to low clearance.					
Ceiling Voids	No Asbestos Found					

Interior

B00A - R0001 - External Movement (1.74 m2)

No Asbestos

B00A - R0002 - Movement (5.13 m2)

No Asbestos

B00A - R0007 - Home Base (56.88 m2)

No Asbestos

B00A - R0010 - Distribution Board (0.12 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00A - R0012 - Staff Room Annexe (17.26 m2)

No Asbestos

B00A - R0014 - Special Programs Room (20.33 m2)

No Asbestos

B00A - R0015 - Kiln Room (0.71 m2)

No Asbestos

B00A - R0016 - General Storeroom (21.13 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4266/B00A/R0016/Floor Coverings Res/Textile/S3					No Asbestos Detected

B00A - R0017 - Movement (29.93 m2)

No Asbestos

B00A - R0018 - External Movement (1.68 m2)

No Asbestos

B00A - R0020 - Home Base Store (4.95 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4266/B00A/R0037/Floor Coverings Res/Textile/S2					No Asbestos Detected

B00A - R0026 - Home Base (58.46 m2)

No Asbestos

B00A - R0027 - Home Base Store (4.88 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4266/B00A/R0037/Floor Coverings Res/Textile/S2					No Asbestos Detected

B00A - R0028 - Home Base (58.46 m2)

No Asbestos

B00A - R0029 - Home Base Store (4.34 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4266/B00A/R0037/Floor Coverings Res/Textile/S2					No Asbestos Detected

B00A - R0036 - Home Base (58.38 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00A - R0037 - Home Base Store (4.31 m2)

Floor Coverings Res/Textile Vinyl Tiles

4266/B00A/R0037/Floor Coverings Res/Textile/S2

No Asbestos Detected

B00A - R0038 - Practical Activities - 1hb (13.24 m2)

No Asbestos

B00A - R0039 - Home Base Store (3.95 m2)

No Asbestos

B00A - R0040 - Home Base (77.87 m2)

No Asbestos

B00A - R0041 - Practical Activities - 1hb (14.12 m2)

No Asbestos

B00A - R0042 - Home Base Store (3.23 m2)

No Asbestos

B00A - R0043 - Home Base Store (2.92 m2)

No Asbestos

B00A - R0044 - Home Base (56.96 m2)

No Asbestos

B00A - R0045 - Withdrawal Space - 2hb (10.55 m2)

No Asbestos

B00A - R0046 - Practical Activities - 2hb (6.37 m2)

No Asbestos

B00A - R0047 - Practical Activities - 2hb (18.72 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Pupil Facilities - 1960 - Concrete Framed (Concrete Framed)

Exterior

Eaves Linings	Flat AC Sheeting	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4266/B00C/Eaves Linings/S8					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	24m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4266/B00C/Eaves Linings/S8					Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

Interior

B00B - R0001 - Home Base (58.62 m2)

No Asbestos

B00B - R0002 - Home Base Store (4.96 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4266/B00A/R0037/Floor Coverings Res/Textile/S2					No Asbestos Detected

B00B - R0003 - Personal Effects Storage (5.1 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4266/B00A/R0037/Floor Coverings Res/Textile/S2					No Asbestos Detected

B00B - R0004 - Personal Effects Storage (4.98 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4266/B00A/R0037/Floor Coverings Res/Textile/S2					No Asbestos Detected

B00B - R0005 - Movement (6.37 m2)

No Asbestos

B00B - R0006 - Home Base (58.61 m2)

No Asbestos

B00B - R0007 - Home Base Store (4.95 m2)

No Asbestos

B00B - R0008 - Distribution Board (0.15 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0009 - External Movement (1.74 m2)

No Asbestos

B00B - R9001 - External Movement (5.66 m2)

No Asbestos

B00B - R9002 - General Storeroom (28.6 m2)

Ceiling Structures/Linings	Flat AC Sheeting	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4266/B00B/R9005/Ceiling Structures/Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00B - R9003 - General Storeroom (14.5 m2)

No Asbestos

B00B - R9004 - External Movement (5.62 m2)

No Asbestos

B00B - R9005 - Toilets - Girls (34.78 m2)

Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4266/B00B/R9005/Ceiling Structures/Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00B - R9006 - Staff Toilet (1.31 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4266/B00B/R9005/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Library - 1961 - Concrete Framed (Concrete Framed)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4266/B00C/Eaves Linings/S8					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	24m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4266/B00C/Eaves Linings/S8					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible - limited access due to low clearance.					

Interior

B00C - R0001 - Home Base (68.93 m2)

Ceiling Structures/Linings	Flat AC Sheeting	69m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4266/B00C/R0001/Ceiling Structures/Linings/S9					Chrysotile (white asbestos) , Crocidolite (blue asbestos)

B00C - R0002 - External Movement (6.67 m2)

No Asbestos

B00C - R0003 - External Movement (35.01 m2)

Ceiling Structures/Linings	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4266/B00C/R0001/Ceiling Structures/Linings/S9					Chrysotile (white asbestos) , Crocidolite (blue asbestos)

B00C - R0004 - Toilets - Girls (33.59 m2)

Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4266/B00C/R0001/Ceiling Structures/Linings/S9					Chrysotile (white asbestos) , Crocidolite (blue asbestos)

B00C - R0005 - Toilets - Boys (33.6 m2)

Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4266/B00C/R0001/Ceiling Structures/Linings/S9					Chrysotile (white asbestos) , Crocidolite (blue asbestos)

B00C - R0006 - Cleaning Distributed Store (3.14 m2)

No Asbestos

B00C - R0007 - Garden Store (22.15 m2)

No Asbestos

B00C - R0008 - General Storeroom (22.49 m2)

No Asbestos

B00C - R0009 - General Storeroom (49.21 m2)

No Asbestos

B00C - R0010 - Garden Store (7.74 m2)

No Asbestos

B00C - R0011 - General Storeroom (7.53 m2)

No Asbestos

B00C - R0012 - Withdrawal Space - 1hb (16.19 m2)

No Asbestos

B00C - R0013 - Staff Toilet (2.09 m2)

Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4266/B00C/R0013/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)

B00C - R0015 - Home Base (56.96 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00C - R0017 - External Movement (1.69 m2)						
No Asbestos						
B00C - R0019 - Distribution Board (0.13 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B00C - R0022 - External Movement (1.67 m2)						
No Asbestos						
B00C - R0023 - Home Base (58.62 m2)						
No Asbestos						
B00C - R0025 - Stairs (2.38 m2)						
No Asbestos						
B00C - R0026 - Movement (9.86 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
4266/B00A/R0037/Floor Coverings Res/Textile/S2					No Asbestos Detected	
B00C - R0027 - Home Base Store (4.65 m2)						
No Asbestos						
B00C - R0028 - Practical Activities - 2hb (17.92 m2)						
No Asbestos						
B00C - R0029 - Home Base Store (4.64 m2)						
No Asbestos						
B00C - R1001 - Security Store (6.02 m2)						
No Asbestos						
B00C - R1002 - Personal Effects Storage (3.76 m2)						
No Asbestos						
B00C - R1003 - External Movement (1.64 m2)						
No Asbestos						
B00C - R1004 - K.L.A. Store (4.86 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
4266/B00A/R0037/Floor Coverings Res/Textile/S2					No Asbestos Detected	
B00C - R1005 - Reading Area (56.64 m2)						
No Asbestos						
B00C - R1006 - Reading Area (67.56 m2)						
No Asbestos						
B00C - R1007 - Library Office/Workroom (21.88 m2)						
No Asbestos						
B00C - R1008 - Library Office/Workroom (3.71 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4266/B00C/R0013/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B00C - R1009 - Movement (1.73 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4266/B00C/R0013/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B00C - R1010 - Staff Toilet (1.71 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4266/B00C/R0013/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B00C - R1011 - K.L.A. Store (9.84 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R1012 - Cleaning Distributed Store (0.27 m2)						
No Asbestos						
B00C - R1013 - External Movement (1.73 m2)						
No Asbestos						
B00C - R1014 - Stairs (2.38 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning/Administration - 1961 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4266/B00C/Eaves Linings/S8					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	24m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4266/B00C/Eaves Linings/S8					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible - due to low clearance.					

Interior

B00D - R0001 - Home Base (59.26 m2)

No Asbestos

B00D - R0002 - Home Base Store (3.1 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4266/B00A/R0037/Floor Coverings Res/Textile/S2					No Asbestos Detected

B00D - R0003 - Personal Effects Storage (9.61 m2)

No Asbestos

B00D - R0004 - Movement (20.37 m2)

No Asbestos

B00D - R0006 - Cleaning Distributed Store (2.49 m2)

No Asbestos

B00D - R0007 - General Storeroom (3.38 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4266/B00A/R0037/Floor Coverings Res/Textile/S2					No Asbestos Detected

B00D - R0009 - General Storeroom (3.04 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4266/B00A/R0037/Floor Coverings Res/Textile/S2					No Asbestos Detected

B00D - R0010 - Staff Room Annexe (8.57 m2)

No Asbestos

B00D - R0011 - Deputy Principal (8.57 m2)

No Asbestos

B00D - R0012 - General Storeroom (3.25 m2)

No Asbestos

B00D - R0013 - General Storeroom (2.48 m2)

No Asbestos

B00D - R0014 - Movement (37.45 m2)

No Asbestos

B00D - R0015 - External Movement (10.43 m2)

No Asbestos

B00D - R0016 - Entry Vestibule (16.96 m2)

No Asbestos

B00D - R0017 - Clerical Office (7.76 m2)

No Asbestos

B00D - R0018 - Clerical Office/Workroom (13.82 m2)

No Asbestos

B00D - R0019 - Principal (18.32 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00D - R0020 - Staff Toilet (4.45 m2)						
No Asbestos						
B00D - R0021 - Main Switch Board (0.79 m2)						
No Asbestos						
B00D - R0022 - Main Switch Board (1 m2)						
No Asbestos						
B00D - R0023 - Cleaning Distributed Store (5.29 m2)						
No Asbestos						
B00D - R0024 - Clerical Office/Workroom (38.9 m2)						
No Asbestos						
B00D - R0025 - Sick Bay (9.64 m2)						
No Asbestos						
B00D - R0026 - Staff Toilet (4.02 m2)						
No Asbestos						
B00D - R0027 - Staff Toilet (4.03 m2)						
No Asbestos						
B00D - R0028 - Movement (36.16 m2)						
No Asbestos						
B00D - R0029 - Movement (20.08 m2)						
No Asbestos						
B00D - R0031 - Home Base (57.61 m2)						
No Asbestos						
B00D - R0032 - Home Base Store (5.07 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
		4266/B00A/R0037/Floor Coverings Res/Textile/S2				No Asbestos Detected
B00D - R0034 - Home Base (57.62 m2)						
No Asbestos						
B00D - R0035 - Home Base Store (5.02 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
		4266/B00A/R0016/Floor Coverings Res/Textile/S3				No Asbestos Detected
B00D - R0036 - Stairs (9.26 m2)						
No Asbestos						
B00D - R0037 - Stairs (3.2 m2)						
No Asbestos						
B00D - R0038 - External Movement (7.71 m2)						
No Asbestos						
B00D - R0039 - Staff Room (47.88 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
		4266/B00A/R0037/Floor Coverings Res/Textile/S2				No Asbestos Detected
B00D - R0040 - Staff Kitchen (8.66 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
		4266/B00A/R0037/Floor Coverings Res/Textile/S2				No Asbestos Detected
B00D - R0041 - Practical Activities - 2hb (17.65 m2)						
No Asbestos						
B00D - R1001 - Home Base (57.68 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
No Asbestos						
B00D - R1002 - Home Base Store (3.08 m2)						
No Asbestos						
B00D - R1006 - Home Base (57.23 m2)						
No Asbestos						
B00D - R1007 - Home Base Store (3.13 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	4266/B00A/R0037/Floor Coverings Res/Textile/S2					No Asbestos Detected
B00D - R1009 - Stairs (13.05 m2)						
No Asbestos						
B00D - R1010 - Practical Activities - 2hb (35.37 m2)						
No Asbestos						
B00D - R9001 - Home Base (56.88 m2)						
Ceiling Structures/Linings	Vermiculite					
	4266/B00D/R9004/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R9002 - Home Base Store (4.22 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	4266/B00A/R0037/Floor Coverings Res/Textile/S2					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	4266/B00D/R9004/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R9004 - Home Base (57.45 m2)						
Ceiling Structures/Linings	Vermiculite					
	4266/B00D/R9004/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R9005 - Home Base Store (4.16 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	4266/B00A/R0037/Floor Coverings Res/Textile/S2					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	4266/B00D/R9004/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R9007 - Movement (18.76 m2)						
No Asbestos						
B00D - R9008 - Cleaning Distributed Store (2.12 m2)						
No Asbestos						
B00D - R9009 - External Movement (1.67 m2)						
No Asbestos						
B00D - R9010 - External Movement (1.81 m2)						
No Asbestos						
B00D - R9011 - Toilets - Boys (41.35 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	42m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4266/B00D/R9014/Ceiling Structures/Linings/S7					Chrysotile (white asbestos) , Crocidolite (blue asbestos)
B00D - R9012 - Other-Vacant (4.65 m2)						
No Asbestos						
B00D - R9013 - Toilets - Girls (40.46 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4266/B00D/R9014/Ceiling Structures/Linings/S7				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00D - R9014 - Movement (15.89 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4266/B00D/R9014/Ceiling Structures/Linings/S7				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00D - R9015 - Cleaning Supplies (10.9 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4266/B00D/R9014/Ceiling Structures/Linings/S7				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00D - R9016 - General Assistant/Bulk Store (11.02 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4266/B00D/R9014/Ceiling Structures/Linings/S7				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00D - R9017 - Stairs (3.2 m2)						
No Asbestos						
B00D - R9018 - Practical Activities - 2hb (18.77 m2)						
Ceiling Structures/Linings	Vermiculite					
4266/B00D/R9004/Ceiling Structures/Linings/S5				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Communal Facilities/Pupil Facilities - 1982 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids - Raked Ceiling Non Accessible Area
- Area inaccessible

Interior

B00H - R0001 - Distribution Board (1.58 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00H - R0002 - Shower/Change (2.81 m2)

Partition Walls (Cubicles) Compressed AC Sheet
4266/B00H/R0007/Partition Walls (Cubicles)/S1

No Asbestos Detected

B00H - R0003 - Movement (6.5 m2)

No Asbestos

B00H - R0004 - Toilets - Boys (11 m2)

Partition Walls (Cubicles) Compressed AC Sheet
4266/B00H/R0007/Partition Walls (Cubicles)/S1

No Asbestos Detected

B00H - R0005 - Raised Platform (52.84 m2)

No Asbestos

B00H - R0006 - External Movement (16.37 m2)

No Asbestos

B00H - R0007 - Toilets - Girls (10.94 m2)

Partition Walls (Cubicles) Compressed AC Sheet
4266/B00H/R0007/Partition Walls (Cubicles)/S1

No Asbestos Detected

B00H - R0008 - Movement (6.57 m2)

No Asbestos

B00H - R0009 - Shower/Change (2.25 m2)

Partition Walls (Cubicles) Compressed AC Sheet
4266/B00H/R0007/Partition Walls (Cubicles)/S1

No Asbestos Detected

B00H - R0010 - Other-Vacant (0.88 m2)

No Asbestos

B00H - R0011 - Cleaning Distributed Store (0.94 m2)

No Asbestos

B00H - R0012 - Communal Space (186.23 m2)

No Asbestos

B00H - R0013 - P.E. Store (15.6 m2)

No Asbestos

B00H - R0014 - Canteen (43.48 m2)

No Asbestos

B00H - R0015 - Canteen Office/Store (4.51 m2)

No Asbestos

B00H - R0016 - Canteen Office/Store (5.65 m2)

No Asbestos

B00H - R0017 - Sports Store (14.19 m2)

No Asbestos

B00H - R0018 - External Movement (31.44 m2)

No Asbestos

B00H - R0019 - External Movement (61.29 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00H - R0020 - External Movement (33.62 m2)						
No Asbestos						
B00H - R0021 - Hall Chair Store (2.58 m2)						
No Asbestos						
B00H - R0022 - Hall Chair Store (2.58 m2)						
No Asbestos						
B00H - R0023 - Disabled Toilet (3.27 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017