


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Lewisham Public School (4369)
Region : Sydney
State Electorate : Summer Hill
Local Government Area : Marrickville

Initial Survey : Noel Arnold & Associates : 11 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 11 - Sep - 2015

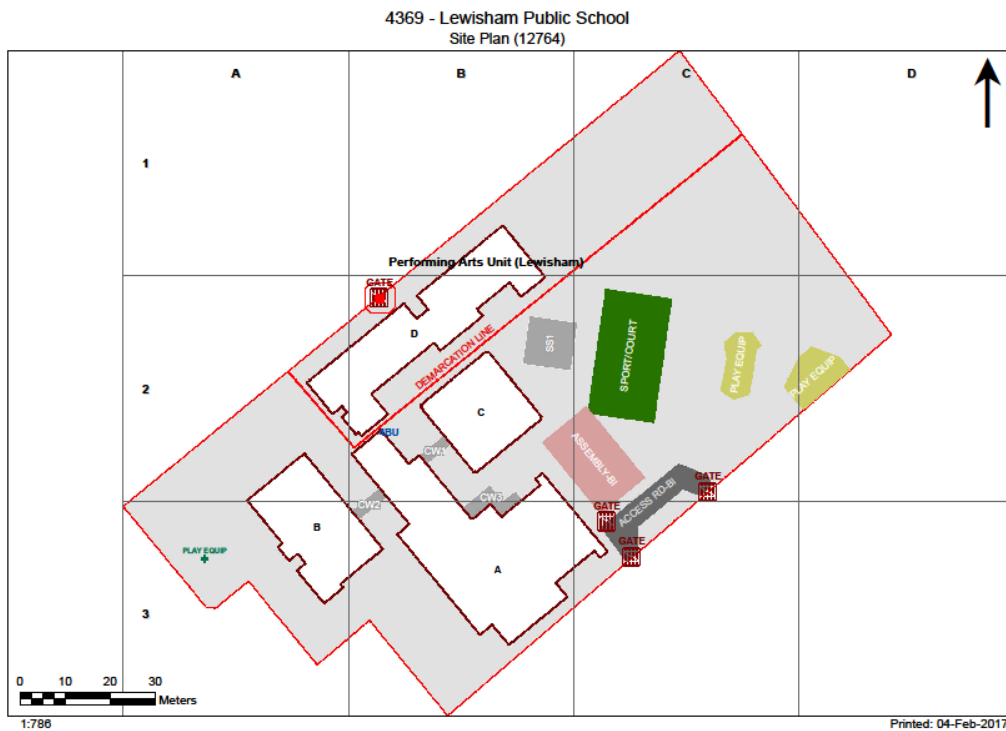

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Pupil Facilities - 1981 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	110m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - No Access Due To Heights						
Gable verge lining	Flat AC Sheeting	100m	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4369/B00A/Gable verge lining/S16					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00A - R0001 - External Movement (42.1 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	4369/B00A/R0009/Ceiling Structures/Linings/S12					

B00A - R0002 - Toilets - Girls (19.8 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4369/B00A/R1020/Partition Walls (Cubicles)/S14					Chrysotile (white asbestos)

B00A - R0005 - P.E. Store (20.59 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	4369/B00A/R0019/Floor Coverings Res/Textile/S11					

B00A - R0006 - Movement (10.79 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	4369/B00A/R0019/Floor Coverings Res/Textile/S11					

B00A - R0007 - General Storeroom (5.33 m2)

No Asbestos

B00A - R0008 - Garden Store (15.25 m2)

No Asbestos

B00A - R0009 - External Movement (179.36 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	4369/B00A/R0009/Ceiling Structures/Linings/S12					

B00A - R0010 - General Storeroom (13.39 m2)

No Asbestos

B00A - R0011 - Distribution Board (0.45 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00A - R0012 - General Storeroom (13 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	4369/B00A/R0019/Floor Coverings Res/Textile/S11					

B00A - R0013 - Teachers Aide Special Ed (16.06 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	4369/B00A/R0019/Floor Coverings Res/Textile/S11					

B00A - R0014 - Home Base - M (51.63 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4369/B00D/R2010/Ceiling Structures/Linings/S7					

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0015 - Practical Activities - M - 1hb (18.83 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	4369/B00D/R2010/Ceiling Structures/Linings/S7					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles					
	4369/B00A/R0019/Floor Coverings Res/Textile/S11					No Asbestos Detected
B00A - R0016 - External Movement (77.4 m2)						
No Asbestos						
B00A - R0017 - Music Store (14.13 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	4369/B00A/R0019/Floor Coverings Res/Textile/S11					No Asbestos Detected
B00A - R0018 - Movement (9.44 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	4369/B00A/R0019/Floor Coverings Res/Textile/S11					No Asbestos Detected
B00A - R0021 - P.E. Store (7.12 m2)						
No Asbestos						
B00A - R0022 - Cleaning Distributed Store (2.3 m2)						
No Asbestos						
B00A - R0023 - Distribution Board (0.39 m2)						
					Note: No inspection of live electrical installation.	
Non Accessible						
B00A - R0024 - Toilets - Boys (20.58 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4369/B00A/R1020/Partition Walls (Cubicles)/S14					Chrysotile (white asbestos)
B00A - R0025 - Canteen (45.06 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	4369/B00A/R0019/Floor Coverings Res/Textile/S11					No Asbestos Detected
B00A - R0026 - Canteen Office/Store (2.91 m2)						
No Asbestos						
B00A - R0027 - Staff Toilet (9.7 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	4369/B00A/R0019/Floor Coverings Res/Textile/S11					No Asbestos Detected
B00A - R0028 - Adjoining School (7.5 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	4369/B00A/R0009/Ceiling Structures/Linings/S12					No Asbestos Detected
B00A - R0030 - Adjoining School (6.93 m2)						
No Asbestos						
B00A - R0031 - Communal Space (256.63 m2)						
No Asbestos						
B00A - R0032 - Raised Platform (105.55 m2)						
No Asbestos						
B00A - R0033 - Movement (4.01 m2)						
No Asbestos						
B00A - R0034 - Movement (8.35 m2)						
No Asbestos						
B00A - R0035 - Communal/Performance Store (11.27 m2)						
No Asbestos						
B00A - R0036 - Cleaning Distributed Store (3.42 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00A - R0037 - Disabled Toilet (2.88 m2)						
No Asbestos						
B00A - R1001 - Movement (14.24 m2)						
No Asbestos						
B00A - R1002 - Movement (44.84 m2)						
No Asbestos						
B00A - R1003 - General Storeroom (9.21 m2)						
No Asbestos						
B00A - R1004 - Practical Activities - 1hb (18.8 m2)						
No Asbestos						
B00A - R1005 - Home Base (51.94 m2)						
No Asbestos						
B00A - R1006 - Home Base (51.87 m2)						
No Asbestos						
B00A - R1007 - Practical Activities - 1hb (18.64 m2)						
No Asbestos						
B00A - R1008 - Withdrawal Space - 1hb (9.07 m2)						
No Asbestos						
B00A - R1009 - Security Store (18.66 m2)						
No Asbestos						
B00A - R1010 - Home Base (51.71 m2)						
No Asbestos						
B00A - R1011 - Practical Activities - 1hb (18.4 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
		4369/B00A/R0019/Floor Coverings Res/Textile/S11				No Asbestos Detected
B00A - R1012 - Distribution Board (0.36 m2)						
					Note: No inspection of live electrical installation.	
No Asbestos						
B00A - R1013 - Cleaning Distributed Store (4.5 m2)						
No Asbestos						
B00A - R1014 - General Storeroom (13.78 m2)						
No Asbestos						
B00A - R1015 - Withdrawal Space - 1hb (15.46 m2)						
No Asbestos						
B00A - R1016 - Home Base (51.64 m2)						
No Asbestos						
B00A - R1017 - Practical Activities - 1hb (18.56 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
		4369/B00A/R0019/Floor Coverings Res/Textile/S11				No Asbestos Detected
B00A - R1018 - Movement (72.49 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
		4369/B00A/R0009/Ceiling Structures/Linings/S12				No Asbestos Detected
B00A - R1019 - Movement (7.37 m2)						
No Asbestos						
B00A - R1020 - Toilets - Girls (17.47 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
		4369/B00A/R1020/Partition Walls (Cubicles)/S14				Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R1021 - Practical Activities - 1hb (18.56 m2)						
No Asbestos						
B00A - R1022 - Home Base (51.87 m2)						
No Asbestos						
B00A - R1023 - Home Base (51.79 m2)						
No Asbestos						
B00A - R1024 - Practical Activities - 1hb (18.49 m2)						
No Asbestos						
B00A - R1025 - Toilets - Boys (19.25 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4369/B00A/R1020/Partition Walls (Cubicles)/S14					Chrysotile (white asbestos)	
B00A - R1026 - Adjoining School (19.46 m2)						
No Asbestos						
B00A - R1027 - Adjoining School (15.38 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
4369/B00A/R0009/Ceiling Structures/Linings/S12					No Asbestos Detected	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1981 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	70m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4369/B00B/Eaves Linings/S17					Chrysotile (white asbestos)
Gable verge lining	Flat AC Sheeting	40m	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4369/B00B/Gable verge lining/S18					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00B - R0001 - Home Base (66.69 m2)

No Asbestos

B00B - R0002 - Practical Activities - 1hb (22.98 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4369/B00D/R2016/Floor Coverings Res/Textile/S8					No Asbestos Detected

B00B - R0003 - Toilets - Boys/Girls (2.87 m2)

No Asbestos

B00B - R0004 - Toilets - Girls (23.66 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4369/B00A/R1020/Partition Walls (Cubicles)/S14					Chrysotile (white asbestos)

B00B - R0005 - Cleaning Distributed Store (0.97 m2)

No Asbestos

B00B - R0006 - Toilets - Boys (17.76 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4369/B00A/R1020/Partition Walls (Cubicles)/S14					Chrysotile (white asbestos)

B00B - R0007 - Movement (61.05 m2)

Ceiling Structures/Linings	Flat AC Sheeting	62m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4369/B00B/R0007/Ceiling Structures/Linings/S15					Chrysotile (white asbestos)

B00B - R0008 - Home Base (73.71 m2)

No Asbestos

B00B - R0009 - Toilets - Boys/Girls (2.87 m2)

No Asbestos

B00B - R0010 - Practical Activities - 1hb (16.71 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4369/B00D/R2016/Floor Coverings Res/Textile/S8					No Asbestos Detected

B00B - R0011 - Practical Activities - 1hb (16.71 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	4369/B00D/R2016/Floor Coverings Res/Textile/S8					No Asbestos Detected

B00B - R0012 - Toilets - Boys/Girls (2.82 m2)

No Asbestos

B00B - R0013 - Home Base (73.71 m2)

No Asbestos

B00B - R0014 - General Storeroom (13.86 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4369/B00B/R0007/Ceiling Structures/Linings/S15					Chrysotile (white asbestos)	
B00B - R0015 - Distribution Board (0.54 m2)				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4369/B00B/R0007/Ceiling Structures/Linings/S15					Chrysotile (white asbestos)	
B00B - R0016 - Craft Store (9.79 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4369/B00B/R0007/Ceiling Structures/Linings/S15					Chrysotile (white asbestos)	
B00B - R0017 - External Movement (14.36 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4369/B00B/R0007/Ceiling Structures/Linings/S15					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - Administration/Library - 1981 - Brick/Block (Brick/Block)						
Exterior						
Eaves Linings	Flat AC Sheeting	3m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - No Access Due To Height						
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Interior						
B00C - R0001 - Deputy Principal (11.36 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4369/B00C/R0013/Ceiling Structures/Linings/S1					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00C - R0002 - Movement (22.82 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4369/B00C/R0013/Ceiling Structures/Linings/S1					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00C - R0003 - Staff Kitchen (11.49 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4369/B00C/R0013/Ceiling Structures/Linings/S1					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00C - R0004 - Staff Room (109 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4369/B00C/R0013/Ceiling Structures/Linings/S1					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	North west	Good Condition (1)	Low (1)	Low Priority (2-3)
	4369/B00C/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00C - R0005 - Staff Toilet (5.85 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4369/B00C/R0013/Ceiling Structures/Linings/S1					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00C - R0006 - Staff Toilet (4.17 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4369/B00C/R0013/Ceiling Structures/Linings/S1					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00C - R0007 - General Storeroom (1.35 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4369/B00C/R0013/Ceiling Structures/Linings/S1					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00C - R0008 - Deputy Principal (11.33 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4369/B00C/R0013/Ceiling Structures/Linings/S1					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00C - R0009 - Movement (17.31 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4369/B00C/R0013/Ceiling Structures/Linings/S1					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00C - R0010 - Distribution Board (2.98 m2)						
Note: No inspection of live electrical installation.						
Electrical Mounting Board	Resinous Board	5Unit	West facing, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4369/B00C/R0010/Electrical Mounting Board/S19					Chrysotile (white asbestos)
B00C - R0011 - Principal (15.46 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	4369/B00C/R0013/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00C - R0012 - Staff Toilet (4.2 m2)						
Ceiling Structures/Linings	Vermiculite					
	4369/B00C/R0013/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00C - R0013 - Entry Vestibule (21.47 m2)						
Ceiling Structures/Linings	Vermiculite					
	4369/B00C/R0013/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	3m2	North west	Good Condition (1)	Low (1)	Low Priority (2-3)
	4369/B00C/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00C - R0014 - Clerical Office/Workroom (8.36 m2)						
Ceiling Structures/Linings	Vermiculite					
	4369/B00C/R0013/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00C - R0015 - Clerical Office (12.39 m2)						
Ceiling Structures/Linings	Vermiculite					
	4369/B00C/R0013/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00C - R0016 - Duplicating Workroom (21.82 m2)						
Ceiling Structures/Linings	Vermiculite					
	4369/B00C/R0013/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4369/B00C/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00C - R0017 - General Storeroom (8.99 m2)						
Ceiling Structures/Linings	Vermiculite					
	4369/B00C/R0013/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00C - R0018 - Staff Toilet (2.94 m2)						
Ceiling Structures/Linings	Vermiculite					
	4369/B00C/R0013/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00C - R0019 - Cleaning Distributed Store (1.23 m2)						
Ceiling Structures/Linings	Vermiculite					
	4369/B00C/R0013/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00C - R0020 - Sick Bay (12.21 m2)						
Ceiling Structures/Linings	Vermiculite					
	4369/B00C/R0013/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00C - R1001 - Seminar/Study (19.59 m2)						
Ceiling Structures/Linings	Vermiculite					
	4369/B00C/R0013/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00C - R1002 - Seminar/Study (16.15 m2)						
Ceiling Structures/Linings	Vermiculite					
	4369/B00C/R0013/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00C - R1003 - Reading Area (236.14 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	4369/B00C/R0013/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R1004 - External Movement (1.82 m2)						
Ceiling Structures/Linings	Vermiculite					
	4369/B00C/R0013/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R1005 - Movement (12.01 m2)						
Ceiling Structures/Linings	Vermiculite					
	4369/B00C/R0013/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R1006 - Entry Vestibule (2.66 m2)						
No Asbestos						
B00C - R1007 - Toilets - Boys (5.44 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4369/B00C/R1009/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)
B00C - R1008 - Cleaning Distributed Store (1.66 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4369/B00C/R1009/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)
B00C - R1009 - Toilets - Girls (4.87 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4369/B00C/R1009/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)
B00C - R1010 - Communications Room (13.03 m2)						
Ceiling Structures/Linings	Vermiculite					
	4369/B00C/R0013/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R1011 - Library Office/Workroom (8.56 m2)						
Ceiling Structures/Linings	Vermiculite					
	4369/B00C/R0013/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R1012 - K.L.A. Store (4.96 m2)						
Ceiling Structures/Linings	Vermiculite					
	4369/B00C/R0013/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R1013 - Library Office/Workroom (19.5 m2)						
Ceiling Structures/Linings	Vermiculite					
	4369/B00C/R0013/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning/Other - 1975 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - No Access Due To Height						
Gable verge lining	Flat AC Sheeting	40m	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4369/B00D/Gable verge lining/S20				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00D - M0001 - Movement (10.01 m2)

No Asbestos

B00D - M0002 - Toilets - Boys (16.5 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4369/B00D/M1002/Partition Walls (Cubicles)/S9				Chrysotile (white asbestos)		

B00D - M0003 - Stairs (2.76 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4369/B00D/M0003/Ceiling Structures/Linings/S21				No Asbestos Detected
----------------------------	------------------	--	--	--	--	-----------------------------

B00D - M1001 - Movement (10.47 m2)

Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4369/B00D/R2001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)		

B00D - M1002 - Toilets - Girls (16.4 m2)

Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4369/B00D/R2001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4369/B00D/M1002/Partition Walls (Cubicles)/S9				Chrysotile (white asbestos)		

B00D - M1003 - Stairs (2.76 m2)

No Asbestos

B00D - R0001 - External Movement (139.3 m2)

No Asbestos

B00D - R0002 - Cleaning Distributed Store (4.26 m2)

No Asbestos

B00D - R0003 - Toilets - Boys (40.27 m2)

Ceiling Structures/Linings	Vermiculite	4369/B00D/R2010/Ceiling Structures/Linings/S7				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4369/B00D/M1002/Partition Walls (Cubicles)/S9				Chrysotile (white asbestos)		

B00D - R0004 - Plant (5.18 m2)

Ceiling Structures/Linings	Vermiculite	4369/B00D/R2010/Ceiling Structures/Linings/S7				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0005 - Cleaning Distributed Store (3.13 m2)

Ceiling Structures/Linings	Vermiculite	4369/B00D/R2010/Ceiling Structures/Linings/S7				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0006 - Toilets - Girls (57.64 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 4369/B00D/R2010/Ceiling Structures/Linings/S7				Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Partition Walls (Cubicles)	Compressed AC Sheet 4369/B00D/M1002/Partition Walls (Cubicles)/S9	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R0007 - Plant (3.41 m2)						
Ceiling Structures/Linings	Vermiculite 4369/B00D/R2010/Ceiling Structures/Linings/S7				Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00D - R0008 - Staff Toilet (4.03 m2)						
Ceiling Structures/Linings	Vermiculite 4369/B00D/R2010/Ceiling Structures/Linings/S7				Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00D - R0009 - Movement (2.56 m2)						
Ceiling Structures/Linings	Vermiculite 4369/B00D/R2010/Ceiling Structures/Linings/S7				Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00D - R0010 - Staff Toilet (4.68 m2)						
Ceiling Structures/Linings	Vermiculite 4369/B00D/R2010/Ceiling Structures/Linings/S7				Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00D - R0011 - Distribution Board Cupboard (0.56 m2)				Note: No inspection of live electrical installation.		
Non Accessible						
B00D - R0012 - Cleaning Distributed Store (2.43 m2)						
No Asbestos						
B00D - R0013 - Other - Regional Use (63.05 m2)						
Ceiling Structures/Linings	Vermiculite 4369/B00D/R2010/Ceiling Structures/Linings/S7				Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles 4369/B00D/R0013/Floor Coverings Res/Textile/S10	64m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R0014 - Cleaning Supplies (7.73 m2)						
No Asbestos						
B00D - R0015 - Home Base (29.75 m2)						
Ceiling Structures/Linings	Vermiculite 4369/B00D/R2010/Ceiling Structures/Linings/S7				Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00D - R0016 - Home Base (41.41 m2)						
Ceiling Structures/Linings	Vermiculite 4369/B00D/R2010/Ceiling Structures/Linings/S7				Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00D - R0017 - Home Base (32.18 m2)						
Ceiling Structures/Linings	Vermiculite 4369/B00D/R2010/Ceiling Structures/Linings/S7				Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles 4369/B00C/R0004/Floor Coverings Res/Textile/S2	33m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R0018 - Home Base (38.29 m2)						
Ceiling Structures/Linings	Vermiculite 4369/B00D/R2010/Ceiling Structures/Linings/S7				Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	39m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4369/B00C/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00D - R0019 - P.E. Store (22.77 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4369/B00D/R2010/Ceiling Structures/Linings/S7					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4369/B00C/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00D - R0020 - Staff Kitchen (18.43 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4369/B00D/R2010/Ceiling Structures/Linings/S7					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4369/B00C/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00D - R0021 - General Storeroom (10.86 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4369/B00D/R2010/Ceiling Structures/Linings/S7					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4369/B00C/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00D - R0022 - Movement (5.12 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4369/B00D/R2010/Ceiling Structures/Linings/S7					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4369/B00C/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00D - R0024 - Staff Kitchen (3.44 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4369/B00D/R2010/Ceiling Structures/Linings/S7					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4369/B00C/R0004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00D - R0025 - Maintenance Bulk Store (13.61 m2)						
No Asbestos						
B00D - R0026 - Cleaning Supplies (16.57 m2)						
No Asbestos						
B00D - R0027 - Movement (1.85 m2)						
No Asbestos						
B00D - R0028 - Stairs (4.27 m2)						
No Asbestos						
B00D - R0029 - External Stairs (0.59 m2)						
No Asbestos						
B00D - R0030 - External Stairs (10.39 m2)						
No Asbestos						
B00D - R0031 - Staff Toilet (2.48 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4369/B00D/R2010/Ceiling Structures/Linings/S7					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R0032 - Toilet - Lobby (2.55 m2)						
No Asbestos						
B00D - R1001 - Movement (47.36 m2)						
No Asbestos						
B00D - R1005 - Home Base (62.81 m2)						
Ceiling Structures/Linings	Vermiculite					
	4369/B00D/R2010/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	4369/B00D/R2005/Floor Coverings Res/Textile/S5					No Asbestos Detected
B00D - R1006 - Distribution Board Cupboard (0.55 m2)						
					Note: No inspection of live electrical installation.	
No Asbestos						
B00D - R1007 - Cleaning Distributed Store (2.43 m2)						
No Asbestos						
B00D - R1008 - Movement (74.25 m2)						
No Asbestos						
B00D - R1010 - Security Store (13.19 m2)						
No Asbestos						
B00D - R1013 - Distribution Board Cupboard (0.18 m2)						
					Note: No inspection of live electrical installation.	
Electrical Mounting Board	Resinous Board	1Unit	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - No Access Due To Electrical Hazzard						
B00D - R1020 - Stairs (6.39 m2)						
No Asbestos						
B00D - R1022 - Stairs (8.76 m2)						
No Asbestos						
B00D - R1023 - Stairs (17.22 m2)						
No Asbestos						
B00D - R1024 - Adjoining School (74.41 m2)						
Ceiling Structures/Linings	Vermiculite					
	4369/B00D/R2010/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1025 - Adjoining School (74.32 m2)						
Ceiling Structures/Linings	Vermiculite					
	4369/B00D/R2010/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1026 - Adjoining School (74 m2)						
Ceiling Structures/Linings	Vermiculite					
	4369/B00D/R2010/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1027 - Adjoining School (125.77 m2)						
Ceiling Structures/Linings	Vermiculite					
	4369/B00D/R2010/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1028 - Movement (5.14 m2)						
No Asbestos						
B00D - R2001 - Movement (45.47 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	46m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4369/B00D/R2001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Wall Linings Internal	Flat AC Sheeting	2m2	North facing, South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
4369/B00D/R2001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)		
B00D - R2005 - Home Base (62.8 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
4369/B00D/R2005/Floor Coverings Res/Textile/S5				No Asbestos Detected		
B00D - R2006 - Distribution Board Cupboard (0.55 m2)				Note: No inspection of live electrical installation.		
Electrical Mounting Board	Flat AC Sheeting	1Unit	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4369/B00D/R0031/Ceiling Structures/Linings/S22				Chrysotile (white asbestos)		
B00D - R2007 - Cleaning Distributed Store (2.43 m2)						
No Asbestos						
B00D - R2008 - Movement (60.32 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	61m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4369/B00D/R2001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)		
B00D - R2009 - General Storeroom (13.19 m2)						
No Asbestos						
B00D - R2012 - Distribution Board Cupboard (0.18 m2)				Note: No inspection of live electrical installation.		
Electrical Mounting Board	Resinous Board	1Unit	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - No Access Due To Electrical hazard						
B00D - R2019 - Stairs (12.16 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4369/B00D/R2001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)		
Wall Linings Internal	Flat AC Sheeting	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4369/B00D/R2001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)		
B00D - R2020 - Stairs (7.57 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4369/B00D/R2001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)		
Wall Linings Internal	Flat AC Sheeting	4m2	North facing, South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
4369/B00D/R2001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)		
B00D - R2021 - Stairs (2.76 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4369/B00D/R2001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)		
B00D - R2022 - Other-Commercial (74.65 m2)						
Ceiling Structures/Linings	Vermiculite					
4369/B00D/R2010/Ceiling Structures/Linings/S7				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R2023 - Other-Commercial (74.24 m2)						
Ceiling Structures/Linings	Vermiculite					
4369/B00D/R2010/Ceiling Structures/Linings/S7				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R2024 - Adjoining School (125.85 m2)						
No Asbestos						
B00D - R2025 - Adjoining School (74 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017