


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Lansvale East Public School (4391)
Region : South Western Sydney
State Electorate : Cabramatta
Local Government Area : Fairfield

Initial Survey : Noel Arnold & Associates : 12 - Mar - 2008
Reviewed By : AECOM : 26 - May - 2015

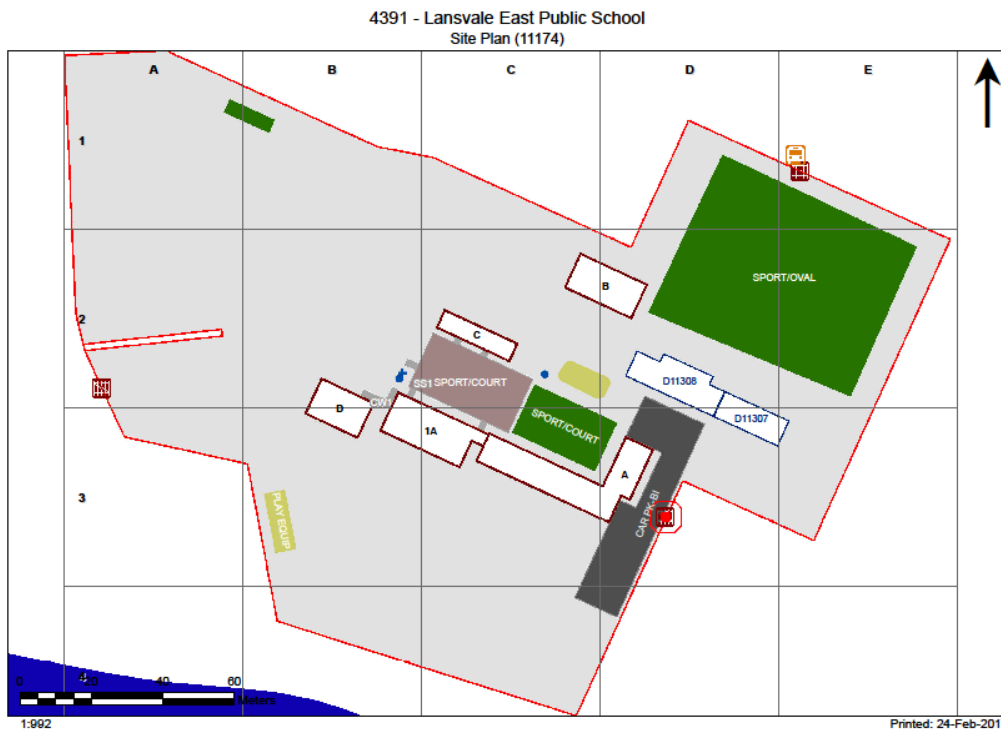

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning - 1967 - Brick/Veneer (Brick/Veneer)**Exterior**

Gable Verge Lining	Flat AC Sheeting	20m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4391/B00A/R0018/Ceiling Structures/Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Eaves Linings	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4391/B00A/R0018/Ceiling Structures/Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00A - R0001 - Movement**

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4391/B00A/R0016/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)	

B00A - R0002 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4391/B00A/R0016/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)	

B00A - R0003 - Home Base Store

No Asbestos

B00A - R0004 - Special Programs Room

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4391/B00A/R0005/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)	

B00A - R0005 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4391/B00A/R0005/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)	

B00A - R0006 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4391/B00A/R0016/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)	

B00A - R0007 - Personal Effects Storage

No Asbestos

B00A - R0008 - Movement

No Asbestos

B00A - R0009 - Home Base Store

No Asbestos

B00A - R0010 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4391/B00A/R0018/Ceiling Structures/Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	
In-fill-panel	Flat AC Sheeting	1m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4391/B00A/R0018/In-fill-panel/S3				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00A - R0011 - Home Base Store

No Asbestos

B00A - R0012 - Home Base Store

No Asbestos

B00A - R0013 - Home Base

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Strip between R0013-R0014	Good Condition (1)	Low (1)	Low Priority (2-3)
4391/B00A/R0016/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	65m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)
4391/B00A/R0005/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00A - R0014 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4391/B00A/R0005/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00A - R0015 - Home Base Store						
No Asbestos						
B00A - R0016 - Personal Effects Storage						
No Asbestos						
B00A - R0017 - Movement						
No Asbestos						
B00A - R0018 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4391/B00A/R0018/Ceiling Structures/Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	3m	East	Good Condition (1)	Low (1)	Low Priority (2-3)
4391/B00A/R0018/In-fill-panel/S1				Chrysotile (white asbestos)		
In-fill-panel	Flat AC Sheeting	1m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
4391/B00A/R0018/In-fill-panel/S3				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0019 - Interview						
No Asbestos						
B00A - R0020 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4391/B00A/R0030/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)		
B00A - R0021 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4391/B00A/R0030/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)		
B00A - R0022 - Clerical Office						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4391/B00A/R0030/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)		
B00A - R0023 - Entry Vestibule						
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4391/B00A/R0030/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)		
B00A - R0024 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4391/B00A/R0018/Ceiling Structures/Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	3m	East	Good Condition (1)	Low (1)	Low Priority (2-3)
4391/B00A/R0018/In-fill-panel/S1				Chrysotile (white asbestos)		
B00A - R0025 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4391/B00A/R0030/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0026 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4391/B00A/R0030/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
B00A - R0027 - Main Switch Board						
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4391/B00A/R0028/Wall Linings Internal/S4					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4391/B00A/R0030/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
Electrical Backing Board	Resinous Board	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00A - R0028 - Staff Toilet						
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4391/B00A/R0028/Wall Linings Internal/S4					Chrysotile (white asbestos)	
B00A - R0029 - Staff Room						
Floor Coverings Res/Textile	Vinyl Tiles	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4391/B00A/R0030/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
B00A - R0030 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4391/B00A/R0030/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1967 - Brick/Veneer (Brick/Veneer)

Exterior

Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4391/B00B/R0008/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	20m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4391/B00B/R0008/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible - limited access gained due to low clearance.					

Interior

B00B - R0001 - Personal Effects Storage

No Asbestos

B00B - R0002 - Home Base Store

No Asbestos

B00B - R0003 - Home Base

No Asbestos

B00B - R0004 - Home Base

No Asbestos

B00B - R0005 - Home Base Store

No Asbestos

B00B - R0006 - Music Store

No Asbestos

B00B - R0007 - Personal Effects Storage

No Asbestos

B00B - R0008 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4391/B00B/R0008/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	4391/B00B/R0008/In-fill-panel/S10				No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1967 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4391/B00C/R0004/Ceiling Structures/Linings/S11			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00C - R0001 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4391/B00C/R0004/Ceiling Structures/Linings/S11			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0002 - Cleaning Supplies

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4391/B00C/R0004/Ceiling Structures/Linings/S11			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0003 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4391/B00C/R0004/Ceiling Structures/Linings/S11			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0004 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4391/B00C/R0004/Ceiling Structures/Linings/S11			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00D - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00D - R0001 - External Movement

No Asbestos

B00D - R0002 - Reading Area

No Asbestos

B00D - R0003 - Library Office/Workroom

No Asbestos

B00D - R0004 - Communications Room

No Asbestos

B00D - R0005 - K.L.A. Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B01A - General Learning - 1967 - Brick/Veneer (Brick/Veneer)

Exterior

Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4391/B01A/R0007/Wall Linings Internal/S8				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	60m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4391/B01A/R0007/Wall Linings Internal/S8				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B01A - R0001 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4391/B01A/R0007/Wall Linings Internal/S8				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	1m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4391/B00A/R0018/In-fill-panel/S3				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B01A - R0002 - Movement

No Asbestos

B01A - R0003 - Personal Effects Storage

No Asbestos

B01A - R0004 - Home Base Store

No Asbestos

B01A - R0005 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles	50m2	Strip between R0006-R0005	Good Condition (1)	Low (1)	Low Priority (2-3)
	4391/B01A/R0005/Floor Coverings Res/Textile/S13				Chrysotile (white asbestos)	

B01A - R0006 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Strip between R0006-R0005	Good Condition (1)	Low (1)	Low Priority (2-3)
	4391/B01A/R0005/Floor Coverings Res/Textile/S13				Chrysotile (white asbestos)	

B01A - R0007 - Toilets - Boys/Girls

Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4391/B01A/R0007/Wall Linings Internal/S8				Chrysotile (white asbestos)	

B01A - R0008 - Home Base Store

No Asbestos

B01A - R0009 - Personal Effects Storage

No Asbestos

B01A - R0010 - Cleaning Distributed Store

No Asbestos

B01A - R0011 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4391/B01A/R0007/Wall Linings Internal/S8				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	1m	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4391/B00A/R0018/In-fill-panel/S3				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B01A - R0012 - External Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 502 - D11307 - Admin Staff/Principal/Clerk/Dup/Clinic : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				23.04 m2

Interior

R1 - Clerical Office

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2

R10 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos				12 m2
---------	---------------	------------------	--	--	--	-------

R2 - Security Store

Ceiling	Flat AC Sheet	Assumed Asbestos				1 m2
---------	---------------	------------------	--	--	--	------

R3 - Duplicating Wookroom

Ceiling	Flat AC Sheet	Assumed Asbestos				12 m2
---------	---------------	------------------	--	--	--	-------

R4 - Clinic-Waiting

Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2
---------	---------------	------------------	--	--	--	-------

R5 - Staff Room

Ceiling	Flat AC Sheet	Assumed Asbestos				36 m2
---------	---------------	------------------	--	--	--	-------

R6 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2
---------	---------------	------------------	--	--	--	-------

R7 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos				2 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2

R8 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos				2 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2

R9 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				27 m2

OS 811 - D11308 - FSU/Shelter/Stores : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				31.68 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Interior

R1 - Canteen

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				28 m2

R2 - Covered Area

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				145 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos				4 m2
---------	---------------	------------------	--	--	--	------

R4 - Sports Store

Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
---------	---------------	------------------	--	--	--	-------

R5 - Garden Store

Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
---------	---------------	------------------	--	--	--	------

R6 - Change Room

Ceiling	Flat AC Sheet	Assumed Asbestos				3 m2
---------	---------------	------------------	--	--	--	------

R7 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos				2 m2
---------	---------------	------------------	--	--	--	------

OS 621 - D15002 - Single Learning Unit - H/Cap : Placement Date - 19/01/2017

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Home Base-I.O.

No Asbestos Found.

R2 - Toilets-Disabled

No Asbestos Found.

R3 - Laundry

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

4391_ASB_261112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017