


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Lethbridge Park Public School (4408)
Region : Western Sydney
State Electorate : Londonderry
Local Government Area : Blacktown

Initial Survey : Noel Arnold & Associates : 23 - May - 2008
Reviewed By : Greencap-NAA : 13 - Aug - 2014

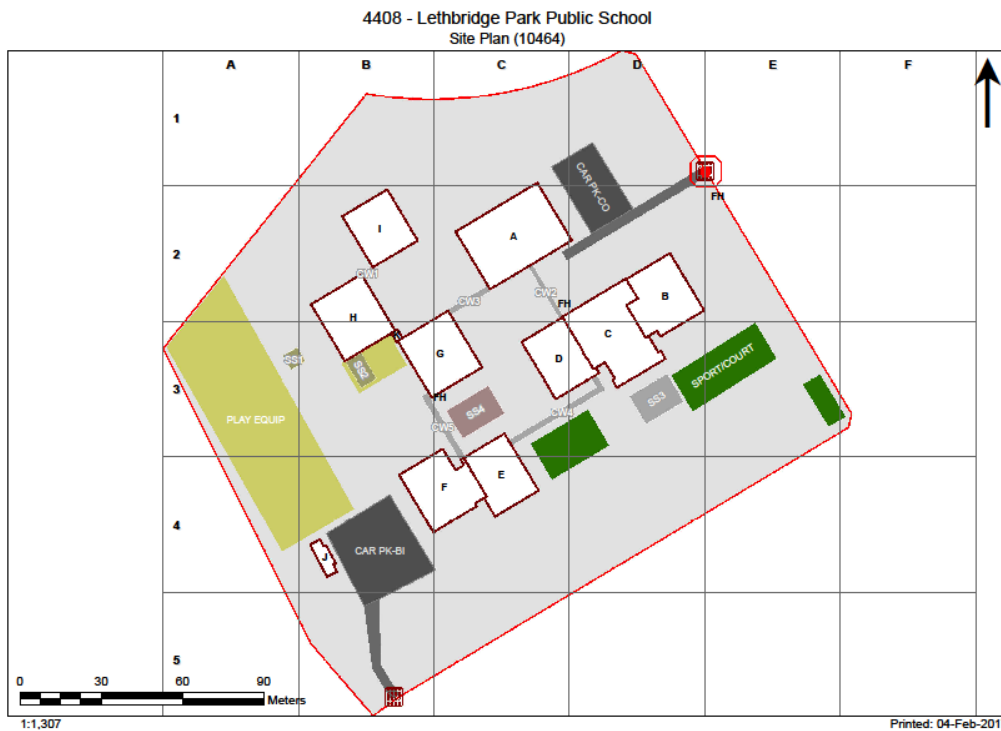

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Pupil Facilities - 1969 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior**B00A - R0001 - Security Store (10.1 m2)**

Floor Coverings Res/Textile Vinyl Tiles 11m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4408/B00B/R0001/Floor Coverings Res/Textile/S3 **Chrysotile (white asbestos)**

B00A - R0002 - Duplicating Workroom (25.14 m2)

Ceiling Structures/Linings Vermiculite 4408/B00B/R0001/Ceiling Structures/Linings/S4 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles 4408/B00A/R0035/Floor Coverings Res/Textile/S17 **No Asbestos Detected**

B00A - R0003 - Staff Room (116.37 m2)

Ceiling Structures/Linings Flat AC Sheeting 117m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4408/B00A/R0003/Ceiling Structures/Linings/S18 **Chrysotile (white asbestos)**

B00A - R0004 - Canteen Office/Store (5.15 m2)

Ceiling Structures/Linings Vermiculite 4408/B00B/R0001/Ceiling Structures/Linings/S4 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0005 - Staff Toilet (2.11 m2)

Ceiling Structures/Linings Vermiculite 4408/B00B/R0001/Ceiling Structures/Linings/S4 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0006 - Canteen Office/Store (5.2 m2)

Ceiling Structures/Linings Vermiculite 4408/B00B/R0001/Ceiling Structures/Linings/S4 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0007 - Canteen (39.59 m2)

Ceiling Structures/Linings Vermiculite 4408/B00B/R0001/Ceiling Structures/Linings/S4 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0008 - Movement (26.28 m2)

No Asbestos

B00A - R0009 - Main Switch Board (10.63 m2)

Electrical Backing Board Resinous Board 3m2 Variable positions Good Condition (1) Low (1) Low Priority (2-3)
4408/B00A/R0009/Electrical Backing Board/S2 **Chrysotile (white asbestos)**

B00A - R0010 - Staff Room Annexe (16.53 m2)

Ceiling Structures/Linings Vermiculite 4408/B00B/R0001/Ceiling Structures/Linings/S4 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles (Under Floor Covering/Carpet) 17m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
4408/B00B/R0001/Floor Coverings Res/Textile/S3 **Chrysotile (white asbestos)**

B00A - R0011 - Staff Room Annexe (22.59 m2)

Ceiling Structures/Linings Vermiculite 4408/B00B/R0001/Ceiling Structures/Linings/S4 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4408/B00B/R0001/Floor Coverings Res/Textile/S3	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0012 - General Storeroom (8.09 m2)						
Ceiling Structures/Linings	Vermiculite 4408/B00B/R0001/Floor Coverings Res/Textile/S3	9m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0013 - Staff Toilet (6.52 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet 4408/B00E/R0004/Partition Walls (Cubicles)/S8	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 4408/B00B/R0001/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0014 - Staff Toilet (6.29 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet 4408/B00E/R0004/Partition Walls (Cubicles)/S8	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 4408/B00B/R0001/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0015 - Movement (5.86 m2)						
Ceiling Structures/Linings	Vermiculite 4408/B00B/R0001/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4408/B00B/R0001/Floor Coverings Res/Textile/S3	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0016 - Community Clinic (7.4 m2)						
Ceiling Structures/Linings	Vermiculite 4408/B00B/R0001/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4408/B00B/R0001/Floor Coverings Res/Textile/S3	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0018 - Community Clinic (25.76 m2)						
Ceiling Structures/Linings	Vermiculite 4408/B00B/R0001/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0019 - Staff Toilet (3.02 m2)						
Ceiling Structures/Linings	Vermiculite 4408/B00B/R0001/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0020 - Security Store (15.25 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 4408/B00B/R0001/Floor Coverings Res/Textile/S3	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0021 - Cleaning Distributed Store (5.63 m2)						
Ceiling Structures/Linings	Vermiculite 4408/B00B/R0001/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0022 - Staff Toilet (2.52 m2)						
Ceiling Structures/Linings	Vermiculite 4408/B00B/R0001/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

4408 Lethbridge Park Public School

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4408/B00B/R0001/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00A - R0023 - General Storeroom (3.38 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4408/B00B/R0001/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4408/B00B/R0001/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00A - R0024 - Deputy Principal (15.89 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4408/B00B/R0001/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
4408/B00B/R0001/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00A - R0025 - Clerical Office (29.09 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4408/B00B/R0001/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	30m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
4408/B00B/R0001/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00A - R0026 - Movement (1.84 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4408/B00B/R0001/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00A - R0027 - Staff Toilet (4.01 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4408/B00B/R0001/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00A - R0028 - Principal (17.39 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4408/B00B/R0001/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
4408/B00H/R0001/Floor Coverings Res/Textile/S11						
B00A - R0029 - Clerical Office (13.05 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4408/B00B/R0001/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00A - R0030 - Entry Vestibule (22.44 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4408/B00B/R0001/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00A - R0031 - Movement (17.63 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4408/B00A/R0003/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)	
B00A - R0032 - Movement (1.47 m2)						
No Asbestos						
B00A - R0033 - Other - Regional Use (8.11 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 4408/B00B/R0001/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4408/B00B/R0001/Floor Coverings Res/Textile/S3	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0034 - Clerical Office/Workroom (24.47 m2)						
Ceiling Structures/Linings	Vermiculite 4408/B00B/R0001/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00A - R0035 - Sick Bay (14.85 m2)						
Ceiling Structures/Linings	Vermiculite 4408/B00B/R0001/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 4408/B00A/R0035/Floor Coverings Res/Textile/S17					No Asbestos Detected
B00A - R0036 - Movement (129.9 m2)						
No Asbestos						
B00A - R0037 - Movement (7.39 m2)						
Ceiling Structures/Linings	Vermiculite 4408/B00B/R0001/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4408/B00B/R0001/Floor Coverings Res/Textile/S3	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0038 - Movement (17.61 m2)						
Ceiling Structures/Linings	Vermiculite 4408/B00B/R0001/Ceiling Structures/Linings/S4					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4408/B00B/R0001/Floor Coverings Res/Textile/S3	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Support Unit - 1969 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	Vermiculite 4408/B00B/R0001/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Interior**B00B - R0001 - Home Base (67.26 m2)**

Ceiling Structures/Linings	Vermiculite 4408/B00B/R0001/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4408/B00B/R0001/Floor Coverings Res/Textile/S3	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00B - R0002 - Cleaning Distributed Store (0.43 m2)

No Asbestos

B00B - R0003 - Distribution Board (0.66 m2)

Note: No inspection of live electrical installation.

In-fill-panel	Flat AC Sheeting 4408/B00H/R0035/Wall Linings Internal/S14	4m	Door Backing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
---------------	---	----	--------------	--------------------	---------	--

B00B - R0004 - Staff Room Annexe (17.1 m2)

Ceiling Structures/Linings	Vermiculite 4408/B00B/R0001/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4408/B00B/R0001/Floor Coverings Res/Textile/S3	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00B - R0007 - Home Base (67.69 m2)

Ceiling Structures/Linings	Vermiculite 4408/B00G/R0009/Ceiling Structures/Linings/S9					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4408/B00H/R0018/Floor Coverings Res/Textile/S12	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 4408/B00H/R0018/Floor Coverings Res/Textile/S19	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00B - R0008 - Movement (93 m2)

No Asbestos

B00B - R0009 - Home Base (66.8 m2)

Ceiling Structures/Linings	Vermiculite 4408/B00B/R0001/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4408/B00B/R0001/Floor Coverings Res/Textile/S3	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00B - R0010 - General Storeroom (7.48 m2)

No Asbestos

B00B - R0011 - Movement (81.65 m2)

No Asbestos

B00B - R0012 - Home Base (67.23 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	4408/B00G/R0009/Ceiling Structures/Linings/S9			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	4408/B00H/R0018/Floor Coverings Res/Textile/S13			No Asbestos Detected	
B00B - R0013 - Stairs (10.73 m2)						
No Asbestos						
B00B - R1001 - Home Base (67.33 m2)						
Ceiling Structures/Linings	Vermiculite	4408/B00B/R0001/Ceiling Structures/Linings/S4			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1002 - Cleaning Distributed Store (0.43 m2)						
No Asbestos						
B00B - R1004 - Home Base - M (67.26 m2)						
Ceiling Structures/Linings	Vermiculite	4408/B00G/R0009/Ceiling Structures/Linings/S9			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1005 - Home Base - M (67.62 m2)						
Ceiling Structures/Linings	Vermiculite	4408/B00G/R0009/Ceiling Structures/Linings/S9			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1006 - Movement (74.62 m2)						
Ceiling Structures/Linings	Vermiculite	4408/B00G/R0009/Ceiling Structures/Linings/S9			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1007 - Home Base (66.99 m2)						
Ceiling Structures/Linings	Vermiculite	4408/B00G/R0009/Ceiling Structures/Linings/S9			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1008 - Stairs (17.46 m2)						
No Asbestos						
B00B - R1009 - General Storeroom (12.76 m2)						
Ceiling Structures/Linings	Vermiculite	4408/B00G/R0009/Ceiling Structures/Linings/S9			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1010 - Staff Toilet (4.44 m2)						
Ceiling Structures/Linings	Vermiculite	4408/B00G/R0009/Ceiling Structures/Linings/S9			Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1969 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	Vermiculite 4408/B00B/R0001/Ceiling Structures/Linings/S4					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Interior

B00C - R0001 - Movement (223.57 m2)						
No Asbestos						
B00C - R0003 - Kiln Room (14.4 m2)						
No Asbestos						
B00C - R0004 - General Storeroom (11.65 m2)						
No Asbestos						
B00C - R0005 - Toilets - Boys (71.87 m2)						
No Asbestos						
B00C - R0006 - Staff Toilet (1.65 m2)						
No Asbestos						
B00C - R0007 - Cleaning Distributed Store (3.35 m2)						
No Asbestos						
B00C - R0008 - Movement (13.47 m2)						
No Asbestos						
B00C - R0009 - Cleaning Supplies (9.34 m2)						
No Asbestos						
B00C - R0010 - Toilets - Girls (81.54 m2)						
No Asbestos						
B00C - R0011 - Movement (22.17 m2)						
No Asbestos						
B00C - R0012 - General Assistant/Bulk Store (27.2 m2)						
No Asbestos						
B00C - R0013 - Distribution Board (0.68 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B00C - R0014 - Garden Store (7.53 m2)						
No Asbestos						
B00C - R0015 - Movement (57.7 m2)						
No Asbestos						
B00C - R0016 - General Assistant/Bulk Store (115.64 m2)						
No Asbestos						
B00C - R0017 - General Assistant/Bulk Store (13.03 m2)						
No Asbestos						
B00C - R0018 - Stairs (10.76 m2)						
No Asbestos						
B00C - R1001 - Home Base (66.98 m2)						
Ceiling Structures/Linings	Vermiculite 4408/B00G/R0009/Ceiling Structures/Linings/S9					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4408/B00H/R0018/Floor Coverings Res/Textile/S12	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4408/B00H/R0018/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)	
B00C - R1002 - Home Base (67.34 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4408/B00G/R0009/Ceiling Structures/Linings/S9					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4408/B00H/R0018/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4408/B00H/R0018/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)	
B00C - R1003 - Movement (92.53 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4408/B00E/R0008/Ceiling Structures/Linings/S7					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00C - R1004 - Home Base (67.25 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4408/B00G/R0009/Ceiling Structures/Linings/S9					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4408/B00H/R0018/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4408/B00H/R0018/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)	
B00C - R1005 - Home Base (67.08 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
4408/B00G/R0009/Ceiling Structures/Linings/S9					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4408/B00H/R0018/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4408/B00H/R0018/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)	
B00C - R1006 - Stairs (17.53 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1969 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00D - R0001 - Home Base (67.15 m2)**

Ceiling Structures/Linings	Vermiculite 4408/B00E/R0008/Ceiling Structures/Linings/S7					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 4408/B00H/R0018/Floor Coverings Res/Textile/S12	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 4408/B00H/R0018/Floor Coverings Res/Textile/S19	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00D - R0002 - Movement (34.84 m2)

No Asbestos

B00D - R0003 - Home Base (67.33 m2)

Ceiling Structures/Linings	Vermiculite 4408/B00E/R0008/Ceiling Structures/Linings/S7					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4408/B00H/R0018/Floor Coverings Res/Textile/S12	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 4408/B00H/R0018/Floor Coverings Res/Textile/S19	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00D - R0004 - Home Base (67.33 m2)

Ceiling Structures/Linings	Vermiculite 4408/B00E/R0008/Ceiling Structures/Linings/S7					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4408/B00H/R0018/Floor Coverings Res/Textile/S12	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 4408/B00H/R0018/Floor Coverings Res/Textile/S19	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00D - R0005 - Cleaning Distributed Store (0.43 m2)

No Asbestos

B00D - R0006 - Distribution Board (0.75 m2)

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting 4408/B00H/R0035/Wall Linings Internal/S14	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------	---	-----	------------	--------------------	---------	--

B00D - R0007 - General Storeroom (16.74 m2)

Ceiling Structures/Linings	Vermiculite 4408/B00E/R0008/Ceiling Structures/Linings/S7					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4408/B00H/R0018/Floor Coverings Res/Textile/S12	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 4408/B00H/R0018/Floor Coverings Res/Textile/S19	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00D - R0008 - Home Base (67.41 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 4408/B00E/R0008/Ceiling Structures/Linings/S7				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 4408/B00H/R0018/Floor Coverings Res/Textile/S12	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Floor Coverings Res/Textile	Adhesive 4408/B00H/R0018/Floor Coverings Res/Textile/S19	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
B00D - R0009 - Movement (65.3 m2)						
No Asbestos						
B00D - R1001 - Home Base (67.33 m2)						
Ceiling Structures/Linings	Vermiculite 4408/B00E/R0008/Ceiling Structures/Linings/S7				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4408/B00H/R0018/Floor Coverings Res/Textile/S12	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Floor Coverings Res/Textile	Adhesive 4408/B00H/R0018/Floor Coverings Res/Textile/S19	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
B00D - R1002 - Movement (34.84 m2)						
Ceiling Structures/Linings	Vermiculite 4408/B00E/R0008/Ceiling Structures/Linings/S7				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
B00D - R1003 - Home Base (67.33 m2)						
Ceiling Structures/Linings	Vermiculite 4408/B00E/R0008/Ceiling Structures/Linings/S7				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4408/B00H/R0018/Floor Coverings Res/Textile/S12	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Floor Coverings Res/Textile	Adhesive 4408/B00H/R0018/Floor Coverings Res/Textile/S19	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
B00D - R1004 - Home Base (67.33 m2)						
Ceiling Structures/Linings	Vermiculite 4408/B00E/R0008/Ceiling Structures/Linings/S7				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4408/B00H/R0018/Floor Coverings Res/Textile/S12	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Floor Coverings Res/Textile	Adhesive 4408/B00H/R0018/Floor Coverings Res/Textile/S19	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
B00D - R1005 - Cleaning Distributed Store (0.45 m2)						
No Asbestos						
B00D - R1006 - General Storeroom (17.83 m2)						
Ceiling Structures/Linings	Vermiculite 4408/B00E/R0008/Ceiling Structures/Linings/S7				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
B00D - R1007 - Home Base (67.33 m2)						
Ceiling Structures/Linings	Vermiculite 4408/B00E/R0008/Ceiling Structures/Linings/S7				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4408/B00H/R0018/Floor Coverings Res/Textile/S12	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 4408/B00H/R0018/Floor Coverings Res/Textile/S19	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1969 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00E - R0001 - Home Base (67.33 m2)

Ceiling Structures/Linings	Vermiculite					
	4408/B00E/R0008/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00E - R0002 - Movement (43.09 m2)

No Asbestos

B00E - R0003 - Cleaning Distributed Store (4.28 m2)

No Asbestos

B00E - R0004 - Toilets - Boys (54.42 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4408/B00E/R0004/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos)

B00E - R0005 - Movement (27.31 m2)

No Asbestos

B00E - R0006 - Toilets - Girls (49.87 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4408/B00E/R0004/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos)

B00E - R0007 - Sports Store (19.64 m2)

No Asbestos

B00E - R0008 - Home Base (67.33 m2)

Ceiling Structures/Linings	Vermiculite					
	4408/B00E/R0008/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00E - R0009 - Distribution Board (0.44 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00E - R0010 - Movement (43.24 m2)

No Asbestos

B00E - R0011 - Movement (7.26 m2)

No Asbestos

B00E - R0012 - Stairs (5.47 m2)

No Asbestos

B00E - R1001 - Home Base (67.33 m2)

Ceiling Structures/Linings	Vermiculite					
	4408/B00E/R0008/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00E - R1002 - Movement (42.55 m2)

Ceiling Structures/Linings	Vermiculite					
	4408/B00E/R0008/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00E - R1003 - Home Base (67.33 m2)

Ceiling Structures/Linings	Vermiculite					
	4408/B00E/R0008/Ceiling Structures/Linings/S7					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00E - R1004 - Home Base (67.33 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings Vermiculite
 4408/B00E/R0008/Ceiling Structures/Linings/S7 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R1005 - Home Base (67.33 m2)

Ceiling Structures/Linings Vermiculite
 4408/B00E/R0008/Ceiling Structures/Linings/S7 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00E - R1006 - Distribution Board (0.44 m2) Note: No inspection of live electrical installation.

No Asbestos

B00E - R1007 - Stairs (9.72 m2)

Ceiling Structures/Linings Vermiculite
 4408/B00E/R0008/Ceiling Structures/Linings/S7 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00F - General Learning - 1969 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	Vermiculite 4408/B00E/R0008/Ceiling Structures/Linings/S7					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Interior**B00F - R0001 - Movement (95.21 m2)**

No Asbestos

B00F - R0002 - Personal Effects Storage (21.27 m2)

Ceiling Structures/Linings	Vermiculite 4408/B00E/R0008/Ceiling Structures/Linings/S7					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

B00F - R0003 - Home Base (95.46 m2)

Ceiling Structures/Linings	Vermiculite 4408/B00E/R0008/Ceiling Structures/Linings/S7					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

B00F - R0004 - Toilets - Boys/Girls (4.02 m2)

Ceiling Structures/Linings	Vermiculite 4408/B00E/R0008/Ceiling Structures/Linings/S7					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

B00F - R0005 - Toilets - Boys (13.02 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 4408/B00F/R0005/Partition Walls (Cubicles)/S15	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
Ceiling Structures/Linings	Vermiculite 4408/B00E/R0008/Ceiling Structures/Linings/S7					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

B00F - R0006 - Toilets - Girls (12.32 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 4408/B00F/R0005/Partition Walls (Cubicles)/S15	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
Ceiling Structures/Linings	Vermiculite 4408/B00E/R0008/Ceiling Structures/Linings/S7					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

B00F - R0007 - Toilets - Boys/Girls (3.54 m2)

Ceiling Structures/Linings	Vermiculite 4408/B00E/R0008/Ceiling Structures/Linings/S7					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

B00F - R0008 - Personal Effects Storage (7.22 m2)

Ceiling Structures/Linings	Vermiculite 4408/B00E/R0008/Ceiling Structures/Linings/S7					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

B00F - R0009 - Home Base (81.39 m2)

Ceiling Structures/Linings	Vermiculite 4408/B00E/R0008/Ceiling Structures/Linings/S7					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

B00F - R0010 - Home Base Store (5.42 m2)

Ceiling Structures/Linings	Vermiculite 4408/B00E/R0008/Ceiling Structures/Linings/S7					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

B00F - R0011 - Home Base (81.17 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	4408/B00E/R0008/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R0012 - Home Base Store (5.42 m2)						
Ceiling Structures/Linings	Vermiculite	4408/B00E/R0008/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R0013 - Home Base Store (5.42 m2)						
Ceiling Structures/Linings	Vermiculite	4408/B00E/R0008/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R0014 - Toilets - Girls (4.24 m2)						
Ceiling Structures/Linings	Vermiculite	4408/B00E/R0008/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R0015 - Movement (40.63 m2)						
No Asbestos						
B00F - R0016 - Stairs (10.8 m2)						
No Asbestos						
B00F - R1001 - Home Base (67.33 m2)						
Ceiling Structures/Linings	Vermiculite	4408/B00E/R0008/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1002 - Movement (74.72 m2)						
Ceiling Structures/Linings	Vermiculite	4408/B00E/R0008/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1003 - Home Base (67.33 m2)						
Ceiling Structures/Linings	Vermiculite	4408/B00E/R0008/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1004 - Home Base (67.33 m2)						
Ceiling Structures/Linings	Vermiculite	4408/B00E/R0008/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1005 - Distribution Board (0.45 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B00F - R1006 - Staff Room Annexe (17.83 m2)						
Ceiling Structures/Linings	Vermiculite	4408/B00E/R0008/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1007 - Home Base (67.33 m2)						
Ceiling Structures/Linings	Vermiculite	4408/B00E/R0008/Ceiling Structures/Linings/S7				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1008 - Stairs (16.62 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Library - 1969 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior**B00G - R0001 - Library Office/Workroom (22.06 m2)**

Ceiling Structures/Linings	Vermiculite 4408/B00G/R0009/Ceiling Structures/Linings/S9	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00G - R0002 - K.L.A. Store (10.56 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4408/B00G/R0002/Floor Coverings Res/Textile/S16	No Asbestos Detected
-----------------------------	--	----------------------

B00G - R0003 - Distribution Board (0.6 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Vermiculite 4408/B00G/R0009/Ceiling Structures/Linings/S9	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00G - R0004 - Personal Effects Storage (9.12 m2)

Ceiling Structures/Linings	Vermiculite 4408/B00G/R0009/Ceiling Structures/Linings/S9	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00G - R0005 - Reading Area (238.03 m2)

Ceiling Structures/Linings	Vermiculite 4408/B00G/R0009/Ceiling Structures/Linings/S9	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00G - R0006 - Seminar/Study (29.55 m2)

Ceiling Structures/Linings	Vermiculite 4408/B00G/R0009/Ceiling Structures/Linings/S9	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00G - R0007 - Staff Toilet (2.9 m2)

Ceiling Structures/Linings	Vermiculite 4408/B00G/R0009/Ceiling Structures/Linings/S9	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00G - R0008 - K.L.A. Store (16.21 m2)

Ceiling Structures/Linings	Vermiculite 4408/B00G/R0009/Ceiling Structures/Linings/S9	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00G - R0009 - K.L.A. Store (20.77 m2)

Ceiling Structures/Linings	Vermiculite 4408/B00G/R0009/Ceiling Structures/Linings/S9	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00G - R0012 - Movement (93.85 m2)

No Asbestos

B00G - R0013 - K.L.A. Store (28.17 m2)

Ceiling Structures/Linings	Vermiculite 4408/B00G/R0009/Ceiling Structures/Linings/S9	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Pre-School Facilities/Other-D.E.C. Admin - 1969 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	Vermiculite 4408/B00H/R0003/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Interior**B00H - R0001 - Out Of School Hours Care Centre (7.56 m2)**

Ceiling Structures/Linings	Vermiculite 4408/B00H/R0003/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

Floor Coverings Res/Textile	Vinyl Tiles 4408/B00H/R0001/Floor Coverings Res/Textile/S11					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

B00H - R0003 - Out Of School Hours Care Centre (7.56 m2)

Ceiling Structures/Linings	Vermiculite 4408/B00H/R0003/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

B00H - R0014 - Other - Regional Use (65.7 m2)

Ceiling Structures/Linings	Vermiculite 4408/B00H/R0003/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4408/B00H/R0018/Floor Coverings Res/Textile/S12	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	------	------------	--------------------	---------	--

Floor Coverings Res/Textile	Adhesive 4408/B00H/R0018/Floor Coverings Res/Textile/S19	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	------	------------	--------------------	---------	--

B00H - R0016 - Other - Regional Use (4.95 m2)

Ceiling Structures/Linings	Vermiculite 4408/B00H/R0003/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

Floor Coverings Res/Textile	Vinyl Tiles 4408/B00H/R0018/Floor Coverings Res/Textile/S12	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	-----	------------	--------------------	---------	--

Floor Coverings Res/Textile	Adhesive 4408/B00H/R0018/Floor Coverings Res/Textile/S19	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	-----	------------	--------------------	---------	--

B00H - R0018 - Community Clinic (34.83 m2)

Ceiling Structures/Linings	Vermiculite 4408/B00H/R0003/Ceiling Structures/Linings/S10					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

Floor Coverings Res/Textile	Vinyl Tiles 4408/B00H/R0018/Floor Coverings Res/Textile/S12	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	------	------------	--------------------	---------	--

Floor Coverings Res/Textile	Vinyl Tiles 4408/B00H/R0018/Floor Coverings Res/Textile/S13					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

Floor Coverings Res/Textile	Adhesive 4408/B00H/R0018/Floor Coverings Res/Textile/S19	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	------	------------	--------------------	---------	--

B00H - R0019 - Community Clinic (27.26 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	4408/B00H/R0003/Ceiling Structures/Linings/S10					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00H - R0020 - Clerical Office - Pre (8.6 m2)						
No Asbestos						
B00H - R0021 - Entry Vestibule (9.19 m2)						
No Asbestos						
B00H - R0022 - Staff Room - Pre (13.61 m2)						
No Asbestos						
B00H - R0023 - General Storeroom - Pre (9.97 m2)						
No Asbestos						
B00H - R0024 - Home Base - Pre (53.66 m2)						
No Asbestos						
B00H - R0025 - Practical Activities - Pre (45.51 m2)						
No Asbestos						
B00H - R0026 - Toilets - Boys/Girls - Pre (17.36 m2)						
No Asbestos						
B00H - R0027 - Laundry - Pre (4.49 m2)						
No Asbestos						
B00H - R0028 - Cleaning Distributed Store (3.1 m2)						
No Asbestos						
B00H - R0029 - Access Shower/Toilet - Type 2 (11.72 m2)						
No Asbestos						
B00H - R0030 - General Storeroom - Pre (12.03 m2)						
No Asbestos						
B00H - R0031 - Kitchen - Pre (10.99 m2)						
No Asbestos						
B00H - R0032 - Personal Effects - Pre (8.31 m2)						
No Asbestos						
B00H - R0033 - Security Store (7.88 m2)						
No Asbestos						
B00H - R0034 - Staff Kitchen (6.88 m2)						
Ceiling Structures/Linings	Vermiculite					
	4408/B00H/R0003/Ceiling Structures/Linings/S10					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4408/B00H/R0018/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4408/B00H/R0018/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)
B00H - R0035 - Distribution Board (0.64 m2)						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4408/B00H/R0035/Wall Linings Internal/S14					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4408/B00H/R0035/Wall Linings Internal/S14					Chrysotile (white asbestos)
B00H - R0036 - Movement (66.08 m2)						
No Asbestos						
B00H - R0037 - Movement (2.87 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00H - R0038 - Movement (9.67 m2)

No Asbestos

B00H - R0039 - Movement (23.48 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Communal Facilities - 1969 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00I - R0005 - Communal Space (317.48 m2)

No Asbestos

B00I - R0006 - Raised Platform (33.91 m2)

No Asbestos

B00I - R0007 - Hall Chair Store (32.26 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Building Services - 1976 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00J - R0001 - Cleaning Supplies (14.29 m2)

No Asbestos

B00J - R0002 - General Assistant/Bulk Store (14.61 m2)

No Asbestos

B00J - R0003 - General Storeroom (17.02 m2)

No Asbestos

B00J - R0004 - Movement (6.54 m2)

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------

Assumed Asbestos - Height Restriction - Approx. 5m

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Building Services - 2004 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Flat Roof No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior

B00K - R0001 - General Assistant/Bulk Store (7.71 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

4408_ASB_030113_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017