


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Leonay Public School (4475)  
**Region :** Western Sydney  
**State Electorate :** Penrith  
**Local Government Area :** Penrith

**Initial Survey :** Noel Arnold & Associates : 13 - May - 2008  
**Reviewed By :** Grencap-NAA : 10 - Jun - 2015

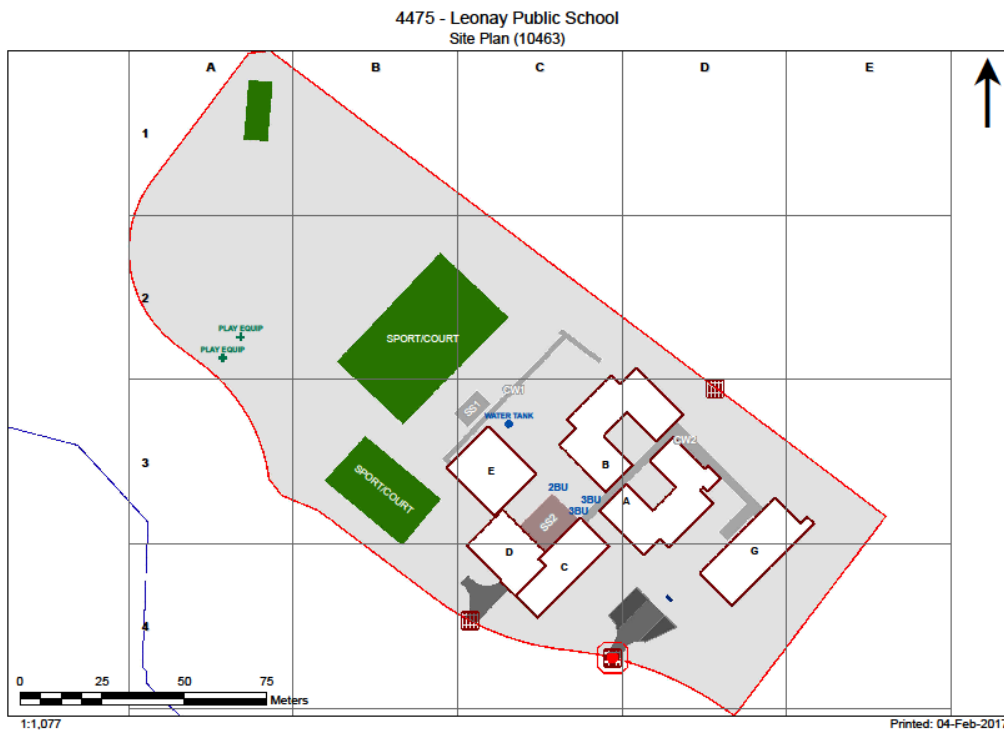

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00A - General Learning/Pupil Facilities - 1974 - Brick/Block (Brick/Block)****Exterior**

Gable Verge Lining	Flat AC Sheeting	4m2	North, South, East, West, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00A/Gable Verge Lining/S13				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids	No Asbestos Found					

**Interior****B00A - R0001 - Toilets - Boys (13.13 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00A/R0010/Ceiling Structures/Linings/S7				<b>Chrysotile (white asbestos)</b>	

**B00A - R0002 - Cleaning Distributed Store (1.83 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00A/R0010/Ceiling Structures/Linings/S7				<b>Chrysotile (white asbestos)</b>	

**B00A - R0003 - Toilets - Girls (15.44 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00A/R0010/Ceiling Structures/Linings/S7				<b>Chrysotile (white asbestos)</b>	

**B00A - R0004 - Practical Activities - 1hb (20.02 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4475/B00A/R0017/Ceiling Structures/Linings/S5				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
Floor Coverings Res/Textile	Vinyl Tiles	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00A/R0017/Floor Coverings Res/Textile/S6				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Adhesive	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00B/R0011/Floor Coverings Res/Textile/S10				<b>Chrysotile (white asbestos)</b>	

**B00A - R0005 - Home Base (54.22 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4475/B00A/R0017/Ceiling Structures/Linings/S5				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00A/R0017/Floor Coverings Res/Textile/S6				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Adhesive	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00B/R0011/Floor Coverings Res/Textile/S10				<b>Chrysotile (white asbestos)</b>	

**B00A - R0006 - Home Base (54.13 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4475/B00A/R0017/Ceiling Structures/Linings/S5				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>	
Floor Coverings Res/Textile	Adhesive	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00B/R0011/Floor Coverings Res/Textile/S10				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00A/R0017/Floor Coverings Res/Textile/S6				<b>Chrysotile (white asbestos)</b>	

**B00A - R0007 - Practical Activities - 1hb (20.02 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 4475/B00A/R0017/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 4475/B00A/R0017/Floor Coverings Res/Textile/S6	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive 4475/B00B/R0011/Floor Coverings Res/Textile/S10	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0008 - Toilets - Girls (15.5 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 4475/B00A/R0010/Ceiling Structures/Linings/S7	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0009 - Distribution Board (1.78 m2)</b> <span style="float: right;">Note: No inspection of live electrical installation.</span>						
Ceiling Structures/Linings	Flat AC Sheeting 4475/B00A/R0010/Ceiling Structures/Linings/S7	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Electrical Backing Board	Resinous Board <b>Assumed Asbestos - Electrical Hazard</b>	1m2	East, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>B00A - R0010 - Toilets - Boys (13.06 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 4475/B00A/R0010/Ceiling Structures/Linings/S7	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0011 - General Storeroom (2.17 m2)</b>						
No Asbestos						
<b>B00A - R0014 - External Movement (16.43 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 4475/B00A/R0010/Ceiling Structures/Linings/S7	12m2	West	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0016 - Home Base (60.97 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4475/B00A/R0017/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Adhesive 4475/B00B/R0011/Floor Coverings Res/Textile/S10	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4475/B00A/R0017/Floor Coverings Res/Textile/S6	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0017 - General Storeroom (10.43 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4475/B00A/R0017/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 4475/B00A/R0017/Floor Coverings Res/Textile/S6	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive 4475/B00B/R0011/Floor Coverings Res/Textile/S10	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0018 - Practical Activities - 1hb (13.51 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4475/B00A/R0017/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00A/R0017/Floor Coverings Res/Textile/S6					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00B/R0011/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>
<b>B00A - R0019 - Practical Activities - 1hb (13.29 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4475/B00A/R0017/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00A/R0017/Floor Coverings Res/Textile/S6					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00B/R0011/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>
<b>B00A - R0020 - Home Base (61 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4475/B00A/R0017/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00A/R0017/Floor Coverings Res/Textile/S6					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00B/R0011/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>
<b>B00A - R0021 - General Storeroom (10.13 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4475/B00A/R0017/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00A - R0024 - General Storeroom (12.81 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00A/R0010/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos)</b>
<b>B00A - R0025 - External Movement (24.83 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00A/R0010/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos)</b>
<b>B00A - R0026 - Movement (69.31 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	70m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00A/R0010/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00B - General Learning/Pupil Facilities - 1974 - Brick/Block (Brick/Block)****Exterior**

Gable Verge Lining	Flat AC Sheeting	4m2	North, South, East, West, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00B/Gable Verge Lining/S11			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

**Interior****B00B - R0001 - External Movement (42.16 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00B/R0014/Ceiling Structures/Linings/S12			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00B - R0002 - Practical Activities - 1hb (21.45 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4475/B00A/R0017/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00B/R0011/Floor Coverings Res/Textile/S9					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00B/R0011/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>

**B00B - R0003 - Home Base (73.73 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4475/B00A/R0017/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	74m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00B/R0011/Floor Coverings Res/Textile/S9					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive	74m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00B/R0011/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>

**B00B - R0004 - Practical Activities - 1hb (21.35 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4475/B00A/R0017/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00B/R0011/Floor Coverings Res/Textile/S9					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00B/R0011/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>

**B00B - R0005 - Home Base (73.63 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	4475/B00A/R0017/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	74m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00B/R0011/Floor Coverings Res/Textile/S9					<b>Chrysotile (white asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Adhesive	74m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4475/B00B/R0011/Floor Coverings Res/Textile/S10				<b>Chrysotile (white asbestos)</b>		
<b>B00B - R0007 - Cleaning Distributed Store (1.81 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4475/B00B/R0014/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00B - R0009 - Practical Activities - 1hb (19.48 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
4475/B00A/R0017/Ceiling Structures/Linings/S5				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4475/B00B/R0011/Floor Coverings Res/Textile/S9				<b>Chrysotile (white asbestos)</b>		
Floor Coverings Res/Textile	Adhesive	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4475/B00B/R0011/Floor Coverings Res/Textile/S10				<b>Chrysotile (white asbestos)</b>		
<b>B00B - R0010 - Home Base (54.32 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
4475/B00A/R0017/Ceiling Structures/Linings/S5				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
Floor Coverings Res/Textile	Vinyl Tiles	1m2	South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
4475/B00B/R0011/Floor Coverings Res/Textile/S9				<b>Chrysotile (white asbestos)</b>		
Floor Coverings Res/Textile	Adhesive	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4475/B00B/R0011/Floor Coverings Res/Textile/S10				<b>Chrysotile (white asbestos)</b>		
<b>B00B - R0011 - Home Base (54.32 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
4475/B00A/R0017/Ceiling Structures/Linings/S5				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4475/B00B/R0011/Floor Coverings Res/Textile/S9				<b>Chrysotile (white asbestos)</b>		
Floor Coverings Res/Textile	Adhesive	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4475/B00B/R0011/Floor Coverings Res/Textile/S10				<b>Chrysotile (white asbestos)</b>		
<b>B00B - R0012 - Practical Activities - 1hb (19.59 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
4475/B00A/R0017/Ceiling Structures/Linings/S5				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4475/B00B/R0011/Floor Coverings Res/Textile/S9				<b>Chrysotile (white asbestos)</b>		
Floor Coverings Res/Textile	Adhesive	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4475/B00B/R0011/Floor Coverings Res/Textile/S10				<b>Chrysotile (white asbestos)</b>		
<b>B00B - R0013 - External Movement (27.01 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4475/B00B/R0014/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00B - R0014 - External Movement (27.04 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
4475/B00B/R0014/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
<b>B00B - R0016 - Distribution Board (1.8 m2)</b>				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4475/B00B/R0014/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Electrical Backing Board	Resinous Board	1m2	South, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Electrical Hazard</b>						
<b>B00B - R0018 - Movement (85.18 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	86m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4475/B00B/R0014/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00B - R0019 - External Movement (17.43 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4475/B00B/R0014/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00B - R0020 - Movement (2.03 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4475/B00B/R0014/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00B - R0021 - Toilets - Boys (26.28 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4475/B00B/R0014/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00B - R0022 - General Storeroom (3.43 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4475/B00B/R0014/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00B - R0023 - Movement (2.03 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4475/B00B/R0014/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00B - R0024 - Toilets - Girls (26.02 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4475/B00B/R0014/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00B - R0025 - General Storeroom (2.86 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4475/B00B/R0014/Ceiling Structures/Linings/S12				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Administration/Pupil Facilities - 1974 - Brick/Block (Brick/Block)**

**Exterior**

Gable Verge Lining	Flat AC Sheeting	2m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00C/Gable Verge Lining/S14				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

**Interior**

**B00C - R0001 - Staff Room (44.51 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00C/R0014/Floor Coverings Res/Textile/S1				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Adhesive	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00C/R0015/Floor Coverings Res/Textile/S15				<b>Chrysotile (white asbestos)</b>	

**B00C - R0002 - Staff Toilet (4.82 m2)**

No Asbestos

**B00C - R0003 - Deputy Principal (13.43 m2)**

Floor Coverings Res/Textile	Adhesive	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00C/R0015/Floor Coverings Res/Textile/S15				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00C/R0014/Floor Coverings Res/Textile/S1				<b>Chrysotile (white asbestos)</b>	

**B00C - R0004 - Deputy Principal (13.21 m2)**

Floor Coverings Res/Textile	Adhesive	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00C/R0015/Floor Coverings Res/Textile/S15				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00C/R0014/Floor Coverings Res/Textile/S1				<b>Chrysotile (white asbestos)</b>	

**B00C - R0005 - Movement (4.15 m2)**

No Asbestos

**B00C - R0006 - Entry Vestibule (19.13 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00C/R0014/Floor Coverings Res/Textile/S1				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Adhesive	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00C/R0015/Floor Coverings Res/Textile/S15				<b>Chrysotile (white asbestos)</b>	

**B00C - R0007 - Clerical Office (11.92 m2)**

Floor Coverings Res/Textile	Adhesive	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00C/R0015/Floor Coverings Res/Textile/S15				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00C/R0014/Floor Coverings Res/Textile/S1				<b>Chrysotile (white asbestos)</b>	

**B00C - R0008 - Principal (23.56 m2)**

Floor Coverings Res/Textile	Adhesive	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00C/R0015/Floor Coverings Res/Textile/S15				<b>Chrysotile (white asbestos)</b>	



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4475/B00C/R0014/Floor Coverings Res/Textile/S1	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R0009 - Cleaning Supplies (7.08 m2)</b>						
Floor Coverings Res/Textile	Adhesive 4475/B00C/R0015/Floor Coverings Res/Textile/S15	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Vinyl Tiles 4475/B00C/R0014/Floor Coverings Res/Textile/S1	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R0010 - General Assistant/Bulk Store (5.33 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 4475/B00C/R0010/Ceiling Structures/Linings/S17	6m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00C - R0011 - Main Switch Board (4.42 m2)</b>						
Electrical Backing Board	Resinous Board <b>Assumed Asbestos - Electrical Hazard</b>	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Ceiling Structures/Linings	Flat AC Sheeting 4475/B00C/R0010/Ceiling Structures/Linings/S17	5m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting 4475/B00B/R0011/Floor Coverings Res/Textile/S10	5m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R0012 - Staff Toilet (2.38 m2)</b>						
No Asbestos						
<b>B00C - R0013 - Canteen Office/Store (2.34 m2)</b>						
No Asbestos						
<b>B00C - R0014 - Canteen Office/Store (2.96 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4475/B00C/R0014/Floor Coverings Res/Textile/S1	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive 4475/B00C/R0015/Floor Coverings Res/Textile/S15	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R0015 - Canteen (23.3 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4475/B00C/R0015/Floor Coverings Res/Textile/S2					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive 4475/B00C/R0015/Floor Coverings Res/Textile/S15	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Vinyl Tiles 4475/B00C/R0014/Floor Coverings Res/Textile/S1	13m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00C - R0016 - Security Store (15.54 m2)</b>						
No Asbestos						
<b>B00C - R0017 - Cleaning Distributed Store (0.89 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 4475/B00C/R0010/Ceiling Structures/Linings/S17	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00C - R0018 - Movement (5.62 m2)</b>						
No Asbestos						
<b>B00C - R0019 - Duplicating Workroom (13.25 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4475/B00C/R0014/Floor Coverings Res/Textile/S1	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive 4475/B00C/R0015/Floor Coverings Res/Textile/S15	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos)</b>
<b>B00C - R0020 - Sick Bay (16.03 m2)</b>						
No Asbestos						
<b>B00C - R0021 - Staff Toilet (4.82 m2)</b>						
No Asbestos						
<b>B00C - R0022 - Movement (14.69 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4475/B00C/R0014/Floor Coverings Res/Textile/S1	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive 4475/B00C/R0015/Floor Coverings Res/Textile/S15	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos)</b>
<b>B00C - R0023 - External Movement (45.56 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Communal Facilities - 1974 - Brick/Block (Brick/Block)**

**Exterior**

Gable Verge Lining	Flat AC Sheeting	2m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00D/Eaves Linings/S18			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Eaves Linings	Flat AC Sheeting	6m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00D/Eaves Linings/S18			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

**Interior**

**B00D - R0001 - Movement (40.95 m2)**

No Asbestos

**B00D - R0002 - General Assistant/Bulk Store (11.06 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00D/Eaves Linings/S18			Chrysotile (white asbestos) , Amosite (brown asbestos)		

**B00D - R0003 - Communal Space (139.55 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	North, Upper portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00D/Eaves Linings/S18			Chrysotile (white asbestos) , Amosite (brown asbestos)		

**B00D - R0004 - Raised Platform (28.56 m2)**

No Asbestos

**B00D - R0005 - Movement (2.44 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00D/Eaves Linings/S18			Chrysotile (white asbestos) , Amosite (brown asbestos)		

**B00D - R0006 - Movement (2.44 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00D/Eaves Linings/S18			Chrysotile (white asbestos) , Amosite (brown asbestos)		

**B00D - R0007 - External Movement (48.12 m2)**

No Asbestos

**B00D - R0008 - Security Store (10.02 m2)**

No Asbestos

**B00D - R0009 - General Storeroom (10.84 m2)**

No Asbestos

**B00D - R0010 - Movement (1.37 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Library/Pupil Facilities - 1974 - Brick/Block (Brick/Block)**

**Exterior**

Gable Verge Lining	Flat AC Sheeting	2m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00E/Gable Verge Lining/S19				<b>Chrysotile (white asbestos)</b>	
Eaves Linings	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00E/Gable Verge Lining/S19				<b>Chrysotile (white asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

**Interior**

**B00E - R0001 - Seminar/Study (11 m2)**

No Asbestos

**B00E - R0002 - K.L.A. Store (10.9 m2)**

No Asbestos

**B00E - R0003 - Communications Room (13.4 m2)**

No Asbestos

**B00E - R0004 - Library Office/Workroom (8.15 m2)**

No Asbestos

**B00E - R0005 - Library Office/Workroom (16.63 m2)**

No Asbestos

**B00E - R0006 - Toilets - Boys (7.98 m2)**

No Asbestos

**B00E - R0007 - Toilets - Girls (7.74 m2)**

No Asbestos

**B00E - R0008 - Staff Toilet (3.52 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00E/R0009/Partition Walls (Cubicles)/S4				<b>Chrysotile (white asbestos)</b>	

**B00E - R0009 - Staff Toilet (3.58 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00E/R0009/Partition Walls (Cubicles)/S4				<b>Chrysotile (white asbestos)</b>	

**B00E - R0010 - Distribution Board (1.12 m2)**

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Membrane	2Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Electrical Hazard</b>					
Door Lining	Flat AC Sheeting	5m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00E/R0010/Wall Linings Internal/S3				<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4475/B00E/R0010/Wall Linings Internal/S3				<b>Chrysotile (white asbestos)</b>	

**B00E - R0011 - Cleaning Distributed Store (0.96 m2)**

No Asbestos

**B00E - R0012 - Movement (12.15 m2)**

No Asbestos

**B00E - R0013 - Reading Area (177.51 m2)**

No Asbestos

**B00E - R0014 - Movement (2.25 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00E - R0015 - External Movement (52.81 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00G - General Learning - 2010 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

**Interior****B00G - R0001 - External Movement (104.05 m2)**

No Asbestos

**B00G - R0002 - Special Programs Store (6.35 m2)**

No Asbestos

**B00G - R0003 - Special Programs Room (32.74 m2)**

No Asbestos

**B00G - R0004 - Practical Activities - 1hb (18.33 m2)**

No Asbestos

**B00G - R0005 - Home Base Store (6.22 m2)**

No Asbestos

**B00G - R0006 - Home Base (59.27 m2)**

No Asbestos

**B00G - R0007 - Withdrawal Space - 2hb (11.16 m2)**

No Asbestos

**B00G - R0008 - Home Base (59.21 m2)**

No Asbestos

**B00G - R0009 - Home Base Store (6.23 m2)**

No Asbestos

**B00G - R0010 - Practical Activities - 1hb (18.39 m2)**

No Asbestos

**B00G - R0011 - Home Base Store (5.73 m2)**

No Asbestos

**B00G - R0012 - Withdrawal Space - 1hb (8.65 m2)**

No Asbestos

**B00G - R0013 - Home Base (58.44 m2)**

No Asbestos

**B00G - R0014 - Practical Activities - 1hb (18.3 m2)**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Listing of Electronic Attachments as of 22/03/2017***

**There are no asbestos related file attachment(s) for this school.**

2017