


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Lithgow High School (8125)
Region : Western NSW
State Electorate : Bathurst
Local Government Area : Lithgow

Initial Survey : Noel Arnold & Associates : 30 - May - 2008
Reviewed By : Greencap-NAA : 17 - Apr - 2015

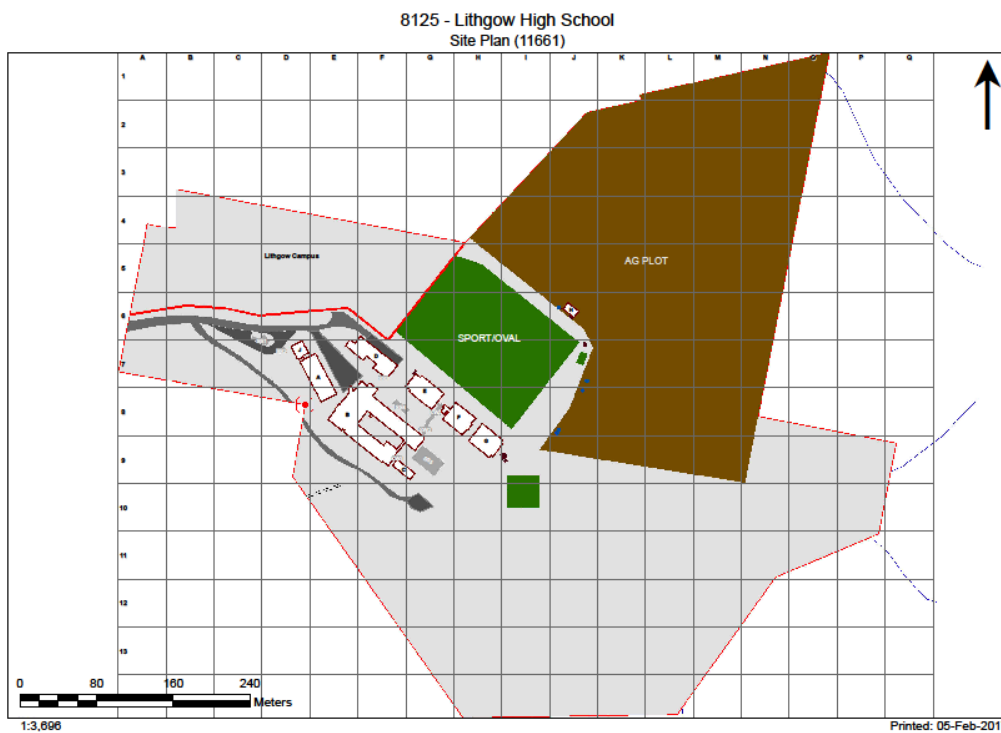

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Technological & Applied Studies - 1959 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 8125/B00B/R1045/Ceiling Structures/Linings/S5					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00A - R0001 - L.P.G. Store (1.13 m2)**

No Asbestos

B00A - R0002 - Materials Store (35.06 m2)

No Asbestos

B00A - R0003 - Materials Store (17.3 m2)

No Asbestos

B00A - R0004 - Materials Technology L.S. (74.46 m2)

No Asbestos

B00A - R0005 - Metal Technology Bay (23.93 m2)

No Asbestos

B00A - R0006 - Welding Area (12.2 m2)

Partition Walls (Cubicles)	Flat AC Sheeting 8125/B00A/R0006/Partition Walls (Cubicles)/S6					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00A - R0007 - Materials Technology L.S. (74.45 m2)

No Asbestos

B00A - R0008 - Design L.S. (35.04 m2)

No Asbestos

B00A - R0009 - General Storeroom (0.35 m2)

No Asbestos

B00A - R0010 - Design L.S. (55.48 m2)

No Asbestos

B00A - R0011 - Movement (9.76 m2)

Ceiling Structures/Linings	Vermiculite 8125/B00A/R0011/Ceiling Structures/Linings/S7					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R0012 - Movement (4.81 m2)

No Asbestos

B00A - R0013 - Staff - Toilet (4.77 m2)

No Asbestos

B00A - R0014 - Staff Study (34.83 m2)

No Asbestos

B00A - R0015 - Distribution Board Cupboard (1.71 m2)

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	2Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-------	------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard**B00A - R0016 - Secure Storeroom (8.37 m2)**

No Asbestos

B00A - R0017 - Resource/Project Store (55.48 m2)

No Asbestos

B00A - R0018 - Cleaning Store - Distributed (3.09 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8125/B00A/R0011/Ceiling Structures/Linings/S7					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0019 - Resource/Project Store (13.87 m2)						
No Asbestos						
B00A - R0020 - Materials Technology L.S. (93.44 m2)						
No Asbestos						
B00A - R0021 - Plant (8.3 m2)						
No Asbestos						
B00A - R0022 - Resource/Project Store (8.49 m2)						
No Asbestos						
B00A - R0023 - Materials Technology L.S. (93.74 m2)						
No Asbestos						
B00A - R0024 - Movement (4.61 m2)						
No Asbestos						
B00A - R0025 - Movement (97.24 m2)						
Ceiling Structures/Linings	Vermiculite		8125/B00A/R0011/Ceiling Structures/Linings/S7			Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Administration - 1962 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	200m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8125/B00B/Eaves Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

Interior**B00B - M1001 - Control Room (14.1 m2)**

No Asbestos

B00B - M1002 - Movement (12.44 m2)

No Asbestos

B00B - M1003 - Control Room (14.4 m2)

No Asbestos

B00B - R0001 - Shower/Change (37.49 m2)

Ceiling Structures/Linings	Vermiculite					
	8125/B00B/R1045/Ceiling Structures/Linings/S5			Limited Samples Taken		
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	38m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8125/B00B/R1059/Floor Coverings Res/Textile/S14			Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Adhesive					
	8125/B00B/R1059/Floor Coverings Res/Textile/S15			No Asbestos Detected		

B00B - R0002 - General Learning Space (52.56 m2)

Ceiling Structures/Linings	Vermiculite					
	8125/B00B/R1045/Ceiling Structures/Linings/S5			Limited Samples Taken		
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8125/B00B/R1059/Floor Coverings Res/Textile/S14			Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Adhesive					
	8125/B00B/R1059/Floor Coverings Res/Textile/S15			No Asbestos Detected		

B00B - R0003 - General Learning Space (52.63 m2)

Ceiling Structures/Linings	Vermiculite					
	8125/B00B/R1045/Ceiling Structures/Linings/S5			Limited Samples Taken		
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8125/B00B/R1059/Floor Coverings Res/Textile/S14			Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Adhesive					
	8125/B00B/R1059/Floor Coverings Res/Textile/S15			No Asbestos Detected		

B00B - R0004 - Distribution Board Cupboard (0.36 m2)

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					
Ceiling Structures/Linings	Flat AC Sheeting	0.5m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	8125/B00B/R1004/Ceiling Structures/Linings/S13			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00B - R0005 - General Learning Space (52.17 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8125/B00B/R1045/Ceiling Structures/Linings/S5					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8125/B00B/R1059/Floor Coverings Res/Textile/S14	52m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8125/B00B/R1059/Floor Coverings Res/Textile/S15					No Asbestos Detected
B00B - R0006 - General Learning Space (52.64 m2)						
Ceiling Structures/Linings	Vermiculite 8125/B00B/R1045/Ceiling Structures/Linings/S5					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8125/B00B/R1059/Floor Coverings Res/Textile/S14	53m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8125/B00B/R1059/Floor Coverings Res/Textile/S15					No Asbestos Detected
B00B - R0007 - General Storeroom (9.55 m2)						
Ceiling Structures/Linings	Vermiculite 8125/B00B/R1045/Ceiling Structures/Linings/S5					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R0008 - Staff Study (42.25 m2)						
Ceiling Structures/Linings	Vermiculite 8125/B00B/R1045/Ceiling Structures/Linings/S5					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R0009 - General Learning Space (52.93 m2)						
Ceiling Structures/Linings	Vermiculite 8125/B00B/R1045/Ceiling Structures/Linings/S5					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R0010 - General Learning Space (53.29 m2)						
Ceiling Structures/Linings	Vermiculite 8125/B00B/R1045/Ceiling Structures/Linings/S5					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R0011 - No Access (10.72 m2)						
No Asbestos						
B00B - R0012 - Movement (177.37 m2)						
Ceiling Structures/Linings	Vermiculite 8125/B00B/R1045/Ceiling Structures/Linings/S5					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R0013 - Movement (4.27 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8125/B00B/R1045/Ceiling Structures/Linings/S5					No Asbestos Detected
B00B - R0014 - Pupil Entry (16.89 m2)						
No Asbestos						
B00B - R0015 - Main Switchroom (8.55 m2)						
Electrical Backing Board	Resinous Board	2Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
B00B - R0017 - Administration - Clerical (54.59 m2)						
No Asbestos						
B00B - R0018 - Interview/Office - Type 1 (19.33 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0019 - Principal Office (13.36 m2)						
No Asbestos						
B00B - R0020 - Interview/Office - Type 1 (12.79 m2)						
No Asbestos						
B00B - R0021 - Public Entry (15.8 m2)						
In-fill-panel	Flat AC Sheeting					No Asbestos Detected
		8125/B00B/R0021/In-fill-panel/S1				
B00B - R0022 - Clinic - Girls (13.85 m2)						
No Asbestos						
B00B - R0023 - Clinic-Toilets (2.4 m2)						
No Asbestos						
B00B - R0024 - Clinic-Toilets (2.2 m2)						
No Asbestos						
B00B - R0025 - Clinic - Boys (14.68 m2)						
No Asbestos						
B00B - R0026 - Duplicating Workroom (42.99 m2)						
No Asbestos						
B00B - R0027 - Cleaning Store - Distributed (3.56 m2)						
No Asbestos						
B00B - R0028 - Toilets-Disabled (12.38 m2)						
No Asbestos						
B00B - R0029 - Movement (44.94 m2)						
No Asbestos						
B00B - R0030 - Plant (51.8 m2)						
No Asbestos						
B00B - R0031 - General Storeroom (13.69 m2)						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
		8125/B00B/R0031/Wall Linings Internal/S2				
B00B - R0032 - General Storeroom (46.25 m2)						
No Asbestos						
B00B - R0033 - Staff Change (4.35 m2)						
No Asbestos						
B00B - R0034 - General Storeroom (4.37 m2)						
No Asbestos						
B00B - R0035 - Student Canteen (73.76 m2)						
No Asbestos						
B00B - R0036 - Movement (125.21 m2)						
No Asbestos						
B00B - R0038 - Toilets-Girls (95.14 m2)						
No Asbestos						
B00B - R0039 - General Assistants (16 m2)						
No Asbestos						
B00B - R0040 - General Storeroom (39.93 m2)						
No Asbestos						
B00B - R0043 - Movement (2.14 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
		8125/B00B/R1045/Ceiling Structures/Linings/S5				
B00B - R0044 - Cleaning Store - Distributed (3.84 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0045 - Movement (2.18 m2)						
No Asbestos						
B00B - R0047 - Art Learning Space (72.71 m2)						
Ceiling Structures/Linings	Vermiculite					
	8125/B00B/R1045/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0048 - Staff Study (24.68 m2)						
Ceiling Structures/Linings	Vermiculite					
	8125/B00B/R1045/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0049 - Art Learning Space (61.24 m2)						
Ceiling Structures/Linings	Vermiculite					
	8125/B00B/R1045/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0050 - Distribution Board Cupboard (0.32 m2)						
				Note: No inspection of live electrical installation.		
Electric Off Peak Heater	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00B - R0051 - Art Learning Space (60.99 m2)						
Ceiling Structures/Linings	Vermiculite					
	8125/B00B/R1045/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0054 - Art Learning Space (59.52 m2)						
Ceiling Structures/Linings	Vermiculite					
	8125/B00B/R1045/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0055 - Resources Store (25.77 m2)						
Ceiling Structures/Linings	Vermiculite					
	8125/B00B/R1045/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0056 - No Access (5.44 m2)						
No Asbestos						
B00B - R0057 - Movement (2.62 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8125/B00B/R1020/Ceiling Structures/Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00B - R0058 - Materials Store (27.27 m2)						
No Asbestos						
B00B - R0059 - Art Learning Space (55.02 m2)						
No Asbestos						
B00B - R0060 - Kiln Space (9.04 m2)						
No Asbestos						
B00B - R0062 - Communication Space (0.84 m2)						
No Asbestos						
B00B - R0063 - Security Store (15.84 m2)						
Ceiling Structures/Linings	Vermiculite					
	8125/B00B/R1045/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0064 - Covered Area (109.63 m2)						
No Asbestos						
B00B - R0066 - Movement (5.01 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0067 - Movement (1.83 m2)						
No Asbestos						
B00B - R0068 - Movement (4.68 m2)						
No Asbestos						
B00B - R0069 - Art Learning Space (39.58 m2)						
Ceiling Structures/Linings	Vermiculite					
	8125/B00B/R1045/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0070 - Computer Store (11.64 m2)						
No Asbestos						
B00B - R0071 - Store (20.66 m2)						
No Asbestos						
B00B - R0072 - Stairs (7.95 m2)						
No Asbestos						
B00B - R0074 - Stairs (3.67 m2)						
No Asbestos						
B00B - R0075 - Stairs (7.9 m2)						
No Asbestos						
B00B - R0076 - General Storeroom (5.48 m2)						
No Asbestos						
B00B - R0077 - Movement (9.05 m2)						
No Asbestos						
B00B - R0078 - Movement (7.43 m2)						
No Asbestos						
B00B - R0079 - Lift (2.24 m2)						
No Asbestos						
B00B - R0080 - Movement (419.34 m2)						
No Asbestos						
B00B - R0081 - Movement (292.33 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	100m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8125/B00B/R1020/Ceiling Structures/Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00B - R0082 - Movement (36.56 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	37m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8125/B00B/R1059/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8125/B00B/R1059/Floor Coverings Res/Textile/S15					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	8125/B00B/R1045/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0083 - Movement (122.45 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	123m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8125/B00B/R1059/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8125/B00B/R1059/Floor Coverings Res/Textile/S15					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	8125/B00B/R1045/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R1001 - General Learning Space (37.62 m2)						
Ceiling Structures/Linings	Vermiculite 8125/B00B/R1045/Ceiling Structures/Linings/S5				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8125/B00B/R1059/Floor Coverings Res/Textile/S14	38m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8125/B00B/R1059/Floor Coverings Res/Textile/S15				No Asbestos Detected	
B00B - R1002 - General Learning Space (51.83 m2)						
Ceiling Structures/Linings	Vermiculite 8125/B00B/R1045/Ceiling Structures/Linings/S5				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8125/B00B/R1059/Floor Coverings Res/Textile/S14	52m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8125/B00B/R1059/Floor Coverings Res/Textile/S15				No Asbestos Detected	
B00B - R1003 - Staff Study (51.83 m2)						
Ceiling Structures/Linings	Vermiculite 8125/B00B/R1045/Ceiling Structures/Linings/S5				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8125/B00B/R1059/Floor Coverings Res/Textile/S14	52m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8125/B00B/R1059/Floor Coverings Res/Textile/S15				No Asbestos Detected	
B00B - R1004 - Distribution Board Cupboard (0.34 m2) Note: No inspection of live electrical installation.						
Electrical Backing Board	Resinous Board	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
Ceiling Structures/Linings	Flat AC Sheeting 8125/B00B/R1004/Ceiling Structures/Linings/S13	0.4m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00B - R1005 - General Learning Space (51.09 m2)						
Ceiling Structures/Linings	Vermiculite 8125/B00B/R1045/Ceiling Structures/Linings/S5				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8125/B00B/R1059/Floor Coverings Res/Textile/S14	52m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8125/B00B/R1059/Floor Coverings Res/Textile/S15				No Asbestos Detected	
B00B - R1006 - General Learning Space (51.85 m2)						
Ceiling Structures/Linings	Vermiculite 8125/B00B/R1045/Ceiling Structures/Linings/S5				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8125/B00B/R1059/Floor Coverings Res/Textile/S14	52m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive					
	8125/B00B/R1059/Floor Coverings Res/Textile/S15					No Asbestos Detected
B00B - R1007 - General Learning Space (51.84 m2)						
Ceiling Structures/Linings	Vermiculite					
	8125/B00B/R1045/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8125/B00B/R1059/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8125/B00B/R1059/Floor Coverings Res/Textile/S15					No Asbestos Detected
B00B - R1008 - General Learning Space (51.84 m2)						
Ceiling Structures/Linings	Vermiculite					
	8125/B00B/R1045/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8125/B00B/R1059/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8125/B00B/R1059/Floor Coverings Res/Textile/S15					No Asbestos Detected
B00B - R1009 - General Learning Space (51.83 m2)						
Ceiling Structures/Linings	Vermiculite					
	8125/B00B/R1045/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8125/B00B/R1059/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8125/B00B/R1059/Floor Coverings Res/Textile/S15					No Asbestos Detected
B00B - R1011 - Movement (175.53 m2)						
Ceiling Structures/Linings	Vermiculite					
	8125/B00B/R1045/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	176m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8125/B00B/R1059/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8125/B00B/R1059/Floor Coverings Res/Textile/S15					No Asbestos Detected
B00B - R1012 - Staff - Toilet (4.46 m2)						
No Asbestos						
B00B - R1013 - Deputy Principal Office (22.62 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	23m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8125/B00B/R1059/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8125/B00B/R1059/Floor Coverings Res/Textile/S15					No Asbestos Detected
B00B - R1014 - Staff Study (17.6 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8125/B00B/R1059/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No		Test Result				
Floor Coverings Res/Textile	Adhesive					
	8125/B00B/R1059/Floor Coverings Res/Textile/S15					No Asbestos Detected
B00B - R1015 - Cleaning Store - Distributed (3.33 m2)						
No Asbestos						
B00B - R1016 - Toilets-Disabled (5 m2)						
Wall Linings Internal	Flat AC Sheeting					
	8125/B00B/R1016/Wall Linings Internal/S12					No Asbestos Detected
B00B - R1017 - Toilets-Boys (22.49 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet					
	8125/B00B/R1018/Partition Walls (Cubicles)/S11					No Asbestos Detected
B00B - R1018 - Toilets-Girls (28.91 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet					
	8125/B00B/R1018/Partition Walls (Cubicles)/S11					No Asbestos Detected
B00B - R1019 - Movement (98.99 m2)						
No Asbestos						
B00B - R1020 - Movement (9.12 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8125/B00B/R1020/Ceiling Structures/Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Infil panel	Flat AC Sheeting	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8125/B00B/R1020/Infil panel/S9					Chrysotile (white asbestos)
B00B - R1021 - Multi-Purpose Space (8.24 m2)						
No Asbestos						
B00B - R1022 - Multi-Purpose Space (9.02 m2)						
No Asbestos						
B00B - R1023 - Multi-Purpose Space (324.35 m2)						
No Asbestos						
B00B - R1024 - Stage (139.72 m2)						
No Asbestos						
B00B - R1025 - Music Store (11.93 m2)						
No Asbestos						
B00B - R1026 - General Storeroom (19.95 m2)						
No Asbestos						
B00B - R1027 - Music Store (20.71 m2)						
No Asbestos						
B00B - R1028 - General Storeroom (20.64 m2)						
No Asbestos						
B00B - R1029 - Cleaning Supplies Store (4.54 m2)						
No Asbestos						
B00B - R1030 - Movement (56.99 m2)						
No Asbestos						
B00B - R1031 - General Learning Space (65.26 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	66m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8125/B00B/R1059/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8125/B00B/R1059/Floor Coverings Res/Textile/S15					No Asbestos Detected
B00B - R1032 - Staff Study (32.16 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8125/B00B/R1059/Floor Coverings Res/Textile/S14	33m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8125/B00B/R1059/Floor Coverings Res/Textile/S15					No Asbestos Detected
B00B - R1033 - General Storeroom (6.74 m2)						
No Asbestos						
B00B - R1034 - General Learning Space (47.18 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8125/B00B/R1059/Floor Coverings Res/Textile/S14	48m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8125/B00B/R1059/Floor Coverings Res/Textile/S15					No Asbestos Detected
B00B - R1035 - Distribution Board Cupboard (0.44 m2)						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting 8125/B00B/R1004/Ceiling Structures/Linings/S13	1m2	Throughout	Some Damage - Unsealed (3) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	Low (1)	Medium Priority (4-5)
Electrical Mounting Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
B00B - R1036 - Staff Study (52.52 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8125/B00B/R1059/Floor Coverings Res/Textile/S14	53m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8125/B00B/R1059/Floor Coverings Res/Textile/S15					No Asbestos Detected
B00B - R1037 - Staff Study (17.44 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8125/B00B/R1059/Floor Coverings Res/Textile/S14	18m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8125/B00B/R1059/Floor Coverings Res/Textile/S15					No Asbestos Detected
B00B - R1038 - Staff Study (12.71 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8125/B00B/R1059/Floor Coverings Res/Textile/S14	13m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8125/B00B/R1059/Floor Coverings Res/Textile/S15					No Asbestos Detected
B00B - R1039 - Commonroom (105.58 m2)						
Ceiling Structures/Linings	Vermiculite 8125/B00B/R1045/Ceiling Structures/Linings/S5					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8125/B00B/R1059/Floor Coverings Res/Textile/S14	106m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8125/B00B/R1059/Floor Coverings Res/Textile/S15					No Asbestos Detected
B00B - R1040 - Cleaning Supplies Store (3.66 m2)						
No Asbestos						
B00B - R1041 - Movement (11.58 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8125/B00B/R1045/Ceiling Structures/Linings/S5				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
B00B - R1042 - General Storeroom (12.97 m2)						
Ceiling Structures/Linings	Vermiculite 8125/B00B/R1045/Ceiling Structures/Linings/S5				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8125/B00B/R1059/Floor Coverings Res/Textile/S14	13m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8125/B00B/R1059/Floor Coverings Res/Textile/S15				No Asbestos Detected	
B00B - R1043 - Staff - Toilet (6.35 m2)						
No Asbestos						
B00B - R1044 - Staff Study (6.24 m2)						
No Asbestos						
B00B - R1046 - Movement (54.54 m2)						
No Asbestos						
B00B - R1048 - Stairs (2.18 m2)						
No Asbestos						
B00B - R1050 - Lift (2.51 m2)						
No Asbestos						
B00B - R1051 - Stairs (17.1 m2)						
No Asbestos						
B00B - R1052 - Stairs (13.61 m2)						
No Asbestos						
B00B - R1053 - Stairs (6.43 m2)						
No Asbestos						
B00B - R1054 - Stairs (14.11 m2)						
No Asbestos						
B00B - R1055 - Movement (59.9 m2)						
No Asbestos						
B00B - R1056 - Movement (7.43 m2)						
No Asbestos						
B00B - R1058 - Administration - Clerical (8.72 m2)						
Ceiling Structures/Linings	Vermiculite 8125/B00B/R1045/Ceiling Structures/Linings/S5				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8125/B00B/R1059/Floor Coverings Res/Textile/S14	9m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8125/B00B/R1059/Floor Coverings Res/Textile/S15				No Asbestos Detected	
B00B - R1059 - Administration - Clerical (12.54 m2)						
Ceiling Structures/Linings	Vermiculite 8125/B00B/R1045/Ceiling Structures/Linings/S5				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8125/B00B/R1059/Floor Coverings Res/Textile/S14	13m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive					
	8125/B00B/R1059/Floor Coverings Res/Textile/S15					No Asbestos Detected
B00B - R1060 - Movement (85.05 m2)						
Ceiling Structures/Linings	Vermiculite					
	8125/B00B/R1045/Ceiling Structures/Linings/S5					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	85m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8125/B00B/R1059/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8125/B00B/R1059/Floor Coverings Res/Textile/S15					No Asbestos Detected
B00B - R1061 - Movement (28.37 m2)						
Ceiling Structures/Linings	Vermiculite					
	8125/B00B/R1045/Ceiling Structures/Linings/S5					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	29m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8125/B00B/R1059/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8125/B00B/R1059/Floor Coverings Res/Textile/S15					No Asbestos Detected
B00B - R2001 - Staff Study (38.27 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	39m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8125/B00B/R1059/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8125/B00B/R1059/Floor Coverings Res/Textile/S15					No Asbestos Detected
B00B - R2002 - General Learning Space (51.98 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8125/B00B/R1059/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8125/B00B/R1059/Floor Coverings Res/Textile/S15					No Asbestos Detected
B00B - R2003 - General Learning Space (51.98 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8125/B00B/R1059/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8125/B00B/R1059/Floor Coverings Res/Textile/S15					No Asbestos Detected
B00B - R2004 - Distribution Board Cupboard (0.36 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	8125/B00B/R1004/Ceiling Structures/Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00B - R2005 - General Learning Space (52.05 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8125/B00B/R1059/Floor Coverings Res/Textile/S14					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive					
	8125/B00B/R1059/Floor Coverings Res/Textile/S15				No Asbestos Detected	
B00B - R2006 - General Learning Space (51.12 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8125/B00B/R1059/Floor Coverings Res/Textile/S14				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive					
	8125/B00B/R1059/Floor Coverings Res/Textile/S15				No Asbestos Detected	
B00B - R2007 - General Learning Space (51.83 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8125/B00B/R1059/Floor Coverings Res/Textile/S14				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive					
	8125/B00B/R1059/Floor Coverings Res/Textile/S15				No Asbestos Detected	
B00B - R2008 - General Learning Space (52.55 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8125/B00B/R1059/Floor Coverings Res/Textile/S14				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive					
	8125/B00B/R1059/Floor Coverings Res/Textile/S15				No Asbestos Detected	
B00B - R2009 - Computer Learning Space (52.55 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8125/B00B/R1059/Floor Coverings Res/Textile/S14				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive					
	8125/B00B/R1059/Floor Coverings Res/Textile/S15				No Asbestos Detected	
B00B - R2010 - Staff Study (14.4 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	15m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8125/B00B/R1059/Floor Coverings Res/Textile/S14				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive					
	8125/B00B/R1059/Floor Coverings Res/Textile/S15				No Asbestos Detected	
B00B - R2011 - General Storeroom (5.75 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8125/B00B/R2011/Floor Coverings Res/Textile/S4				Chrysotile (white asbestos)	
B00B - R2012 - Staff Study (7.91 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8125/B00B/R1059/Floor Coverings Res/Textile/S14				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive					
	8125/B00B/R1059/Floor Coverings Res/Textile/S15				No Asbestos Detected	
B00B - R2013 - Movement (142 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	142m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8125/B00B/R1059/Floor Coverings Res/Textile/S14				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive					
	8125/B00B/R1059/Floor Coverings Res/Textile/S15				No Asbestos Detected	
B00B - R2014 - General Storeroom (8.28 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00B - R2015 - Movement (136 m2)						
No Asbestos						
B00B - R2016 - General Storeroom (11.02 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8125/B00B/R2011/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B00B - R2017 - Staff Study (26.72 m2)						
No Asbestos						
B00B - R2018 - General Learning Space (52.48 m2)						
No Asbestos						
B00B - R2019 - General Learning Space (54.82 m2)						
No Asbestos						
B00B - R2020 - General Learning Space (54.3 m2)						
No Asbestos						
B00B - R2021 - Distribution Board Cupboard (0.36 m2)				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting	0.5m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
8125/B00B/R1004/Ceiling Structures/Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00B - R2022 - General Learning Space (55.77 m2)						
No Asbestos						
B00B - R2023 - General Learning Space (52.77 m2)						
No Asbestos						
B00B - R2024 - General Learning Space (54.39 m2)						
No Asbestos						
B00B - R2025 - Stairs (14.83 m2)						
No Asbestos						
B00B - R2026 - Stairs (12.76 m2)						
No Asbestos						
B00B - R2027 - Stairs (13.84 m2)						
No Asbestos						
B00B - R2028 - Stairs (18.71 m2)						
No Asbestos						
B00B - R2029 - Movement (7.7 m2)						
No Asbestos						
B00B - Room+1 - Walkway north to south near canteen						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8125/B00B/R1020/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1962 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	20m2	Surround	Good Condition (1)	Low (1)	Low Priority (2-3)
	8125/B00C/R0004/Ceiling Structures/Linings/S16			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

Interior

B00C - R0004 - External Movement (12.37 m2)

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8125/B00C/R0004/Ceiling Structures/Linings/S16			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00C - R0007 - Toilets-Boys (103.7 m2)

Ceiling Structures/Linings	Flat AC Sheeting	104m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8125/B00C/R0004/Ceiling Structures/Linings/S16			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00C - R0008 - Change (62.24 m2)

Ceiling Structures/Linings	Flat AC Sheeting	63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8125/B00C/R0004/Ceiling Structures/Linings/S16			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1957 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	200m2	Surround	Good Condition (1)	Low (1)	Low Priority (2-3)
	8125/B00B/Eaves Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

Interior

B00D - R0001 - Performance Workspace (54.13 m2)

No Asbestos

B00D - R0002 - General Storeroom (6.42 m2)

No Asbestos

B00D - R0003 - Special Learning Space (51.72 m2)

No Asbestos

B00D - R0004 - General Storeroom (6.68 m2)

No Asbestos

B00D - R0005 - General Storeroom (6.42 m2)

No Asbestos

B00D - R0006 - General Storeroom (6.2 m2)

No Asbestos

B00D - R0007 - Special Learning Space (53.5 m2)

No Asbestos

B00D - R0008 - General Storeroom (4.84 m2)

No Asbestos

B00D - R0009 - Special Learning Space (63.32 m2)

No Asbestos

B00D - R0010 - General Storeroom (9.59 m2)

No Asbestos

B00D - R0011 - Staff Study (11.56 m2)

No Asbestos

B00D - R0012 - Staff - Toilet (2.59 m2)

No Asbestos

B00D - R0013 - Toilets-Disabled (19.91 m2)

No Asbestos

B00D - R0014 - Laundry (12.36 m2)

No Asbestos

B00D - R0015 - Toilets-Disabled (21.82 m2)

No Asbestos

B00D - R0017 - Movement (1.34 m2)

No Asbestos

B00D - R0018 - Cleaning Store - Distributed (0.57 m2)

No Asbestos

B00D - R0019 - Toilets-Boys (15.1 m2)

Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
	8125/B00B/R1018/Partition Walls (Cubicles)/S11					

B00D - R0020 - Cleaning Store - Distributed (2.9 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R0021 - Toilets-Girls (18.65 m2)						
No Asbestos						
B00D - R0022 - Distribution Board Cupboard (1.28 m2)						
Note: No inspection of live electrical installation.						
Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00D - R0023 - Distribution Board Cupboard (1.86 m2)						
Note: No inspection of live electrical installation.						
Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00D - R0024 - General Storeroom (0.73 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8125/B00B/R1004/Ceiling Structures/Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
B00D - R0025 - Movement (131.37 m2)						
No Asbestos						
B00D - R0026 - Movement (2.24 m2)						
No Asbestos						
B00D - R0027 - Movement (3.2 m2)						
No Asbestos						
B00D - R0028 - Movement (160.84 m2)						
No Asbestos						
B00D - R0029 - Covered Outdoor Space (76.84 m2)						
No Asbestos						
B00D - R0030 - Stairs (2.75 m2)						
No Asbestos						
B00D - R0031 - Stairs (2.19 m2)						
No Asbestos						
B00D - R1001 - Music Learning Space (67.36 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	68m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8125/B00D/R1009/Floor Coverings Res/Textile/S17				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Adhesive					
8125/B00D/R1009/Floor Coverings Res/Textile/S18				No Asbestos Detected		
B00D - R1002 - Music Store (15.65 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8125/B00B/R1004/Ceiling Structures/Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8125/B00D/R1009/Floor Coverings Res/Textile/S17				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Adhesive					
8125/B00D/R1009/Floor Coverings Res/Textile/S18				No Asbestos Detected		
B00D - R1003 - Performance Workspace (67.43 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	68m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8125/B00D/R1009/Floor Coverings Res/Textile/S17				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Adhesive					
8125/B00D/R1009/Floor Coverings Res/Textile/S18				No Asbestos Detected		
B00D - R1004 - General Learning Space (30.99 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8125/B00D/R1009/Floor Coverings Res/Textile/S17	31m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8125/B00D/R1009/Floor Coverings Res/Textile/S18					No Asbestos Detected
B00D - R1005 - Music Store (4.44 m2)						
No Asbestos						
B00D - R1006 - Staff Study (27.75 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8125/B00D/R1009/Floor Coverings Res/Textile/S17	28m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8125/B00D/R1009/Floor Coverings Res/Textile/S18					No Asbestos Detected
B00D - R1007 - General Storeroom (8.03 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8125/B00D/R1009/Floor Coverings Res/Textile/S17	8m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8125/B00D/R1009/Floor Coverings Res/Textile/S18					No Asbestos Detected
B00D - R1008 - Staff - Toilet (7.01 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet 8125/B00D/R1008/Partition Walls (Cubicles)/S19					No Asbestos Detected
B00D - R1009 - Movement (104.47 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8125/B00D/R1009/Floor Coverings Res/Textile/S17	105m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8125/B00D/R1009/Floor Coverings Res/Textile/S18					No Asbestos Detected
B00D - R1010 - Staff Study (32.49 m2)						
No Asbestos						
B00D - R1011 - Stairs (13.24 m2)						
No Asbestos						
B00D - R1012 - Stairs (14.06 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Science/Technological & Applied Studies - 1970 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00E - R0001 - Laboratory L.S. (93.63 m2)	No Asbestos
B00E - R0002 - Distribution Board Cupboard (0.96 m2)	No Asbestos Note: No inspection of live electrical installation.
B00E - R0003 - Preparation (32.7 m2)	No Asbestos
B00E - R0004 - Laboratory L.S. (93.63 m2)	No Asbestos
B00E - R0006 - General Learning Space (46.56 m2)	No Asbestos
B00E - R0007 - Movement (13.01 m2)	No Asbestos
B00E - R0008 - Cleaning Supplies Store (3.75 m2)	No Asbestos
B00E - R0009 - Staff Study (17.06 m2)	No Asbestos
B00E - R0010 - General Learning Space (48.13 m2)	No Asbestos
B00E - R0011 - Darkroom Space (30.6 m2)	No Asbestos
B00E - R0012 - General Learning Space (52.39 m2)	No Asbestos
B00E - R0013 - General Learning Space (52.54 m2)	No Asbestos
B00E - R0014 - Movement (103.28 m2)	No Asbestos
B00E - R0015 - Stairs (15.51 m2)	No Asbestos
B00E - R0016 - Senior Study (72.15 m2)	No Asbestos
B00E - R0017 - Change (5.08 m2)	No Asbestos
B00E - R1001 - Seminar (39.97 m2)	No Asbestos
B00E - R1002 - Cleaning Supplies Store (2.92 m2)	No Asbestos
B00E - R1003 - Food Technology L.S. (75.8 m2)	No Asbestos
B00E - R1004 - Food/Research Space (25.63 m2)	No Asbestos
B00E - R1005 - Food Technology L.S. (103 m2)	No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00E - R1008 - Staff - Toilet (5 m2)						
No Asbestos						
B00E - R1009 - Laundry (6.62 m2)						
No Asbestos						
B00E - R1010 - Distribution Board Cupboard (0.72 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B00E - R1011 - Secure Storeroom (6.59 m2)						
No Asbestos						
B00E - R1012 - Design L.S. (57.58 m2)						
No Asbestos						
B00E - R1013 - Design L.S. (74.55 m2)						
No Asbestos						
B00E - R1014 - Design L.S. (74.56 m2)						
No Asbestos						
B00E - R1016 - Staff Study (48.36 m2)						
No Asbestos						
B00E - R1017 - Movement (102.03 m2)						
No Asbestos						
B00E - R1018 - Stairs (13.84 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Library/Science Learning - 1970 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior**B00F - M1001 - Senior Study (16.12 m2)**

No Asbestos

B00F - M1002 - Senior Study (14.54 m2)

No Asbestos

B00F - M1003 - Senior Study (19.86 m2)

No Asbestos

B00F - M1004 - Senior Study (14.54 m2)

No Asbestos

B00F - M1005 - General Storeroom (38.36 m2)

No Asbestos

B00F - M1006 - Plant (5.64 m2)

No Asbestos

B00F - M1007 - Movement (15.5 m2)

No Asbestos

B00F - M1008 - Stairs (2.43 m2)

No Asbestos

B00F - M1009 - Stairs (2.43 m2)

No Asbestos

B00F - R0001 - Laboratory L.S. (91.32 m2)

No Asbestos

B00F - R0002 - Staff Study (48.67 m2)

Ceiling Structures/Linings Vermiculite
8125/B00B/R1045/Ceiling Structures/Linings/S5

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00F - R0003 - Laboratory L.S. (91.39 m2)

No Asbestos

B00F - R0004 - Laboratory L.S. (91.4 m2)

No Asbestos

B00F - R0005 - Chemical Store (1.84 m2)

Ceiling Structures/Linings Vermiculite
8125/B00B/R1045/Ceiling Structures/Linings/S5

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00F - R0006 - Preparation (44.79 m2)

No Asbestos

B00F - R0007 - Laboratory L.S. (91.4 m2)

No Asbestos

B00F - R0008 - Apparatus Store (17.06 m2)

No Asbestos

B00F - R0009 - Distribution Board Cupboard (0.47 m2)

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-------	------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard

B00F - R0010 - Movement (40.37 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00F - R0011 - Movement (30.42 m2)						
No Asbestos						
B00F - R0012 - Cleaning Supplies Store (7.85 m2)						
No Asbestos						
B00F - R0013 - Plant (9.68 m2)						
No Asbestos						
B00F - R0014 - Stairs (8.11 m2)						
No Asbestos						
B00F - R1001 - Seminar (12.8 m2)						
No Asbestos						
B00F - R1002 - Seminar (12.15 m2)						
No Asbestos						
B00F - R1003 - No Access (13.15 m2)						
No Asbestos						
B00F - R1004 - Cleaning Supplies Store (0.62 m2)						
No Asbestos						
B00F - R1005 - Movement (4.24 m2)						
No Asbestos						
B00F - R1006 - Distribution Board Cupboard (0.26 m2)						
					Note: No inspection of live electrical installation.	
Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00F - R1007 - Seminar (12.09 m2)						
No Asbestos						
B00F - R1008 - General Storeroom (12.64 m2)						
No Asbestos						
B00F - R1009 - Main Area (323.76 m2)						
Ceiling Structures/Linings	Vermiculite					
	8125/B00B/R1045/Ceiling Structures/Linings/S5					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00F - R1010 - Audio Visual Workroom (28.63 m2)						
No Asbestos						
B00F - R1011 - Administration - Clerical (9.3 m2)						
No Asbestos						
B00F - R1012 - General Storeroom (12.72 m2)						
No Asbestos						
B00F - R1013 - Workroom (17.53 m2)						
No Asbestos						
B00F - R1014 - Staff - Toilet (2.77 m2)						
No Asbestos						
B00F - R1015 - Movement (27.9 m2)						
No Asbestos						
B00F - R1016 - Movement (3.11 m2)						
No Asbestos						
B00F - R1017 - Staff - Toilet (2.79 m2)						
No Asbestos						
B00F - R1018 - Computer Learning Space (72.23 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings Vermiculite
 8125/B00B/R1045/Ceiling Structures/Linings/S5 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00F - R1019 - Stairs (16.63 m2)

No Asbestos

B00F - R1020 - Stairs (1.96 m2)

No Asbestos

B00F - R1021 - Stairs (2.3 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Physical Education - 1987 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00G - R0001 - External Movement (8.6 m2)

No Asbestos

B00G - R0002 - Sport Equipment Store (39.34 m2)

No Asbestos

B00G - R0005 - Distribution Board Cupboard (0.63 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00G - R0006 - Movement (8.6 m2)

No Asbestos

B00G - R0007 - External Movement (8.63 m2)

No Asbestos

B00G - R0008 - Shower/Change (27.56 m2)

No Asbestos

B00G - R0009 - Staff Change (5.4 m2)

No Asbestos

B00G - R0010 - Shower/Change (27.56 m2)

No Asbestos

B00G - R0011 - External Movement (8.63 m2)

No Asbestos

B00G - R0012 - Gymnasium (457.99 m2)

No Asbestos

B00G - R0013 - Staff Study (21.51 m2)

No Asbestos

B00G - R0014 - Sport Equipment Store (40.94 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Agricultural Science - 1962 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior

B00H - R0001 - Machine Storage (38.22 m2)

No Asbestos

B00H - R0002 - Class Tools Storage (36.65 m2)

Wall Linings Internal Flat AC Sheeting
 8125/B00H/R0002/Wall Linings Internal/S20 **No Asbestos Detected**

B00H - R0003 - Animal Space (25.14 m2)

Wall Linings Internal Flat AC Sheeting
 8125/B00H/R0002/Wall Linings Internal/S20 **No Asbestos Detected**

B00H - R0004 - Plant Space (11.37 m2)

Wall Linings Internal Flat AC Sheeting
 8125/B00H/R0002/Wall Linings Internal/S20 **No Asbestos Detected**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Technological & Applied Studies - 2011 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00J - R0001 - Materials Learning Space - Type 1 (116.34 m2)

No Asbestos

B00J - R0002 - Project Store - Type 1 (11.23 m2)

No Asbestos

B00J - R0003 - Materials Store (15.2 m2)

No Asbestos

B00J - R0004 - Distribution Board Cupboard (0.71 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00J - R0005 - Outdoor Learning Area (33.5 m2)

No Asbestos

B00J - R0006 - Dust Extraction Space (3.91 m2)

No Asbestos

B00J - R0007 - External Movement (8.95 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017