


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Leeton High School (8156)
Region : Riverina
State Electorate : Murray
Local Government Area : Leeton

Initial Survey : Noel Arnold & Associates : 18 - Dec - 2009
Reviewed By : Greencap-NAA : 18 - May - 2015

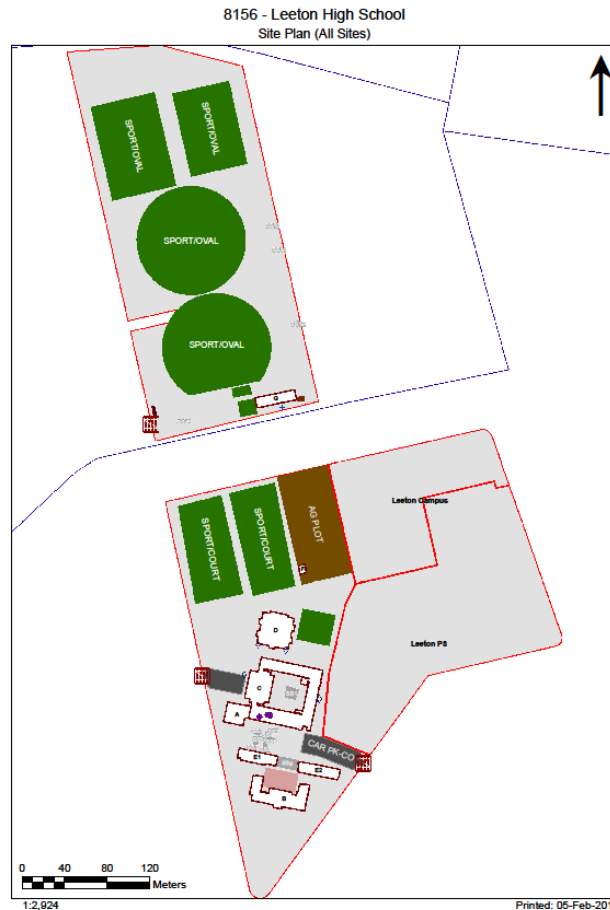

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1971 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00A/R0013/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					

Interior**B00A - R0001 - Garden Store Room (17.38 m2)**

No Asbestos

B00A - R0002 - Chair Store (18.02 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00A/R0010/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00A - R0005 - Deputy Principal Office (18.15 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00A/R0010/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00A - R0008 - Principal Office (16.06 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00A/R0010/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00A - R0009 - General Storeroom (1.17 m2)

Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00A/R0010/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00A - R0010 - Duplicating Workroom (13.54 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8156/B00A/R0010/Floor Coverings Res/Textile/S2					
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00A/R0010/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00A - R0011 - Administration - Clerical (22.66 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00A/R0010/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00A - R0013 - External Movement (3.11 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00A/R0013/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)

B00A - R0014 - General Storeroom (2.41 m2)

Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00A/R0010/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00A - R0015 - Interview/Office - Type 1 (12.08 m2)

Floor Coverings Res/Textile	Vinyl Tiles	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00A/R0010/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)

B00A - R0017 - Staff - Toilet (9.22 m2)

No Asbestos

B00A - R0018 - Disabled Toilet (5.99 m2)

No Asbestos

B00A - R0020 - General Storeroom (15.53 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8156/B00A/R0010/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)		
B00A - R0021 - Distribution Board Cupboard (0.64 m2)				Note: No inspection of live electrical installation.		
Electrical Mounting Board	Resinous Board	1Unit	to wall	Good Condition (1)	Low (1)	Low Priority (2-3)
8156/B00A/R0021/Electrical Mounting Board/S11				Chrysotile (white asbestos)		
Debris	AC Fragments/Debris	0.5m2	to ground	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
8156/B00A/R0021/Debris/S12				Chrysotile (white asbestos)		
B00A - R0023 - Administration - Clerical (6.12 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8156/B00A/R0010/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)		
B00A - R0024 - Deputy Principal Office (18.71 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8156/B00A/R0010/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)		
B00A - R0025 - Uniform Shop (11.97 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8156/B00A/R0010/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)		
B00A - R0026 - Clinic - Girls (10.66 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8156/B00A/R0010/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)		
B00A - R0027 - Public Reception (21.85 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8156/B00A/R0010/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)		
B00A - R0028 - Administration - Clerical (42.25 m2)						
No Asbestos						
B00A - R0029 - Movement (30.73 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8156/B00A/R0010/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)		
B00A - R0030 - Student Reception (16.46 m2)						
No Asbestos						
B00A - R0031 - Movement (8.51 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8156/B00A/R0013/Ceiling Structures/Linings/S8				Chrysotile (white asbestos)		
B00A - R0032 - Movement (14.71 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8156/B00A/R0013/Ceiling Structures/Linings/S8				Chrysotile (white asbestos)		
B00A - R0033 - Toilet - Lobby (6.4 m2)						
No Asbestos						
B00A - R0034 - Staff - Toilet (1.53 m2)						
No Asbestos						
B00A - R0035 - Staff - Toilet (1.97 m2)						
Incinerator	Millboard	1Unit	to wall	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00A - R0036 - Toilet - Lobby (2.25 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00A - R0037 - Toilet - Lobby (1.35 m2)

No Asbestos

B00A - R0038 - Staff - Toilet (1.3 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00B - General Learning - 1926 - Brick/Block (Brick/Block)**Exterior**

Wall Cladding	Flat AC Sheeting	20m2	North east of building, outside rooms BR0023, BR0024, BR0025, BR0026 and BR0027	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8156/B00B/Wall Cladding/S9				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	500m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00B/R0028/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Small space					

Interior**B00B - R0001 - General Learning Space (51.6 m2)**

Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B00B/R0014/Floor Coverings Res/Textile/S14				No Asbestos Detected	

B00B - R0002 - General Learning Space (45.64 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B00B/R0014/Floor Coverings Res/Textile/S14				No Asbestos Detected	

B00B - R0003 - Interview/Office - Type 1 (11.78 m2)

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00B/R0028/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	

Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B00B/R0014/Floor Coverings Res/Textile/S14				No Asbestos Detected	

B00B - R0004 - General Learning Space (46.1 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B00B/R0014/Floor Coverings Res/Textile/S14				No Asbestos Detected	

B00B - R0005 - General Learning Space (46.3 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B00B/R0014/Floor Coverings Res/Textile/S14				No Asbestos Detected	

B00B - R0006 - General Learning Space (45.84 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B00B/R0014/Floor Coverings Res/Textile/S14				No Asbestos Detected	

B00B - R0007 - Security Store (5.45 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B00B/R0007/Floor Coverings Res/Textile/S15				No Asbestos Detected	

B00B - R0008 - Interview/Office - Type 1 (18.4 m2)

No Asbestos

B00B - R0009 - External Movement (13.13 m2)

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00B/R0028/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	

B00B - R0010 - Movement (12.45 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00B - R0011 - Cleaning Store - Distributed (4.69 m2)						
No Asbestos						
B00B - R0012 - General Learning Space (45.06 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B00B/R0014/Floor Coverings Res/Textile/S14					No Asbestos Detected
B00B - R0013 - General Learning Space (46.83 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B00B/R0014/Floor Coverings Res/Textile/S14					No Asbestos Detected
B00B - R0014 - General Learning Space (45.85 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B00B/R0014/Floor Coverings Res/Textile/S14					No Asbestos Detected
B00B - R0015 - External Movement (3.98 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00B/R0028/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)
B00B - R0016 - General Storeroom (9.83 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00B/R0028/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B00B/R0014/Floor Coverings Res/Textile/S14					No Asbestos Detected
B00B - R0017 - General Learning Space (45.78 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B00B/R0014/Floor Coverings Res/Textile/S14					No Asbestos Detected
B00B - R0018 - General Learning Space (45.91 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B00B/R0014/Floor Coverings Res/Textile/S14					No Asbestos Detected
B00B - R0019 - External Movement (1.88 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8156/B00B/Wall Cladding/S9					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	4m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8156/B00B/Wall Cladding/S9					Chrysotile (white asbestos)
B00B - R0020 - Commonroom (36.49 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00B/R0028/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B00B/R0014/Floor Coverings Res/Textile/S14					No Asbestos Detected
B00B - R0021 - Commonroom (36.59 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B00B/R0014/Floor Coverings Res/Textile/S14					No Asbestos Detected
B00B - R0022 - Senior Study (37.11 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00B/R0028/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B00B/R0014/Floor Coverings Res/Textile/S14				No Asbestos Detected	
B00B - R0023 - Staff - Toilet (8.45 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00B/R0028/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	
B00B - R0024 - Staff - Toilet (9.34 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00B/R0028/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	
Incinerator	Millboard	1Unit	to wall	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					
B00B - R0025 - Cleaning Store - Distributed (1.56 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00B/R0028/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	
B00B - R0026 - External Movement (1.63 m2)						
Wall Linings Internal	Flat AC Sheeting	4m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8156/B00B/Wall Cladding/S9				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00B/R0028/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	
B00B - R0027 - General Storeroom (13.31 m2)						
Wall Linings Internal	Flat AC Sheeting	25m2	East facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8156/B00B/R0027/Wall Linings Internal/S17				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00B/R0028/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B00B/R0007/Floor Coverings Res/Textile/S15				No Asbestos Detected	
B00B - R0028 - Movement (59.4 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00B/R0028/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	
B00B - R0029 - Movement (86.94 m2)						
Wall Linings Internal	Flat AC Sheeting	10m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00B/R0028/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	
B00B - R0030 - Stairs (1.59 m2)						
No Asbestos						
B00B - R1001 - Staff Study (7.69 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00B/R0028/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B00B/R0007/Floor Coverings Res/Textile/S15				No Asbestos Detected	
B00B - R1002 - General Learning Space (59.12 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00B/R0028/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B00B/R0014/Floor Coverings Res/Textile/S14				No Asbestos Detected	
B00B - R1003 - Staff Study (25.68 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00B/R0028/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	1m2	At Air Conditioning Unit	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00B/Wall Cladding/S9				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B00B/R0014/Floor Coverings Res/Textile/S14				No Asbestos Detected	
B00B - R1004 - General Storeroom (3.21 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B00B/R0014/Floor Coverings Res/Textile/S14				No Asbestos Detected	
B00B - R1005 - Computer Learning Space (48.7 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00B/R0028/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B00B/R0014/Floor Coverings Res/Textile/S14				No Asbestos Detected	
B00B - R1006 - Cleaning Store - Distributed (2.29 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00B/R0028/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B00B/R0014/Floor Coverings Res/Textile/S14				No Asbestos Detected	
B00B - R1007 - Staff Study (17.72 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00B/R0028/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B00B/R0014/Floor Coverings Res/Textile/S14				No Asbestos Detected	
B00B - R1008 - Staff Study (17.87 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00B/R0028/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B00B/R0007/Floor Coverings Res/Textile/S15				No Asbestos Detected	
B00B - R1010 - Movement (32.13 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00B/R0028/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B00B/R0014/Floor Coverings Res/Textile/S14				No Asbestos Detected	
B00B - R1011 - Stairs (13.77 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00B/R0028/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	
B00B - R9001 - Maintenance Bulk Store (11.63 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Pillar Packing	Resinous Membrane 8156/B00B/R9001/Stump packing/S7					No Asbestos Detected
B00B - R9002 - General Storeroom (32.68 m2)						
Pillar Packing	Resinous Membrane 8156/B00B/R9001/Stump packing/S7					No Asbestos Detected
B00B - R9003 - General Assistants (25.1 m2)						
Thermacon Heater	Millboard	2Unit	Stored	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Technological & Applied Studies - 1971 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	500m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00A/R0013/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Area inaccessible					

Interior

B00C - R0001 - General Storeroom (35.82 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8156/B00C/R0001/Ceiling Structures/Linings/S5					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0002 - Toilets-Girls (43.5 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8156/B00C/R0001/Ceiling Structures/Linings/S5					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0003 - Materials Store (10 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8156/B00C/R0001/Ceiling Structures/Linings/S5					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0004 - Resource/Project Store (9.6 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8156/B00C/R0001/Ceiling Structures/Linings/S5					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0005 - Wood Technology Bay (85.25 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8156/B00C/R0001/Ceiling Structures/Linings/S5					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0006 - Metal Technology Bay (80.64 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8156/B00C/R0001/Ceiling Structures/Linings/S5					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0007 - Welding Area (15.92 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8156/B00C/R0001/Ceiling Structures/Linings/S5					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0008 - Metal Technology Bay (9.24 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8156/B00C/R0001/Ceiling Structures/Linings/S5					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0009 - Distribution Board Cupboard (0.6 m2)

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1Unit	to wall	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00A/R0021/Electrical Mounting Board/S11					Chrysotile (white asbestos)

B00C - R0010 - General Storeroom (25.26 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8156/B00C/R0001/Ceiling Structures/Linings/S5					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Tiles	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00C/R0041/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

B00C - R0011 - Toilets-Girls (43.5 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8156/B00C/R0001/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0012 - Toilets-Boys (35.65 m2)						
Ceiling Structures/Linings	Vermiculite					
	8156/B00C/R0001/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0013 - Maintenance Bulk Store (11.38 m2)						
No Asbestos						
B00C - R0014 - Distribution Board Cupboard (0.9 m2)						
				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Membrane	1Unit	to wall	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00A/R0021/Electrical Mounting Board/S11					Chrysotile (white asbestos)
B00C - R0015 - General Storeroom (17.01 m2)						
Ceiling Structures/Linings	Vermiculite					
	8156/B00C/R0001/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0016 - Workroom (15.83 m2)						
Ceiling Structures/Linings	Vermiculite					
	8156/B00C/R0001/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0017 - Librarian (16.5 m2)						
Ceiling Structures/Linings	Vermiculite					
	8156/B00C/R0001/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0018 - Workroom (12.29 m2)						
Ceiling Structures/Linings	Vermiculite					
	8156/B00C/R0001/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0019 - Workroom (12.92 m2)						
Ceiling Structures/Linings	Vermiculite					
	8156/B00C/R0001/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0020 - Main Area (197.55 m2)						
Ceiling Structures/Linings	Vermiculite					
	8156/B00C/R0001/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0021 - Seminar (51.1 m2)						
Ceiling Structures/Linings	Vermiculite					
	8156/B00C/R0001/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0024 - Computer Learning Space (78.55 m2)						
Ceiling Structures/Linings	Vermiculite					
	8156/B00C/R0001/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0025 - Special Learning Space (29.86 m2)						
Ceiling Structures/Linings	Vermiculite					
	8156/B00C/R0001/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0026 - Staff Study (8.88 m2)						
Ceiling Structures/Linings	Vermiculite					
	8156/B00C/R0001/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0027 - Darkroom Space (17.29 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00C - R0028 - General Storeroom (8.78 m2)						
No Asbestos						
B00C - R0029 - Darkroom Space (19.08 m2)						
No Asbestos						
B00C - R0030 - Pantry (6.17 m2)						
No Asbestos						
B00C - R0031 - Student Canteen (48.97 m2)						
No Asbestos						
B00C - R0032 - Cleaning Supplies Store (9.31 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8156/B00C/R0041/Heat-proof Mat/S22					No Asbestos Detected
B00C - R0033 - Main Switchroom (9.17 m2)						
Electrical Mounting Board	Resinous Board	1Unit	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00C/R0041/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
B00C - R0034 - Staff - Toilet (4.33 m2)						
Incinerator	Millboard	1Unit	to wall	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
Assumed Asbestos - Electrical Hazard						
B00C - R0035 - General Storeroom (13.43 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00C/R0041/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
B00C - R0036 - Public Entry (3.32 m2)						
No Asbestos						
B00C - R0037 - General Storeroom (5.41 m2)						
No Asbestos						
B00C - R0038 - Staff - Toilet (4.22 m2)						
No Asbestos						
B00C - R0039 - Distribution Board Cupboard (0.57 m2)						
					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Flat AC Sheeting	0.5m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	8156/B00C/R1041/Debris/S20					Chrysotile (white asbestos)
Debris	AC Fragments/Debris	0.5m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	8156/B00C/R1041/Debris/S20					Chrysotile (white asbestos)
Electrical Mounting Board	Resinous Board	1Unit	to wall	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00A/R0021/Electrical Mounting Board/S11					Chrysotile (white asbestos)
B00C - R0040 - General Storeroom (25.99 m2)						
Ceiling Structures/Linings	Vermiculite					
	8156/B00C/R0001/Ceiling Structures/Linings/S5					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Small oven	Millboard	2Unit	Stored on top shelf	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	8156/B00C/R0040/Small oven/S23					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00C/R0041/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0041 - Laboratory L.S. (92.78 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	93m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00C/R0041/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8156/B00C/R0001/Ceiling Structures/Linings/S5				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Heat-proof Mat	Flat AC Sheeting					No Asbestos Detected
	8156/B00C/R0041/Heat-proof Mat/S22					
B00C - R0042 - Preparation (29 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	29m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00C/R0041/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8156/B00C/R0001/Ceiling Structures/Linings/S5				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Fume Cupboard - Internal infill panel to ceiling duct	Flat AC Sheeting	2Unit	East & west	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	8156/B00C/R0042/Fume Cupboard - Internal infill panel to ceiling duct/S21				Chrysotile (white asbestos)	
B00C - R0043 - Chemical Store (9.99 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00C/R0041/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8156/B00C/R0001/Ceiling Structures/Linings/S5				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00C - R0044 - Laboratory L.S. (92.9 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	93m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00C/R0041/Floor Coverings Res/Textile/S3				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8156/B00C/R0001/Ceiling Structures/Linings/S5				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Heat-proof Mat	Flat AC Sheeting					No Asbestos Detected
	8156/B00C/R0041/Heat-proof Mat/S22					
B00C - R0045 - General Learning Space (52.71 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8156/B00C/R0001/Ceiling Structures/Linings/S5				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00C - R0046 - General Storeroom (6.28 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8156/B00C/R0001/Ceiling Structures/Linings/S5				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00C - R0047 - Distribution Board Cupboard (0.58 m2)						
Electrical Backing Board	Resinous Board	1Unit	to wall	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00A/R0021/Electrical Mounting Board/S11				Chrysotile (white asbestos)	
B00C - R0048 - Staff Study (32.6 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8156/B00C/R0001/Ceiling Structures/Linings/S5				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00C - R0049 - Cleaning Store - Distributed (7.54 m2)						
No Asbestos						
B00C - R0050 - Cleaning Store - Distributed (7.89 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00C - R0051 - Cleaning Store - Distributed (8.27 m2)						
No Asbestos						
B00C - R0052 - Multi-Purpose Space (309.97 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	310m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8156/B00C/R1066/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	
B00C - R0053 - General Storeroom (8.28 m2)						
No Asbestos						
B00C - R0054 - Movement (470.21 m2)						
No Asbestos						
B00C - R0055 - Movement (40.14 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8156/B00C/R1066/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	
B00C - R0056 - Dust Extraction Space (3.85 m2)						
No Asbestos						
B00C - R0057 - External Stairs (8 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8156/B00C/R1066/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	
B00C - R0058 - Covered Outdoor Space (22.35 m2)						
No Asbestos						
B00C - R0059 - External Stairs (8.29 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8156/B00C/R1066/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	
B00C - R0060 - External Movement (15.48 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8156/B00A/R0013/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
B00C - R0061 - Audio Visual Workroom (24.97 m2)						
Ceiling Structures/Linings	Vermiculite	8156/B00C/R0061/Ceiling Structures/Linings/S24			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00C - R0062 - Lift (2.25 m2)						
No Asbestos						
B00C - R0063 - External Stairs (7.64 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8156/B00C/R1066/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	
B00C - R0064 - External Movement (1.45 m2)						
No Asbestos						
B00C - R0065 - External Stairs (7.75 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8156/B00C/R1066/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	
B00C - R1001 - Music Learning Space (53.22 m2)						
Ceiling Structures/Linings	Vermiculite	8156/B00C/R1056/Ceiling Structures/Linings/S25			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00C - R1002 - Music Learning Space (26.06 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8156/B00C/R1056/Ceiling Structures/Linings/S25					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R1004 - Distribution Board Cupboard (0.87 m2)					Note: No inspection of live electrical installation.	
Electrical Mounting Board	Resinous Board 8156/B00A/R0021/Electrical Mounting Board/S11	1Unit	to wall	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 8156/B00C/R1041/Debris/S20	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
Debris	AC Fragments/Debris 8156/B00C/R1041/Debris/S20	0.5m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
B00C - R1005 - Wood Technology Bay (103.07 m2)						
Ceiling Structures/Linings	Vermiculite 8156/B00C/R1056/Ceiling Structures/Linings/S25					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R1006 - Materials Store (25.88 m2)						
Ceiling Structures/Linings	Vermiculite 8156/B00C/R1056/Ceiling Structures/Linings/S25					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R1007 - Design L.S. (52.93 m2)						
Ceiling Structures/Linings	Vermiculite 8156/B00C/R1056/Ceiling Structures/Linings/S25					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R1008 - Cleaning Store - Distributed (6.23 m2)						
Ceiling Structures/Linings	Vermiculite 8156/B00C/R1056/Ceiling Structures/Linings/S25					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R1009 - General Storeroom (6.17 m2)						
Ceiling Structures/Linings	Vermiculite 8156/B00C/R1056/Ceiling Structures/Linings/S25					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R1010 - Distribution Board Cupboard (0.72 m2)					Note: No inspection of live electrical installation.	
Electrical Mounting Board	Resinous Board 8156/B00A/R0021/Electrical Mounting Board/S11	1Unit	North facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 8156/B00C/R1041/Debris/S20	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
Debris	Flat AC Sheeting 8156/B00C/R1041/Debris/S20	0.5m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
B00C - R1012 - Music Learning Space (53.29 m2)						
Ceiling Structures/Linings	Vermiculite 8156/B00C/R1056/Ceiling Structures/Linings/S25					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Sheet 8156/B00C/R1021/Floor Coverings Res/Textile/S29					No Asbestos Detected
Floor Underlay	Millboard 8156/B00C/R1026/Floor underlay/S30	54m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1014 - General Storeroom (4.61 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8156/B00C/R1056/Ceiling Structures/Linings/S25				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Sheet 8156/B00C/R1021/Floor Coverings Res/Textile/S29				No Asbestos Detected	
Floor Underlay	Millboard 8156/B00C/R1026/Floor underlay/S30	5m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
B00C - R1015 - Resources Store (4.26 m2)						
Ceiling Structures/Linings	Vermiculite 8156/B00C/R1056/Ceiling Structures/Linings/S25				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Sheet 8156/B00C/R1021/Floor Coverings Res/Textile/S29				No Asbestos Detected	
Floor Underlay	Millboard 8156/B00C/R1026/Floor underlay/S30	5m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
B00C - R1016 - Art Learning Space (53.29 m2)						
Ceiling Structures/Linings	Vermiculite 8156/B00C/R1056/Ceiling Structures/Linings/S25				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
B00C - R1017 - Art Learning Space (58.27 m2)						
Ceiling Structures/Linings	Vermiculite 8156/B00C/R1056/Ceiling Structures/Linings/S25				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
B00C - R1018 - Kiln Space (22.13 m2)						
Ceiling Structures/Linings	Vermiculite 8156/B00C/R1056/Ceiling Structures/Linings/S25				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
B00C - R1019 - Resources Store (10.1 m2)						
Ceiling Structures/Linings	Vermiculite 8156/B00C/R1056/Ceiling Structures/Linings/S25				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Sheet 8156/B00C/R1021/Floor Coverings Res/Textile/S29				No Asbestos Detected	
Floor Underlay	Millboard 8156/B00C/R1026/Floor underlay/S30	10m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
B00C - R1020 - Distribution Board Cupboard (0.72 m2)						
Electrical Mounting Board	Resinous Board 8156/B00A/R0021/Electrical Mounting Board/S11	1Unit	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Ceiling Structures/Linings	Flat AC Sheeting 8156/B00C/R1041/Debris/S20	1m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
B00C - R1021 - General Storeroom (39.39 m2)						
Ceiling Structures/Linings	Vermiculite 8156/B00C/R1056/Ceiling Structures/Linings/S25				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Sheet 8156/B00C/R1021/Floor Coverings Res/Textile/S29				No Asbestos Detected	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Underlay	Millboard	40m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
8156/B00C/R1026/Floor underlay/S30					Chrysotile (white asbestos)	
B00C - R1022 - Staff Study (26.03 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8156/B00C/R1056/Ceiling Structures/Linings/S25					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
8156/B00C/R1021/Floor Coverings Res/Textile/S29						
Floor Underlay	Millboard	27m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
8156/B00C/R1026/Floor underlay/S30					Chrysotile (white asbestos)	
B00C - R1023 - General Learning Space (52.78 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8156/B00C/R1056/Ceiling Structures/Linings/S25					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
8156/B00C/R1021/Floor Coverings Res/Textile/S29						
Floor Underlay	Millboard	53m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
8156/B00C/R1026/Floor underlay/S30					Chrysotile (white asbestos)	
B00C - R1024 - Staff Study (19.24 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8156/B00C/R1056/Ceiling Structures/Linings/S25					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
8156/B00C/R1021/Floor Coverings Res/Textile/S29						
Floor Underlay	Millboard	20m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
8156/B00C/R1026/Floor underlay/S30					Chrysotile (white asbestos)	
B00C - R1025 - General Storeroom (6.21 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8156/B00C/R1056/Ceiling Structures/Linings/S25					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
8156/B00C/R1021/Floor Coverings Res/Textile/S29						
Floor Underlay	Millboard	7m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
8156/B00C/R1026/Floor underlay/S30					Chrysotile (white asbestos)	
B00C - R1026 - General Learning Space (53.15 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8156/B00C/R1056/Ceiling Structures/Linings/S25					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
8156/B00C/R1021/Floor Coverings Res/Textile/S29						
Floor underlay	Millboard	53m2	Lower portion	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
8156/B00C/R1026/Floor underlay/S30					Chrysotile (white asbestos)	
B00C - R1027 - Cleaning Store - Distributed (3.31 m2)						
No Asbestos						
B00C - R1028 - Plant (2.26 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00C - R1029 - Cleaning Supplies Store (5.1 m2)						
No Asbestos						
B00C - R1030 - Toilets-Girls (8.13 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8156/B00C/R1030/Partition Walls (Cubicles)/S18					Chrysotile (white asbestos)	
Incinerator	Millboard	1Unit	to wall	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
Assumed Asbestos - Electrical Hazard						
B00C - R1031 - Pupil Entry (4.79 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8156/B00C/R1066/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	
B00C - R1032 - Toilets-Girls (21.86 m2)						
Recently Modified Space	Requires Inspection					
B00C - R1033 - Shower/Change (45.52 m2)						
Recently Modified Space	Requires Inspection					
B00C - R1034 - Shower/Change (39.88 m2)						
Recently Modified Space	Requires Inspection					
B00C - R1035 - Toilets-Boys (23.1 m2)						
Recently Modified Space	Requires Inspection					
B00C - R1036 - Pupil Entry (4.98 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8156/B00C/R1066/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	
B00C - R1037 - Cleaning Store - Distributed (3.29 m2)						
No Asbestos						
B00C - R1038 - Plant (2.26 m2)						
No Asbestos						
B00C - R1039 - General Storeroom (5.34 m2)						
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Stored	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
Assumed Asbestos - Electrical Hazard						
B00C - R1040 - Toilets-Boys (7.95 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8156/B00C/R1030/Partition Walls (Cubicles)/S18					Chrysotile (white asbestos)	
B00C - R1041 - Distribution Board Cupboard (0.73 m2)						
					Note: No inspection of live electrical installation.	
Electrical Mounting Board	Resinous Board	1Unit	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
Debris	AC Fragments/Debris	0.5m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
8156/B00C/R1041/Debris/S20					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	0.5m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
8156/B00C/R1041/Debris/S20					Chrysotile (white asbestos)	
B00C - R1042 - Staff Study (25.89 m2)						
No Asbestos						
B00C - R1043 - General Learning Space (52.78 m2)						
No Asbestos						
B00C - R1044 - General Learning Space (52.93 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00C - R1045 - General Learning Space (52.35 m2)						
No Asbestos						
B00C - R1046 - General Storeroom (6.32 m2)						
No Asbestos						
B00C - R1047 - General Storeroom (6.3 m2)						
No Asbestos						
B00C - R1048 - General Storeroom (6.27 m2)						
No Asbestos						
B00C - R1049 - General Storeroom (6.23 m2)						
No Asbestos						
B00C - R1052 - General Learning Space (53.22 m2)						
No Asbestos						
B00C - R1053 - Materials Store (15.49 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8156/B00C/R1066/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	
B00C - R1055 - External Stairs (20.01 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8156/B00C/R1066/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	
B00C - R1056 - Materials Store (37.15 m2)						
Ceiling Structures/Linings	Vermiculite					
8156/B00C/R1056/Ceiling Structures/Linings/S25					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Stored Panels	Flat AC Sheeting					
8156/B00C/R1056/Stored Panels/S26					No Asbestos Detected	
B00C - R1057 - Dust Extraction Space (3.64 m2)						
No Asbestos						
B00C - R1058 - External Stairs (20.6 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8156/B00C/R1066/Ceiling Structures/Linings/S19					Chrysotile (white asbestos)	
B00C - R1059 - Music Store (14.49 m2)						
Ceiling Structures/Linings	Vermiculite					
8156/B00C/R1056/Ceiling Structures/Linings/S25					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Sheet					
8156/B00C/R1021/Floor Coverings Res/Textile/S29					No Asbestos Detected	
Floor Underlay	Millboard	15m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
8156/B00C/R1026/Floor underlay/S30					Chrysotile (white asbestos)	
B00C - R1060 - Music Store (10.18 m2)						
Ceiling Structures/Linings	Vermiculite					
8156/B00C/R1056/Ceiling Structures/Linings/S25					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles					
8156/B00C/R1060/Floor Coverings Res/Textile/S27					No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive					
8156/B00C/R1060/Floor Coverings Res/Textile/S28					No Asbestos Detected	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B00C/R1021/Floor Coverings Res/Textile/S29				No Asbestos Detected	
Floor Underlay	Millboard	11m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	8156/B00C/R1026/Floor underlay/S30				Chrysotile (white asbestos)	
B00C - R1061 - Movement (13.92 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00C/R1066/Ceiling Structures/Linings/S19				Chrysotile (white asbestos)	
B00C - R1062 - External Stairs (17.44 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00C/R1066/Ceiling Structures/Linings/S19				Chrysotile (white asbestos)	
B00C - R1063 - Lift (2.25 m2)						
No Asbestos						
B00C - R1064 - External Stairs (17.7 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00C/R1066/Ceiling Structures/Linings/S19				Chrysotile (white asbestos)	
B00C - R1065 - General Learning Space (79.93 m2)						
No Asbestos						
B00C - R1066 - Movement (368.11 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	370m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B00C/R1066/Ceiling Structures/Linings/S19				Chrysotile (white asbestos)	
B00C - R1067 - Senior Study						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Multi Purpose Facilities - 1991 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids - Flat Roof No Asbestos Found

Interior**B00D - M0001 - Control Room (140.06 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00D - M0002 - Performing Arts Store (28.91 m2)

No Asbestos

B00D - M0003 - Movement (1.27 m2)

No Asbestos

B00D - M0004 - Stairs (0.79 m2)

No Asbestos

B00D - M0005 - Stairs (5.4 m2)

No Asbestos

B00D - M0006 - Stairs (4.79 m2)

No Asbestos

B00D - R0001 - Shower/Change (32.9 m2)

No Asbestos

B00D - R0002 - Pupil Entry (1.48 m2)

No Asbestos

B00D - R0003 - Sport Equipment Store (13.28 m2)

No Asbestos

B00D - R0004 - Staff Study (18.56 m2)

No Asbestos

B00D - R0005 - Toilets-Girls (18.5 m2)

No Asbestos

B00D - R0006 - Staff Kitchen (12.55 m2)

Floor Coverings Res/Textile Vinyl Sheet

8156/B00D/R0006/Floor Coverings Res/Textile/S4

No Asbestos Detected

B00D - R0007 - Pupil Entry (6.66 m2)

No Asbestos

B00D - R0008 - Pupil Entry (4.58 m2)

No Asbestos

B00D - R0009 - Distribution Board Cupboard (1.42 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00D - R0010 - Toilets-Disabled (4.25 m2)

No Asbestos

B00D - R0011 - Cleaning Store - Distributed (2.08 m2)

No Asbestos

B00D - R0012 - Toilets-Boys (12.36 m2)

No Asbestos

B00D - R0013 - Sport Equipment Store (28.28 m2)

No Asbestos

B00D - R0014 - Staff Shower (5.74 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R0015 - Sport Equipment Store (7.2 m2)						
No Asbestos						
B00D - R0016 - Pupil Entry (1.48 m2)						
No Asbestos						
B00D - R0017 - Shower/Change (31.58 m2)						
No Asbestos						
B00D - R0018 - Pupil Entry (5.9 m2)						
No Asbestos						
B00D - R0019 - Stage (78.13 m2)						
No Asbestos						
B00D - R0020 - Pupil Entry (6.01 m2)						
No Asbestos						
B00D - R0021 - Multi-Purpose Space (503.4 m2)						
No Asbestos						
B00D - R0022 - External Movement (10.63 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
		8156/B00D/R0027/Ceiling Structures/Linings/S31				No Asbestos Detected
B00D - R0023 - External Movement (10.85 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
		8156/B00D/R0027/Ceiling Structures/Linings/S31				No Asbestos Detected
B00D - R0024 - External Movement (10.6 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
		8156/B00D/R0027/Ceiling Structures/Linings/S31				No Asbestos Detected
B00D - R0025 - External Movement (10.66 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
		8156/B00D/R0027/Ceiling Structures/Linings/S31				No Asbestos Detected
B00D - R0026 - External Movement (32.97 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
		8156/B00D/R0027/Ceiling Structures/Linings/S31				No Asbestos Detected
B00D - R0027 - External Movement (10.64 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
		8156/B00D/R0027/Ceiling Structures/Linings/S31				No Asbestos Detected
B00D - R0028 - Stairs (0.79 m2)						
No Asbestos						
B00D - R0029 - Movement (1.98 m2)						
No Asbestos						
B00D - R0030 - Stairs (4.55 m2)						
No Asbestos						
B00D - R0031 - Stairs (5.58 m2)						
No Asbestos						
B00D - R0032 - Movement (4.36 m2)						
No Asbestos						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Agricultural Science - 1983 - Steel (Steel)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00F - R0001 - Agriculture Covered Area (25.26 m2)

No Asbestos

B00F - R0002 - Machine Storage (22.26 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Other-Community Use/Multi Purpose Facilities - 2006 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 8156/B00G/R0005/Wall Linings Internal/S38					No Asbestos Detected
Wall Cladding	Flat AC Sheeting 8156/B00G/R0005/Wall Linings Internal/S38					No Asbestos Detected
Ceiling Voids - Flat Roof	Asbestos Dust	0.5m2	Throughout	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
Assumed Asbestos - Area inaccessible. Associated with						
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

Interior

B00G - R0001 - External Movement (137.54 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8156/B00G/R0005/Wall Linings Internal/S38					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00G - R0002 - Other-Community Use (18.66 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8156/B00G/R0005/Wall Linings Internal/S38					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00G - R0003 - Sport Equipment Store (18.31 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8156/B00G/R0005/Wall Linings Internal/S38					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00G - R0004 - Other-Community Use (18.25 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8156/B00G/R0005/Wall Linings Internal/S38					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00G - R0005 - Other-Community Use (53.48 m2)

Wall Linings Internal	Flat AC Sheeting 8156/B00G/R0005/Wall Linings Internal/S38					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 8156/B00G/R0005/Wall Linings Internal/S38					No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet 8156/B00G/R0005/Partition Walls (Cubicles)/S39	15m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)						

B00G - R0006 - Other-Community Use (37.33 m2)

Wall Linings Internal	Flat AC Sheeting 8156/B00G/R0005/Wall Linings Internal/S38					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 8156/B00G/R0005/Wall Linings Internal/S38					No Asbestos Detected
Partition Walls (Cubicles)	Compressed AC Sheet 8156/B00G/R0005/Partition Walls (Cubicles)/S39	15m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)						

B00G - R0007 - Other-Community Use (38.1 m2)

Wall Linings Internal	Flat AC Sheeting 8156/B00G/R0005/Wall Linings Internal/S38					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 8156/B00G/R0005/Wall Linings Internal/S38					No Asbestos Detected

B00G - R0008 - Other-Community Use (29.68 m2)

Wall Linings Internal	Flat AC Sheeting 8156/B00G/R0005/Wall Linings Internal/S38					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 8156/B00G/R0005/Wall Linings Internal/S38					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0E1 - Science Learning - 1958 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting 8156/B0E1/R0002/Ceiling Structures/Linings/S10					No Asbestos Detected
Wall cladding - infill panels	Flat AC Sheeting 8156/B0E1/Wall cladding - infill panels/S33					No Asbestos Detected
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible						

Interior**B0E1 - R0001 - Laboratory L.S. (94.81 m2)**

Wall infill panels	Flat AC Sheeting 8156/B0E1/R0004/Wall infill panels/S32					No Asbestos Detected
--------------------	--	--	--	--	--	-----------------------------

B0E1 - R0002 - External Movement (41.3 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8156/B0E1/R0002/Ceiling Structures/Linings/S10					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B0E1 - R0003 - Staff Study (41.57 m2)

No Asbestos

B0E1 - R0004 - General Learning Space (53.5 m2)

Wall infill panels	Flat AC Sheeting 8156/B0E1/R0004/Wall infill panels/S32					No Asbestos Detected
--------------------	--	--	--	--	--	-----------------------------

B0E1 - R0005 - Laboratory L.S. (94.6 m2)

Wall infill panels	Flat AC Sheeting 8156/B0E1/R0004/Wall infill panels/S32					No Asbestos Detected
--------------------	--	--	--	--	--	-----------------------------

B0E1 - R0006 - Apparatus Store (16.11 m2)

No Asbestos

B0E1 - R0007 - Preparation (23.24 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0E2 - Technological & Applied Studies - 1958 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B0E2/R0004/Wall Linings Internal/S34					Chrysotile (white asbestos)
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	4m	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible					
Ceiling Voids	Non Accessible Area - Area inaccessible					

Interior**B0E2 - R0001 - Resource/Project Store (5.25 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	8156/B0E2/R0001/Floor Coverings Res/Textile/S6					No Asbestos Detected

B0E2 - R0002 - Materials Store (5.45 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	8156/B0E2/R0001/Floor Coverings Res/Textile/S6					No Asbestos Detected

B0E2 - R0003 - Staff Study (12.32 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B0E2/R0003/Floor Coverings Res/Textile/S35					No Asbestos Detected

B0E2 - R0004 - Pupil Entry (5.96 m2)

Wall Linings Internal	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B0E2/R0004/Wall Linings Internal/S34					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B0E2/R0004/Wall Linings Internal/S34					Chrysotile (white asbestos)

B0E2 - R0008 - Pupil Entry (1.74 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B0E2/R0004/Wall Linings Internal/S34					Chrysotile (white asbestos)

B0E2 - R0013 - Food Technology L.S. (71.36 m2)

Wall Linings Internal	Flat AC Sheeting	2m2	Behind heater	Good Condition (1)	Low (1)	Low Priority (2-3)
	8156/B0E2/R0013/Wall Linings Internal/S36					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Sheet					
	8156/B0E2/R0003/Floor Coverings Res/Textile/S35					No Asbestos Detected
Cupboards - Shelves covering	Bituminous membrane (felt)					
	8156/B0E2/R0013/Cupboards - Shelves covering/S37					No Asbestos Detected

B0E2 - R0014 - Materials Technology L.S. (57.91 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8156/B0E2/R0001/Floor Coverings Res/Textile/S6					No Asbestos Detected

B0E2 - R0016 - Food/Research Space (13.1 m2)

No Asbestos Found

B0E2 - R0017 - Pantry (7.5 m2)

No Asbestos Found

B0E2 - R0018 - Preparation - Materials (17.51 m2)

No Asbestos Found

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B0E2 - R0019 - Laundry (1.14 m2)						
No Asbestos Found						
B0E2 - R0020 - Food Technology L.S. (102.36 m2)						
No Asbestos Found						
B0E2 - R0021 - External Movement (67.02 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8156/B0E2/R0004/Wall Linings Internal/S34					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017