


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Liverpool Boys High School (8186)
Region : South Western Sydney
State Electorate : Liverpool
Local Government Area : Liverpool

Initial Survey : Noel Arnold & Associates : 31 - Mar - 2008
Reviewed By : Greencap-NAA : 26 - Aug - 2014

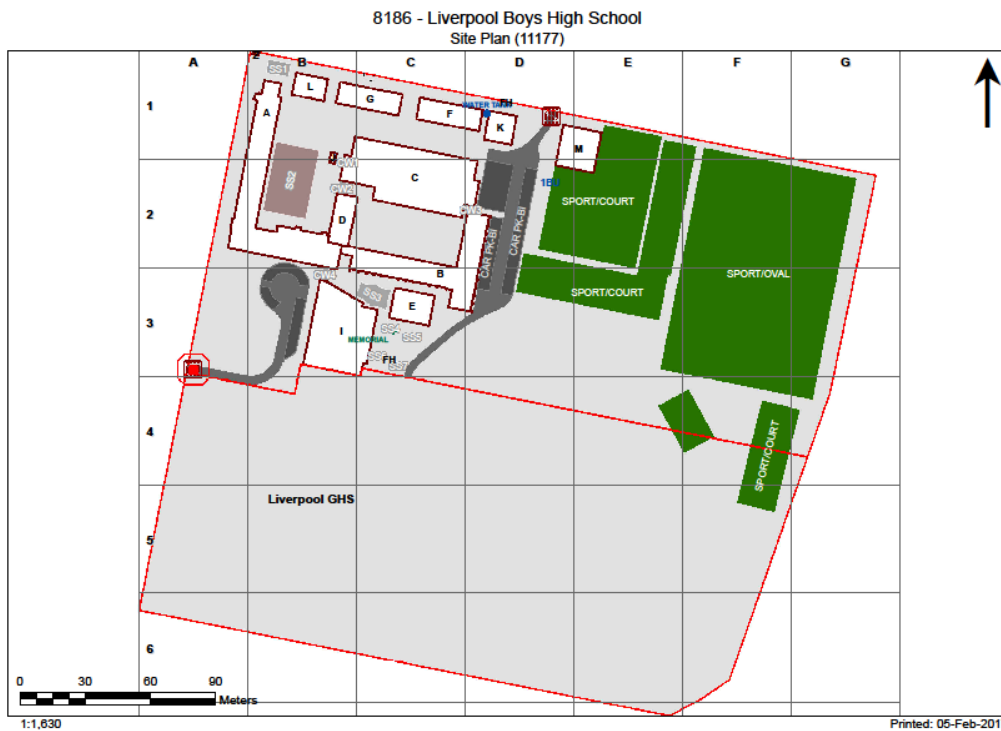

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning/Science Learning - 1955 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - Extreme Access Issue - Obstructed Area - To tight to access with ladder due to being in the middle of the room.					
Awnings outside basement Art Room	Flat AC Sheeting 8186/B00A/Awnings/S2				No Asbestos Detected	
Gable Verge Lining	Flat AC Sheeting	50m	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8186/B00F/Eaves Linings/S27				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Height Restriction - Extreme Access Issue - Obstructed Area - To tight to access with ladder due to being in the middle of the room.					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00A - R0001 - Staff Study (26.54 m2)	No Asbestos					
B00A - R0002 - Cleaning Store - Distributed (3.56 m2)	No Asbestos					
B00A - R0003 - Staff - Toilet (5.73 m2)	No Asbestos					
B00A - R0004 - General Storeroom (8.33 m2)	No Asbestos					
B00A - R0005 - General Learning Space (49.85 m2)	No Asbestos					
B00A - R0006 - General Learning Space (49.88 m2)	No Asbestos					
B00A - R0007 - General Learning Space (49.85 m2)	No Asbestos					
B00A - R0008 - General Learning Space (49.92 m2)	No Asbestos					
B00A - R0009 - General Learning Space (49.79 m2)	No Asbestos					
B00A - R0010 - General Learning Space (49.71 m2)	No Asbestos					
B00A - R0011 - Office/Store (17.17 m2)	No Asbestos					
B00A - R0012 - Movement (157.25 m2)	No Asbestos					
B00A - R0013 - Cleaning Store - Distributed (6.22 m2)	No Asbestos					
B00A - R0014 - Administration - Clerical (24.92 m2)	No Asbestos					
B00A - R0015 - Staff - Toilet (6.27 m2)	No Asbestos					
B00A - R0016 - Principal Office (24.62 m2)	No Asbestos					
B00A - R0017 - Leading Teacher (13.28 m2)	No Asbestos					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
No Asbestos						
B00A - R0018 - Staff - Toilet (6.03 m2)						
No Asbestos						
B00A - R0019 - Public Reception (107.35 m2)						
No Asbestos						
B00A - R0022 - Isolation Space (12.17 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8186/B00A/R0022/Floor Coverings Res/Textile/S13					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
	8186/B00A/R0022/Floor Coverings Res/Textile/S14					No Asbestos Detected
B00A - R0025 - Movement (18.31 m2)						
No Asbestos						
B00A - R0027 - Movement (6.57 m2)						
No Asbestos						
B00A - R0029 - Printing/Photocopying (33.54 m2)						
No Asbestos						
B00A - R0030 - Movement (49.25 m2)						
No Asbestos						
B00A - R0031 - External Movement (65.98 m2)						
Floor Coverings Res/Textile	Resinous Membrane					
	8186/B00A/R0031/Floor Coverings Res/Textile/S20					No Asbestos Detected
B00A - R0032 - External Movement (9.12 m2)						
No Asbestos						
B00A - R0034 - Stairs (11.07 m2)						
No Asbestos						
B00A - R0035 - Stairs (2.54 m2)						
No Asbestos						
B00A - R0036 - Stairs (2.24 m2)						
No Asbestos						
B00A - R0037 - Distribution Board Cupboard (0.64 m2)						Note: No inspection of live electrical installation.
No Asbestos						
B00A - R0038 - Handwashing Facilities (0.73 m2)						
No Asbestos						
B00A - R0039 - Student Waiting (19.28 m2)						
No Asbestos						
B00A - R0040 - Deputy Principal Office (15.46 m2)						
No Asbestos						
B00A - R0041 - Deputy Principal Office (15.94 m2)						
No Asbestos						
B00A - R0042 - General Storeroom (7.65 m2)						
No Asbestos						
B00A - R0043 - Movement (7.14 m2)						
No Asbestos						
B00A - R0044 - General Storeroom (5.25 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	5.25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8186/B00A/R0044/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive					
8186/B00A/R0044/Floor Coverings Res/Textile/S16					No Asbestos Detected	
B00A - R0045 - Archive Store (5.36 m2)						
No Asbestos						
B00A - R0046 - Staff Kitchen (9.87 m2)						
No Asbestos						
B00A - R0047 - Commonroom (84.75 m2)						
No Asbestos						
B00A - R0048 - Distribution Board Cupboard (0.41 m2)					Note: No inspection of live electrical installation.	
Electrical Backing Board	Resinous Board	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00A - R0049 - External Movement (1.7 m2)						
No Asbestos						
B00A - R0050 - External Movement (4.03 m2)						
No Asbestos						
B00A - R1001 - Cleaning Store - Distributed (3.61 m2)						
No Asbestos						
B00A - R1002 - Leading Teacher (26.56 m2)						
No Asbestos						
B00A - R1003 - Staff - Toilet (5.5 m2)						
No Asbestos						
B00A - R1004 - Resources Store (16.68 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
8186/B00A/R1004/Floor Coverings Res/Textile/S17					No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive					
8186/B00A/R1004/Floor Coverings Res/Textile/S18					No Asbestos Detected	
B00A - R1005 - Staff Study (52.27 m2)						
No Asbestos						
B00A - R1006 - General Learning Space (52.19 m2)						
No Asbestos						
B00A - R1007 - General Learning Space (52.18 m2)						
No Asbestos						
B00A - R1008 - General Learning Space (52.13 m2)						
No Asbestos						
B00A - R1009 - General Learning Space (52.27 m2)						
No Asbestos						
B00A - R1010 - General Learning Space (52.26 m2)						
No Asbestos						
B00A - R1011 - Resources Store (17.46 m2)						
No Asbestos						
B00A - R1012 - Interview/Office - Type 1 (13.86 m2)						
No Asbestos						
B00A - R1013 - Laboratory L.S. (103.16 m2)						
No Asbestos						
B00A - R1014 - Preparation - Science (33.16 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R1015 - Laboratory L.S. (101.86 m2)						
No Asbestos						
B00A - R1018 - General Storeroom (23.14 m2)						
No Asbestos						
B00A - R1019 - Computer Learning Space (66.77 m2)						
No Asbestos						
B00A - R1020 - Stairs (12.72 m2)						
No Asbestos						
B00A - R1021 - Stairs (11.32 m2)						
No Asbestos						
B00A - R1022 - Stairs (11.05 m2)						
No Asbestos						
B00A - R1023 - Handwashing Facilities (0.79 m2)						
No Asbestos						
B00A - R1024 - Movement (163.96 m2)						
No Asbestos						
B00A - R1025 - Movement (26.42 m2)						
No Asbestos						
B00A - R1026 - Movement (79.78 m2)						
No Asbestos						
B00A - R1027 - Staff Study (32.09 m2)						
No Asbestos						
B00A - R1028 - Tea Room (2.25 m2)						
No Asbestos						
B00A - R1029 - Movement (16.68 m2)						
No Asbestos						
B00A - R1030 - Handwashing Facilities (1.13 m2)						
No Asbestos						
B00A - R9001 - General Storeroom (3.23 m2)						
No Asbestos						
B00A - R9003 - Art Learning Space (106.42 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	108m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8186/B00A/R9003/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00A - R9004 - Art Learning Space (107.36 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	108m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8186/B00A/R9003/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00A - R9005 - Resources Store (10.34 m2)						
No Asbestos						
B00A - R9006 - Resources Store (11.07 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8186/B00A/R9003/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00A - R9007 - External Movement (52.22 m2)						
No Asbestos						
B00A - R9008 - Kiln Space (25.69 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8186/B00A/R9003/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00A - R9009 - Stairs (7.1 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00A - R9010 - Interview/Office - Type 1 (21.46 m2)

No Asbestos

B00A - R9011 - Tea Room (3.7 m2)

No Asbestos

B00A - R9012 - External Movement (2.62 m2)

Ceiling Structures/Linings Compressed AC Sheet
8186/B00A/R9012/Ceiling Structures/Linings/S19

No Asbestos Detected

B00A - R9013 - External Movement (2.62 m2)

Ceiling Structures/Linings Compressed AC Sheet
8186/B00A/R9012/Ceiling Structures/Linings/S19

No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Science Learning - 1955 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	Non Accessible Area - Area inaccessible

Interior

B00B - R0001 - Cleaning Store - Distributed (5.63 m2)

No Asbestos

B00B - R0002 - Distribution Board Cupboard (0.68 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0003 - Laboratory L.S. (92.87 m2)

Floor Coverings Res/Textile	Vinyl Tiles	94m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8186/B00B/R0003/Floor Coverings Res/Textile/S3						Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite	8186/B00B/R0003/Ceiling Structures/Linings/S21			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00B - R0004 - Preparation - Science (28.63 m2)

Ceiling Structures/Linings	Vermiculite	8186/B00B/R0003/Ceiling Structures/Linings/S21			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	29m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8186/B00B/R0003/Floor Coverings Res/Textile/S3						Chrysotile (white asbestos)

B00B - R0005 - Chemical Store (10.17 m2)

Ceiling Structures/Linings	Vermiculite	8186/B00B/R0003/Ceiling Structures/Linings/S21			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8186/B00B/R0003/Floor Coverings Res/Textile/S3						Chrysotile (white asbestos)

B00B - R0006 - Apparatus Store (26 m2)

Ceiling Structures/Linings	Vermiculite	8186/B00B/R0003/Ceiling Structures/Linings/S21			Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8186/B00B/R0003/Floor Coverings Res/Textile/S3						Chrysotile (white asbestos)

B00B - R0007 - Staff Shower (7.21 m2)

No Asbestos

B00B - R0008 - General Storeroom (0.98 m2)

No Asbestos

B00B - R0009 - Movement (7.96 m2)

No Asbestos

B00B - R0010 - Change (31.8 m2)

No Asbestos

B00B - R0011 - Toilets-Boys (37.82 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8186/B00B/R0011/Partition Walls (Cubicles)/S8						Chrysotile (white asbestos)

B00B - R0012 - Change (31.72 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00B - R0013 - Staff - Toilet (5.69 m2)						
No Asbestos						
B00B - R0014 - Distribution Board Cupboard (0.62 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B00B - R0015 - Resources Store (11.95 m2)						
Ceiling Structures/Linings	Vermiculite					
	8186/B00B/R0003/Ceiling Structures/Linings/S21					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0017 - Laboratory L.S. (92.85 m2)						
Ceiling Structures/Linings	Vermiculite					
	8186/B00B/R0003/Ceiling Structures/Linings/S21					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	93m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8186/B00B/R0003/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
Fume Cupboard	Flat AC Sheeting	1Unit	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8186/B00B/R0017/Fume Cupboard/S4					Chrysotile (white asbestos)
B00B - R0020 - Laboratory L.S. (92.98 m2)						
Ceiling Structures/Linings	Vermiculite					
	8186/B00B/R0003/Ceiling Structures/Linings/S21					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	94m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8186/B00B/R0003/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
B00B - R0021 - Distribution Board Cupboard (0.68 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B00B - R0022 - Cleaning Store - Distributed (5.6 m2)						
No Asbestos						
B00B - R0025 - General Storeroom (7.51 m2)						
No Asbestos						
B00B - R0026 - External Movement (18.2 m2)						
No Asbestos						
B00B - R0027 - Movement (11.89 m2)						
No Asbestos						
B00B - R0028 - Movement (11.65 m2)						
No Asbestos						
B00B - R0029 - Movement (11.57 m2)						
No Asbestos						
B00B - R0030 - Stairs (9.71 m2)						
No Asbestos						
B00B - R0031 - Stairs (10.01 m2)						
No Asbestos						
B00B - R0032 - Stairs (9.94 m2)						
No Asbestos						
B00B - R0033 - Preparation - Science (39.36 m2)						
Ceiling Structures/Linings	Vermiculite					
	8186/B00B/R0003/Ceiling Structures/Linings/S21					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	39.35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8186/B00B/R0003/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00B - R0034 - Staff Study (12.96 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8186/B00B/R0003/Ceiling Structures/Linings/S21					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	12.96m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8186/B00B/R0003/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00B - R0035 - Tea Room (13.55 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8186/B00B/R0003/Ceiling Structures/Linings/S21					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	13.54m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8186/B00B/R0003/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00B - R0036 - Movement (22.45 m2)						
Infill panels	Flat AC Sheeting					No Asbestos Detected
8186/B00B/R0036/Infill panels/S22						
B00B - R0037 - External Movement (189.22 m2)						
No Asbestos						
B00B - R1001 - Distribution Board Cupboard (0.67 m2)						
No Asbestos						
Note: No inspection of live electrical installation.						
B00B - R1002 - General Learning Space (52.65 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8186/B00B/R0003/Ceiling Structures/Linings/S21					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00B - R1003 - General Learning Space (52.72 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8186/B00B/R0003/Ceiling Structures/Linings/S21					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00B - R1004 - Resources Store (6.19 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8186/B00B/R0003/Ceiling Structures/Linings/S21					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00B - R1005 - Resources Store (6.25 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8186/B00B/R0003/Ceiling Structures/Linings/S21					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00B - R1006 - General Learning Space (52.72 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8186/B00B/R0003/Ceiling Structures/Linings/S21					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00B - R1007 - General Learning Space (52.21 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8186/B00B/R0003/Ceiling Structures/Linings/S21					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00B - R1008 - General Learning Space (52.25 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8186/B00B/R0003/Ceiling Structures/Linings/S21					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00B - R1009 - General Storeroom (6.28 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8186/B00B/R0003/Ceiling Structures/Linings/S21					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1010 - Cleaning Store - Distributed (6.23 m2)						
Ceiling Structures/Linings	Vermiculite					
	8186/B00B/R0003/Ceiling Structures/Linings/S21					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1012 - Resources Store (20.14 m2)						
Ceiling Structures/Linings	Vermiculite					
	8186/B00B/R0003/Ceiling Structures/Linings/S21					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1013 - Distribution Board Cupboard (0.69 m2)						
					Note: No inspection of live electrical installation.	
No Asbestos						
B00B - R1014 - Resources Store (12.3 m2)						
Ceiling Structures/Linings	Vermiculite					
	8186/B00B/R0003/Ceiling Structures/Linings/S21					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Sheet					
	8186/B00B/R1014/Floor Coverings Res/Textile/S23					No Asbestos Detected
B00B - R1015 - Computer Learning Space (52.8 m2)						
Ceiling Structures/Linings	Vermiculite					
	8186/B00B/R0003/Ceiling Structures/Linings/S21					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1016 - Staff Study (26.18 m2)						
Ceiling Structures/Linings	Vermiculite					
	8186/B00B/R0003/Ceiling Structures/Linings/S21					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	26.17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8186/B00B/R0003/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
B00B - R1018 - Staff Study (26.07 m2)						
Ceiling Structures/Linings	Vermiculite					
	8186/B00B/R0003/Ceiling Structures/Linings/S21					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	26.06m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8186/B00B/R0003/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
B00B - R1019 - Careers Advisers Office (12.14 m2)						
Ceiling Structures/Linings	Vermiculite					
	8186/B00B/R0003/Ceiling Structures/Linings/S21					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1020 - Interview/Office - Type 1 (12.78 m2)						
Ceiling Structures/Linings	Vermiculite					
	8186/B00B/R0003/Ceiling Structures/Linings/S21					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1021 - Staff - Toilet (5.13 m2)						
No Asbestos						
B00B - R1022 - Clinic - Boys (5.88 m2)						
Ceiling Structures/Linings	Vermiculite					
	8186/B00B/R0003/Ceiling Structures/Linings/S21					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1023 - Administration - Clerical (16.82 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings Vermiculite
 8186/B00B/R0003/Ceiling Structures/Linings/S21 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R1024 - Leading Teacher (8.56 m2)

Ceiling Structures/Linings Vermiculite
 8186/B00B/R0003/Ceiling Structures/Linings/S21 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R1025 - Distribution Board Cupboard (0.72 m2) Note: No inspection of live electrical installation.

No Asbestos

B00B - R1027 - Stairs (17.71 m2)

No Asbestos

B00B - R1028 - Stairs (17.74 m2)

No Asbestos

B00B - R1029 - Stairs (17.91 m2)

No Asbestos

B00B - R1030 - Staff Study (62.54 m2)

Ceiling Structures/Linings Vermiculite
 8186/B00B/R0003/Ceiling Structures/Linings/S21 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles 52.51m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)
 8186/B00B/R0003/Floor Coverings Res/Textile/S3 **Chrysotile (white asbestos)**

B00B - R1031 - Tea Room (2.96 m2)

Ceiling Structures/Linings Vermiculite
 8186/B00B/R0003/Ceiling Structures/Linings/S21 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles 2.96m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)
 8186/B00B/R0003/Floor Coverings Res/Textile/S3 **Chrysotile (white asbestos)**

B00B - R1032 - Handwashing Facilities (0.49 m2)

No Asbestos

B00B - R1033 - Student Waiting (14.17 m2)

Thermacon Heater Encapsulated Insulation material within unit 1Unit Northeast Good Condition (1) Low (1) Low Priority (2-3)
Assumed Asbestos - Area inaccessible

B00B - R1034 - External Movement (252.78 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Technological & Applied Studies/Pupil Facilities - 1955 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Roof	Non Accessible Area - Area inaccessible

Interior

B00C - R0002 - Archive Store (24.37 m2)

No Asbestos

B00C - R0005 - Main Switchroom (24.17 m2)

No Asbestos

B00C - R0006 - General Storeroom (70.58 m2)

No Asbestos

B00C - R0007 - General Storeroom (59.83 m2)

No Asbestos

B00C - R0008 - General Storeroom (6.65 m2)

No Asbestos

B00C - R0009 - General Storeroom (6.23 m2)

No Asbestos

B00C - R0010 - General Storeroom (13.67 m2)

No Asbestos

B00C - R0012 - Garden Store Room (25.16 m2)

No Asbestos

B00C - R0014 - Staff Study (38.61 m2)

No Asbestos

B00C - R0019 - Sport Equipment Store (13.98 m2)

Floor Coverings Res/Textile	Vinyl Tiles	
	8186/B00C/R1024/Floor Coverings Res/Textile/S5	No Asbestos Detected

B00C - R0021 - General Storeroom (6.44 m2)

No Asbestos

B00C - R0022 - Staff - Toilet (3.52 m2)

No Asbestos

B00C - R0023 - Cleaning Store - Distributed (1.54 m2)

No Asbestos

B00C - R0024 - Pantry (12.35 m2)

No Asbestos

B00C - R0025 - General Assistants (64.97 m2)

No Asbestos

B00C - R0026 - General Storeroom (11.79 m2)

No Asbestos

B00C - R0027 - Staff Study (19.27 m2)

No Asbestos

B00C - R0028 - Movement (4.34 m2)

No Asbestos

B00C - R0030 - Staff Study (35.16 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0031 - Sport Equipment Store (20.87 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8186/B00C/R0031/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00C - R0032 - Sport Equipment Store (5.44 m2)						
No Asbestos						
B00C - R0033 - Staff - Toilet (1.61 m2)						
No Asbestos						
B00C - R0034 - Fitness Laboratory (83.87 m2)						
No Asbestos						
B00C - R0035 - Dark Room (7.82 m2)						
No Asbestos						
B00C - R0037 - External Movement (259.82 m2)						
No Asbestos						
B00C - R0038 - Movement (199.01 m2)						
No Asbestos						
B00C - R0039 - General Storeroom (3.58 m2)						
No Asbestos						
B00C - R0040 - Food Technology L.S. (105.54 m2)						
No Asbestos						
B00C - R0041 - Pantry (6.84 m2)						
No Asbestos						
B00C - R0044 - Art Learning Space (48.83 m2)						
No Asbestos						
B00C - R0045 - Darkroom Space (0.82 m2)						
No Asbestos						
B00C - R0046 - Dark Room (8.84 m2)						
No Asbestos						
B00C - R0047 - Resources Store (7.82 m2)						
No Asbestos						
B00C - R0048 - General Storeroom (12.81 m2)						
No Asbestos						
B00C - R0049 - Computer Store (13.38 m2)						
No Asbestos						
B00C - R0050 - Student Canteen (96.71 m2)						
No Asbestos						
B00C - R0051 - General Storeroom (26.09 m2)						
No Asbestos						
B00C - R0052 - Bulk Store (11.53 m2)						
No Asbestos						
B00C - R0053 - External Movement (28.74 m2)						
No Asbestos						
B00C - R0054 - External Movement (35.5 m2)						
No Asbestos						
B00C - R1001 - Staff - Toilet (7.04 m2)						
No Asbestos						
B00C - R1003 - Cleaning Store - Distributed (3.61 m2)						
No Asbestos						
B00C - R1004 - Computer Room (10.38 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
No Asbestos						
B00C - R1005 - Resources Store (16.97 m2)						
Wall Linings Internal	Flat AC Sheeting	7m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8186/B00C/R1006/Wall Linings Internal/S24				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R1006 - Design L.S. (82 m2)						
Wall Linings Internal	Flat AC Sheeting	15m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8186/B00C/R1006/Wall Linings Internal/S24				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R1007 - Resources Store (16.8 m2)						
Wall Linings Internal	Flat AC Sheeting	15m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8186/B00C/R1006/Wall Linings Internal/S24				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R1008 - Class Tools Storage (10.36 m2)						
Wall Linings Internal	Flat AC Sheeting	15m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8186/B00C/R1006/Wall Linings Internal/S24				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R1009 - Wood Technology L.S. (110.66 m2)						
No Asbestos						
B00C - R1010 - Resources Store (16.83 m2)						
Wall Linings Internal	Flat AC Sheeting	8m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8186/B00C/R1006/Wall Linings Internal/S24				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R1011 - Resources Store (10.36 m2)						
Wall Linings Internal	Flat AC Sheeting	7m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8186/B00C/R1006/Wall Linings Internal/S24				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R1012 - Design L.S. (53.58 m2)						
Wall Linings Internal	Flat AC Sheeting	53.56m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8186/B00C/R1006/Wall Linings Internal/S24				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R1013 - Computer Learning Space (57.18 m2)						
No Asbestos						
B00C - R1014 - Project Store - Type 1 (27.62 m2)						
No Asbestos						
B00C - R1016 - Materials Store (15.81 m2)						
No Asbestos						
B00C - R1017 - Resources Store (10.23 m2)						
No Asbestos						
B00C - R1022 - Bulk Store (21.65 m2)						
Wall Linings Internal	Flat AC Sheeting	15m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8186/B00C/R1006/Wall Linings Internal/S24				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R1023 - Tiered Learning Area (60.64 m2)						
No Asbestos						
B00C - R1024 - Resources Store (10.39 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	7m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8186/B00C/R1006/Wall Linings Internal/S24				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R1026 - Handwashing Facilities (0.96 m2)

No Asbestos

B00C - R1027 - Handwashing Facilities (0.95 m2)

No Asbestos

B00C - R1029 - Wood Technology L.S. (104.8 m2)

Wall Linings Internal	Flat AC Sheeting	15m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8186/B00C/R1006/Wall Linings Internal/S24				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R1030 - Dust Extraction Space (3.81 m2)

No Asbestos

B00C - R1031 - Staff Study (11.59 m2)

No Asbestos

B00C - R1032 - Staff Study (29.06 m2)

No Asbestos

B00C - R1033 - Tea Room (3.63 m2)

No Asbestos

B00C - R1034 - Movement (71.12 m2)

No Asbestos

B00C - R1035 - Metal Technology L.S. (119.94 m2)

No Asbestos

B00C - R1036 - Welding Area (19.16 m2)

No Asbestos

B00C - R1037 - External Movement (31.98 m2)

No Asbestos

B00C - R1038 - Movement (82.89 m2)

No Asbestos

B00C - R1039 - External Movement (31.34 m2)

No Asbestos

B00C - R1040 - Wood Technology L.S. (110 m2)

No Asbestos

B00C - R1041 - Materials Store (21.21 m2)

No Asbestos

B00C - R1042 - Dust Extraction Space (4.93 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1955 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior**B00D - R0003 - External Movement (6.02 m2)**

No Asbestos

B00D - R0004 - Movement (4.05 m2)

No Asbestos

B00D - R0005 - External Movement (14.11 m2)

No Asbestos

B00D - R0006 - Toilets-Boys (5.3 m2)

No Asbestos

B00D - R0007 - Toilets-Disabled (9.85 m2)

No Asbestos

B00D - R0008 - Toilets-Boys (85.32 m2)

No Asbestos

B00D - R0009 - General Storeroom (9.77 m2)

No Asbestos

B00D - R0010 - Plant (1.33 m2)

No Asbestos

B00D - R0011 - External Movement (60.13 m2)

No Asbestos

B00D - R1001 - Movement (135.03 m2)

No Asbestos

B00D - R1002 - Movement (65.14 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Music - 1993 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00E - R0001 - External Movement (35.38 m2)**

No Asbestos

B00E - R0003 - Practice/Seminar (11.83 m2)

No Asbestos

B00E - R0004 - Practice/Seminar (11.96 m2)

No Asbestos

B00E - R0005 - Music Learning Space (59.35 m2)Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found**B00E - R0006 - Music Store (16.88 m2)**

No Asbestos

B00E - R0007 - Practice/Seminar (26.25 m2)Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found**B00E - R0008 - Music Learning Space (77.08 m2)**Vinyl Tiles (Under Floor
Covering/Carpet) No Asbestos Found

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1955 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	50m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8186/B00F/Eaves Linings/S27					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8186/B00F/Eaves Linings/S27					Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found					
Ceiling Voids	Non Accessible Area - Area inaccessible					

Interior**B00F - R0001 - Resources Store (5.59 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8186/B00F/R0002/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)

B00F - R0002 - External Movement (64.3 m2)

Ceiling Structures/Linings	Flat AC Sheeting	62m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8186/B00F/R0002/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)

B00F - R0006 - General Learning Space (52.79 m2)

Ceiling Structures/Linings	Flat AC Sheeting	54m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8186/B00F/R0002/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)

B00F - R0007 - General Learning Space (159.52 m2)

Recently Modified Space	Requires Inspection					
-------------------------	---------------------	--	--	--	--	--

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1955 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	No Asbestos Found
Underfloor Voids	No Asbestos Found
Gable Verge Lining	No Asbestos Found

Interior

B00G - R0001 - General Learning Space (63.54 m2)

No Asbestos

B00G - R0002 - Resources Store (5.85 m2)

No Asbestos

B00G - R0003 - General Learning Space (52.07 m2)

No Asbestos

B00G - R0006 - Resources Store (5.62 m2)

No Asbestos

B00G - R0007 - External Movement (44.47 m2)

Ceiling Structures/Linings	Flat AC Sheeting	44m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	--------------	--------------------	---------	--------------------

8186/B00G/R0007/Ceiling Structures/Linings/S6

Chrysotile (white asbestos)

B00G - R0008 - General Learning Space (52.21 m2)

No Asbestos

B00G - R0009 - General Learning Space (52.72 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Library/Multi Purpose Facilities - 1955 - Brick/Block (Brick/Block)

Exterior

Gable Verge Lining	Flat AC Sheeting	40m	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8186/B00F/Eaves Linings/S27					Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Area inaccessible					

Interior

B00I - M1001 - General Storeroom (6.15 m2)

No Asbestos

B00I - R0001 - Movement (131.21 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8186/B00I/R0001/Ceiling Structures/Linings/S28					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00I - R0002 - Chair Store (27.75 m2)

Loose panel near door	Flat AC Sheeting					No Asbestos Detected
	8186/B00I/R0002/Loose Cement Panel near door/S10					

B00I - R0003 - Distribution Board Cupboard (0.5 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00I - R0004 - Toilets-Boys (5.58 m2)

No Asbestos

B00I - R0005 - Toilets-Girls (7.13 m2)

No Asbestos

B00I - R0009 - Cleaning Store - Distributed (8.6 m2)

No Asbestos

B00I - R0012 - Librarian (13.88 m2)

No Asbestos

B00I - R0013 - Library Administration (17.82 m2)

No Asbestos

B00I - R0014 - Plant (31.86 m2)

No Asbestos

B00I - R0015 - Movement (2 m2)

No Asbestos

B00I - R0016 - External Movement (8.71 m2)

No Asbestos

B00I - R0017 - Study Space (12.1 m2)

No Asbestos

B00I - R0018 - Study Space (13.1 m2)

No Asbestos

B00I - R0019 - Stairs (2.36 m2)

No Asbestos

B00I - R0022 - Study Space (10.61 m2)

No Asbestos

B00I - R0023 - Main Area (465.05 m2)

No Asbestos

B00I - R0024 - External Movement (17.8 m2)

No Asbestos

B00I - R0025 - External Movement (4.33 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
	No Asbestos					
	B00I - R0026 - Movement (2.33 m2)					
	No Asbestos					
	B00I - R0027 - Stairs (6.24 m2)					
	No Asbestos					
	B00I - R0029 - Library Administration (50.6 m2)					
	No Asbestos					
	B00I - R0030 - Audio Visual Workroom (37.83 m2)					
	No Asbestos					
	B00I - R0031 - General Storeroom (19.69 m2)					
	No Asbestos					
	B00I - R0032 - Senior Study (26.12 m2)					
	No Asbestos					
	B00I - R1001 - Staff Kitchen (6.57 m2)					
	No Asbestos					
	B00I - R1002 - Movement (39.65 m2)					
	No Asbestos					
	B00I - R1003 - Multi-Purpose Space (293.29 m2)					
	No Asbestos					
	B00I - R1004 - Stage (78.36 m2)					
	No Asbestos					
	B00I - R1005 - Movement (19.61 m2)					
	No Asbestos					
	B00I - R1006 - Toilets-Girls (21.53 m2)					
	No Asbestos					
	B00I - R1007 - Toilets-Boys (19.47 m2)					
	No Asbestos					
	B00I - R1008 - Movement (3.24 m2)					
	No Asbestos					
	B00I - R1009 - External Movement (113.57 m2)					
	No Asbestos					
	B00I - R1010 - External Movement (9.48 m2)					
	No Asbestos					
	B00I - R1011 - Stairs (3.89 m2)					
	No Asbestos					
	B00I - R1012 - Movement (1.59 m2)					
	No Asbestos					
	B00I - R1013 - Stairs (14.67 m2)					
	No Asbestos					
	B00I - R1014 - Stairs (2.6 m2)					
	No Asbestos					
	B00I - R2001 - Control Room (43.46 m2)					
	No Asbestos					
	B00I - R2002 - Movement (1.47 m2)					
	No Asbestos					
	B00I - R2003 - Stairs (3.84 m2)					
	No Asbestos					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Building Services - 1955 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - Area inaccessible
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B00J - R0001 - General Storeroom (5.6 m2)

No Asbestos

B00J - R0002 - Cleaning Store - Distributed (3.95 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Language Centre - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids - Raked Ceiling Non Accessible Area
 - Area inaccessible

Interior

B00K - R0001 - Computer Learning Space (91.81 m2)

No Asbestos

B00K - R0002 - Seminar - Type 2 (18.78 m2)

No Asbestos

B00K - R0003 - Resources Store (10.05 m2)

No Asbestos

B00K - R0004 - Computer Store (9.4 m2)

No Asbestos

B00K - R0005 - External Movement (27.12 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Performance Learning - 2008 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids No Asbestos Found

Ceiling Voids - Raked Ceiling No Asbestos Found

Interior

B00L - R0001 - Performance Workspace (122.47 m2)

No Asbestos

B00L - R0002 - Resources Store (4.87 m2)

No Asbestos

B00L - R0003 - External Movement (21.8 m2)

Verandah	Compressed AC Sheet 8186/B00L/R0003/Verandah/S25	No Asbestos Detected
----------	---	-----------------------------

Ceiling Structures/Linings	Flat AC Sheeting 8186/B00L/R0003/Ceiling Structures/Linings/S26	No Asbestos Detected
----------------------------	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Technological & Applied Studies/Mechanical Service - 2014 - Steel (Steel)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00M - R0001 - Workshop (264.81 m2)

No Asbestos

B00M - R0002 - External Movement (72.26 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Z - Building Services - 1955 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - Area inaccessible
Underfloor Voids	Non Accessible Area - Area inaccessible

Interior

B00Z - R0001 - Plant (2.84 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017