


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Lake Macquarie High School (8210)  
**Region :** Hunter/Central Coast  
**State Electorate :** Lake Macquarie  
**Local Government Area :** Lake Macquarie

**Initial Survey :** Noel Arnold & Associates : 23 - May - 2008  
**Reviewed By :** Grencap-NAA : 26 - Mar - 2015

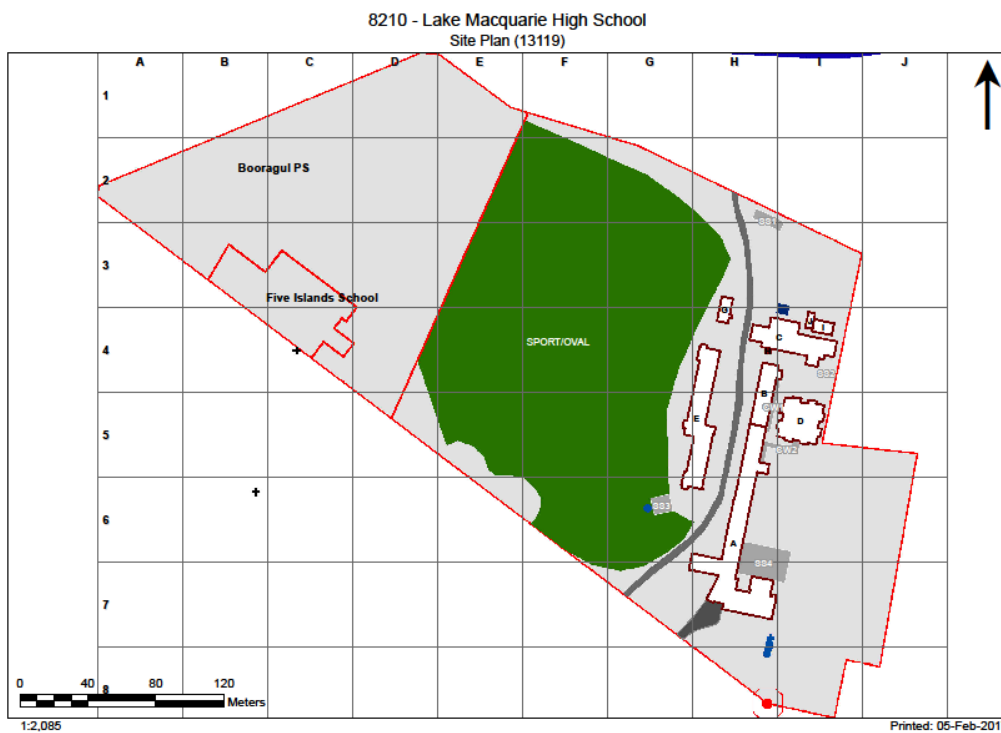

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00A - Various - 1958 - Brick/Block (Brick/Block)****Exterior**

|  |  |       |                    |                            |   |                       |
|--|--|-------|--------------------|----------------------------|---|-----------------------|
| Eaves Linings                              | Flat AC Sheeting   | 150m2 | Throughout         | Good Condition (1)         | Low (1)   | Low Priority (2-3)    |
|  | 8210/B00A/Eaves Linings/S10                              |       |                    |                            | <b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b> |                       |
| Ceiling Voids                              | No Asbestos Found  |       |                    |                            |   |                       |
| Underfloor Voids - Packing to Floor Joists | Flat AC Sheeting   | 5m2   | Variable positions | Some Damage - Unsealed (3) | Low (1)   | Medium Priority (4-5) |
|  | 8210/B00C/Underfloor Voids - Packing to Floor Joists/S19 |       |                    |                            | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>                               |                       |

**Interior****B00A - R0001 - Movement (118.08 m2)**

No Asbestos

**B00A - R0002 - Toilets-Girls (32.41 m2)**

No Asbestos

**B00A - R0003 - Cleaning Store - Distributed (1.25 m2)**

No Asbestos

**B00A - R0004 - General Storeroom (3.42 m2)**

No Asbestos

**B00A - R0005 - Garden Store Room (13.88 m2)**

No Asbestos

**B00A - R0006 - Movement (149.27 m2)**

No Asbestos

**B00A - R0007 - General Storeroom (1.97 m2)**

|                       |  |  |  |  |                             |  |
|-----------------------|--|--|--|--|-----------------------------|--|
| Wall Linings Internal | Flat AC Sheeting                         |  |  |  |                             |  |
|                       | 8210/B00A/R0007/Wall Linings Internal/S9 |  |  |  | <b>No Asbestos Detected</b> |  |

**B00A - R0008 - Multi-Purpose Space (10.91 m2)**

|                       |  |  |  |  |                             |  |
|-----------------------|--|--|--|--|-----------------------------|--|
| Wall Linings Internal | Flat AC Sheeting                         |  |  |  |                             |  |
|                       | 8210/B00A/R0007/Wall Linings Internal/S9 |  |  |  | <b>No Asbestos Detected</b> |  |

**B00A - R0009 - Staff - Toilet (2.91 m2)**

No Asbestos

**B00A - R0010 - Student Canteen (49.12 m2)**

No Asbestos

**B00A - R0011 - Movement (192.54 m2)**

No Asbestos

**B00A - R0012 - Toilets-Boys (50.03 m2)**

No Asbestos

**B00A - R0013 - Performance Workspace (71.09 m2)**

|                             |  |      |            |                    |                                    |                    |
|-----------------------------|--|------|------------|--------------------|------------------------------------|--------------------|
| Floor Coverings Res/Textile | Vinyl Tiles (Under Floor Covering/Carpet)      | 72m2 | Throughout | Minimal Damage (2) | Low (1)                            | Low Priority (2-3) |
|                             | 8210/B00A/R0013/Floor Coverings Res/Textile/S7 |      |            |                    | <b>Chrysotile (white asbestos)</b> |                    |
| Floor Coverings Res/Textile | Adhesive                                       |      |            |                    |                                    |                    |
|                             | 8210/B00A/R0013/Floor Coverings Res/Textile/S8 |      |            |                    | <b>No Asbestos Detected</b>        |                    |

**B00A - R0014 - Distribution Board Cupboard (5.62 m2)**

Note: No inspection of live electrical installation.

|                          |                |     |      |                    |         |                    |
|--------------------------|----------------|-----|------|--------------------|---------|--------------------|
| Electrical Backing Board | Resinous Board | 1m2 | West | Good Condition (1) | Low (1) | Low Priority (2-3) |
|--------------------------|----------------|-----|------|--------------------|---------|--------------------|

**Assumed Asbestos - Electrical Hazard****B00A - R0015 - Cleaning Supplies Store (6.13 m2)**

No Asbestos

**B00A - R0016 - Cleaning Store - Distributed (6.28 m2)**

| Product  | Material Description                            | Extent | Location Reference | Material Condition | Risk Status   | Control Priority   |
|--|---|--------|--------------------|--------------------|---|--------------------|
| Sample No  |   |        |                    |                    | Test Result   |                    |
| No Asbestos  |   |        |                    |                    |   |                    |
| <b>B00A - R0017 - General Storeroom (11.79 m2)</b>       |   |        |                    |                    |   |                    |
| No Asbestos  |   |        |                    |                    |   |                    |
| <b>B00A - R0018 - Multi-Purpose Space (70.64 m2)</b>     |   |        |                    |                    |   |                    |
| No Asbestos  |   |        |                    |                    |   |                    |
| <b>B00A - R0019 - Cleaning Supplies Store (11.43 m2)</b> |   |        |                    |                    |   |                    |
| No Asbestos  |   |        |                    |                    |   |                    |
| <b>B00A - R0020 - General Storeroom (50.2 m2)</b>        |   |        |                    |                    |   |                    |
| No Asbestos  |   |        |                    |                    |   |                    |
| <b>B00A - R0021 - Stairs (0.41 m2)</b>                   |   |        |                    |                    |   |                    |
| No Asbestos  |   |        |                    |                    |   |                    |
| <b>B00A - R0022 - Stairs (8.13 m2)</b>                   |   |        |                    |                    |   |                    |
| No Asbestos  |   |        |                    |                    |   |                    |
| <b>B00A - R0023 - Movement (5.12 m2)</b>                 |   |        |                    |                    |   |                    |
| No Asbestos  |   |        |                    |                    |   |                    |
| <b>B00A - R0024 - Movement (2.19 m2)</b>                 |   |        |                    |                    |   |                    |
| No Asbestos  |   |        |                    |                    |   |                    |
| <b>B00A - R0025 - Movement (2.2 m2)</b>                  |   |        |                    |                    |   |                    |
| No Asbestos  |   |        |                    |                    |   |                    |
| <b>B00A - R0026 - Movement (16.33 m2)</b>                |   |        |                    |                    |   |                    |
| No Asbestos  |   |        |                    |                    |   |                    |
| <b>B00A - R0027 - Movement (11.04 m2)</b>                |   |        |                    |                    |   |                    |
| In-fill-panel  | Flat AC Sheeting                                | 30m    | West               | Good Condition (1) | Low (1)   | Low Priority (2-3) |
|  | 8210/B00C/Eaves Linings/S1                      |        |                    |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |                    |
| <b>B00A - R0028 - General Storeroom (70.83 m2)</b>       |   |        |                    |                    |   |                    |
| No Asbestos  |   |        |                    |                    |   |                    |
| <b>B00A - R1001 - Computer Learning Space (56.81 m2)</b> |   |        |                    |                    |   |                    |
| Floor Coverings Res/Textile                              | Vinyl Tiles (Under Floor Covering/Carpet)       | 57m2   | Throughout         | Minimal Damage (2) | Low (1)   | Low Priority (2-3) |
|  | 8210/B00A/R0013/Floor Coverings Res/Textile/S7  |        |                    |                    | <b>Chrysotile (white asbestos)</b>                            |                    |
| Floor Coverings Res/Textile                              | Adhesive  |        |                    |                    |   |                    |
|  | 8210/B00A/R0013/Floor Coverings Res/Textile/S8  |        |                    |                    | <b>No Asbestos Detected</b>                                   |                    |
| <b>B00A - R1002 - Staff Study (38.1 m2)</b>              |   |        |                    |                    |   |                    |
| Floor Coverings Res/Textile                              | Vinyl Tiles (Under Floor Covering/Carpet)       | 39m2   | Throughout         | Minimal Damage (2) | Low (1)   | Low Priority (2-3) |
|  | 8210/B00A/R0013/Floor Coverings Res/Textile/S7  |        |                    |                    | <b>Chrysotile (white asbestos)</b>                            |                    |
| Floor Coverings Res/Textile                              | Adhesive  |        |                    |                    |   |                    |
|  | 8210/B00A/R0013/Floor Coverings Res/Textile/S8  |        |                    |                    | <b>No Asbestos Detected</b>                                   |                    |
| <b>B00A - R1003 - Staff Study (18.32 m2)</b>             |   |        |                    |                    |   |                    |
| Floor Coverings Res/Textile                              | Vinyl Sheet                                     |        |                    |                    |   |                    |
|  | 8210/B00A/R1034/Floor Coverings Res/Textile/S12 |        |                    |                    | <b>No Asbestos Detected</b>                                   |                    |
| Floor Coverings Res/Textile                              | Backing   |        |                    |                    |   |                    |
|  | 8210/B00A/R1034/Floor Coverings Res/Textile/S13 |        |                    |                    | <b>No Asbestos Detected</b>                                   |                    |
| <b>B00A - R1004 - Staff Study (34.55 m2)</b>             |   |        |                    |                    |   |                    |
| Floor Coverings Res/Textile                              | Vinyl Tiles (Under Floor Covering/Carpet)       | 35m2   | Throughout         | Minimal Damage (2) | Low (1)   | Low Priority (2-3) |
|  | 8210/B00A/R0013/Floor Coverings Res/Textile/S7  |        |                    |                    | <b>Chrysotile (white asbestos)</b>                            |                    |

| Product   | Material Description                           | Extent | Location Reference | Material Condition | Risk Status | Control Priority                   |
|---|--|--------|--------------------|--------------------|-------------|------------------------------------|
| Sample No   |  |        |                    |                    | Test Result |                                    |
| Floor Coverings Res/Textile                             | Adhesive                                       |        |                    |                    |             |                                    |
|   | 8210/B00A/R0013/Floor Coverings Res/Textile/S8 |        |                    |                    |             | <b>No Asbestos Detected</b>        |
| <b>B00A - R1005 - Staff - Toilet (4.97 m2)</b>          |  |        |                    |                    |             |                                    |
| No Asbestos   |  |        |                    |                    |             |                                    |
| <b>B00A - R1006 - Cleaning Supplies Store (3.52 m2)</b> |  |        |                    |                    |             |                                    |
| No Asbestos   |  |        |                    |                    |             |                                    |
| <b>B00A - R1007 - General Storeroom (8.55 m2)</b>       |  |        |                    |                    |             |                                    |
| No Asbestos   |  |        |                    |                    |             |                                    |
| <b>B00A - R1008 - General Learning Space (50.33 m2)</b> |  |        |                    |                    |             |                                    |
| Floor Coverings Res/Textile                             | Vinyl Tiles (Under Floor Covering/Carpet)      | 51m2   | Throughout         | Minimal Damage (2) | Low (1)     | Low Priority (2-3)                 |
|   | 8210/B00A/R0013/Floor Coverings Res/Textile/S7 |        |                    |                    |             | <b>Chrysotile (white asbestos)</b> |
| Floor Coverings Res/Textile                             | Adhesive                                       |        |                    |                    |             |                                    |
|   | 8210/B00A/R0013/Floor Coverings Res/Textile/S8 |        |                    |                    |             | <b>No Asbestos Detected</b>        |
| <b>B00A - R1009 - General Learning Space (50.27 m2)</b> |  |        |                    |                    |             |                                    |
| Floor Coverings Res/Textile                             | Vinyl Tiles (Under Floor Covering/Carpet)      | 51m2   | Throughout         | Minimal Damage (2) | Low (1)     | Low Priority (2-3)                 |
|   | 8210/B00A/R0013/Floor Coverings Res/Textile/S7 |        |                    |                    |             | <b>Chrysotile (white asbestos)</b> |
| Floor Coverings Res/Textile                             | Adhesive                                       |        |                    |                    |             |                                    |
|   | 8210/B00A/R0013/Floor Coverings Res/Textile/S8 |        |                    |                    |             | <b>No Asbestos Detected</b>        |
| <b>B00A - R1010 - General Learning Space (50.33 m2)</b> |  |        |                    |                    |             |                                    |
| Floor Coverings Res/Textile                             | Vinyl Tiles (Under Floor Covering/Carpet)      | 51m2   | Throughout         | Minimal Damage (2) | Low (1)     | Low Priority (2-3)                 |
|   | 8210/B00A/R0013/Floor Coverings Res/Textile/S7 |        |                    |                    |             | <b>Chrysotile (white asbestos)</b> |
| Floor Coverings Res/Textile                             | Adhesive                                       |        |                    |                    |             |                                    |
|   | 8210/B00A/R0013/Floor Coverings Res/Textile/S8 |        |                    |                    |             | <b>No Asbestos Detected</b>        |
| <b>B00A - R1011 - General Learning Space (50.33 m2)</b> |  |        |                    |                    |             |                                    |
| Floor Coverings Res/Textile                             | Vinyl Tiles (Under Floor Covering/Carpet)      | 51m2   | Throughout         | Minimal Damage (2) | Low (1)     | Low Priority (2-3)                 |
|   | 8210/B00A/R0013/Floor Coverings Res/Textile/S7 |        |                    |                    |             | <b>Chrysotile (white asbestos)</b> |
| Floor Coverings Res/Textile                             | Adhesive                                       |        |                    |                    |             |                                    |
|   | 8210/B00A/R0013/Floor Coverings Res/Textile/S8 |        |                    |                    |             | <b>No Asbestos Detected</b>        |
| <b>B00A - R1012 - General Learning Space (50.26 m2)</b> |  |        |                    |                    |             |                                    |
| Floor Coverings Res/Textile                             | Vinyl Tiles (Under Floor Covering/Carpet)      | 51m2   | Throughout         | Minimal Damage (2) | Low (1)     | Low Priority (2-3)                 |
|   | 8210/B00A/R0013/Floor Coverings Res/Textile/S7 |        |                    |                    |             | <b>Chrysotile (white asbestos)</b> |
| Floor Coverings Res/Textile                             | Adhesive                                       |        |                    |                    |             |                                    |
|   | 8210/B00A/R0013/Floor Coverings Res/Textile/S8 |        |                    |                    |             | <b>No Asbestos Detected</b>        |
| <b>B00A - R1013 - General Learning Space (50.33 m2)</b> |  |        |                    |                    |             |                                    |
| Floor Coverings Res/Textile                             | Vinyl Tiles (Under Floor Covering/Carpet)      | 51m2   | Throughout         | Minimal Damage (2) | Low (1)     | Low Priority (2-3)                 |
|   | 8210/B00A/R0013/Floor Coverings Res/Textile/S7 |        |                    |                    |             | <b>Chrysotile (white asbestos)</b> |
| Floor Coverings Res/Textile                             | Adhesive                                       |        |                    |                    |             |                                    |
|   | 8210/B00A/R0013/Floor Coverings Res/Textile/S8 |        |                    |                    |             | <b>No Asbestos Detected</b>        |
| <b>B00A - R1014 - Duplicating Workroom (27.23 m2)</b>   |  |        |                    |                    |             |                                    |
| No Asbestos   |  |        |                    |                    |             |                                    |
| <b>B00A - R1015 - Deputy Principal Office (13.7 m2)</b> |  |        |                    |                    |             |                                    |
| No Asbestos   |  |        |                    |                    |             |                                    |

| Product  | Material Description                      | Extent | Location Reference | Material Condition | Risk Status   | Control Priority   |
|--|---|--------|--------------------|--------------------|---|--------------------|
| Sample No  |   |        |                    |                    | Test Result   |                    |
| <b>B00A - R1016 - Multi-Purpose Space (7.43 m2)</b>        |   |        |                    |                    |   |                    |
| No Asbestos  |   |        |                    |                    |   |                    |
| <b>B00A - R1021 - Stage (92.51 m2)</b>                     |   |        |                    |                    |   |                    |
| No Asbestos  |   |        |                    |                    |   |                    |
| <b>B00A - R1022 - Multi-Purpose Space (260.45 m2)</b>      |   |        |                    |                    |   |                    |
| No Asbestos  |   |        |                    |                    |   |                    |
| <b>B00A - R1023 - Control Room (9.18 m2)</b>               |   |        |                    |                    |   |                    |
| No Asbestos  |   |        |                    |                    |   |                    |
| <b>B00A - R1024 - Interview/Office - Type 1 (15.59 m2)</b> |   |        |                    |                    |   |                    |
| Floor Coverings Res/Textile                                | Vinyl Tiles (Under Floor Covering/Carpet) | 16m2   | Throughout         | Minimal Damage (2) | Low (1)   | Low Priority (2-3) |
| 8210/B00A/R0013/Floor Coverings Res/Textile/S7             |   |        |                    |                    | <b>Chrysotile (white asbestos)</b>                            |                    |
| Floor Coverings Res/Textile                                | Adhesive                                  |        |                    |                    |   |                    |
| 8210/B00A/R0013/Floor Coverings Res/Textile/S8             |   |        |                    |                    | <b>No Asbestos Detected</b>                                   |                    |
| <b>B00A - R1025 - Public Entry (71.49 m2)</b>              |   |        |                    |                    |   |                    |
| Floor Coverings Res/Textile                                | Vinyl Tiles (Under Floor Covering/Carpet) | 72m2   | Throughout         | Minimal Damage (2) | Low (1)   | Low Priority (2-3) |
| 8210/B00A/R0013/Floor Coverings Res/Textile/S7             |   |        |                    |                    | <b>Chrysotile (white asbestos)</b>                            |                    |
| Floor Coverings Res/Textile                                | Adhesive                                  |        |                    |                    |   |                    |
| 8210/B00A/R0013/Floor Coverings Res/Textile/S8             |   |        |                    |                    | <b>No Asbestos Detected</b>                                   |                    |
| <b>B00A - R1026 - Sport Equipment Store (10.95 m2)</b>     |   |        |                    |                    |   |                    |
| Ceiling Structures/Linings                                 | Flat AC Sheeting                          | 11m2   | Throughout         | Good Condition (1) | Low (1)   | Low Priority (2-3) |
| 8210/B00A/R1028/Ceiling Structures/Linings/S5              |   |        |                    |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |                    |
| <b>B00A - R1027 - Ancillary Staff (19.88 m2)</b>           |   |        |                    |                    |   |                    |
| No Asbestos  |   |        |                    |                    |   |                    |
| <b>B00A - R1028 - Staff - Toilet (5.4 m2)</b>              |   |        |                    |                    |   |                    |
| Ceiling Structures/Linings                                 | Flat AC Sheeting                          | 6m2    | Throughout         | Good Condition (1) | Low (1)   | Low Priority (2-3) |
| 8210/B00A/R1028/Ceiling Structures/Linings/S5              |   |        |                    |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |                    |
| Partition Walls (Cubicles)                                 | Compressed AC Sheet                       | 5m2    | North              | Good Condition (1) | Low (1)   | Low Priority (2-3) |
| 8210/B00A/R1028/Partition Walls (Cubicles)/S11             |   |        |                    |                    | <b>Chrysotile (white asbestos)</b>                            |                    |
| <b>B00A - R1029 - General Storeroom (14.79 m2)</b>         |   |        |                    |                    |   |                    |
| No Asbestos  |   |        |                    |                    |   |                    |
| <b>B00A - R1032 - Principal Office (16.55 m2)</b>          |   |        |                    |                    |   |                    |
| No Asbestos  |   |        |                    |                    |   |                    |
| <b>B00A - R1033 - Staff - Toilet (3.33 m2)</b>             |   |        |                    |                    |   |                    |
| No Asbestos  |   |        |                    |                    |   |                    |
| <b>B00A - R1034 - General Storeroom (1.8 m2)</b>           |   |        |                    |                    |   |                    |
| Floor Coverings Res/Textile                                | Vinyl Sheet                               |        |                    |                    |   |                    |
| 8210/B00A/R1034/Floor Coverings Res/Textile/S12            |   |        |                    |                    | <b>No Asbestos Detected</b>                                   |                    |
| Floor Coverings Res/Textile                                | Backing                                   |        |                    |                    |   |                    |
| 8210/B00A/R1034/Floor Coverings Res/Textile/S13            |   |        |                    |                    | <b>No Asbestos Detected</b>                                   |                    |
| <b>B00A - R1035 - Clinic - Girls (5.64 m2)</b>             |   |        |                    |                    |   |                    |
| Floor Coverings Res/Textile                                | Vinyl Tiles (Under Floor Covering/Carpet) | 6m2    | Throughout         | Good Condition (1) | Low (1)   | Low Priority (2-3) |
| 8210/B00A/R2015/Floor Coverings Res/Textile/S4             |   |        |                    |                    | <b>Chrysotile (white asbestos)</b>                            |                    |

| Product  | Material Description                            | Extent | Location Reference | Material Condition | Risk Status | Control Priority  |
|--|---|--------|--------------------|--------------------|-------------|---|
| Sample No  |   |        |                    |                    | Test Result |   |
| Floor Coverings Res/Textile                                | Backing   |        |                    |                    |             |   |
|  | 8210/B00A/R1034/Floor Coverings Res/Textile/S13 |        |                    |                    |             | <b>No Asbestos Detected</b>                                   |
| <b>B00A - R1036 - Clinic - Boys (5.34 m2)</b>              |   |        |                    |                    |             |   |
| No Asbestos  |   |        |                    |                    |             |   |
| <b>B00A - R1037 - Staff - Toilet (3.61 m2)</b>             |   |        |                    |                    |             |   |
| No Asbestos  |   |        |                    |                    |             |   |
| <b>B00A - R1038 - Movement (1.86 m2)</b>                   |   |        |                    |                    |             |   |
| No Asbestos  |   |        |                    |                    |             |   |
| <b>B00A - R1039 - Staff - Toilet (4.14 m2)</b>             |   |        |                    |                    |             |   |
| No Asbestos  |   |        |                    |                    |             |   |
| <b>B00A - R1040 - Movement (2.15 m2)</b>                   |   |        |                    |                    |             |   |
| No Asbestos  |   |        |                    |                    |             |   |
| <b>B00A - R1041 - Administration - Clerical (10.55 m2)</b> |   |        |                    |                    |             |   |
| Floor Coverings Res/Textile                                | Vinyl Tiles (Under Floor Covering/Carpet)       | 11m2   | Throughout         | Minimal Damage (2) | Low (1)     | Low Priority (2-3)  |
|  | 8210/B00A/R1041/Floor Coverings Res/Textile/S14 |        |                    |                    |             | <b>Chrysotile (white asbestos)</b>                            |
| Floor Coverings Res/Textile                                | Adhesive  |        |                    |                    |             |   |
|  | 8210/B00A/R1041/Floor Coverings Res/Textile/S15 |        |                    |                    |             | <b>No Asbestos Detected</b>                                   |
| <b>B00A - R1043 - Stairs (11.48 m2)</b>                    |   |        |                    |                    |             |   |
| No Asbestos  |   |        |                    |                    |             |   |
| <b>B00A - R1044 - Stairs (13.66 m2)</b>                    |   |        |                    |                    |             |   |
| No Asbestos  |   |        |                    |                    |             |   |
| <b>B00A - R1045 - Stairs (9.84 m2)</b>                     |   |        |                    |                    |             |   |
| Ceiling Structures/Linings                                 | Flat AC Sheeting                                | 10m2   | Throughout         | Good Condition (1) | Low (1)     | Low Priority (2-3)  |
|  | 8210/B00A/R1028/Ceiling Structures/Linings/S5   |        |                    |                    |             | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |
| <b>B00A - R1046 - Stairs (12.45 m2)</b>                    |   |        |                    |                    |             |   |
| No Asbestos  |   |        |                    |                    |             |   |
| <b>B00A - R1047 - Stairs (5.14 m2)</b>                     |   |        |                    |                    |             |   |
| No Asbestos  |   |        |                    |                    |             |   |
| <b>B00A - R1048 - Chair Store (7.61 m2)</b>                |   |        |                    |                    |             |   |
| No Asbestos  |   |        |                    |                    |             |   |
| <b>B00A - R1049 - Staff - Toilet (3.49 m2)</b>             |   |        |                    |                    |             |   |
| No Asbestos  |   |        |                    |                    |             |   |
| <b>B00A - R1050 - Student Canteen (13.64 m2)</b>           |   |        |                    |                    |             |   |
| No Asbestos  |   |        |                    |                    |             |   |
| <b>B00A - R1051 - Student Canteen (69.65 m2)</b>           |   |        |                    |                    |             |   |
| No Asbestos  |   |        |                    |                    |             |   |
| <b>B00A - R1052 - Movement (2.67 m2)</b>                   |   |        |                    |                    |             |   |
| No Asbestos  |   |        |                    |                    |             |   |
| <b>B00A - R1053 - Movement (2.97 m2)</b>                   |   |        |                    |                    |             |   |
| No Asbestos  |   |        |                    |                    |             |   |
| <b>B00A - R1054 - Movement (19.49 m2)</b>                  |   |        |                    |                    |             |   |
| Ceiling Structures/Linings                                 | Flat AC Sheeting                                | 20m2   | Throughout         | Good Condition (1) | Low (1)     | Low Priority (2-3)  |
|  | 8210/B00A/R1028/Ceiling Structures/Linings/S5   |        |                    |                    |             | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |
| <b>B00A - R1055 - Movement (223.63 m2)</b>                 |   |        |                    |                    |             |   |

| Product  | Material Description   | Extent | Location Reference | Material Condition | Risk Status | Control Priority  |
|--|--|--------|--------------------|--------------------|-------------|---|
| Sample No  |  |        |                    |                    | Test Result |   |
| Electrical Backing Board                                     | Resinous Board   | 1Unit  | East               | Good Condition (1) | Low (1)     | Low Priority (2-3)  |
| <b>Assumed Asbestos - Electrical Hazard</b>                  |  |        |                    |                    |             |   |
| <b>B00A - R1056 - Administration - Clerical (60.42 m2)</b>   |  |        |                    |                    |             |   |
| No Asbestos  |  |        |                    |                    |             |   |
| <b>B00A - R1057 - Movement (19.42 m2)</b>                    |  |        |                    |                    |             |   |
| Electrical Mounting Board                                    | Resinous Board   | 2Unit  | East               | Good Condition (1) | Low (1)     | Low Priority (2-3)  |
| <b>Assumed Asbestos - Electrical Hazard</b>                  |  |        |                    |                    |             |   |
| <b>B00A - R2001 - Staff Study (29.75 m2)</b>                 |  |        |                    |                    |             |   |
| Floor Coverings Res/Textile                                  | Vinyl Tiles (Under Floor Covering/Carpet)<br>8210/B00A/R2014/Floor Coverings Res/Textile/S16 | 30m2   | Throughout         | Minimal Damage (2) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>                            |
| Floor Coverings Res/Textile                                  | Adhesive<br>8210/B00A/R2014/Floor Coverings Res/Textile/S17                                  |        |                    |                    |             | <b>No Asbestos Detected</b>   |
| <b>B00A - R2002 - Staff Study (34.47 m2)</b>                 |  |        |                    |                    |             |   |
| Floor Coverings Res/Textile                                  | Vinyl Tiles (Under Floor Covering/Carpet)<br>8210/B00A/R2014/Floor Coverings Res/Textile/S16 | 35m2   | Throughout         | Minimal Damage (2) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>                            |
| Floor Coverings Res/Textile                                  | Adhesive<br>8210/B00A/R2014/Floor Coverings Res/Textile/S16                                  | 35m2   | Throughout         | Minimal Damage (2) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>                            |
| <b>B00A - R2003 - Staff Study (8.46 m2)</b>                  |  |        |                    |                    |             |   |
| Floor Coverings Res/Textile                                  | Vinyl Tiles (Under Floor Covering/Carpet)<br>8210/B00A/R2014/Floor Coverings Res/Textile/S16 | 9m2    | Throughout         | Minimal Damage (2) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>                            |
| Floor Coverings Res/Textile                                  | Adhesive<br>8210/B00A/R2014/Floor Coverings Res/Textile/S17                                  |        |                    |                    |             | <b>No Asbestos Detected</b>   |
| <b>B00A - R2004 - Cleaning Store - Distributed (3.52 m2)</b> |  |        |                    |                    |             |   |
| No Asbestos  |  |        |                    |                    |             |   |
| <b>B00A - R2005 - Staff - Toilet (4.85 m2)</b>               |  |        |                    |                    |             |   |
| Ceiling Structures/Linings                                   | Flat AC Sheeting<br>8210/B00A/R1028/Ceiling Structures/Linings/S5                            | 5m2    | Throughout         | Good Condition (1) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |
| <b>B00A - R2006 - General Learning Space (50.09 m2)</b>      |  |        |                    |                    |             |   |
| Floor Coverings Res/Textile                                  | Vinyl Tiles (Under Floor Covering/Carpet)<br>8210/B00A/R2014/Floor Coverings Res/Textile/S16 | 50m2   | Throughout         | Minimal Damage (2) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>                            |
| Floor Coverings Res/Textile                                  | Adhesive<br>8210/B00A/R2014/Floor Coverings Res/Textile/S17                                  |        |                    |                    |             | <b>No Asbestos Detected</b>   |
| <b>B00A - R2007 - General Learning Space (49.98 m2)</b>      |  |        |                    |                    |             |   |
| Floor Coverings Res/Textile                                  | Vinyl Tiles (Under Floor Covering/Carpet)<br>8210/B00A/R2014/Floor Coverings Res/Textile/S16 | 50m2   | Throughout         | Minimal Damage (2) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>                            |
| Floor Coverings Res/Textile                                  | Adhesive<br>8210/B00A/R2014/Floor Coverings Res/Textile/S17                                  |        |                    |                    |             | <b>No Asbestos Detected</b>   |
| <b>B00A - R2008 - General Learning Space (50.03 m2)</b>      |  |        |                    |                    |             |   |
| Floor Coverings Res/Textile                                  | Vinyl Tiles (Under Floor Covering/Carpet)<br>8210/B00A/R2014/Floor Coverings Res/Textile/S16 | 50m2   | Throughout         | Minimal Damage (2) | Low (1)     | Low Priority (2-3)<br><b>Chrysotile (white asbestos)</b>                            |

| Product   | Material Description                            | Extent | Location Reference | Material Condition | Risk Status                        | Control Priority   |
|---|---|--------|--------------------|--------------------|------------------------------------|--------------------|
| Sample No   |   |        |                    |                    | Test Result                        |                    |
| Floor Coverings Res/Textile                             | Adhesive  |        |                    |                    |                                    |                    |
|   | 8210/B00A/R2014/Floor Coverings Res/Textile/S17 |        |                    |                    | <b>No Asbestos Detected</b>        |                    |
| <b>B00A - R2009 - General Learning Space (49.97 m2)</b> |   |        |                    |                    |                                    |                    |
| Floor Coverings Res/Textile                             | Vinyl Tiles (Under Floor Covering/Carpet)       | 50m2   | Throughout         | Minimal Damage (2) | Low (1)                            | Low Priority (2-3) |
|   | 8210/B00A/R2014/Floor Coverings Res/Textile/S16 |        |                    |                    | <b>Chrysotile (white asbestos)</b> |                    |
| Floor Coverings Res/Textile                             | Adhesive  |        |                    |                    |                                    |                    |
|   | 8210/B00A/R2014/Floor Coverings Res/Textile/S17 |        |                    |                    | <b>No Asbestos Detected</b>        |                    |
| <b>B00A - R2010 - General Learning Space (49.96 m2)</b> |   |        |                    |                    |                                    |                    |
| Floor Coverings Res/Textile                             | Vinyl Tiles (Under Floor Covering/Carpet)       | 50m2   | Throughout         | Minimal Damage (2) | Low (1)                            | Low Priority (2-3) |
|   | 8210/B00A/R2014/Floor Coverings Res/Textile/S16 |        |                    |                    | <b>Chrysotile (white asbestos)</b> |                    |
| Floor Coverings Res/Textile                             | Adhesive  |        |                    |                    |                                    |                    |
|   | 8210/B00A/R2014/Floor Coverings Res/Textile/S17 |        |                    |                    | <b>No Asbestos Detected</b>        |                    |
| <b>B00A - R2011 - General Learning Space (49.64 m2)</b> |   |        |                    |                    |                                    |                    |
| Floor Coverings Res/Textile                             | Vinyl Tiles (Under Floor Covering/Carpet)       | 50m2   | Throughout         | Minimal Damage (2) | Low (1)                            | Low Priority (2-3) |
|   | 8210/B00A/R2014/Floor Coverings Res/Textile/S16 |        |                    |                    | <b>Chrysotile (white asbestos)</b> |                    |
| Floor Coverings Res/Textile                             | Adhesive  |        |                    |                    |                                    |                    |
|   | 8210/B00A/R2014/Floor Coverings Res/Textile/S17 |        |                    |                    | <b>No Asbestos Detected</b>        |                    |
| <b>B00A - R2013 - General Learning Space (50.42 m2)</b> |   |        |                    |                    |                                    |                    |
| Floor Coverings Res/Textile                             | Vinyl Tiles (Under Floor Covering/Carpet)       | 51m2   | Throughout         | Minimal Damage (2) | Low (1)                            | Low Priority (2-3) |
|   | 8210/B00A/R2014/Floor Coverings Res/Textile/S16 |        |                    |                    | <b>Chrysotile (white asbestos)</b> |                    |
| Floor Coverings Res/Textile                             | Adhesive  |        |                    |                    |                                    |                    |
|   | 8210/B00A/R2014/Floor Coverings Res/Textile/S17 |        |                    |                    | <b>No Asbestos Detected</b>        |                    |
| <b>B00A - R2014 - Leading Teacher (15.25 m2)</b>        |   |        |                    |                    |                                    |                    |
| Floor Coverings Res/Textile                             | Vinyl Tiles (Under Floor Covering/Carpet)       | 16m2   | Throughout         | Minimal Damage (2) | Low (1)                            | Low Priority (2-3) |
|   | 8210/B00A/R2014/Floor Coverings Res/Textile/S16 |        |                    |                    | <b>Chrysotile (white asbestos)</b> |                    |
| Floor Coverings Res/Textile                             | Adhesive  |        |                    |                    |                                    |                    |
|   | 8210/B00A/R2014/Floor Coverings Res/Textile/S17 |        |                    |                    | <b>No Asbestos Detected</b>        |                    |
| <b>B00A - R2015 - General Storeroom (23.45 m2)</b>      |   |        |                    |                    |                                    |                    |
| Floor Coverings Res/Textile                             | Vinyl Tiles (Under Floor Covering/Carpet)       | 24m2   | Throughout         | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
|   | 8210/B00A/R0013/Floor Coverings Res/Textile/S7  |        |                    |                    | <b>Chrysotile (white asbestos)</b> |                    |
| <b>B00A - R2016 - Multi-Purpose Space (13.94 m2)</b>    |   |        |                    |                    |                                    |                    |
| Floor Coverings Res/Textile                             | Vinyl Tiles (Under Floor Covering/Carpet)       | 14m2   | Throughout         | Minimal Damage (2) | Low (1)                            | Low Priority (2-3) |
|   | 8210/B00A/R2014/Floor Coverings Res/Textile/S16 |        |                    |                    | <b>Chrysotile (white asbestos)</b> |                    |
| Floor Coverings Res/Textile                             | Adhesive  |        |                    |                    |                                    |                    |
|   | 8210/B00A/R2014/Floor Coverings Res/Textile/S17 |        |                    |                    | <b>No Asbestos Detected</b>        |                    |
| <b>B00A - R2017 - Commonroom (129.88 m2)</b>            |   |        |                    |                    |                                    |                    |
| Floor Coverings Res/Textile                             | Vinyl Tiles (Under Floor Covering/Carpet)       | 130m2  | Throughout         | Minimal Damage (2) | Low (1)                            | Low Priority (2-3) |
|   | 8210/B00A/R2014/Floor Coverings Res/Textile/S16 |        |                    |                    | <b>Chrysotile (white asbestos)</b> |                    |
| Floor Coverings Res/Textile                             | Adhesive  |        |                    |                    |                                    |                    |
|   | 8210/B00A/R2014/Floor Coverings Res/Textile/S17 |        |                    |                    | <b>No Asbestos Detected</b>        |                    |
| <b>B00A - R2018 - Movement (193.48 m2)</b>              |   |        |                    |                    |                                    |                    |



| Product                  | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority   |
|--------------------------|----------------------|--------|--------------------|--------------------|-------------|--------------------|
| Sample No                |                      |        |                    |                    | Test Result |                    |
| Electrical Backing Board | Resinous Board       | 2Unit  | East               | Good Condition (1) | Low (1)     | Low Priority (2-3) |

**Assumed Asbestos - Electrical Hazard**

**B00A - R2019 - Stairs (15.45 m2)**

No Asbestos

**B00A - R2020 - Stairs (11.48 m2)**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00B - Various - 1958 - Brick/Block (Brick/Block)****Exterior**

|  |  |      |                    |                            |         |   |
|--|--|------|--------------------|----------------------------|---------|---|
| Eaves Linings                              | Flat AC Sheeting   | 60m2 | Throughout         | Good Condition (1)         | Low (1) | Low Priority (2-3)  |
|  | 8210/B00A/Eaves Linings/S10                              |      |                    |                            |         | <b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b> |
| Ceiling Voids                              | No Asbestos Found  |      |                    |                            |         |   |
| Underfloor Voids - Packing to Floor Joists | Flat AC Sheeting   | 5m2  | Variable positions | Some Damage - Unsealed (3) | Low (1) | Medium Priority (4-5)   |
|  | 8210/B00C/Underfloor Voids - Packing to Floor Joists/S19 |      |                    |                            |         | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>                               |

**Interior****B00B - R0001 - Laundry (15.58 m2)**

No Asbestos

**B00B - R0002 - Food Technology L.S. (115.27 m2)**

No Asbestos

**B00B - R0003 - Preparation (15.41 m2)**

No Asbestos

**B00B - R0004 - Food Technology L.S. (110.01 m2)**

No Asbestos

**B00B - R0005 - Movement (6.61 m2)**

|                          |                |       |      |                    |         |                    |
|--------------------------|----------------|-------|------|--------------------|---------|--------------------|
| Electrical Backing Board | Resinous Board | 1Unit | West | Good Condition (1) | Low (1) | Low Priority (2-3) |
|--------------------------|----------------|-------|------|--------------------|---------|--------------------|

**Assumed Asbestos - Electrical Hazard****B00B - R0006 - Cleaning Store - Distributed (2.8 m2)**

No Asbestos

**B00B - R0007 - Staff Study (14.6 m2)**

No Asbestos

**B00B - R0008 - Food/Research Space (11.78 m2)**

No Asbestos

**B00B - R0009 - Staff - Toilet (3.67 m2)**

No Asbestos

**B00B - R0010 - Food/Research Space (5.69 m2)**

No Asbestos

**B00B - R0011 - Stairs (6.3 m2)**

No Asbestos

**B00B - R0012 - Movement (1.05 m2)**

No Asbestos

**B00B - R0013 - Movement (1.04 m2)**

No Asbestos

**B00B - R0014 - Stairs (4.45 m2)**

No Asbestos

**B00B - R0015 - Movement (2.52 m2)**

No Asbestos

**B00B - R1001 - General Learning Space (55.07 m2)**

No Asbestos

**B00B - R1002 - Materials Technology L.S. (59.5 m2)**

No Asbestos

**B00B - R1003 - Materials Store (8.39 m2)**

No Asbestos

| Product  | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|--|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No  |                      |        |                    |                    | Test Result |                  |
| <b>B00B - R1004 - Resources Store (11.43 m2)</b>             |                      |        |                    |                    |             |                  |
| No Asbestos  |                      |        |                    |                    |             |                  |
| <b>B00B - R1005 - Materials Store (8.27 m2)</b>              |                      |        |                    |                    |             |                  |
| No Asbestos  |                      |        |                    |                    |             |                  |
| <b>B00B - R1006 - Materials Store (9.89 m2)</b>              |                      |        |                    |                    |             |                  |
| No Asbestos  |                      |        |                    |                    |             |                  |
| <b>B00B - R1007 - Art Learning Space (62.66 m2)</b>          |                      |        |                    |                    |             |                  |
| No Asbestos  |                      |        |                    |                    |             |                  |
| <b>B00B - R1008 - Interview/Office - Type 1 (7.19 m2)</b>    |                      |        |                    |                    |             |                  |
| No Asbestos  |                      |        |                    |                    |             |                  |
| <b>B00B - R1009 - General Storeroom (6.55 m2)</b>            |                      |        |                    |                    |             |                  |
| No Asbestos  |                      |        |                    |                    |             |                  |
| <b>B00B - R1010 - Staff - Toilet (6.5 m2)</b>                |                      |        |                    |                    |             |                  |
| No Asbestos  |                      |        |                    |                    |             |                  |
| <b>B00B - R1011 - Cleaning Store - Distributed (2.08 m2)</b> |                      |        |                    |                    |             |                  |
| No Asbestos  |                      |        |                    |                    |             |                  |
| <b>B00B - R1012 - Movement (53.35 m2)</b>                    |                      |        |                    |                    |             |                  |
| No Asbestos  |                      |        |                    |                    |             |                  |
| <b>B00B - R1013 - Movement (2.7 m2)</b>                      |                      |        |                    |                    |             |                  |
| No Asbestos  |                      |        |                    |                    |             |                  |
| <b>B00B - R1014 - Stairs (6.26 m2)</b>                       |                      |        |                    |                    |             |                  |
| No Asbestos  |                      |        |                    |                    |             |                  |
| <b>B00B - R1015 - Stairs (15.13 m2)</b>                      |                      |        |                    |                    |             |                  |
| No Asbestos  |                      |        |                    |                    |             |                  |

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    | Test Result        |             |                  |

**B00C - Various - 1958 - Brick/Block (Brick/Block)****Exterior**

|  |  |      |                    |   |         |                    |
|--|--|------|--------------------|---|---------|--------------------|
| Eaves Linings                              | Flat AC Sheeting   | 90m2 | Throughout         | Good Condition (1)  | Low (1) | Low Priority (2-3) |
|  | 8210/B00C/Eaves Linings/S1                               |      |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |         |                    |
| Underfloor Voids - Packing to Floor Joists | Encapsulated Insulation material within unit             | 5m2  | Variable positions | Minimal Damage (2)  | Low (1) | Low Priority (2-3) |
|  | 8210/B00C/Underfloor Voids - Packing to Floor Joists/S19 |      |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |         |                    |
| Ceiling Voids - Raked Ceiling              | No Asbestos Found  |      |                    |   |         |                    |

**Interior****B00C - R0004 - Movement (9.25 m2)**

|                       |   |     |       |   |         |                    |
|-----------------------|---|-----|-------|---|---------|--------------------|
| Wall Linings Internal | Flat AC Sheeting                          | 6m2 | North | Good Condition (1)  | Low (1) | Low Priority (2-3) |
|                       | 8210/B00C/R0008/Wall Linings Internal/S18 |     |       | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |         |                    |

**B00C - R0005 - Cleaning Store - Distributed (3.37 m2)**

No Asbestos

**B00C - R0009 - Stairs (4.09 m2)**

|                            |   |     |            |   |         |                    |
|----------------------------|---|-----|------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting                              | 5m2 | Throughout | Good Condition (1)  | Low (1) | Low Priority (2-3) |
|                            | 8210/B00C/R1007/Ceiling Structures/Linings/S2 |     |            | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |         |                    |

**B00C - R0011 - Bulk Store (8.64 m2)**

|                        |  |      |                    |   |         |                       |
|------------------------|--|------|--------------------|---|---------|-----------------------|
| packing to floor beams | Flat AC Sheeting   | 10m2 | Variable positions | Some Damage - Unsealed (3)                                    | Low (1) | Medium Priority (4-5) |
|                        | 8210/B00C/Underfloor Voids - Packing to Floor Joists/S19 |      |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |         |                       |
| packing to floor beams | Flat AC Sheeting   | 10m2 | Variable positions | Some Damage - Unsealed (3)                                    | Low (1) | Medium Priority (4-5) |
|                        | 8210/B00C/Underfloor Voids - Packing to Floor Joists/S19 |      |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |         |                       |

**B00C - R0012 - General Learning Space (36.08 m2)**

Recently Modified Space Requires Inspection

**B00C - R0013 - Workshop Area (163.93 m2)**

Recently Modified Space Requires Inspection

**B00C - R0014 - Welding Area (4.28 m2)**

Recently Modified Space Requires Inspection

**B00C - R0015 - Welding Area (4.28 m2)**

Recently Modified Space Requires Inspection

**B00C - R0016 - Welding Area (4.28 m2)**

Recently Modified Space Requires Inspection

**B00C - R0017 - General Learning Space (57.01 m2)**

Recently Modified Space Requires Inspection

**B00C - R0018 - Workshop Area (44.24 m2)**

Recently Modified Space Requires Inspection

**B00C - R1001 - Materials Technology L.S. (105.34 m2)**

|                            |   |       |            |   |         |                    |
|----------------------------|---|-------|------------|---|---------|--------------------|
| Ceiling Structures/Linings | Flat AC Sheeting                              | 106m2 | Throughout | Good Condition (1)  | Low (1) | Low Priority (2-3) |
|                            | 8210/B00C/R1007/Ceiling Structures/Linings/S2 |       |            | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |         |                    |

**B00C - R1002 - Movement (8.43 m2)**

| Product  | Material Description                            | Extent | Location Reference | Material Condition  | Risk Status | Control Priority                   |
|--|---|--------|--------------------|---|-------------|------------------------------------|
| Sample No  |   |        |                    | Test Result   |             |                                    |
| Ceiling Structures/Linings                                   | Flat AC Sheeting                                | 9m2    | Throughout         | Good Condition (1)  | Low (1)     | Low Priority (2-3)                 |
|  | 8210/B00C/R1007/Ceiling Structures/Linings/S2   |        |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |             |                                    |
| <b>B00C - R1003 - Staff Study (20.35 m2)</b>                 |   |        |                    |   |             |                                    |
| Ceiling Structures/Linings                                   | Flat AC Sheeting                                | 21m2   | Throughout         | Good Condition (1)  | Low (1)     | Low Priority (2-3)                 |
|  | 8210/B00C/R1007/Ceiling Structures/Linings/S2   |        |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |             |                                    |
| Floor Coverings Res/Textile                                  | Vinyl Sheet                                     |        |                    |   |             |                                    |
|  | 8210/B00C/R1011/Floor Coverings Res/Textile/S21 |        |                    |   |             | <b>No Asbestos Detected</b>        |
| Floor Coverings Res/Textile                                  | Backing   |        |                    |   |             |                                    |
|  | 8210/B00C/R1011/Floor Coverings Res/Textile/S22 |        |                    |   |             | <b>No Asbestos Detected</b>        |
| <b>B00C - R1004 - Staff Change (5.65 m2)</b>                 |   |        |                    |   |             |                                    |
| Ceiling Structures/Linings                                   | Flat AC Sheeting                                | 6m2    | Throughout         | Good Condition (1)  | Low (1)     | Low Priority (2-3)                 |
|  | 8210/B00C/R1007/Ceiling Structures/Linings/S2   |        |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |             |                                    |
| <b>B00C - R1005 - Staff - Toilet (2.44 m2)</b>               |   |        |                    |   |             |                                    |
| No Asbestos  |   |        |                    |   |             |                                    |
| <b>B00C - R1006 - Cleaning Store - Distributed (2.35 m2)</b> |   |        |                    |   |             |                                    |
| No Asbestos  |   |        |                    |   |             |                                    |
| <b>B00C - R1007 - Movement (59.72 m2)</b>                    |   |        |                    |   |             |                                    |
| Ceiling Structures/Linings                                   | Flat AC Sheeting                                | 60m2   | Throughout         | Good Condition (1)  | Low (1)     | Low Priority (2-3)                 |
|  | 8210/B00C/R1007/Ceiling Structures/Linings/S2   |        |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |             |                                    |
| Electrical Backing Board                                     | Resinous Board                                  | 1Unit  | North              | Good Condition (1)  | Low (1)     | Low Priority (2-3)                 |
|  |   |        |                    | <b>Assumed Asbestos - Electrical Hazard</b>                   |             |                                    |
| <b>B00C - R1008 - Materials Technology L.S. (132.3 m2)</b>   |   |        |                    |   |             |                                    |
| Ceiling Structures/Linings                                   | Flat AC Sheeting                                | 133m2  | Throughout         | Good Condition (1)  | Low (1)     | Low Priority (2-3)                 |
|  | 8210/B00C/R1007/Ceiling Structures/Linings/S2   |        |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |             |                                    |
| Wall Linings Internal  | Flat AC Sheeting                                | 80m2   | East, West         | Good Condition (1)  | Low (1)     | Low Priority (2-3)                 |
|  | 8210/B00C/R0008/Wall Linings Internal/S18       |        |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |             |                                    |
| Hot Metal Workbench  | Compressed AC Sheet                             | 1m2    | South              | Some Damage - Unsealed (3)                                    | Low (1)     | Medium Priority (4-5)              |
|  | 8210/B00C/R1008/Hot Metal Workbench/S20         |        |                    |   |             | <b>Chrysotile (white asbestos)</b> |
| <b>B00C - R1009 - Staff Study (9.19 m2)</b>                  |   |        |                    |   |             |                                    |
| Ceiling Structures/Linings                                   | Flat AC Sheeting                                | 10m2   | Throughout         | Good Condition (1)  | Low (1)     | Low Priority (2-3)                 |
|  | 8210/B00C/R1007/Ceiling Structures/Linings/S2   |        |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |             |                                    |
| Wall Linings Internal  | Flat AC Sheeting                                | 50m2   | Throughout         | Good Condition (1)  | Low (1)     | Low Priority (2-3)                 |
|  | 8210/B00C/R0008/Wall Linings Internal/S18       |        |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |             |                                    |
| <b>B00C - R1010 - Resource/Project Store (16.18 m2)</b>      |   |        |                    |   |             |                                    |
| Ceiling Structures/Linings                                   | Flat AC Sheeting                                | 17m2   | Throughout         | Good Condition (1)  | Low (1)     | Low Priority (2-3)                 |
|  | 8210/B00C/R1007/Ceiling Structures/Linings/S2   |        |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |             |                                    |

| Product   | Material Description                            | Extent | Location Reference | Material Condition  | Risk Status | Control Priority   |
|---|---|--------|--------------------|---|-------------|--------------------|
| Sample No   |   |        |                    | Test Result   |             |                    |
| Wall Linings Internal                                   | Flat AC Sheeting                                | 40m2   | East, West         | Good Condition (1)  | Low (1)     | Low Priority (2-3) |
|   | 8210/B00C/R1007/Ceiling Structures/Linings/S2   |        |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |             |                    |
| <b>B00C - R1011 - Staff Study (9.07 m2)</b>             |   |        |                    |   |             |                    |
| Ceiling Structures/Linings                              | Flat AC Sheeting                                | 10m2   | Throughout         | Good Condition (1)  | Low (1)     | Low Priority (2-3) |
|   | 8210/B00C/R1007/Ceiling Structures/Linings/S2   |        |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |             |                    |
| Wall Linings Internal                                   | Flat AC Sheeting                                | 30m2   | Throughout         | Good Condition (1)  | Low (1)     | Low Priority (2-3) |
|   | 8210/B00C/R0008/Wall Linings Internal/S18       |        |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |             |                    |
| Floor Coverings Res/Textile                             | Vinyl Sheet                                     |        |                    |   |             |                    |
|   | 8210/B00C/R1011/Floor Coverings Res/Textile/S21 |        |                    | <b>No Asbestos Detected</b>                                   |             |                    |
| Floor Coverings Res/Textile                             | Backing   |        |                    |   |             |                    |
|   | 8210/B00C/R1011/Floor Coverings Res/Textile/S22 |        |                    | <b>No Asbestos Detected</b>                                   |             |                    |
| <b>B00C - R1012 - Resource/Project Store (15.79 m2)</b> |   |        |                    |   |             |                    |
| Ceiling Structures/Linings                              | Flat AC Sheeting                                | 16m2   | Throughout         | Good Condition (1)  | Low (1)     | Low Priority (2-3) |
|   | 8210/B00C/R1007/Ceiling Structures/Linings/S2   |        |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |             |                    |
| Wall Linings Internal                                   | Flat AC Sheeting                                | 45m2   | Throughout         | Good Condition (1)  | Low (1)     | Low Priority (2-3) |
|   | 8210/B00C/R0008/Wall Linings Internal/S18       |        |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |             |                    |
| <b>B00C - R1013 - Design L.S. (52.16 m2)</b>            |   |        |                    |   |             |                    |
| Ceiling Structures/Linings                              | Flat AC Sheeting                                | 53m2   | Throughout         | Good Condition (1)  | Low (1)     | Low Priority (2-3) |
|   | 8210/B00C/R1007/Ceiling Structures/Linings/S2   |        |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |             |                    |
| Wall Linings Internal                                   | Flat AC Sheeting                                | 200m2  | Throughout         | Good Condition (1)  | Low (1)     | Low Priority (2-3) |
|   | 8210/B00C/R1013/Wall Linings Internal/S3        |        |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |             |                    |
| <b>B00C - R1014 - General Learning Space (51.28 m2)</b> |   |        |                    |   |             |                    |
| Ceiling Structures/Linings                              | Flat AC Sheeting                                | 52m2   | Throughout         | Good Condition (1)  | Low (1)     | Low Priority (2-3) |
|   | 8210/B00C/R1007/Ceiling Structures/Linings/S2   |        |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |             |                    |
| Wall Linings Internal                                   | Flat AC Sheeting                                | 180m2  | West               | Good Condition (1)  | Low (1)     | Low Priority (2-3) |
|   | 8210/B00C/R0008/Wall Linings Internal/S18       |        |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |             |                    |
| <b>B00C - R1015 - Multi-Purpose Space (4.06 m2)</b>     |   |        |                    |   |             |                    |
| Ceiling Structures/Linings                              | Flat AC Sheeting                                | 5m2    | Throughout         | Good Condition (1)  | Low (1)     | Low Priority (2-3) |
|   | 8210/B00C/R1007/Ceiling Structures/Linings/S2   |        |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |             |                    |
| Wall Linings Internal                                   | Flat AC Sheeting                                | 8m2    | Throughout         | Good Condition (1)  | Low (1)     | Low Priority (2-3) |
|   | 8210/B00C/R0008/Wall Linings Internal/S18       |        |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |             |                    |
| <b>B00C - R1016 - Resources Space (11.44 m2)</b>        |   |        |                    |   |             |                    |
| Ceiling Structures/Linings                              | Flat AC Sheeting                                | 12m2   | Throughout         | Good Condition (1)  | Low (1)     | Low Priority (2-3) |
|   | 8210/B00C/R1007/Ceiling Structures/Linings/S2   |        |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |             |                    |

| Product                                       | Material Description | Extent | Location Reference | Material Condition  | Risk Status | Control Priority   |
|---|----------------------|--------|--------------------|---|-------------|--------------------|
| Sample No                                     |                      |        |                    |   | Test Result |                    |
| <b>B00C - R1017 - Staff Study (8.61 m2)</b>   |                      |        |                    |   |             |                    |
| Ceiling Structures/Linings                    | Flat AC Sheeting     | 9m2    | Throughout         | Good Condition (1)  | Low (1)     | Low Priority (2-3) |
| 8210/B00C/R1007/Ceiling Structures/Linings/S2 |                      |        |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |             |                    |
| <b>B00C - R1018 - Stairs (7.82 m2)</b>        |                      |        |                    |   |             |                    |
| Ceiling Structures/Linings                    | Flat AC Sheeting     | 8m2    | Throughout         | Good Condition (1)  | Low (1)     | Low Priority (2-3) |
| 8210/B00C/R1007/Ceiling Structures/Linings/S2 |                      |        |                    | <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b> |             |                    |

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00D - Various - 1984 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

**Interior****B00D - R0001 - Main Area (402.32 m2)**

No Asbestos

**B00D - R0002 - Resources Store (4.89 m2)**

No Asbestos

**B00D - R0003 - Audio Visual Workroom (34.78 m2)**

No Asbestos

**B00D - R0004 - Workroom (40.57 m2)**

No Asbestos

**B00D - R0005 - Librarian (11.85 m2)**

No Asbestos

**B00D - R0006 - Entry (16 m2)**

No Asbestos

**B00D - R0007 - Distribution Board Cupboard (1.23 m2)**

Note: No inspection of live electrical installation.

|                          |                |       |      |                    |         |                    |
|--------------------------|----------------|-------|------|--------------------|---------|--------------------|
| Electrical Backing Board | Resinous Board | 2Unit | West | Good Condition (1) | Low (1) | Low Priority (2-3) |
|--------------------------|----------------|-------|------|--------------------|---------|--------------------|

**Assumed Asbestos - Electrical**

Wall Linings Internal Flat AC Sheeting  
8210/B00D/R0007/Wall Linings Internal/S23

**No Asbestos Detected**

**B00D - R0008 - Staff - Toilet (2.39 m2)**

No Asbestos

**B00D - R0009 - Staff - Toilet (2.4 m2)**

No Asbestos

**B00D - R0010 - Cleaning Store - Distributed (0.88 m2)**

No Asbestos

**B00D - R0011 - Seminar (13.47 m2)**

No Asbestos

**B00D - R0012 - Seminar (20.71 m2)**

No Asbestos

2017



| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00E - Various - 1973 - Brick/Block (Brick/Block)****Exterior**

|                                   |   |      |                              |                    |                            |                             |
|-----------------------------------|---|------|------------------------------|--------------------|----------------------------|-----------------------------|
| Infil panel                       | Flat AC Sheeting<br>8210/B00E/Infil panel/S24 |      |                              |                    |                            | No Asbestos Detected        |
| Ceiling Voids - Flat Roof         | No Asbestos Found                             |      |                              |                    |                            |                             |
| Underfloor Voids - Slab on Ground | No Asbestos Found                             |      |                              |                    |                            |                             |
| Roof                              | Resinous Membrane<br>8210/B00E/Roof/S29       | 12m2 | North,South and west porches | Minimal Damage (2) | Low (1) Low Priority (2-3) | Chrysotile (white asbestos) |

**Interior****B00E - R0002 - Preparation (37.58 m2)**

|   |   |  |  |  |  |                       |
|---|---|--|--|--|--|-----------------------|
| Ceiling Structures/Linings  | Vermiculite<br>8210/B00E/R9006/Ceiling Structures/Linings/S25 |  |  |  |  | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |  |  |  |  |                       |

**B00E - R0004 - General Learning Space (52.6 m2)**

|   |  |  |  |  |  |                       |
|---|--|--|--|--|--|-----------------------|
| Ceiling Structures/Linings  | Vermiculite<br>8210/B00E/R9006/Ceiling Structures/Linings/S25  |  |  |  |  | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |  |  |  |  |  |                       |
| Floor Coverings Res/Textile   | Vinyl Sheet<br>8210/B00E/R0004/Floor Coverings Res/Textile/S26 |  |  |  |  | No Asbestos Detected  |
| Floor Coverings Res/Textile   | Adhesive<br>8210/B00E/R0004/Floor Coverings Res/Textile/S27    |  |  |  |  | No Asbestos Detected  |

**B00E - R0005 - General Learning Space (52.89 m2)**

|   |  |  |  |  |  |                       |
|---|--|--|--|--|--|-----------------------|
| Ceiling Structures/Linings  | Vermiculite<br>8210/B00E/R0005/Ceiling Structures/Linings/S6                                 |  |  |  |  | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |  |  |  |  |  |                       |
| Floor Coverings Res/Textile   | Vinyl Tiles (Under Floor Covering/Carpet)<br>8210/B00E/R0004/Floor Coverings Res/Textile/S26 |  |  |  |  | No Asbestos Detected  |
| Floor Coverings Res/Textile   | Adhesive<br>8210/B00E/R0004/Floor Coverings Res/Textile/S27                                  |  |  |  |  | No Asbestos Detected  |

**B00E - R0006 - Staff - Toilet (6.59 m2)**

No Asbestos

**B00E - R0007 - Cleaning Store - Distributed (3.95 m2)**

No Asbestos

**B00E - R0008 - Chemical Store (11.38 m2)**

|   |   |  |  |  |  |                       |
|---|---|--|--|--|--|-----------------------|
| Ceiling Structures/Linings  | Vermiculite<br>8210/B00E/R9006/Ceiling Structures/Linings/S25 |  |  |  |  | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |  |  |  |  |                       |
| Lintel  | Compressed AC Sheet<br>8210/B00E/R0008/Lintel/S28             |  |  |  |  | No Asbestos Detected  |

**B00E - R0009 - Apparatus Store (25.9 m2)**

|   |   |  |  |  |  |                       |
|---|---|--|--|--|--|-----------------------|
| Ceiling Structures/Linings  | Vermiculite<br>8210/B00E/R9006/Ceiling Structures/Linings/S25 |  |  |  |  | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |  |  |  |  |                       |

**B00E - R0010 - Laboratory L.S. (85.78 m2)**

|   |   |  |  |  |  |                       |
|---|---|--|--|--|--|-----------------------|
| Ceiling Structures/Linings  | Vermiculite<br>8210/B00E/R9006/Ceiling Structures/Linings/S25 |  |  |  |  | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |  |  |  |  |                       |

| Product   | Material Description                           | Extent | Location Reference | Material Condition | Risk Status | Control Priority      |
|---|--|--------|--------------------|--------------------|-------------|-----------------------|
| Sample No   |  |        |                    |                    | Test Result |                       |
| <b>B00E - R0011 - Preparation (38.8 m2)</b>   |  |        |                    |                    |             |                       |
| Ceiling Structures/Linings  | Vermiculite                                    |        |                    |                    |             |                       |
|   | 8210/B00E/R9006/Ceiling Structures/Linings/S25 |        |                    |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |  |        |                    |                    |             |                       |
| <b>B00E - R0012 - Laboratory L.S. (86.09 m2)</b>  |  |        |                    |                    |             |                       |
| Ceiling Structures/Linings  | Vermiculite                                    |        |                    |                    |             |                       |
|   | 8210/B00E/R9006/Ceiling Structures/Linings/S25 |        |                    |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |  |        |                    |                    |             |                       |
| <b>B00E - R0013 - Cleaning Store - Distributed (1.5 m2)</b>   |  |        |                    |                    |             |                       |
| Ceiling Structures/Linings  | Vermiculite                                    |        |                    |                    |             |                       |
|   | 8210/B00E/R9006/Ceiling Structures/Linings/S25 |        |                    |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |  |        |                    |                    |             |                       |
| <b>B00E - R0014 - Cleaning Store - Distributed (1.55 m2)</b>  |  |        |                    |                    |             |                       |
| Ceiling Structures/Linings  | Vermiculite                                    |        |                    |                    |             |                       |
|   | 8210/B00E/R9006/Ceiling Structures/Linings/S25 |        |                    |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |  |        |                    |                    |             |                       |
| <b>B00E - R0015 - Movement (123.74 m2)</b>  |  |        |                    |                    |             |                       |
| Ceiling Structures/Linings  | Vermiculite                                    |        |                    |                    |             |                       |
|   | 8210/B00E/R9006/Ceiling Structures/Linings/S25 |        |                    |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |  |        |                    |                    |             |                       |
| Electrical Backing Board  | Resinous Board                                 | 1Unit  | East               | Good Condition (1) | Low (1)     | Low Priority (2-3)    |
| <b>Assumed Asbestos - Electrical Hazard</b>   |  |        |                    |                    |             |                       |
| <b>B00E - R0016 - Movement (97.36 m2)</b>   |  |        |                    |                    |             |                       |
| Ceiling Structures/Linings  | Vermiculite                                    |        |                    |                    |             |                       |
|   | 8210/B00E/R9006/Ceiling Structures/Linings/S25 |        |                    |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |  |        |                    |                    |             |                       |
| Electrical Backing Board  | Resinous Board                                 | 1Unit  | West               | Good Condition (1) | Low (1)     | Low Priority (2-3)    |
| <b>Assumed Asbestos - Electrical</b>  |  |        |                    |                    |             |                       |
| <b>B00E - R0017 - Movement (6.3 m2)</b>   |  |        |                    |                    |             |                       |
| No Asbestos   |  |        |                    |                    |             |                       |
| <b>B00E - R0018 - Stairs (1 m2)</b>   |  |        |                    |                    |             |                       |
| Ceiling Structures/Linings  | Vermiculite                                    |        |                    |                    |             |                       |
|   | 8210/B00E/R9006/Ceiling Structures/Linings/S25 |        |                    |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |  |        |                    |                    |             |                       |
| <b>B00E - R0019 - Stairs (2.21 m2)</b>  |  |        |                    |                    |             |                       |
| Ceiling Structures/Linings  | Vermiculite                                    |        |                    |                    |             |                       |
|   | 8210/B00E/R9006/Ceiling Structures/Linings/S25 |        |                    |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |  |        |                    |                    |             |                       |
| <b>B00E - R0020 - Movement (7.59 m2)</b>  |  |        |                    |                    |             |                       |
| No Asbestos   |  |        |                    |                    |             |                       |
| <b>B00E - R0021 - Stairs (0.82 m2)</b>  |  |        |                    |                    |             |                       |
| Ceiling Structures/Linings  | Vermiculite                                    |        |                    |                    |             |                       |
|   | 8210/B00E/R9006/Ceiling Structures/Linings/S25 |        |                    |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |  |        |                    |                    |             |                       |
| <b>B00E - R0022 - Stairs (22.81 m2)</b>   |  |        |                    |                    |             |                       |
| Ceiling Structures/Linings  | Vermiculite                                    |        |                    |                    |             |                       |
|   | 8210/B00E/R9006/Ceiling Structures/Linings/S25 |        |                    |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |  |        |                    |                    |             |                       |
| <b>B00E - R0023 - Movement (3.57 m2)</b>  |  |        |                    |                    |             |                       |
| Ceiling Structures/Linings  | Vermiculite                                    |        |                    |                    |             |                       |
|   | 8210/B00E/R9006/Ceiling Structures/Linings/S25 |        |                    |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |  |        |                    |                    |             |                       |

| Product   | Material Description                      | Extent  | Location Reference | Material Condition | Risk Status | Control Priority      |
|---|---|---|--------------------|--------------------|-------------|-----------------------|
| Sample No   |   |   |                    |                    | Test Result |                       |
| <b>B00E - R0024 - Movement (6.31 m2)</b>  |   |   |                    |                    |             |                       |
| Ceiling Structures/Linings  | Vermiculite                               |   |                    |                    |             |                       |
|   |   | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |                    |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |   |                    |                    |             |                       |
| <b>B00E - R0025 - General Learning Space - Type 3 (40.15 m2)</b>  |   |   |                    |                    |             |                       |
| Ceiling Structures/Linings  | Vermiculite                               |   |                    |                    |             |                       |
|   |   | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |                    |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |   |                    |                    |             |                       |
| <b>B00E - R0026 - Science Laboratory (45.58 m2)</b>   |   |   |                    |                    |             |                       |
| Ceiling Structures/Linings  | Vermiculite                               |   |                    |                    |             |                       |
|   |   | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |                    |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |   |                    |                    |             |                       |
| <b>B00E - R0027 - Science Laboratory (46.82 m2)</b>   |   |   |                    |                    |             |                       |
| Ceiling Structures/Linings  | Vermiculite                               |   |                    |                    |             |                       |
|   |   | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |                    |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |   |                    |                    |             |                       |
| <b>B00E - R0028 - General Learning Space - Type 3 (40.31 m2)</b>  |   |   |                    |                    |             |                       |
| Ceiling Structures/Linings  | Vermiculite                               |   |                    |                    |             |                       |
|   |   | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |                    |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |   |                    |                    |             |                       |
| <b>B00E - R1001 - Music Learning Space (66.28 m2)</b>   |   |   |                    |                    |             |                       |
| Ceiling Structures/Linings  | Vermiculite                               |   |                    |                    |             |                       |
|   |   | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |                    |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |   |                    |                    |             |                       |
| Floor Coverings Res/Textile   | Vinyl Tiles (Under Floor Covering/Carpet) |   |                    |                    |             |                       |
|   |   | 8210/B00C/R1011/Floor Coverings Res/Textile/S21 |                    |                    |             | No Asbestos Detected  |
| Floor Coverings Res/Textile   | Backing                                   |   |                    |                    |             |                       |
|   |   | 8210/B00C/R1011/Floor Coverings Res/Textile/S22 |                    |                    |             | No Asbestos Detected  |
| <b>B00E - R1002 - Music Store (12.67 m2)</b>  |   |   |                    |                    |             |                       |
| Ceiling Structures/Linings  | Vermiculite                               |   |                    |                    |             |                       |
|   |   | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |                    |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |   |                    |                    |             |                       |
| <b>B00E - R1003 - Music Learning Space (52.53 m2)</b>   |   |   |                    |                    |             |                       |
| Ceiling Structures/Linings  | Vermiculite                               |   |                    |                    |             |                       |
|   |   | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |                    |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |   |                    |                    |             |                       |
| Floor Coverings Res/Textile   | Vinyl Tiles (Under Floor Covering/Carpet) |   |                    |                    |             |                       |
|   |   | 8210/B00C/R1011/Floor Coverings Res/Textile/S21 |                    |                    |             | No Asbestos Detected  |
| Floor Coverings Res/Textile   | Backing                                   |   |                    |                    |             |                       |
|   |   | 8210/B00C/R1011/Floor Coverings Res/Textile/S22 |                    |                    |             | No Asbestos Detected  |
| <b>B00E - R1004 - Materials Store (6.27 m2)</b>   |   |   |                    |                    |             |                       |
| Ceiling Structures/Linings  | Vermiculite                               |   |                    |                    |             |                       |
|   |   | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |                    |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |   |                    |                    |             |                       |
| <b>B00E - R1005 - Darkroom Space (6.23 m2)</b>  |   |   |                    |                    |             |                       |
| Ceiling Structures/Linings  | Vermiculite                               |   |                    |                    |             |                       |
|   |   | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |                    |                    |             | Limited Samples Taken |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |   |                    |                    |             |                       |
| <b>B00E - R1006 - Darkroom Space (13.6 m2)</b>  |   |   |                    |                    |             |                       |

| Product   | Material Description                      | Extent  | Location Reference | Material Condition | Risk Status           | Control Priority |
|---|---|---|--------------------|--------------------|-----------------------|------------------|
| Sample No   |   |   |                    |                    | Test Result           |                  |
| Ceiling Structures/Linings  | Vermiculite                               | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |                    |                    | Limited Samples Taken |                  |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |   |                    |                    |                       |                  |
| <b>B00E - R1007 - Workroom (11.41 m2)</b>   |   |   |                    |                    |                       |                  |
| Ceiling Structures/Linings  | Vermiculite                               | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |                    |                    | Limited Samples Taken |                  |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |   |                    |                    |                       |                  |
| <b>B00E - R1008 - Resource/Project Store (11.5 m2)</b>  |   |   |                    |                    |                       |                  |
| Ceiling Structures/Linings  | Vermiculite                               | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |                    |                    | Limited Samples Taken |                  |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |   |                    |                    |                       |                  |
| <b>B00E - R1009 - Art Learning Space (95.82 m2)</b>   |   |   |                    |                    |                       |                  |
| Ceiling Structures/Linings  | Vermiculite                               | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |                    |                    | Limited Samples Taken |                  |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |   |                    |                    |                       |                  |
| <b>B00E - R1010 - Resources Store (11.16 m2)</b>  |   |   |                    |                    |                       |                  |
| Ceiling Structures/Linings  | Vermiculite                               | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |                    |                    | Limited Samples Taken |                  |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |   |                    |                    |                       |                  |
| <b>B00E - R1011 - Staff Study (26.23 m2)</b>  |   |   |                    |                    |                       |                  |
| Ceiling Structures/Linings  | Vermiculite                               | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |                    |                    | Limited Samples Taken |                  |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |   |                    |                    |                       |                  |
| Floor Coverings Res/Textile   | Vinyl Tiles (Under Floor Covering/Carpet) | 8210/B00E/R0004/Floor Coverings Res/Textile/S26 |                    |                    | No Asbestos Detected  |                  |
| Floor Coverings Res/Textile   | Adhesive                                  | 8210/B00E/R0004/Floor Coverings Res/Textile/S27 |                    |                    | No Asbestos Detected  |                  |
| <b>B00E - R1012 - Staff - Toilet (6.49 m2)</b>  |   |   |                    |                    |                       |                  |
| No Asbestos   |   |   |                    |                    |                       |                  |
| <b>B00E - R1013 - General Storeroom (13.06 m2)</b>  |   |   |                    |                    |                       |                  |
| Ceiling Structures/Linings  | Vermiculite                               | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |                    |                    | Limited Samples Taken |                  |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |   |                    |                    |                       |                  |
| Floor Coverings Res/Textile   | Vinyl Sheet                               | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |                    |                    | No Asbestos Detected  |                  |
| <b>B00E - R1014 - Staff Study (39.45 m2)</b>  |   |   |                    |                    |                       |                  |
| Ceiling Structures/Linings  | Vermiculite                               | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |                    |                    | Limited Samples Taken |                  |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |   |                    |                    |                       |                  |
| Floor Coverings Res/Textile   | Vinyl Tiles (Under Floor Covering/Carpet) | 8210/B00E/R0004/Floor Coverings Res/Textile/S26 |                    |                    | No Asbestos Detected  |                  |
| Floor Coverings Res/Textile   | Adhesive                                  | 8210/B00E/R0004/Floor Coverings Res/Textile/S27 |                    |                    | No Asbestos Detected  |                  |
| <b>B00E - R1015 - Computer Store (5.04 m2)</b>  |   |   |                    |                    |                       |                  |
| Ceiling Structures/Linings  | Vermiculite                               | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |                    |                    | Limited Samples Taken |                  |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |   |                    |                    |                       |                  |
| <b>B00E - R1016 - Resources Store (5.09 m2)</b>   |   |   |                    |                    |                       |                  |

| Product   | Material Description                      | Extent  | Location Reference | Material Condition | Risk Status           | Control Priority |
|---|---|---|--------------------|--------------------|-----------------------|------------------|
| Sample No   |   |   |                    |                    | Test Result           |                  |
| Ceiling Structures/Linings  | Vermiculite                               | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |                    |                    | Limited Samples Taken |                  |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |   |                    |                    |                       |                  |
| <b>B00E - R1017 - Cleaning Store - Distributed (2.1 m2)</b>   |   |   |                    |                    |                       |                  |
| Ceiling Structures/Linings  | Vermiculite                               | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |                    |                    | Limited Samples Taken |                  |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |   |                    |                    |                       |                  |
| <b>B00E - R1018 - Computer Learning Space (52.53 m2)</b>  |   |   |                    |                    |                       |                  |
| Ceiling Structures/Linings  | Vermiculite                               | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |                    |                    | Limited Samples Taken |                  |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |   |                    |                    |                       |                  |
| Floor Coverings Res/Textile   | Vinyl Tiles (Under Floor Covering/Carpet) | 8210/B00E/R0004/Floor Coverings Res/Textile/S26 |                    |                    | No Asbestos Detected  |                  |
| Floor Coverings Res/Textile   | Adhesive                                  | 8210/B00E/R0004/Floor Coverings Res/Textile/S27 |                    |                    | No Asbestos Detected  |                  |
| <b>B00E - R1019 - Workroom (12.72 m2)</b>   |   |   |                    |                    |                       |                  |
| Ceiling Structures/Linings  | Vermiculite                               | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |                    |                    | Limited Samples Taken |                  |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |   |                    |                    |                       |                  |
| Floor Coverings Res/Textile   | Vinyl Tiles (Under Floor Covering/Carpet) | 8210/B00E/R0004/Floor Coverings Res/Textile/S26 |                    |                    | No Asbestos Detected  |                  |
| Floor Coverings Res/Textile   | Adhesive                                  | 8210/B00E/R0004/Floor Coverings Res/Textile/S27 |                    |                    | No Asbestos Detected  |                  |
| <b>B00E - R1020 - Staff Study (12.79 m2)</b>  |   |   |                    |                    |                       |                  |
| Ceiling Structures/Linings  | Vermiculite                               | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |                    |                    | Limited Samples Taken |                  |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |   |                    |                    |                       |                  |
| Floor Coverings Res/Textile   | Adhesive                                  | 8210/B00E/R0004/Floor Coverings Res/Textile/S27 |                    |                    | No Asbestos Detected  |                  |
| Floor Coverings Res/Textile   | Vinyl Sheet                               | 8210/B00E/R0004/Floor Coverings Res/Textile/S26 |                    |                    | No Asbestos Detected  |                  |
| <b>B00E - R1021 - Senior Study (65.38 m2)</b>   |   |   |                    |                    |                       |                  |
| Ceiling Structures/Linings  | Vermiculite                               | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |                    |                    | Limited Samples Taken |                  |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |   |                    |                    |                       |                  |
| Floor Coverings Res/Textile   | Vinyl Sheet                               | 8210/B00E/R0004/Floor Coverings Res/Textile/S26 |                    |                    | No Asbestos Detected  |                  |
| Floor Coverings Res/Textile   | Adhesive                                  | 8210/B00E/R0004/Floor Coverings Res/Textile/S27 |                    |                    | No Asbestos Detected  |                  |
| <b>B00E - R1022 - Staff Study (12.82 m2)</b>  |   |   |                    |                    |                       |                  |
| Ceiling Structures/Linings  | Vermiculite                               | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |                    |                    | Limited Samples Taken |                  |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |   |                    |                    |                       |                  |
| Floor Coverings Res/Textile   | Vinyl Sheet                               | 8210/B00E/R0004/Floor Coverings Res/Textile/S26 |                    |                    | No Asbestos Detected  |                  |

| Product   | Material Description                            | Extent | Location Reference | Material Condition | Risk Status                  | Control Priority   |
|---|---|--------|--------------------|--------------------|------------------------------|--------------------|
| Sample No   |   |        |                    |                    | Test Result                  |                    |
| Floor Coverings Res/Textile   | Adhesive  |        |                    |                    |                              |                    |
|   | 8210/B00E/R0004/Floor Coverings Res/Textile/S27 |        |                    |                    | <b>No Asbestos Detected</b>  |                    |
| <b>B00E - R1023 - Computer Resource (12.86 m2)</b>  |   |        |                    |                    |                              |                    |
| Ceiling Structures/Linings  | Vermiculite                                     |        |                    |                    |                              |                    |
|   | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |        |                    |                    | <b>Limited Samples Taken</b> |                    |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |        |                    |                    |                              |                    |
| Floor Coverings Res/Textile   | Vinyl Sheet                                     |        |                    |                    |                              |                    |
|   | 8210/B00E/R0004/Floor Coverings Res/Textile/S26 |        |                    |                    | <b>No Asbestos Detected</b>  |                    |
| Floor Coverings Res/Textile   | Adhesive  |        |                    |                    |                              |                    |
|   | 8210/B00E/R0004/Floor Coverings Res/Textile/S27 |        |                    |                    | <b>No Asbestos Detected</b>  |                    |
| <b>B00E - R1024 - Staff Study (11.87 m2)</b>  |   |        |                    |                    |                              |                    |
| Ceiling Structures/Linings  | Vermiculite                                     |        |                    |                    |                              |                    |
|   | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |        |                    |                    | <b>Limited Samples Taken</b> |                    |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |        |                    |                    |                              |                    |
| Floor Coverings Res/Textile   | Vinyl Tiles (Under Floor Covering/Carpet)       |        |                    |                    |                              |                    |
|   | 8210/B00E/R0004/Floor Coverings Res/Textile/S26 |        |                    |                    | <b>No Asbestos Detected</b>  |                    |
| Floor Coverings Res/Textile   | Adhesive  |        |                    |                    |                              |                    |
|   | 8210/B00E/R0004/Floor Coverings Res/Textile/S27 |        |                    |                    | <b>No Asbestos Detected</b>  |                    |
| <b>B00E - R1025 - Stairs (16.34 m2)</b>   |   |        |                    |                    |                              |                    |
| Ceiling Structures/Linings  | Vermiculite                                     |        |                    |                    |                              |                    |
|   | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |        |                    |                    | <b>Limited Samples Taken</b> |                    |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |        |                    |                    |                              |                    |
| <b>B00E - R1026 - Movement (109.04 m2)</b>  |   |        |                    |                    |                              |                    |
| Ceiling Structures/Linings  | Vermiculite                                     |        |                    |                    |                              |                    |
|   | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |        |                    |                    | <b>Limited Samples Taken</b> |                    |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |        |                    |                    |                              |                    |
| <b>B00E - R1028 - Stairs (4.75 m2)</b>  |   |        |                    |                    |                              |                    |
| Ceiling Structures/Linings  | Vermiculite                                     |        |                    |                    |                              |                    |
|   | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |        |                    |                    | <b>Limited Samples Taken</b> |                    |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |        |                    |                    |                              |                    |
| <b>B00E - R1030 - Stairs (15.96 m2)</b>   |   |        |                    |                    |                              |                    |
| Ceiling Structures/Linings  | Vermiculite                                     |        |                    |                    |                              |                    |
|   | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |        |                    |                    | <b>Limited Samples Taken</b> |                    |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |        |                    |                    |                              |                    |
| <b>B00E - R1031 - Movement (82.6 m2)</b>  |   |        |                    |                    |                              |                    |
| Ceiling Structures/Linings  | Vermiculite                                     |        |                    |                    |                              |                    |
|   | 8210/B00E/R9006/Ceiling Structures/Linings/S25  |        |                    |                    | <b>Limited Samples Taken</b> |                    |
| <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i> |   |        |                    |                    |                              |                    |
| Electrical Backing Board  | Resinous Board                                  | 1Unit  | West               | Good Condition (1) | Low (1)                      | Low Priority (2-3) |
| <b>Assumed Asbestos - Electrical Hazard</b>   |   |        |                    |                    |                              |                    |
| <b>B00E - R2001 - General Storeroom (6.61 m2)</b>   |   |        |                    |                    |                              |                    |
| No Asbestos   |   |        |                    |                    |                              |                    |
| <b>B00E - R9001 - Sport Equipment Store (50.16 m2)</b>  |   |        |                    |                    |                              |                    |
| No Asbestos   |   |        |                    |                    |                              |                    |
| <b>B00E - R9002 - Shower/Change (49.06 m2)</b>  |   |        |                    |                    |                              |                    |
| No Asbestos   |   |        |                    |                    |                              |                    |
| <b>B00E - R9003 - Shower/Change (5.36 m2)</b>   |   |        |                    |                    |                              |                    |
| No Asbestos   |   |        |                    |                    |                              |                    |
| <b>B00E - R9004 - Movement (15.76 m2)</b>   |   |        |                    |                    |                              |                    |

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

Ceiling Structures/Linings Vermiculite  
 8210/B00E/R9006/Ceiling Structures/Linings/S25 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00E - R9005 - Stairs (2.99 m2)**

Ceiling Structures/Linings Vermiculite  
 8210/B00E/R9006/Ceiling Structures/Linings/S25 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00E - R9006 - Movement (17.77 m2)**

Ceiling Structures/Linings Vermiculite  
 8210/B00E/R9006/Ceiling Structures/Linings/S25 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---------|----------------------|--------|--------------------|--------------------|-------------|------------------|
|         | Sample No            |        |                    |                    |             | Test Result      |

**B00G - Multi Purpose Facilities - 2010 - Steel (Steel)****Exterior**

|                  |                   |
|------------------|-------------------|
| Ceiling Voids    | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

**Interior****B00G - R0001 - External Movement (3.13 m2)**

No Asbestos

**B00G - R0002 - Staff Kitchen (10.94 m2)**

No Asbestos

**B00G - R0003 - Staff - Toilet (3.01 m2)**

No Asbestos

**B00G - R0004 - Toilet - Lobby (2.16 m2)**

No Asbestos

**B00G - R0005 - Movement (2.16 m2)**

No Asbestos

**B00G - R0006 - Staff Shower (3 m2)**

No Asbestos

**B00G - R0007 - Staff Study (47.83 m2)**

No Asbestos

**B00G - R0008 - Careers Advisers Office (10.59 m2)**

No Asbestos

**B00G - R0009 - Aboriginal Resource Centre (10.59 m2)**

No Asbestos

2017



| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00H - Mechanical Services - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

|                                   |                             |  |  |  |                             |
|-----------------------------------|-----------------------------|--|--|--|-----------------------------|
| Ceiling Voids - Flat Roof         | No Asbestos Found           |  |  |  |                             |
| Underfloor Voids - Slab on Ground | No Asbestos Found           |  |  |  |                             |
| Eaves Linings                     | Flat AC Sheeting            |  |  |  |                             |
|                                   | 8210/B00H/Eaves Linings/S30 |  |  |  | <b>No Asbestos Detected</b> |

**Interior**

**B00H - R0001 - Plant (5.37 m2)**

|                            |                             |  |  |  |                             |
|----------------------------|-----------------------------|--|--|--|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting            |  |  |  |                             |
|                            | 8210/B00H/Eaves Linings/S30 |  |  |  | <b>No Asbestos Detected</b> |

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00I - Storage - 2005 - Metal Shed (Metal Shed)**

**Exterior**

|                 |                   |
|-----------------|-------------------|
| Ceiling Void    | No Asbestos Found |
| Underfloor Void | No Asbestos Found |

**Interior**

**B00I - R0001 - Bulk Store (78.26 m2)**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00J - Storage - 2014 - Metal Shed (Metal Shed)**

**Exterior**

|                 |                   |
|-----------------|-------------------|
| Ceiling Void    | No Asbestos Found |
| Underfloor Void | No Asbestos Found |

**Interior**

**B00J - R0001 - General Assistants (34.63 m2)**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017