


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Lake Illawarra High School (8474)
Region : Illawarra and South East
State Electorate : Shellharbour
Local Government Area : Shellharbour

Initial Survey : Noel Arnold & Associates : 21 - Apr - 2008
Reviewed By : Grencap-NAA : 26 - Aug - 2014

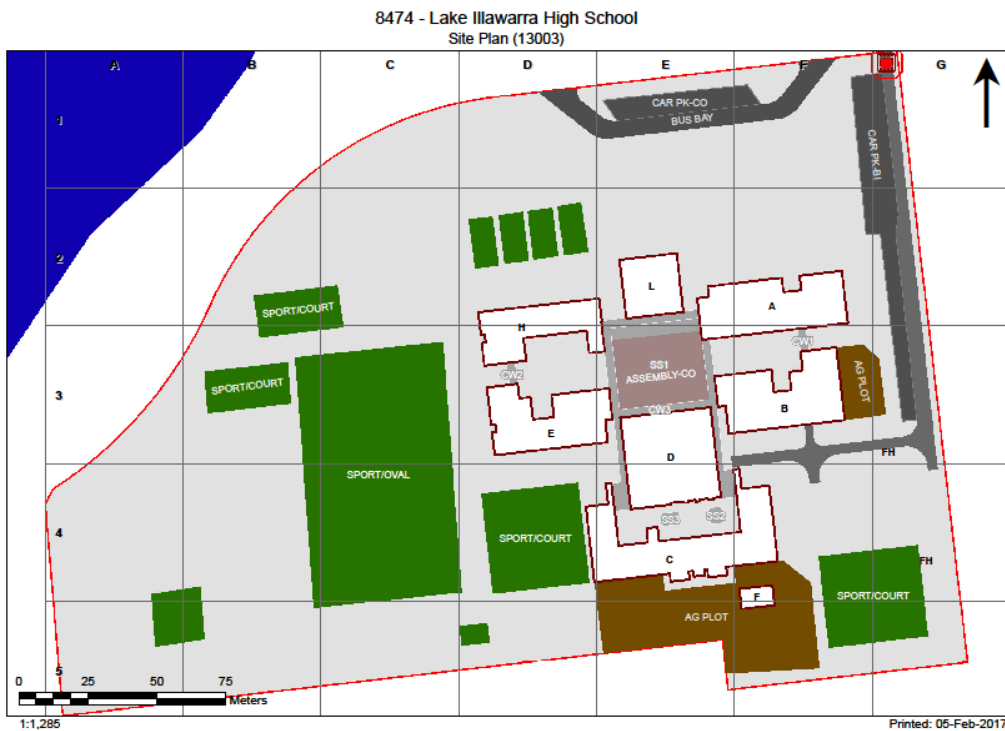

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1974 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	Non Accessible Area - Height Restriction

Interior**B00A - R0001 - Interview/Office - Type 1 (12.73 m2)**

Ceiling Structures/Linings	Vermiculite 8474/B00A/R0024/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8474/B00A/R0001/Floor Coverings Res/Textile/S40	12.73m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8474/B00A/R0001/Floor Coverings Res/Textile/S41	12.73m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00A - R0002 - Cleaning Store - Distributed (3.37 m2)

Floor Coverings Res/Textile	Adhesive 8474/B00A/R0001/Floor Coverings Res/Textile/S41	3.37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8474/B00A/R0001/Floor Coverings Res/Textile/S40	3.37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00A - R0005 - Darkroom Space (13.32 m2)

Ceiling Structures/Linings	Vermiculite 8474/B00A/R0024/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	---

B00A - R0007 - External Movement (10.44 m2)

No Asbestos

B00A - R0008 - Careers Advisers Office (13.39 m2)

Ceiling Structures/Linings	Vermiculite 8474/B00A/R0024/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Adhesive 8474/B00A/R0001/Floor Coverings Res/Textile/S41	13.39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8474/B00A/R0001/Floor Coverings Res/Textile/S40	13.39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00A - R0009 - Interview/Office - Type 1 (13.28 m2)

Ceiling Structures/Linings	Vermiculite 8474/B00A/R0024/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Adhesive 8474/B00A/R0001/Floor Coverings Res/Textile/S41	13.28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8474/B00A/R0001/Floor Coverings Res/Textile/S40	13.28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00A - R0010 - External Movement (27.24 m2)

No Asbestos

B00A - R0011 - Sport Equipment Store (5.75 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Adhesive	5.75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S41				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	5.75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S40				Chrysotile (white asbestos)		
B00A - R0012 - Commonroom (126.52 m2)						
Ceiling Structures/Linings	Vermiculite					
8474/B00A/R0024/Ceiling Structures/Linings/S1				Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
8474/B00A/R0012/Floor Coverings Res/Textile/S3				No Asbestos Detected		
B00A - R0013 - External Movement (9.12 m2)						
No Asbestos						
B00A - R0014 - General Storeroom (5.57 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
8474/B00A/R0012/Floor Coverings Res/Textile/S3				No Asbestos Detected		
B00A - R0015 - Staff - Toilet (20.08 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
8474/B00A/R0015/Floor Coverings Res/Textile/S4				No Asbestos Detected		
B00A - R0016 - Clinic-Waiting (25.81 m2)						
Ceiling Structures/Linings	Vermiculite					
8474/B00A/R0024/Ceiling Structures/Linings/S1				Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
8474/B00A/R0015/Floor Coverings Res/Textile/S4				No Asbestos Detected		
B00A - R0017 - General Storeroom (9.14 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
8474/B00A/R0015/Floor Coverings Res/Textile/S4				No Asbestos Detected		
B00A - R0018 - Duplicating Workroom (21.71 m2)						
Ceiling Structures/Linings	Vermiculite					
8474/B00A/R0024/Ceiling Structures/Linings/S1				Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0019 - Staff - Toilet (5.17 m2)						
No Asbestos						
B00A - R0020 - Staff - Toilet (5.21 m2)						
No Asbestos						
B00A - R0021 - Movement (46.81 m2)						
Ceiling Structures/Linings	Vermiculite					
8474/B00A/R0024/Ceiling Structures/Linings/S1				Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Adhesive	46.81m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S41				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	46.81m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S40				Chrysotile (white asbestos)		
B00A - R0022 - General Storeroom (7.4 m2)						
No Asbestos						
B00A - R0023 - External Movement (87.83 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00A - R0024 - Public Entry (16.96 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00A/R0024/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Adhesive 8474/B00A/R0001/Floor Coverings Res/Textile/S41	16.96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8474/B00A/R0001/Floor Coverings Res/Textile/S40	16.96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0025 - Administration - Clerical (11.6 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00A/R0024/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Adhesive 8474/B00A/R0001/Floor Coverings Res/Textile/S41	11.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8474/B00A/R0001/Floor Coverings Res/Textile/S40	11.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0026 - Administration - Clerical (28.91 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00A/R0024/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Adhesive 8474/B00A/R0001/Floor Coverings Res/Textile/S41	28.91m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8474/B00A/R0001/Floor Coverings Res/Textile/S40	28.91m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0027 - Principal Office (21.95 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00A/R0024/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Adhesive 8474/B00A/R0001/Floor Coverings Res/Textile/S41	21.95m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8474/B00A/R0001/Floor Coverings Res/Textile/S40	21.95m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0028 - Staff - Toilet (3.33 m2)						
No Asbestos						
B00A - R0029 - General Storeroom (1.87 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00A/R0015/Floor Coverings Res/Textile/S4					No Asbestos Detected
B00A - R0030 - Security Store (13.62 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00A/R0024/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0031 - Distribution Board Cupboard (1.41 m2)						
				Note: No inspection of live electrical installation.		
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00A/R0015/Floor Coverings Res/Textile/S4					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Adhesive	1.41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S41				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	1.41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S40				Chrysotile (white asbestos)		
B00A - R0032 - Staff - Toilet (21.22 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
8474/B00A/R0015/Floor Coverings Res/Textile/S4				No Asbestos Detected		
B00A - R0033 - Staff Change (5.59 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
8474/B00A/R0015/Floor Coverings Res/Textile/S4				No Asbestos Detected		
B00A - R0034 - External Movement (9.15 m2)						
No Asbestos						
B00A - R0035 - Interview/Office - Type 1 (10.82 m2)						
Ceiling Structures/Linings	Vermiculite					
8474/B00A/R0024/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Adhesive	10.82m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S41				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	10.82m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S40				Chrysotile (white asbestos)		
B00A - R0036 - Interview/Office - Type 1 (11.66 m2)						
Ceiling Structures/Linings	Vermiculite					
8474/B00A/R0024/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Adhesive	11.66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S41				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	11.66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S40				Chrysotile (white asbestos)		
B00A - R0037 - Toilets-Girls (6.4 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0037/Partition Walls (Cubicles)/S2				Chrysotile (white asbestos)		
B00A - R0038 - Toilets-Boys (5.95 m2)						
No Asbestos						
B00A - R0039 - Interview/Office - Type 1 (12.17 m2)						
Ceiling Structures/Linings	Vermiculite					
8474/B00A/R0024/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Adhesive	12.17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S41				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	12.17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S40				Chrysotile (white asbestos)		
B00A - R0040 - Interview/Office - Type 1 (12.07 m2)						
Ceiling Structures/Linings	Vermiculite					
8474/B00A/R0024/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Adhesive	12.07m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S41				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	12.07m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S40				Chrysotile (white asbestos)		
B00A - R0041 - Movement (57.15 m2)						
Ceiling Structures/Linings	Vermiculite					
8474/B00A/R0024/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Adhesive	57.15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S41				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	57.15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S40				Chrysotile (white asbestos)		
B00A - R0042 - Art Learning Space (45.96 m2)						
Ceiling Structures/Linings	Vermiculite					
8474/B00A/R0024/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Adhesive	45.96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S41				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	45.96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S40				Chrysotile (white asbestos)		
B00A - R0043 - General Learning Space (41.61 m2)						
Ceiling Structures/Linings	Vermiculite					
8474/B00A/R0024/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Adhesive	41.61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S41				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	41.61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S40				Chrysotile (white asbestos)		
B00A - R0044 - Dark Room (18.33 m2)						
Ceiling Structures/Linings	Vermiculite					
8474/B00A/R0024/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Adhesive	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S40				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S40				Chrysotile (white asbestos)		
B00A - R0045 - External Stairs (16 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
B00A - R0046 - External Stairs (17.31 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	17.31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
B00A - R1001 - General Learning Space (64.02 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8474/B00A/R0024/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Adhesive 8474/B00A/R0001/Floor Coverings Res/Textile/S41	64.02m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8474/B00A/R0001/Floor Coverings Res/Textile/S40	64.02m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
B00A - R1002 - General Learning Space (64.22 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00A/R0024/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Adhesive 8474/B00A/R0001/Floor Coverings Res/Textile/S41	64.22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8474/B00A/R0001/Floor Coverings Res/Textile/S40	64.22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
B00A - R1003 - General Learning Space (53.8 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00A/R0024/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Adhesive 8474/B00A/R0001/Floor Coverings Res/Textile/S41	53.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8474/B00A/R0001/Floor Coverings Res/Textile/S40	53.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
B00A - R1004 - Movement (21.22 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00A/R0024/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Adhesive 8474/B00A/R0001/Floor Coverings Res/Textile/S41	21.22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8474/B00A/R0001/Floor Coverings Res/Textile/S40	21.22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
B00A - R1005 - External Movement (58.15 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8474/B00A/R1017/Ceiling Structures/Linings/S6	25m2	Over stairs	Good Condition (1)	Low (1)	Low Priority (2-3)
Floor Coverings Res/Textile	Adhesive 8474/B00A/R0001/Floor Coverings Res/Textile/S41	58.15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8474/B00A/R0001/Floor Coverings Res/Textile/S40	51.85m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
B00A - R1006 - Study Space (39.78 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00A/R0024/Ceiling Structures/Linings/S1				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Adhesive 8474/B00A/R0001/Floor Coverings Res/Textile/S41	39.78m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8474/B00A/R0001/Floor Coverings Res/Textile/S40	39.78m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1007 - Cleaning Store - Distributed (1.45 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00A/R0024/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00A/R0015/Floor Coverings Res/Textile/S4					No Asbestos Detected
B00A - R1008 - Toilets-Boys (17.22 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8474/B00A/R1008/Ceiling Structures/Linings/S5	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet 8474/B00A/R0037/Partition Walls (Cubicles)/S2	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1009 - Distribution Board Cupboard (0.7 m2) Note: No inspection of live electrical installation.						
Floor Coverings Res/Textile	Adhesive 8474/B00A/R0001/Floor Coverings Res/Textile/S41	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8474/B00A/R0001/Floor Coverings Res/Textile/S40	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Electrical Backing Board	Resinous Board 8474/B00A/R1009/Electrical Backing Board/S42	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1010 - Toilets-Girls (18.59 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8474/B00A/R1008/Ceiling Structures/Linings/S5	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet 8474/B00A/R0037/Partition Walls (Cubicles)/S2	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1011 - Clinic - Boys (12.57 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00A/R0024/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Adhesive 8474/B00A/R0001/Floor Coverings Res/Textile/S41	12.57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8474/B00A/R0001/Floor Coverings Res/Textile/S40	12.57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1012 - Clinic - Girls (16.62 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00A/R0024/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Adhesive 8474/B00A/R0001/Floor Coverings Res/Textile/S41	16.62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8474/B00A/R0001/Floor Coverings Res/Textile/S40	16.62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1013 - General Storeroom (5.85 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8474/B00A/R0024/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Adhesive 8474/B00A/R0001/Floor Coverings Res/Textile/S41	5.85m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8474/B00A/R0001/Floor Coverings Res/Textile/S40	5.85m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1014 - Deputy Principal Office (16.57 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00A/R0024/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Adhesive 8474/B00A/R0001/Floor Coverings Res/Textile/S41	16.57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8474/B00A/R0001/Floor Coverings Res/Textile/S40	16.57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1015 - Leading Teacher (12.53 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00A/R0024/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Adhesive 8474/B00A/R0001/Floor Coverings Res/Textile/S41	12.53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8474/B00A/R0001/Floor Coverings Res/Textile/S40	12.53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1016 - Movement (74.59 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00A/R0024/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Adhesive 8474/B00A/R0001/Floor Coverings Res/Textile/S41	74.59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8474/B00A/R0001/Floor Coverings Res/Textile/S40	74.59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1017 - External Movement (63.26 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8474/B00A/R1017/Ceiling Structures/Linings/S6	25m2	Over stairs	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1018 - Staff Study (30.56 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00A/R0024/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Adhesive 8474/B00A/R0001/Floor Coverings Res/Textile/S41	30.56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8474/B00A/R0001/Floor Coverings Res/Textile/S40	30.56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1019 - General Learning Space (52.77 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00A/R0024/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Adhesive	52.77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S41				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S40				Chrysotile (white asbestos)		
B00A - R1020 - General Learning Space (52.77 m2)						
Ceiling Structures/Linings	Vermiculite					
8474/B00A/R0024/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Adhesive	52.77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S41				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S40				Chrysotile (white asbestos)		
B00A - R1021 - General Learning Space (53.14 m2)						
Ceiling Structures/Linings	Vermiculite					
8474/B00A/R0024/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Adhesive	53.14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S41				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S40				Chrysotile (white asbestos)		
B00A - R1022 - General Learning Space (53.8 m2)						
Ceiling Structures/Linings	Vermiculite					
8474/B00A/R0024/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Adhesive	53.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S41				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00A/R0001/Floor Coverings Res/Textile/S40				Chrysotile (white asbestos)		
B00A - R1023 - External Stairs (23.18 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	23.18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
B00A - R1024 - External Stairs (24 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	24.0m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Science/Agricultural Science - 1974 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Raft slab on ground
Ceiling Voids	Non Accessible Area - Height Restriction
Ceiling Voids	Non Accessible Area - Height Restriction

Interior**B00B - R0001 - Laboratory L.S. (71.12 m2)**

Ceiling Structures/Linings	Vermiculite 8474/B00B/R0018/Ceiling Structures/Linings/S8					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00B/R0020/Floor Coverings Res/Textile/S9	71.12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00B - R0002 - Computer Resource (22.31 m2)

Ceiling Structures/Linings	Vermiculite 8474/B00B/R0018/Ceiling Structures/Linings/S8					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00B/R0020/Floor Coverings Res/Textile/S9	22.31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00B - R0003 - Apparatus Store (12.77 m2)

Ceiling Structures/Linings	Vermiculite 8474/B00B/R0018/Ceiling Structures/Linings/S8					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00B/R0020/Floor Coverings Res/Textile/S9	12.77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00B - R0004 - Staff Study (32.65 m2)

Ceiling Structures/Linings	Vermiculite 8474/B00B/R0018/Ceiling Structures/Linings/S8					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00B/R0020/Floor Coverings Res/Textile/S9	32.65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00B - R0005 - General Storeroom (3.36 m2)

Ceiling Structures/Linings	Vermiculite 8474/B00B/R0018/Ceiling Structures/Linings/S8					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00B/R0020/Floor Coverings Res/Textile/S9	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00B - R0007 - Distribution Board Cupboard (0.59 m2)

No Asbestos						Note: No inspection of live electrical installation.
-------------	--	--	--	--	--	--

B00B - R0008 - Workshop Area (42.37 m2)

Ceiling Structures/Linings	Flat AC Sheeting 8474/B00B/R0008/Ceiling Structures/Linings/S44	42.37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	---------	------------	--------------------	---------	---

B00B - R0009 - Laboratory L.S. (93.84 m2)

Ceiling Structures/Linings	Vermiculite 8474/B00B/R0018/Ceiling Structures/Linings/S8					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	--	--	--	--	--	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0010 - Preparation (36.45 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00B/R0020/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
8474/B00B/R0018/Ceiling Structures/Linings/S8					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R0011 - Chemical Store (3.76 m2)						
Ceiling Structures/Linings	Vermiculite					
8474/B00B/R0018/Ceiling Structures/Linings/S8					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00B/R0020/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00B - R0012 - Growing/Breeding (14.08 m2)						
Ceiling Structures/Linings	Vermiculite					
8474/B00B/R0018/Ceiling Structures/Linings/S8					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00B/R0020/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00B - R0014 - General Storeroom (7.43 m2)						
No Asbestos						
B00B - R0015 - Toilets-Girls (20.65 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet					
8474/B00B/R0015/Partition Walls (Cubicles)/S7					No Asbestos Detected	
B00B - R0016 - Toilets-Boys (17.51 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet					
8474/B00B/R0015/Partition Walls (Cubicles)/S7					No Asbestos Detected	
B00B - R0017 - Cleaning Store - Distributed (1.51 m2)						
No Asbestos						
B00B - R0018 - Study Space (25.81 m2)						
Ceiling Structures/Linings	Vermiculite					
8474/B00B/R0018/Ceiling Structures/Linings/S8					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R0019 - Distribution Board Cupboard (0.62 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B00B - R0020 - Apparatus Store (37.63 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00B/R0020/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00B - R0021 - General Storeroom (14.35 m2)						
No Asbestos						
B00B - R0022 - Lift (0.84 m2)						
No Asbestos						
B00B - R0023 - External Movement (169.28 m2)						
No Asbestos						
B00B - R0024 - External Stairs (15.43 m2)						
Ceiling Structures/Linings	Non Accessible Area - Height Restriction					
B00B - R0025 - External Stairs (8.23 m2)						
Ceiling Structures/Linings	Non Accessible Area - Height Restriction					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00B - R0026 - Laboratory L.S. (93.93 m2)						
Ceiling Structures/Linings	Vermiculite					
	8474/B00B/R0018/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0027 - Laboratory L.S. (89.11 m2)						
Ceiling Structures/Linings	Vermiculite					
	8474/B00B/R0018/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1002 - Distribution Board Cupboard (0.57 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B00B - R1003 - Preparation (32.56 m2)						
Ceiling Structures/Linings	Vermiculite					
	8474/B00B/R0018/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8474/B00B/R0020/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00B - R1004 - Apparatus Store (3.54 m2)						
Ceiling Structures/Linings	Vermiculite					
	8474/B00B/R0018/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8474/B00B/R0020/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00B - R1005 - Apparatus Store (12.82 m2)						
Ceiling Structures/Linings	Vermiculite					
	8474/B00B/R0018/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8474/B00B/R0020/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00B - R1011 - Plant (0.71 m2)						
Electrical Backing Board	Resinous Board	.2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8474/B00B/R1011/Electrical Backing Board/S46					Chrysotile (white asbestos)
B00B - R1013 - Toilets-Girls (19.55 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	8474/B00B/R1020/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
	8474/B00B/R0015/Partition Walls (Cubicles)/S7					
B00B - R1014 - Toilets-Girls (17.69 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8474/B00B/R1020/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)
B00B - R1015 - Cleaning Store - Distributed (1.52 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8474/B00B/R1020/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)
B00B - R1016 - External Movement (4.43 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8474/B00B/R1020/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8474/B00B/R0020/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R1017 - General Storeroom (7.71 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8474/B00B/R1020/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8474/B00B/R0020/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00B - R1018 - Plant Space (12.46 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8474/B00B/R1020/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8474/B00B/R1018/Floor Coverings Res/Textile/S12					
B00B - R1019 - Distribution Board Cupboard (0.65 m2) Note: No inspection of live electrical installation.						
Electrical Backing Board	Resinous Board	0.2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8474/B00B/R1019/Electrical Backing Board/S43					Chrysotile (white asbestos)
B00B - R1020 - Chemical Store (37.14 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8474/B00B/R1020/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8474/B00B/R0020/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)
B00B - R1021 - Lift (0.84 m2)						
No Asbestos						
B00B - R1022 - External Movement (139.36 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	140m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8474/B00B/R1022/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)
B00B - R1023 - External Stairs (24.06 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	24.06m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Height Restriction
B00B - R1024 - External Stairs (23.25 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	23.25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Height Restriction
B00B - R1028 - Laboratory L.S. (87.41 m2)						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	8474/B00B/R1029/Wall Linings Internal/S45					
B00B - R1029 - Laboratory L.S. (87.32 m2)						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	8474/B00B/R1029/Wall Linings Internal/S45					
B00B - R1030 - Preparation - Science (52.24 m2)						
Ceiling Structures/Linings	Vermiculite	52.24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Above false ceiling
B00B - R1031 - Laboratory L.S. (86.42 m2)						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	8474/B00B/R1029/Wall Linings Internal/S45					
B00B - R1032 - Laboratory L.S. (86.24 m2)						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	8474/B00B/R1029/Wall Linings Internal/S45					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Art/Technological & Applied Studies - 1974 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	Non Accessible Area - Area inaccessible

Interior**B00C - R0001 - General Assistants (13.17 m2)**

No Asbestos

B00C - R0002 - Staff - Toilet (4.35 m2)

No Asbestos

B00C - R0004 - Maintenance Bulk Store (18.64 m2)

No Asbestos

B00C - R0006 - Distribution Board Cupboard (0.58 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00C - R0016 - Materials Technology L.S. (77.48 m2)

Ceiling Structures/Linings Vermiculite
8474/B00C/R0007/Ceiling Structures/Linings/S13

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**B00C - R0017 - Wood Technology Bay (13.41 m2)**

Ceiling Structures/Linings Vermiculite
8474/B00C/R0007/Ceiling Structures/Linings/S13

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**B00C - R0018 - Wood Technology Bay (19.21 m2)**

Ceiling Structures/Linings Vermiculite
8474/B00C/R0007/Ceiling Structures/Linings/S13

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**B00C - R0019 - Materials Technology L.S. (77.67 m2)**

Ceiling Structures/Linings Vermiculite
8474/B00C/R0007/Ceiling Structures/Linings/S13

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**B00C - R0020 - General Learning Space (31.53 m2)**

No Asbestos

B00C - R0021 - General Storeroom (6.23 m2)

No Asbestos

B00C - R0022 - General Storeroom (5.86 m2)

No Asbestos

B00C - R0023 - Distribution Board Cupboard (0.59 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00C - R0024 - Art Learning Space (66.25 m2)

Ceiling Structures/Linings Vermiculite
8474/B00C/R0007/Ceiling Structures/Linings/S13

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Tiles	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8474/B00C/R0024/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)

B00C - R0025 - Kiln Space (69.76 m2)

Ceiling Structures/Linings	Flat AC Sheeting	70m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

Assumed Asbestos - Height Restriction

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting 8474/B00C/R0025/Wall Linings Internal/S18					No Asbestos Detected
B00C - R0034 - Distribution Board Cupboard (0.57 m2)					Note: No inspection of live electrical installation.	
Electrical Backing Board	Resinous Board 8474/B00C/R0034/Electrical Backing Board/S48	1.0m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R0036 - Dust Extraction Space (7.17 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00C/R0007/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R0037 - Cleaning Store - Distributed (6.13 m2)					No Asbestos	
B00C - R0038 - General Storeroom (6.13 m2)					No Asbestos	
B00C - R0039 - Art Learning Space (67.47 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00C/R0007/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00C/R0026/Floor Coverings Res/Textile/S17					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00C/R0024/Floor Coverings Res/Textile/S16	67.47m2	South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R0040 - Movement (3.61 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00C/R0026/Floor Coverings Res/Textile/S17					No Asbestos Detected
B00C - R0041 - Craft Store (17.55 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00C/R0026/Floor Coverings Res/Textile/S17					No Asbestos Detected
B00C - R0042 - Art Learning Space (62.92 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00C/R0024/Floor Coverings Res/Textile/S16	62.92m2	South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8474/B00C/R0007/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R0043 - Darkroom Space (3.14 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00C/R0007/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00C/R0026/Floor Coverings Res/Textile/S17					No Asbestos Detected
B00C - R0044 - Dark Room (37.77 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00C/R0007/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00C/R0026/Floor Coverings Res/Textile/S17					No Asbestos Detected
B00C - R0045 - General Storeroom (2.38 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8474/B00C/R0007/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R0046 - External Stairs (6.31 m2)						
No Asbestos						
B00C - R0047 - Store (20.54 m2)						
No Asbestos						
B00C - R0048 - Store (20.68 m2)						
No Asbestos						
B00C - R0049 - External Stairs (6.8 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Assumed Asbestos - Height Restriction</i>
B00C - R0050 - External Stairs (6.8 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Assumed Asbestos - Height Restriction</i>
B00C - R0054 - Metal Technology Bay (89.29 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00C/R0007/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R0055 - Metal Technology Bay (107.65 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00C/R0007/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R0056 - Store (10.01 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00C/R0007/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R0057 - Metal Technology Bay (80.08 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00C/R0007/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R0058 - Workshop Area (3.85 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00C/R0007/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R0059 - Welding Area (3.94 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00C/R0007/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R0060 - Welding Area (3.92 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00C/R0007/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R0061 - External Movement (30.03 m2)						
No Asbestos						
B00C - R0062 - External Movement (116.6 m2)						
No Asbestos						
B00C - R1001 - Staff Study (55.79 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00C/R0007/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R1002 - Staff - Toilet (10.28 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8474/B00C/R1003/Ceiling Structures/Linings/S19				Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8474/B00C/R1003/Partition Walls (Cubicles)/S20				Chrysotile (white asbestos)	
B00C - R1003 - Staff - Toilet (10.34 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8474/B00C/R1003/Ceiling Structures/Linings/S19				Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8474/B00C/R1003/Partition Walls (Cubicles)/S20				Chrysotile (white asbestos)	
B00C - R1004 - Distribution Board Cupboard (0.54 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B00C - R1005 - Computer Learning Space (66.07 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8474/B00C/R0007/Ceiling Structures/Linings/S13				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
In-fill-panel	Flat AC Sheeting	2m	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Height Restriction					
B00C - R1006 - Computer Resource (23.29 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8474/B00C/R0007/Ceiling Structures/Linings/S13				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00C - R1007 - Design L.S. (66.36 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8474/B00C/R0007/Ceiling Structures/Linings/S13				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	66.36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8474/B00C/R0024/Floor Coverings Res/Textile/S16				Chrysotile (white asbestos)	
B00C - R1008 - Movement (7.17 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8474/B00C/R0007/Ceiling Structures/Linings/S13				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	7.17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8474/B00C/R0024/Floor Coverings Res/Textile/S16				Chrysotile (white asbestos)	
B00C - R1009 - Food Technology L.S. (94.42 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8474/B00C/R0007/Ceiling Structures/Linings/S13				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	95m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8474/B00C/R0024/Floor Coverings Res/Textile/S16				Chrysotile (white asbestos)	
B00C - R1010 - Laundry (14.49 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8474/B00C/R0007/Ceiling Structures/Linings/S13				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8474/B00C/R0024/Floor Coverings Res/Textile/S16				Chrysotile (white asbestos)	
B00C - R1011 - Food/Research Space (16.67 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8474/B00C/R0007/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00C/R0024/Floor Coverings Res/Textile/S16	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1012 - Staff Study (15.16 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00C/R0007/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R1013 - Food/Research Space (95.69 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00C/R0007/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00C/R0024/Floor Coverings Res/Textile/S16	96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1014 - External Movement (4.62 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00C/R0007/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R1015 - Commonroom (31.7 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00C/R0007/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00C/R0024/Floor Coverings Res/Textile/S16	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1016 - Cleaning Supplies Store (11.43 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00C/R0007/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00C/R0024/Floor Coverings Res/Textile/S16	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1017 - Distribution Board Cupboard (0.59 m2)						
No Asbestos				Note: No inspection of live electrical installation.		
B00C - R1018 - Design L.S. (69.57 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00C/R0007/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00C/R0024/Floor Coverings Res/Textile/S16	20m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting	3m	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Height Restriction
B00C - R1019 - Materials Store (5.12 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00C/R0007/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00C/R0024/Floor Coverings Res/Textile/S16	5.12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1020 - Design L.S. (69.28 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8474/B00C/R0007/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00C/R0024/Floor Coverings Res/Textile/S16	20m2	South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1021 - Materials Store (6.3 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00C/R0007/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00C/R0024/Floor Coverings Res/Textile/S16	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1022 - External Movement (2.79 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00C/R0007/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R1023 - External Movement (4.76 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00C/R0007/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R1024 - General Storeroom (19.39 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00C/R0007/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00C/R0024/Floor Coverings Res/Textile/S16	19.39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1025 - Cleaning Supplies Store (13.4 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00C/R0007/Ceiling Structures/Linings/S13					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00C/R0024/Floor Coverings Res/Textile/S16	13.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1026 - Distribution Board Cupboard (0.56 m2)						
No Asbestos				Note: No inspection of live electrical installation.		
B00C - R1027 - External Movement (160.41 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8474/B00C/R1027/Ceiling Structures/Linings/S21	161m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1028 - External Stairs (10.32 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Other - 1974 - Brick/Block (Brick/Block)**Exterior**

In-fill-panel	Compressed AC Sheet 8474/B00D/In-fill-panel/S38					No Asbestos Detected
Electrical Backing Board	Resinous Board 8474/B00D/Electrical Backing Board/S47	2.4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00D - R0001 - Student Canteen (59.43 m2)**

No Asbestos

B00D - R0002 - Office/Store (11.56 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8474/B00D/R0002/Floor Coverings Res/Textile/S22	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	------	------------	--------------------	---------	--

B00D - R0003 - Staff - Toilet (10.22 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8474/B00D/R0002/Floor Coverings Res/Textile/S22	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	------	------------	--------------------	---------	--

B00D - R0004 - Staff Study (11.2 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8474/B00D/R0002/Floor Coverings Res/Textile/S22	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	------	------------	--------------------	---------	--

B00D - R0005 - External Movement (4.86 m2)

No Asbestos

B00D - R0006 - General Storeroom (0.89 m2)

No Asbestos

B00D - R0007 - Shower/Change (24.94 m2)

No Asbestos

B00D - R0008 - Toilets-Girls (14.85 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 8474/B00D/R0008/Partition Walls (Cubicles)/S36	8m2	West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	-----	------	--------------------	---------	--

B00D - R0009 - Shower/Change (43.85 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 8474/B00D/R0009/Partition Walls (Cubicles)/S37	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	------	------------	--------------------	---------	--

B00D - R0010 - Movement (0.87 m2)

No Asbestos

B00D - R0011 - Shower/Change (25.07 m2)

No Asbestos

B00D - R0012 - Toilets-Girls (14.72 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 8474/B00D/R0008/Partition Walls (Cubicles)/S36	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	-----	------	--------------------	---------	--

B00D - R0013 - External Movement (30.47 m2)

No Asbestos

B00D - R0014 - Plant (3.27 m2)

No Asbestos

B00D - R0016 - Performing Arts Store (20.05 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00D/R0002/Floor Coverings Res/Textile/S22					Chrysotile (white asbestos)	
B00D - R0017 - Performance Workspace (103.11 m2)						
No Asbestos						
B00D - R0018 - External Movement (5.68 m2)						
No Asbestos						
B00D - R0020 - Sport Equipment Store (8.55 m2)						
No Asbestos						
B00D - R0021 - Cleaning Store - Distributed (2.25 m2)						
No Asbestos						
B00D - R0022 - Main Switchroom (9.51 m2)						
No Asbestos						
B00D - R0023 - Sport Equipment Store (8.23 m2)						
No Asbestos						
B00D - R0024 - External Movement (4.85 m2)						
No Asbestos						
B00D - R0025 - Sport Equipment Store (62.24 m2)						
No Asbestos						
B00D - R0026 - Pupil Entry (67.01 m2)						
No Asbestos						
B00D - R0027 - Multi-Purpose Space (457.8 m2)						
No Asbestos						
B00D - R1001 - External Movement (1.03 m2)						
No Asbestos						
B00D - R1002 - Shower/Change (32.29 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00D/R1012/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	
B00D - R1003 - Toilets-Boys (6.09 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00D/R1012/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	
B00D - R1004 - Cleaning Store - Distributed (2.95 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00D/R1012/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	
B00D - R1005 - Staff Shower (11.61 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00D/R1012/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	
B00D - R1006 - Plant (12.93 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00D/R1012/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	
Flue	Fibre Cement Pipe	4m	West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8474/B00D/R1006/Flue/S24					Chrysotile (white asbestos)	
B00D - R1007 - Music Learning Space (13.76 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00D/R1012/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00D/R0002/Floor Coverings Res/Textile/S22				Chrysotile (white asbestos)		
B00D - R1008 - Music Learning Space (82.83 m2)						
No Asbestos						
B00D - R1009 - Music Learning Space (79.01 m2)						
No Asbestos						
B00D - R1010 - Control Room (25.68 m2)						
No Asbestos						
B00D - R1011 - Control Room (14.3 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00D/R0002/Floor Coverings Res/Textile/S22				Chrysotile (white asbestos)		
B00D - R1012 - General Storeroom (11.83 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00D/R1012/Ceiling Structures/Linings/S23				Chrysotile (white asbestos)		
B00D - R1013 - Control Room (13.2 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00D/R1012/Ceiling Structures/Linings/S23				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00D/R0002/Floor Coverings Res/Textile/S22				Chrysotile (white asbestos)		
B00D - R1014 - Gymnasium (44.93 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00D/R1012/Ceiling Structures/Linings/S23				Chrysotile (white asbestos)		
B00D - R1015 - External Movement (0.96 m2)						
No Asbestos						
B00D - R1016 - Shower/Change (32.32 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00D/R1012/Ceiling Structures/Linings/S23				Chrysotile (white asbestos)		
B00D - R1017 - Cleaning Store - Distributed (3.01 m2)						
No Asbestos						
B00D - R1018 - Toilets-Boys (6.58 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00D/R1012/Ceiling Structures/Linings/S23				Chrysotile (white asbestos)		
B00D - R1019 - Shower/Change (45.28 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00D/R1012/Ceiling Structures/Linings/S23				Chrysotile (white asbestos)		
B00D - R1020 - External Movement (21.87 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00D/R1012/Ceiling Structures/Linings/S23				Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning/Art - 1974 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	Non Accessible Area - Area inaccessible

Interior**B00E - R0001 - General Storeroom (6.59 m2)**

No Asbestos

B00E - R0002 - General Learning Space (53.66 m2)

Ceiling Structures/Linings	Vermiculite 8474/B00E/R0014/Ceiling Structures/Linings/S25					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00E/R0004/Floor Coverings Res/Textile/S28	53.66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00E - R0003 - General Learning Space (52.56 m2)

Ceiling Structures/Linings	Vermiculite 8474/B00E/R0014/Ceiling Structures/Linings/S25					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00E/R0004/Floor Coverings Res/Textile/S28	52.56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00E - R0004 - Darkroom Space (25.11 m2)

Ceiling Structures/Linings	Vermiculite 8474/B00E/R0014/Ceiling Structures/Linings/S25					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00E/R0004/Floor Coverings Res/Textile/S28	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00E - R0005 - Cleaning Store - Distributed (0.63 m2)

No Asbestos

B00E - R0006 - Distribution Board Cupboard (1 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00E - R0007 - Computer Resource (5.8 m2)

Ceiling Structures/Linings	Vermiculite 8474/B00E/R0014/Ceiling Structures/Linings/S25					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00E/R0004/Floor Coverings Res/Textile/S28	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00E - R0008 - Staff Study (45.45 m2)

Ceiling Structures/Linings	Vermiculite 8474/B00E/R0014/Ceiling Structures/Linings/S25					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00E/R0004/Floor Coverings Res/Textile/S28	45.45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00E - R0009 - General Learning Space (52.49 m2)

No Asbestos

B00E - R0010 - Art Learning Space (66.01 m2)

No Asbestos

B00E - R0011 - General Learning Space (51.2 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00E - R0012 - General Learning Space (53.73 m2)

Ceiling Structures/Linings	Vermiculite					
	8474/B00E/R0014/Ceiling Structures/Linings/S25					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	53.73m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8474/B00E/R0004/Floor Coverings Res/Textile/S28					Chrysotile (white asbestos)

B00E - R0013 - General Storeroom (14.73 m2)

No Asbestos

B00E - R0014 - General Learning Space (53.66 m2)

Ceiling Structures/Linings	Vermiculite					
	8474/B00E/R0014/Ceiling Structures/Linings/S25					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	53.66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8474/B00E/R0004/Floor Coverings Res/Textile/S28					Chrysotile (white asbestos)

B00E - R0015 - Toilets-Girls (24.91 m2)

Partition Walls (Cubicles)	Compressed AC Sheet					
	8474/B00E/R0015/Partition Walls (Cubicles)/S26					No Asbestos Detected

B00E - R0016 - Cleaning Store - Distributed (3.91 m2)

Ceiling Structures/Linings	Vermiculite					
	8474/B00E/R0014/Ceiling Structures/Linings/S25					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

B00E - R0017 - Toilets-Boys (24.1 m2)

Partition Walls (Cubicles)	Compressed AC Sheet					
	8474/B00E/R0017/Partition Walls (Cubicles)/S27					No Asbestos Detected

B00E - R0018 - External Movement (160.8 m2)

No Asbestos

B00E - R0019 - External Stairs (9.84 m2)

Ceiling Structures/Linings	Flat AC Sheeting	9.84m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Height Restriction					

B00E - R0020 - External Stairs (17.1 m2)

Ceiling Structures/Linings	Flat AC Sheeting	17.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Height Restriction					

B00E - R1001 - General Learning Space (52.92 m2)

Ceiling Structures/Linings	Vermiculite					
	8474/B00E/R0014/Ceiling Structures/Linings/S25					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

B00E - R1002 - General Learning Space (53.15 m2)

Ceiling Structures/Linings	Vermiculite					
	8474/B00E/R0014/Ceiling Structures/Linings/S25					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

B00E - R1003 - Computer Learning Space (52.56 m2)

Ceiling Structures/Linings	Vermiculite					
	8474/B00E/R0014/Ceiling Structures/Linings/S25					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

B00E - R1004 - Staff Study (25.3 m2)

Ceiling Structures/Linings	Vermiculite					
	8474/B00E/R0014/Ceiling Structures/Linings/S25					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

B00E - R1005 - Cleaning Store - Distributed (0.64 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
---------	----------------------	--------	--------------------	--------------------	-------------	------------------

Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00E/R1005/Ceiling Structures/Linings/S30				Chrysotile (white asbestos)		

B00E - R1006 - Distribution Board Cupboard (0.96 m2) Note: No inspection of live electrical installation.

No Asbestos

B00E - R1007 - General Storeroom (4.64 m2)

Ceiling Structures/Linings	Vermiculite					
8474/B00E/R0014/Ceiling Structures/Linings/S25				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00E/R0004/Floor Coverings Res/Textile/S28				Chrysotile (white asbestos)		

B00E - R1008 - Staff Study (46.43 m2)

Ceiling Structures/Linings	Vermiculite					
8474/B00E/R0014/Ceiling Structures/Linings/S25				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00E - R1009 - General Learning Space (52.93 m2)

No Asbestos

B00E - R1010 - General Learning Space (65.64 m2)

No Asbestos

B00E - R1011 - General Learning Space (50.72 m2)

Ceiling Structures/Linings	Vermiculite					
8474/B00E/R0014/Ceiling Structures/Linings/S25				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00E - R1012 - General Learning Space (53 m2)

Ceiling Structures/Linings	Vermiculite					
8474/B00E/R0014/Ceiling Structures/Linings/S25				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00E - R1013 - General Learning Space (53.07 m2)

Ceiling Structures/Linings	Vermiculite					
8474/B00E/R0014/Ceiling Structures/Linings/S25				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00E - R1014 - External Movement (137.58 m2)

Ceiling Structures/Linings	Flat AC Sheeting	40m2	Over stairs	Good Condition (1)	Low (1)	Low Priority (2-3)
8474/B00E/R1014/Ceiling Structures/Linings/S29				Chrysotile (white asbestos)		

B00E - R1015 - External Stairs (25.55 m2)

Ceiling Structures/Linings	Flat AC Sheeting	25.55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction Height Restriction						

B00E - R1016 - External Stairs (25.11 m2)

Ceiling Structures/Linings	Flat AC Sheeting	25.11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Agricultural Science - 1974 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00F - R0001 - External Movement (21.11 m2)

No Asbestos

B00F - R0002 - Animal Space (20.43 m2)

No Asbestos

B00F - R0003 - Animal Space (42.31 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 1974 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	Non Accessible Area - Area inaccessible
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior**B00H - R0001 - Toilets-Boys (24.37 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet 8474/B00H/R0001/Partition Walls (Cubicles)/S32	No Asbestos Detected
----------------------------	---	-----------------------------

B00H - R0002 - Cleaning Store - Distributed (2.39 m2)

Ceiling Structures/Linings	Vermiculite 8474/B00H/R0002/Ceiling Structures/Linings/S33	Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	---

B00H - R0003 - General Learning Space (52.55 m2)

Ceiling Structures/Linings	Vermiculite 8474/B00H/R0002/Ceiling Structures/Linings/S33	Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	---

Floor Coverings Res/Textile	Vinyl Tiles 8474/B00H/R0007/Floor Coverings Res/Textile/S34	No Asbestos Detected
-----------------------------	--	-----------------------------

B00H - R0004 - General Learning Space (52.19 m2)

Ceiling Structures/Linings	Vermiculite 8474/B00H/R0002/Ceiling Structures/Linings/S33	Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	---

Floor Coverings Res/Textile	Vinyl Tiles 8474/B00H/R0007/Floor Coverings Res/Textile/S34	No Asbestos Detected
-----------------------------	--	-----------------------------

B00H - R0005 - Distribution Board Cupboard (0.79 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00H - R0006 - Staff Study (41.85 m2)

Ceiling Structures/Linings	Vermiculite 8474/B00H/R0002/Ceiling Structures/Linings/S33	Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	---

Floor Coverings Res/Textile	Vinyl Tiles 8474/B00H/R0007/Floor Coverings Res/Textile/S34	No Asbestos Detected
-----------------------------	--	-----------------------------

B00H - R0007 - General Storeroom (4.33 m2)

Ceiling Structures/Linings	Vermiculite 8474/B00H/R0002/Ceiling Structures/Linings/S33	Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	---

Floor Coverings Res/Textile	Vinyl Tiles 8474/B00H/R0007/Floor Coverings Res/Textile/S34	No Asbestos Detected
-----------------------------	--	-----------------------------

B00H - R0008 - Cleaning Store - Distributed (0.68 m2)

Ceiling Structures/Linings	Vermiculite 8474/B00H/R0002/Ceiling Structures/Linings/S33	Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	---

B00H - R0009 - Study Space (25.08 m2)

Ceiling Structures/Linings	Vermiculite 8474/B00H/R0002/Ceiling Structures/Linings/S33	Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	---

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	8474/B00H/R0007/Floor Coverings Res/Textile/S34					No Asbestos Detected
B00H - R0010 - General Learning Space (52.92 m2)						
Ceiling Structures/Linings	Vermiculite					
	8474/B00H/R0002/Ceiling Structures/Linings/S33					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8474/B00H/R0007/Floor Coverings Res/Textile/S34					No Asbestos Detected
B00H - R0011 - General Learning Space (66.12 m2)						
Ceiling Structures/Linings	Vermiculite					
	8474/B00H/R0002/Ceiling Structures/Linings/S33					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8474/B00H/R0007/Floor Coverings Res/Textile/S34					No Asbestos Detected
B00H - R0012 - General Learning Space (67.03 m2)						
Ceiling Structures/Linings	Vermiculite					
	8474/B00H/R0002/Ceiling Structures/Linings/S33					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8474/B00H/R0007/Floor Coverings Res/Textile/S34					No Asbestos Detected
B00H - R0013 - General Storeroom (15.2 m2)						
Ceiling Structures/Linings	Vermiculite					
	8474/B00H/R0002/Ceiling Structures/Linings/S33					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00H - R0014 - General Storeroom (7.12 m2)						
No Asbestos						
B00H - R0015 - External Movement (146.77 m2)						
No Asbestos						
B00H - R0016 - External Stairs (9.01 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	9.01m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Assumed Asbestos - Height Restriction</i>						
B00H - R0017 - External Stairs (18.04 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	18.04m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Assumed Asbestos - Height Restriction</i>						
B00H - R1001 - Toilets-Girls (23.43 m2)						
Ceiling Structures/Linings	Vermiculite					
	8474/B00H/R0002/Ceiling Structures/Linings/S33					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Partition Walls (Cubicles)	Compressed AC Sheet					
	8474/B00H/R0001/Partition Walls (Cubicles)/S32					No Asbestos Detected
B00H - R1002 - Cleaning Store - Distributed (2.39 m2)						
Ceiling Structures/Linings	Vermiculite					
	8474/B00H/R0002/Ceiling Structures/Linings/S33					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00H - R1003 - General Learning Space (52.57 m2)						
Ceiling Structures/Linings	Vermiculite					
	8474/B00H/R0002/Ceiling Structures/Linings/S33					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00H - R1004 - General Learning Space (52.57 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8474/B00H/R0002/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00H - R1005 - Distribution Board Cupboard (0.8 m2)					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Flat AC Sheeting 8474/B00H/R1005/Ceiling Structures/Linings/S35	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00H - R1006 - General Storeroom (19.48 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00H/R0002/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00H - R1007 - Staff Study (25.85 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00H/R0002/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8474/B00H/R0007/Floor Coverings Res/Textile/S34					No Asbestos Detected
B00H - R1008 - Cleaning Store - Distributed (0.7 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00H/R0002/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00H - R1009 - Staff Study (25.31 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00H/R0002/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00H - R1010 - General Learning Space (52.93 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00H/R0002/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00H - R1011 - General Learning Space (64.98 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00H/R0002/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00H - R1012 - General Learning Space (66.01 m2)						
Ceiling Structures/Linings	Vermiculite 8474/B00H/R0002/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00H - R1013 - External Movement (121.04 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8474/B00H/R1013/Ceiling Structures/Linings/S39	122m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00H - R1014 - External Stairs (25.3 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	25.3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Height Restriction
B00H - R1015 - External Stairs (25.23 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	25.23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Height Restriction

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Library - 1974 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	Non Accessible Area - Area inaccessible
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior**B00L - R0001 - Audio Visual Workroom (46.81 m2)**

Ceiling Structures/Linings	Vermiculite 8474/B00L/R0001/Ceiling Structures/Linings/S31	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00L - R0002 - Secure Storeroom (6.99 m2)

No Asbestos

B00L - R0003 - Staff - Toilet (4.08 m2)

Ceiling Structures/Linings	Vermiculite 8474/B00L/R0001/Ceiling Structures/Linings/S31	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00L - R0004 - Librarian (15.25 m2)

Ceiling Structures/Linings	Vermiculite 8474/B00L/R0001/Ceiling Structures/Linings/S31	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00L - R0005 - Entry (14.53 m2)

Ceiling Structures/Linings	Vermiculite 8474/B00L/R0001/Ceiling Structures/Linings/S31	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00L - R0006 - External Movement (2.99 m2)

No Asbestos

B00L - R0007 - Workroom (46.96 m2)

Ceiling Structures/Linings	Vermiculite 8474/B00L/R0001/Ceiling Structures/Linings/S31	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00L - R0008 - Staff - Toilet (4.02 m2)

Ceiling Structures/Linings	Vermiculite 8474/B00L/R0001/Ceiling Structures/Linings/S31	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00L - R0009 - General Storeroom (5.01 m2)

No Asbestos

B00L - R0010 - Cleaning Store - Distributed (1.7 m2)

No Asbestos

B00L - R0011 - Main Area (194.74 m2)

Ceiling Structures/Linings	Vermiculite 8474/B00L/R0001/Ceiling Structures/Linings/S31	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00L - R0012 - Tiered Learning Area (12.34 m2)

Ceiling Structures/Linings	Vermiculite 8474/B00L/R0001/Ceiling Structures/Linings/S31	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00L - R0013 - Movement (29.93 m2)

Ceiling Structures/Linings	Vermiculite 8474/B00L/R0001/Ceiling Structures/Linings/S31	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

B00L - R0014 - Stairs (0.61 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00L - R0015 - Stairs (0.62 m2)						
No Asbestos						
B00L - R1001 - Computer Resource (15.4 m2)						
Ceiling Structures/Linings	Vermiculite					
	8474/B00L/R0001/Ceiling Structures/Linings/S31					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00L - R1002 - Main Area (114.1 m2)						
Ceiling Structures/Linings	Vermiculite					
	8474/B00L/R0001/Ceiling Structures/Linings/S31					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00L - R1003 - Distribution Board Cupboard (0.9 m2)						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting	0.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8474/B00L/R1003/Ceiling Structures/Linings/S50					Chrysotile (white asbestos)
B00L - R1004 - Main Area (101.67 m2)						
Ceiling Structures/Linings	Vermiculite					
	8474/B00L/R0001/Ceiling Structures/Linings/S31					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00L - R1005 - Cleaning Store - Distributed (0.9 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	0.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8474/B00L/R1003/Ceiling Structures/Linings/S50					Chrysotile (white asbestos)
B00L - R1006 - Seminar (15.4 m2)						
Ceiling Structures/Linings	Vermiculite					
	8474/B00L/R0001/Ceiling Structures/Linings/S31					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00L - R1007 - Seminar (15.52 m2)						
Ceiling Structures/Linings	Vermiculite					
	8474/B00L/R0001/Ceiling Structures/Linings/S31					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00L - R1008 - Interview/Office - Type 1 (15.44 m2)						
Ceiling Structures/Linings	Vermiculite					
	8474/B00L/R0001/Ceiling Structures/Linings/S31					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00L - R1009 - Seminar (15.44 m2)						
Ceiling Structures/Linings	Vermiculite					
	8474/B00L/R0001/Ceiling Structures/Linings/S31					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00L - R1010 - Stairs (3.16 m2)						
No Asbestos						
B00L - R1011 - Stairs (3.12 m2)						
No Asbestos						
B00L - Room+1 - High Level Plant Room						
Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017