


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Lambton High School (8482)
Region : Hunter/Central Coast
State Electorate : Newcastle
Local Government Area : Newcastle

Initial Survey : Noel Arnold & Associates : 11 - Mar - 2008
Reviewed By : Grencap-NAA : 10 - Feb - 2015

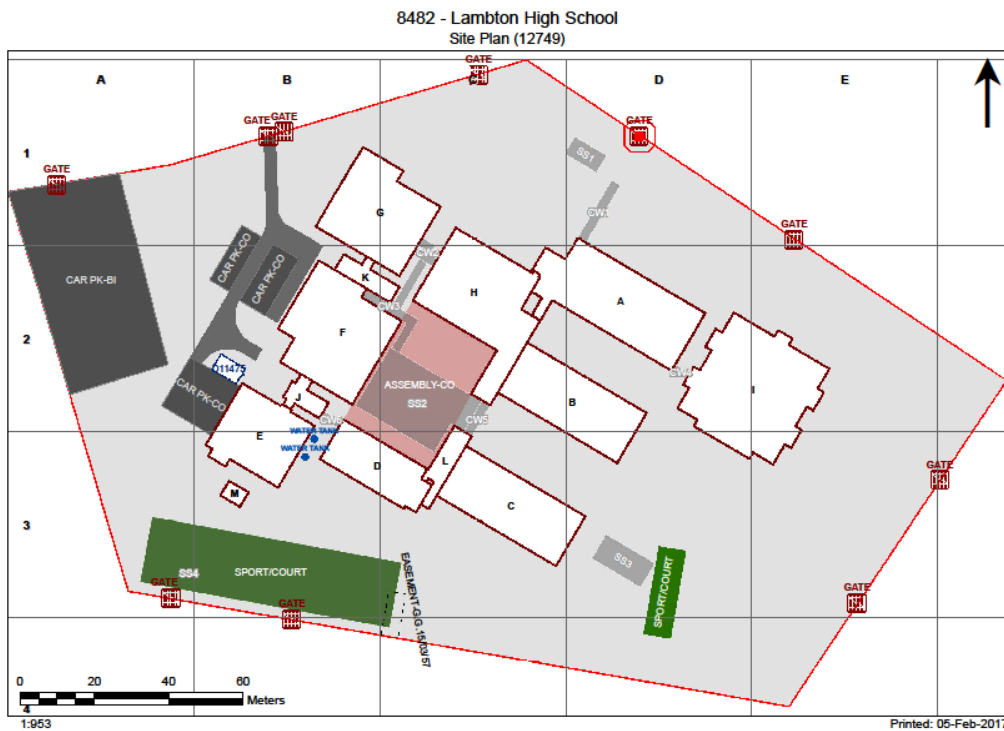

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1972 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior**B00A - R0002 - General Storeroom (15.95 m2)**

Floor Coverings Res/Textile Vinyl Tiles 16m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)
8482/B00A/R0002/Floor Coverings Res/Textile/S10 **Chrysotile (white asbestos)**

Ceiling Structures/Linings Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0003 - Duplicating Workroom (8.68 m2)

Ceiling Structures/Linings Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles (Under Floor Covering/Carpet) 9m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
8482/B00A/R0002/Floor Coverings Res/Textile/S10 **Chrysotile (white asbestos)**

B00A - R0005 - Commonroom (92.08 m2)

Ceiling Structures/Linings Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles (Under Floor Covering/Carpet) 93m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
8482/B00A/R0002/Floor Coverings Res/Textile/S10 **Chrysotile (white asbestos)**

B00A - R0006 - Clinic-Waiting (14.45 m2)

Ceiling Structures/Linings Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles (Under Floor Covering/Carpet) 15m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
8482/B00A/R0002/Floor Coverings Res/Textile/S10 **Chrysotile (white asbestos)**

B00A - R0007 - Staff Study (9.47 m2)

Ceiling Structures/Linings Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0008 - Interview/Office - Type 1 (9.68 m2)

Ceiling Structures/Linings Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles (Under Floor Covering/Carpet) 10m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
8482/B00A/R0002/Floor Coverings Res/Textile/S10 **Chrysotile (white asbestos)**

B00A - R0009 - General Storeroom (2.25 m2)

Ceiling Structures/Linings Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles (Under Floor Covering/Carpet) 3m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
8482/B00A/R0002/Floor Coverings Res/Textile/S10 **Chrysotile (white asbestos)**

B00A - R0010 - Cleaning Store - Distributed (2.9 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8482/B00A/R0001/Floor Coverings Res/Textile/S13				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	adhesive					
8482/B00A/R0001/Floor Coverings Res/Textile/S14				No Asbestos Detected		
B00A - R0011 - Distribution Board Cupboard (1.18 m2)				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00A - R0012 - Security Store (15.27 m2)						
Ceiling Structures/Linings	Vermiculite					
8482/B00C/R0009/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8482/B00A/R0001/Floor Coverings Res/Textile/S13				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	adhesive					
8482/B00A/R0001/Floor Coverings Res/Textile/S14				No Asbestos Detected		
B00A - R0013 - Principal Office (22.55 m2)						
Ceiling Structures/Linings	Vermiculite					
8482/B00C/R0009/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8482/B00A/R0002/Floor Coverings Res/Textile/S10				Chrysotile (white asbestos)		
B00A - R0016 - Deputy Principal Office (19.91 m2)						
Ceiling Structures/Linings	Vermiculite					
8482/B00C/R0009/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8482/B00A/R0002/Floor Coverings Res/Textile/S10				Chrysotile (white asbestos)		
B00A - R0017 - Interview/Office - Type 1 (16.26 m2)						
Ceiling Structures/Linings	Vermiculite					
8482/B00C/R0009/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8482/B00A/R0002/Floor Coverings Res/Textile/S10				Chrysotile (white asbestos)		
B00A - R0018 - Movement (7.26 m2)						
No Asbestos						
B00A - R0019 - Public Entry (46.4 m2)						
Ceiling Structures/Linings	Vermiculite					
8482/B00C/R0009/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R0020 - Staff - Toilet (9.13 m2)						
Ceiling Structures/Linings	Vermiculite					
8482/B00C/R0009/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R0021 - Staff - Toilet (10.22 m2)						
Ceiling Structures/Linings	Vermiculite					
8482/B00C/R0009/Ceiling Structures/Linings/S1				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R0022 - Toilets-Girls (10.18 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0023 - Toilets-Boys (9.24 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0024 - Movement (63.11 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R0002/Floor Coverings Res/Textile/S10	64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0025 - Movement (7.83 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R0002/Floor Coverings Res/Textile/S10	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0026 - Teachers Aides (12.11 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R0002/Floor Coverings Res/Textile/S10	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0027 - Staff Study (13.39 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R0002/Floor Coverings Res/Textile/S10	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0028 - Movement (87.1 m2)						
No Asbestos						
B00A - R0029 - Movement (50.72 m2)						
No Asbestos						
B00A - R0030 - Stairs (4.65 m2)						
No Asbestos						
B00A - R0031 - Movement (18.59 m2)						
No Asbestos						
B00A - R0032 - Movement (9.89 m2)						
No Asbestos						
B00A - R0033 - External Movement (6.12 m2)						
No Asbestos						
B00A - R0034 - Movement (3.46 m2)						
No Asbestos						
B00A - R0035 - Lift (2.1 m2)						
No Asbestos						
B00A - R0036 - Administration - Clerical (53.12 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8482/B00A/R1014/Ceiling Structures/Linings/S9					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R0002/Floor Coverings Res/Textile/S10	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0037 - External Movement (16.81 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0038 - Movement (17.32 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0039 - Staff Study (13.22 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0040 - Staff Study (15.32 m2)						
Recently Modified Space	Requires Inspection					
B00A - R0041 - Archive Store (9.03 m2)						
Recently Modified Space	Requires Inspection					
B00A - R1001 - Computer Learning Space (53.92 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1002 - General Learning Space (53.91 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1003 - Staff Study (22.22 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1004 - General Storeroom (6.72 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00A/R1015/Floor Coverings Res/Textile/S15	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8482/B00A/R1015/Floor Coverings Res/Textile/S16					No Asbestos Detected
B00A - R1005 - Cleaning Store - Distributed (3.28 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00A/R1015/Floor Coverings Res/Textile/S15	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive					
	8482/B00A/R1015/Floor Coverings Res/Textile/S16					No Asbestos Detected
B00A - R1006 - General Learning Space (59.89 m2)						
Ceiling Structures/Linings	Vermiculite					
	8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8482/B00A/R1015/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)
B00A - R1007 - General Learning Space (59.88 m2)						
Ceiling Structures/Linings	Vermiculite					
	8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8482/B00A/R1015/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)
B00A - R1008 - Senior Study (53.84 m2)						
Ceiling Structures/Linings	Vermiculite					
	8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8482/B00A/R1015/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)
B00A - R1009 - General Learning Space (39.82 m2)						
Ceiling Structures/Linings	Vermiculite					
	8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8482/B00A/R1015/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)
B00A - R1010 - General Learning Space (39.81 m2)						
Ceiling Structures/Linings	Vermiculite					
	8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8482/B00A/R1015/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)
B00A - R1011 - Distribution Board Cupboard (0.53 m2)						
Electrical Mounting Board	Resinous Board	2Unit	South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Electrical Hazard
B00A - R1013 - General Learning Space (39.98 m2)						
Ceiling Structures/Linings	Vermiculite					
	8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8482/B00A/R1015/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)
B00A - R1014 - Movement (1.76 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	8482/B00A/R1014/Ceiling Structures/Linings/S9					No Asbestos Detected
B00A - R1015 - Movement (60.13 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8482/B00A/R1015/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings	Vermiculite					
	8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Adhesive					
	8482/B00A/R1015/Floor Coverings Res/Textile/S16					No Asbestos Detected

B00A - R1016 - General Storeroom (7.37 m2)

Ceiling Structures/Linings	Vermiculite					
	8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8482/B00A/R1015/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)

B00A - R1017 - Staff Study (10.07 m2)

Ceiling Structures/Linings	Vermiculite					
	8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R1018 - Stairs (14.98 m2)

Ceiling Structures/Linings	Vermiculite					
	8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R1019 - Movement (15.28 m2)

No Asbestos

B00A - R1020 - Stairs (18.59 m2)

No Asbestos

B00A - R1021 - Movement (37.1 m2)

No Asbestos

B00A - R1022 - Movement (6.53 m2)

No Asbestos

B00A - R1023 - Movement (3.46 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1972 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00B - R0001 - General Learning Space (53.7 m2)

Ceiling Structures/Linings	Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00B - R0002 - General Learning Space (53.7 m2)

Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00B - R0003 - Staff Study (13.01 m2)

Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00B - R0004 - Cleaning Store - Distributed (2.32 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8482/B00A/R1015/Floor Coverings Res/Textile/S15	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	-----	--------------	--------------------	---------	---

B00B - R0005 - Staff Study (10.6 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

B00B - R0006 - Distribution Board Cupboard (0.99 m2)

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
--------------------------	----------------	-------	------	--------------------	---------	--

B00B - R0007 - Apparatus Store (30.87 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8482/B00A/R1015/Floor Coverings Res/Textile/S15	31m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8482/B00A/R1015/Floor Coverings Res/Textile/S16					No Asbestos Detected

B00B - R0008 - Darkroom Space (7.96 m2)

Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

B00B - R0009 - Staff - Toilet (5.34 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R0010 - General Storeroom (4.55 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00A/R1015/Floor Coverings Res/Textile/S15	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8482/B00A/R1015/Floor Coverings Res/Textile/S16					No Asbestos Detected
B00B - R0011 - General Learning Space (52.97 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R0012 - General Learning Space (39.45 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R0013 - General Learning Space (52.6 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R0014 - General Learning Space (51.51 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R0015 - Movement (1.87 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R0017 - General Storeroom (4.22 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00A/R1015/Floor Coverings Res/Textile/S15	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8482/B00A/R1015/Floor Coverings Res/Textile/S16					No Asbestos Detected
B00B - R0019 - Movement (10.16 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R0021 - Staff Study (32.73 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R0022 - Movement (94.02 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00B - R1001 - General Learning Space (53.69 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1002 - General Learning Space (53.7 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1003 - Staff Study (18.37 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1004 - General Learning Space (53.7 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1005 - General Learning Space (54.06 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1006 - General Learning Space (53.69 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1007 - General Learning Space (54.06 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1008 - Staff Study (10.54 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1009 - Cleaning Store - Distributed (3.6 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00A/R1015/Floor Coverings Res/Textile/S15	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1010 - Distribution Board Cupboard (1.41 m2)						
				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting 8482/B00B/R1010/Ceiling Structures/Linings/S18	2m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Electrical Mounting Board	Resinous Board	1Unit	West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
B00B - R1011 - General Storeroom (18.37 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00A/R1015/Floor Coverings Res/Textile/S15	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1012 - General Learning Space (53.69 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1013 - Staff Study (39.18 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1014 - Movement (1.29 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8482/B00C/R0009/Ceiling Structures/Linings/S1					No Asbestos Detected
B00B - R1015 - Movement (27.34 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00A/R1015/Floor Coverings Res/Textile/S15	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R1016 - Movement (14.93 m2)						
Ceiling Structures/Linings	Vermiculite					
	8482/B00B/R0019/Ceiling Structures/Linings/S17				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8482/B00A/R1015/Floor Coverings Res/Textile/S15				Chrysotile (white asbestos)	

B00B - R1017 - Movement (15.05 m2)						
Ceiling Structures/Linings	Vermiculite					
	8482/B00B/R0019/Ceiling Structures/Linings/S17				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1972 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior**B00C - R0001 - General Learning Space (53.7 m2)**

Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00C - R0002 - Staff Study (24.84 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	------	------------	--------------------	---------	--

B00C - R0003 - General Learning Space (53.7 m2)

Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00C - R0004 - General Storeroom (10.59 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8482/B00A/R1015/Floor Coverings Res/Textile/S15	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	------	--------------	--------------------	---------	--

B00C - R0005 - General Learning Space (53.7 m2)

Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00C - R0006 - General Learning Space (53.34 m2)

Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00C - R0007 - Movement (1.71 m2)

No Asbestos

B00C - R0008 - General Storeroom (4.37 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8482/B00A/R1015/Floor Coverings Res/Textile/S15	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	-----	--------------	--------------------	---------	--

B00C - R0009 - Staff - Toilet (4.84 m2)

Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	---

B00C - R0010 - Staff - Toilet (8.92 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R0011 - Apparatus Store (31.38 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00A/R1015/Floor Coverings Res/Textile/S15	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8482/B00A/R1015/Floor Coverings Res/Textile/S16					No Asbestos Detected
B00C - R0012 - Distribution Board Cupboard (1.04 m2)				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Board 8482/B00C/R0012/Electrical Backing Board/S19	3Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R0013 - Staff Study (11.05 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R0014 - Cleaning Store - Distributed (2.48 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00A/R1015/Floor Coverings Res/Textile/S15	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R0017 - General Storeroom (9.54 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00A/R1015/Floor Coverings Res/Textile/S15	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R0018 - General Storeroom (5.11 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00A/R1015/Floor Coverings Res/Textile/S15	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R0019 - General Learning Space (53.69 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R0021 - Movement (5.91 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R0022 - Staff Study (50.14 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R0023 - Movement (78.09 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00C - R0024 - Store (5.57 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00A/R1015/Floor Coverings Res/Textile/S15	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1001 - General Learning Space (53.7 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1002 - General Learning Space (53.69 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1003 - Movement (18.73 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00A/R1015/Floor Coverings Res/Textile/S15	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1004 - Staff Study (18.2 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1005 - General Learning Space (53.69 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1006 - General Learning Space (54.43 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1007 - General Learning Space (53.7 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00B/R0019/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8482/B00A/R1015/Floor Coverings Res/Textile/S15				Chrysotile (white asbestos)		
B00C - R1008 - General Learning Space (54.44 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8482/B00B/R0019/Ceiling Structures/Linings/S17				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8482/B00A/R1015/Floor Coverings Res/Textile/S15				Chrysotile (white asbestos)		
B00C - R1009 - General Storeroom (17.86 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8482/B00B/R0019/Ceiling Structures/Linings/S17				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8482/B00A/R1015/Floor Coverings Res/Textile/S15				Chrysotile (white asbestos)		
B00C - R1010 - Distribution Board Cupboard (1.43 m2)						
				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8482/B00B/R1010/Ceiling Structures/Linings/S18				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Electrical Mounting Board	Resinous Board	3Unit	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00C - R1011 - Cleaning Store - Distributed (2.61 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8482/B00B/R0019/Ceiling Structures/Linings/S17				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8482/B00A/R1015/Floor Coverings Res/Textile/S15				Chrysotile (white asbestos)		
B00C - R1012 - Staff Study (10.72 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8482/B00B/R0019/Ceiling Structures/Linings/S17				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8482/B00A/R1015/Floor Coverings Res/Textile/S15				Chrysotile (white asbestos)		
B00C - R1013 - Staff Study (39.45 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8482/B00B/R0019/Ceiling Structures/Linings/S17				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8482/B00A/R1015/Floor Coverings Res/Textile/S15				Chrysotile (white asbestos)		
B00C - R1014 - General Learning Space (53.33 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8482/B00B/R0019/Ceiling Structures/Linings/S17				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8482/B00A/R1015/Floor Coverings Res/Textile/S15				Chrysotile (white asbestos)		
B00C - R1015 - Movement (27.9 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8482/B00B/R0019/Ceiling Structures/Linings/S17				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8482/B00A/R1015/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)	
B00C - R1016 - Movement (1.34 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8482/B00B/R1010/Ceiling Structures/Linings/S18					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00C - R1017 - Movement (13.08 m2)						
Ceiling Structures/Linings	Vermiculite					
8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Science/Art - 1975 - Brick/Block (Brick/Block)**Exterior**

Wall Cladding	Flat AC Sheeting	3m2	South facing, East facing, Upper portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8482/B00D/Wall Cladding/S22					Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00D - R0001 - General Assistants (23.31 m2)**

No Asbestos

B00D - R0002 - Garden Store Room (0.9 m2)

No Asbestos

B00D - R0003 - Garden Store Room (0.8 m2)

No Asbestos

B00D - R0004 - Distribution Board Cupboard (0.72 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	3Unit	North facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8482/B00C/R0012/Electrical Backing Board/S19					Chrysotile (white asbestos)

B00D - R0005 - Garden Store Room (0.9 m2)

No Asbestos

B00D - R0006 - Laboratory L.S. (90.57 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8482/B00D/R1007/Ceiling Structures/Linings/S21					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0007 - Preparation (48.46 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8482/B00D/R1007/Ceiling Structures/Linings/S21					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Tiles	49m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8482/B00A/R1015/Floor Coverings Res/Textile/S15					Chrysotile (white asbestos)

B00D - R0008 - Laboratory L.S. (90.56 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8482/B00D/R1007/Ceiling Structures/Linings/S21					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0009 - Movement (63.69 m2)

No Asbestos

B00D - R1001 - Movement (0.63 m2)

No Asbestos

B00D - R1002 - General Storeroom (10.47 m2)

No Asbestos

B00D - R1003 - General Storeroom (12.07 m2)

No Asbestos

B00D - R1004 - General Learning Space (90.08 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8482/B00D/R1007/Ceiling Structures/Linings/S21					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	90m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1005 - Staff Study (48.46 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00D/R1007/Ceiling Structures/Linings/S21					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1006 - Art Learning Space (90.25 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00D/R1007/Ceiling Structures/Linings/S21					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00G/R1016/Floor Coverings Res/Textile/S4	91m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1007 - Movement (60.55 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00D/R1007/Ceiling Structures/Linings/S21					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00D - R1008 - Plant (1.46 m2)						
Ceiling Structures/Linings	Compressed AC Sheet 8482/B00D/R1011/Ceiling Structures/Linings/S20	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00D - R1009 - Garden Store Room (1.46 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00D/R1007/Ceiling Structures/Linings/S21					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00D - R1010 - Distribution Board Cupboard (1.46 m2) Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Vermiculite 8482/B00D/R1007/Ceiling Structures/Linings/S21					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
B00D - R1011 - Plant (1.46 m2)						
Ceiling Structures/Linings	Compressed AC Sheet 8482/B00D/R1011/Ceiling Structures/Linings/S20	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Technological & Applied Studies/Art - 1972 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00E - R0001 - Toilets-Boys (68.05 m2)

Ceiling Structures/Linings	Vermiculite					
	8482/B00E/R0001/Ceiling Structures/Linings/S2					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Toilet Cist-en In-fill Panel	Flat AC Sheeting	4m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8482/B00E/R0001/Toilet listen in-fill panel/S3					Chrysotile (white asbestos)

B00E - R0002 - Cleaning Store - Distributed (2.01 m2)

Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8482/B00G/R1016/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)

B00E - R0003 - Distribution Board Cupboard (2.75 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	5Unit	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8482/B00C/R0012/Electrical Backing Board/S19					Chrysotile (white asbestos)

B00E - R0004 - Welding Area (10.81 m2)

Floor Coverings Res/Textile	Flat AC Sheeting					
	8482/B00E/R0004/Floor Coverings Res/Textile/S11					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

B00E - R0005 - Materials Technology L.S. (72.06 m2)

Ceiling Structures/Linings	Vermiculite					
	8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

B00E - R0006 - Materials Store (21.01 m2)

No Asbestos

B00E - R0007 - Metal Technology Bay (10.44 m2)

Floor Coverings Res/Textile	Flat AC Sheeting					
	8482/B00E/R0004/Floor Coverings Res/Textile/S11					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Hot Metal Workbench	Flat AC Sheeting	2m2	North facing	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	8482/B00E/R0007/Hot Metal Workbench/S12					Chrysotile (white asbestos)

B00E - R0008 - Materials Technology L.S. (82.87 m2)

Ceiling Structures/Linings	Vermiculite					
	8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Hot Metal Workbench	Flat AC Sheeting	2m2	South facing, West facing	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	8482/B00E/R0007/Hot Metal Workbench/S12					Chrysotile (white asbestos)

B00E - R0009 - Darkroom Space (18.27 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00G/R1016/Floor Coverings Res/Textile/S4	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0010 - Art Learning Space (63.93 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00G/R1016/Floor Coverings Res/Textile/S4	64m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0011 - Bulk Store (7.97 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00G/R1016/Floor Coverings Res/Textile/S4	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0012 - Movement (37.69 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00G/R1016/Floor Coverings Res/Textile/S4	38m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0013 - Movement (1.91 m2)						
No Asbestos						
B00E - R0014 - Kiln Space (13.14 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00G/R1016/Floor Coverings Res/Textile/S4	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R0015 - Plant (12.33 m2)						
Recently Modified Space	Requires Inspection					
B00E - R1001 - Design L.S. (52.08 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1002 - General Storeroom (8 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00G/R1016/Floor Coverings Res/Textile/S4	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00E - R1003 - Distribution Board Cupboard (0.98 m2)						
Electrical Backing Board	Resinous Board	2Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
B00E - R1004 - Materials Technology L.S. (83.02 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1005 - Materials Store (21.12 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1006 - Materials Store (5.31 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1007 - Materials Technology L.S. (83.01 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R1008 - Cleaning Store - Distributed (0.67 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00A/R1015/Floor Coverings Res/Textile/S15	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00E - R1009 - Materials Technology L.S. (8.7 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00A/R1015/Floor Coverings Res/Textile/S15	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00E - R1010 - Design L.S. (52.82 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00E - R1011 - Staff Study (26.05 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00A/R1015/Floor Coverings Res/Textile/S15	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00E - R1012 - Movement (2.02 m2)						
No Asbestos						
B00E - R1013 - Movement (46.56 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00C/R0009/Ceiling Structures/Linings/S1					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00G/R1016/Floor Coverings Res/Textile/S4	47m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00E - R1014 - General Storeroom (5.23 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8482/B00G/R1016/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B00E - R1015 - Materials Store (4.25 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8482/B00C/R0009/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8482/B00G/R1016/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B00E - R1016 - No Access (4.96 m2)						
No Asbestos						
B00E - R1017 - Materials Store (4.05 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8482/B00C/R0009/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8482/B00G/R1016/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities - 1972 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior**B00F - R0002 - Movement (79.65 m2)**

Ceiling Structures/Linings Vermiculite
8482/B00F/R0002/Ceiling Structures/Linings/S23 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00F - R0003 - Sport Equipment Store (7.28 m2)

No Asbestos

B00F - R0004 - Sport Equipment Store (25.43 m2)

No Asbestos

B00F - R0005 - Distribution Board Cupboard (0.74 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board Resinous Board 1Unit South facing Good Condition (1) Low (1) Low Priority (2-3)
8482/B00C/R0012/Electrical Backing Board/S19 **Chrysotile (white asbestos)**

B00F - R0006 - Chair Store (15.93 m2)

No Asbestos

B00F - R0007 - Cleaning Store - Distributed (1 m2)

No Asbestos

B00F - R0008 - Sport Equipment Store (20.92 m2)

No Asbestos

B00F - R0009 - Staff - Toilet (3.3 m2)

Ceiling Structures/Linings Vermiculite
8482/B00F/R0002/Ceiling Structures/Linings/S23 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00F - R0010 - General Storeroom (5.49 m2)

No Asbestos

B00F - R0011 - Staff - Toilet (4.05 m2)

Ceiling Structures/Linings Vermiculite
8482/B00F/R0002/Ceiling Structures/Linings/S23 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00F - R0012 - Student Canteen (52.44 m2)

Floor Coverings Res/Textile Vinyl Tiles 53m2 Throughout Minimal Damage (2) Low (1) Low Priority (2-3)
8482/B00A/R1015/Floor Coverings Res/Textile/S15 **Chrysotile (white asbestos)**

Electrical Backing Board Resinous Board 1Unit North Good Condition (1) Low (1) Low Priority (2-3)
Assumed Asbestos - Electrical Hazard

B00F - R0013 - General Storeroom (6.1 m2)

Floor Coverings Res/Textile Vinyl Tiles 7m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)
8482/B00G/R1016/Floor Coverings Res/Textile/S4 **Chrysotile (white asbestos)**

B00F - R0014 - Main Switchroom (10.3 m2)

Electrical Mounting Board Resinous Board 3Unit East Good Condition (1) Low (1) Low Priority (2-3)
Assumed Asbestos - Electrical Hazard

B00F - R0015 - Tiered Learning Area (187.14 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	8482/B00F/R0002/Ceiling Structures/Linings/S23				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R0016 - Audio Visual Workroom (120.05 m2)						
Ceiling Structures/Linings	Vermiculite	8482/B00F/R0002/Ceiling Structures/Linings/S23				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R0017 - Movement (134.08 m2)						
No Asbestos						
B00F - R1001 - Cleaning Store - Distributed (3.59 m2)						
No Asbestos						
B00F - R1002 - Staff Change (9.83 m2)						
No Asbestos						
B00F - R1003 - Staff - Toilet (7.82 m2)						
No Asbestos						
B00F - R1005 - Shower/Change (46.77 m2)						
No Asbestos						
B00F - R1006 - Shower/Change (47.51 m2)						
No Asbestos						
B00F - R1008 - Staff - Toilet (7.81 m2)						
No Asbestos						
B00F - R1009 - Staff Change (9.92 m2)						
No Asbestos						
B00F - R1010 - Cleaning Store - Distributed (3.57 m2)						
Hot water system flue	Fibre Cement Pipe	2m	North facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8482/B00F/R1010/Hot water system flue/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R1012 - Movement (11.64 m2)						
No Asbestos						
B00F - R1013 - Movement (13.8 m2)						
Recently Modified Space	Requires Inspection					
B00F - R1014 - Store (23.71 m2)						
Recently Modified Space	Requires Inspection					
B00F - R1015 - Movement (4.95 m2)						
Recently Modified Space	Requires Inspection					
B00F - R1016 - Toilets-Boys (10.37 m2)						
Recently Modified Space	Requires Inspection					
B00F - R1017 - Movement (4.95 m2)						
Recently Modified Space	Requires Inspection					
B00F - R1018 - Toilets-Girls (10.43 m2)						
Recently Modified Space	Requires Inspection					
B00F - R1019 - Movement (13.72 m2)						
Recently Modified Space	Requires Inspection					
B00F - R1020 - Change (13.34 m2)						
Recently Modified Space	Requires Inspection					
B00F - R9001 - General Storeroom (116.27 m2)						
No Asbestos						
B00F - Room+1 - Added Room						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings Vermiculite
 8482/B00F/R0002/Ceiling Structures/Linings/S23

Limited Samples Taken

Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00F - Room+2 - Added Room

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Technological & Applied Studies/Art - 1972 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior**B00G - R0001 - Food Technology L.S. (81.97 m2)**

Floor Coverings Res/Textile Vinyl Tiles 82m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)
8482/B00G/R1016/Floor Coverings Res/Textile/S4 **Chrysotile (white asbestos)**

Ceiling Structures/Linings Vermiculite 8482/B00E/R0001/Ceiling Structures/Linings/S2 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00G - R0008 - General Learning Space (65.67 m2)

Ceiling Structures/Linings Vermiculite 8482/B00E/R0001/Ceiling Structures/Linings/S2 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles (Under Floor Covering/Carpet) 66m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
8482/B00G/R1016/Floor Coverings Res/Textile/S4 **Chrysotile (white asbestos)**

B00G - R0011 - Staff Study (32.34 m2)

Ceiling Structures/Linings Vermiculite 8482/B00E/R0001/Ceiling Structures/Linings/S2 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles (Under Floor Covering/Carpet) 33m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
8482/B00G/R1016/Floor Coverings Res/Textile/S4 **Chrysotile (white asbestos)**

B00G - R0012 - General Storeroom (4.73 m2)

Ceiling Structures/Linings Vermiculite 8482/B00E/R0001/Ceiling Structures/Linings/S2 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles 5m2 All surfaces Good Condition (1) Low (1) Low Priority (2-3)
8482/B00G/R1016/Floor Coverings Res/Textile/S4 **Chrysotile (white asbestos)**

B00G - R0013 - Staff Study (17.49 m2)

Ceiling Structures/Linings Vermiculite 8482/B00E/R0001/Ceiling Structures/Linings/S2 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile Vinyl Tiles (Under Floor Covering/Carpet) 18m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
8482/B00G/R1016/Floor Coverings Res/Textile/S4 **Chrysotile (white asbestos)**

B00G - R0014 - Distribution Board Cupboard (0.96 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board Resinous Board 2Unit West facing Good Condition (1) Low (1) Low Priority (2-3)
8482/B00C/R0012/Electrical Backing Board/S19 **Chrysotile (white asbestos)**

B00G - R0015 - Toilets-Girls (65.54 m2)

Ceiling Structures/Linings Vermiculite 8482/B00E/R0001/Ceiling Structures/Linings/S2 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00G - R0016 - Movement (2.11 m2)

No Asbestos

B00G - R0018 - Food Technology L.S. (113.85 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00G - R0019 - Preparation - Materials (20.72 m2)						
No Asbestos						
B00G - R0020 - Pantry (10.08 m2)						
No Asbestos						
B00G - R0021 - Other (14.69 m2)						
No Asbestos						
B00G - R0022 - Laundry (4.08 m2)						
No Asbestos						
B00G - R0023 - General Storeroom (1.02 m2)						
No Asbestos						
B00G - R0024 - Movement (71.45 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	72NA	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8482/B00G/R1016/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8482/B00C/R0009/Ceiling Structures/Linings/S1					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00G - R0025 - External Movement (40.88 m2)						
No Asbestos						
B00G - R0026 - Staff Study (9.74 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8482/B00G/R1016/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
B00G - R1001 - Materials Technology L.S. (65.3 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8482/B00E/R0001/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8482/B00G/R1016/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
B00G - R1002 - Music Learning Space (65.29 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8482/B00E/R0001/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8482/B00G/R1016/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
B00G - R1003 - Staff Study (32.16 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8482/B00E/R0001/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8482/B00G/R1016/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
B00G - R1004 - Music Learning Space (65.3 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8482/B00E/R0001/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8482/B00G/R1016/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
B00G - R1005 - Darkroom Space (13.87 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8482/B00E/R0001/Ceiling Structures/Linings/S2					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00G/R1016/Floor Coverings Res/Textile/S4	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R1006 - Art Learning Space (65.3 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00E/R0001/Ceiling Structures/Linings/S2					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00G/R1016/Floor Coverings Res/Textile/S4	66m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R1007 - Art Learning Space (64.86 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00E/R0001/Ceiling Structures/Linings/S2					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00G/R1016/Floor Coverings Res/Textile/S4	65m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R1008 - Distribution Board Cupboard (0.84 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 8482/B00G/R1008/Ceiling Structures/Linings/S5	1m2	All surfaces	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
Electrical Mounting Board	Resinous Board 8482/B00C/R0012/Electrical Backing Board/S19	2Unit	West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R1009 - Materials Technology L.S. (64.97 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00E/R0001/Ceiling Structures/Linings/S2					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8482/B00G/R1016/Floor Coverings Res/Textile/S6	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R1010 - Shower/Change (4.54 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00E/R0001/Ceiling Structures/Linings/S2					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00G/R1016/Floor Coverings Res/Textile/S4	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R1011 - Materials Store (10.59 m2)						
Ceiling Structures/Linings	Vermiculite 8482/B00E/R0001/Ceiling Structures/Linings/S2					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00G/R1016/Floor Coverings Res/Textile/S4	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R1013 - Resources Store (1.35 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00G/R1016/Floor Coverings Res/Textile/S4	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00G - R1014 - Resources Space (1.91 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8482/B00G/R1016/Floor Coverings Res/Textile/S4	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00G - R1015 - Cleaning Store - Distributed (0.85 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8482/B00G/R1016/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B00G - R1016 - Movement (56.48 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	57m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8482/B00G/R1016/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
8482/B00E/R0001/Ceiling Structures/Linings/S2					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Library/Science - 1972 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior

B00H - M1001 - Main Area (154.8 m2)

Ceiling Structures/Linings Vermiculite
 8482/B00E/R0001/Ceiling Structures/Linings/S2 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00H - M1002 - Seminar (23.82 m2)

Ceiling Structures/Linings Vermiculite
 8482/B00E/R0001/Ceiling Structures/Linings/S2 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00H - M1003 - Seminar (23.82 m2)

Ceiling Structures/Linings Vermiculite
 8482/B00E/R0001/Ceiling Structures/Linings/S2 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00H - R0001 - Laboratory L.S. (91.58 m2)

Ceiling Structures/Linings Vermiculite
 8482/B00E/R0001/Ceiling Structures/Linings/S2 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00H - R0002 - Preparation (49.26 m2)

Ceiling Structures/Linings Vermiculite
 8482/B00E/R0001/Ceiling Structures/Linings/S2 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00H - R0003 - Laboratory L.S. (91.57 m2)

Ceiling Structures/Linings Vermiculite
 8482/B00E/R0001/Ceiling Structures/Linings/S2 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00H - R0004 - Distribution Board Cupboard (0.73 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board Resinous Board 2Unit North facing Good Condition (1) Low (1) Low Priority (2-3)
 8482/B00C/R0012/Electrical Backing Board/S19 **Chrysotile (white asbestos)**

B00H - R0005 - Laboratory L.S. (91.57 m2)

Ceiling Structures/Linings Vermiculite
 8482/B00F/R0002/Ceiling Structures/Linings/S23 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00H - R0006 - Preparation (49.27 m2)

Floor Coverings Res/Textile Vinyl Tiles 50m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)
 8482/B00H/R0002/Floor Coverings Res/Textile/S8 **No Asbestos Detected - Note 1**

Ceiling Structures/Linings Vermiculite
 8482/B00E/R0001/Ceiling Structures/Linings/S2 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00H - R0007 - Laboratory L.S. (91.57 m2)

Ceiling Structures/Linings Vermiculite
 8482/B00E/R0001/Ceiling Structures/Linings/S2 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00H - R0008 - Movement (2.73 m2)

No Asbestos

B00H - R0009 - Movement (2.48 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00H - R0010 - Movement (58.58 m2)						
No Asbestos						
B00H - R0013 - General Storeroom (17.25 m2)						
No Asbestos						
B00H - R0014 - General Storeroom (4.34 m2)						
No Asbestos						
B00H - R0015 - Movement (11.64 m2)						
No Asbestos						
B00H - R0016 - Movement (87.88 m2)						
No Asbestos						
B00H - R0017 - Toilets-Disabled (12.93 m2)						
No Asbestos						
B00H - R0018 - Plant (15.28 m2)						
No Asbestos						
B00H - R1001 - Staff - Toilet (4.81 m2)						
Ceiling Structures/Linings	Vermiculite					
	8482/B00E/R0001/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00H - R1002 - Staff - Toilet (4.81 m2)						
Ceiling Structures/Linings	Vermiculite					
	8482/B00E/R0001/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00H - R1003 - Workroom (13.69 m2)						
Ceiling Structures/Linings	Vermiculite					
	8482/B00E/R0001/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00H - R1004 - General Storeroom (8.13 m2)						
Ceiling Structures/Linings	Vermiculite					
	8482/B00E/R0001/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8482/B00G/R1016/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
B00H - R1005 - Audio Visual Workroom (35.55 m2)						
Ceiling Structures/Linings	Vermiculite					
	8482/B00E/R0001/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00H - R1006 - Librarian (9.86 m2)						
Ceiling Structures/Linings	Vermiculite					
	8482/B00E/R0001/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00H - R1007 - Seminar (13.03 m2)						
Ceiling Structures/Linings	Vermiculite					
	8482/B00E/R0001/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00H - R1008 - Seminar (14.6 m2)						
Ceiling Structures/Linings	Vermiculite					
	8482/B00E/R0001/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00H - R1009 - Seminar (13.6 m2)						
Ceiling Structures/Linings	Vermiculite					
	8482/B00E/R0001/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00H - R1010 - Distribution Board Cupboard (0.52 m2)				Note: No inspection of live electrical installation.		
Electrical Mounting Board	Resinous Board	2Unit	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8482/B00C/R0012/Electrical Backing Board/S19					Chrysotile (white asbestos)	
B00H - R1011 - Cleaning Store - Distributed (2.03 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8482/B00G/R1016/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B00H - R1012 - Distribution Board Cupboard (0.28 m2)				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00H - R1013 - Seminar (14.36 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8482/B00E/R0001/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00H - R1014 - Seminar (12.96 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8482/B00E/R0001/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00H - R1015 - Main Area (379.42 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
8482/B00E/R0001/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
B00H - R1016 - Movement (17.25 m2)						
No Asbestos						
B00H - R1017 - Movement (125.46 m2)						
No Asbestos						
B00H - R1018 - Movement (2.36 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Multi Purpose Facilities - 1997 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids - Raked Ceiling No Asbestos Found

Interior**B00I - M0001 - Movement (39.95 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00I - M0002 - Multi-Purpose Space (94.82 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00I - R0001 - Shower/Change (21.11 m2)

No Asbestos

B00I - R0002 - Chair Store (13.41 m2)

No Asbestos

B00I - R0003 - Movement (2.89 m2)

No Asbestos

B00I - R0004 - Movement (10.59 m2)

No Asbestos

B00I - R0005 - Movement (1.1 m2)

No Asbestos

B00I - R0006 - Movement (1.1 m2)

No Asbestos

B00I - R0007 - Movement (2.89 m2)

No Asbestos

B00I - R0008 - Shower/Change (21.18 m2)

No Asbestos

B00I - R0009 - Movement (11.23 m2)

No Asbestos

B00I - R0010 - Chair Store (13.03 m2)

No Asbestos

B00I - R0011 - Stage (87.99 m2)

No Asbestos

B00I - R0012 - Multi-Purpose Space (480.86 m2)

No Asbestos

B00I - R0013 - Movement (3.91 m2)

No Asbestos

B00I - R0014 - Sport Equipment Store (27.81 m2)

No Asbestos

B00I - R0015 - Distribution Board Cupboard (1.26 m2)

No Asbestos

Note: No inspection of live electrical installation.

B00I - R0016 - Toilets-Boys (15.12 m2)

No Asbestos

B00I - R0017 - Cleaning Store - Distributed (3.46 m2)

No Asbestos

B00I - R0018 - Disabled Toilet (5.52 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B001 - R0019 - Movement (24.76 m2)						
No Asbestos						
B001 - R0020 - Staff Kitchen (12.46 m2)						
No Asbestos						
B001 - R0021 - Movement (6.34 m2)						
No Asbestos						
B001 - R0022 - Toilets-Girls (19.33 m2)						
No Asbestos						
B001 - R0023 - Sport Equipment Store (20.77 m2)						
No Asbestos						
B001 - R0024 - Movement (1.54 m2)						
No Asbestos						
B001 - R0025 - Movement (5.18 m2)						
No Asbestos						
B001 - R0026 - Movement (8.36 m2)						
No Asbestos						
B001 - R0027 - Movement (10.55 m2)						
No Asbestos						
B001 - R0028 - Movement (10.56 m2)						
No Asbestos						
B001 - R0029 - Movement (32.84 m2)						
No Asbestos						
B001 - R0030 - Movement (10.55 m2)						
No Asbestos						
B001 - R0031 - Movement (10.55 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Pupil Facilities/Other - 1999 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior**B00J - R0001 - Resources Store (11.59 m2)**

No Asbestos

B00J - R0002 - Kiln Space (15.35 m2)

No Asbestos

B00J - R0003 - General Storeroom (8.15 m2)

No Asbestos

B00J - R0004 - Movement (1.82 m2)

No Asbestos

B00J - R0005 - Stairs (1.86 m2)

No Asbestos

B00J - R0006 - Movement (4.45 m2)

No Asbestos

B00J - R0007 - Movement (6.91 m2)

No Asbestos

B00J - R0008 - Movement (1.98 m2)

No Asbestos

B00J - R1001 - Movement (8.15 m2)

No Asbestos

B00J - R1002 - Movement (14.03 m2)

No Asbestos

B00J - R1003 - Movement (4.45 m2)

No Asbestos

B00J - R1004 - Movement (9.78 m2)

No Asbestos

B00J - R1005 - Movement (14.11 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Storage - 1999 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior**B00K - M0001 - Music Store (13.41 m2)**

No Asbestos

B00K - R0001 - Music Store (26.46 m2)

No Asbestos

B00K - R0002 - Movement (13.58 m2)

No Asbestos

B00K - R0003 - General Storeroom (6.34 m2)

No Asbestos

B00K - R0004 - General Storeroom (10.63 m2)

No Asbestos

B00K - R0005 - External Movement (7.85 m2)

No Asbestos

B00K - R0006 - Movement (6.3 m2)

No Asbestos

B00K - R0007 - Stairs (6.34 m2)

No Asbestos

B00K - R1001 - Movement (6.41 m2)

No Asbestos

B00K - R1002 - Movement (14.09 m2)

No Asbestos

B00K - R1003 - Movement (6.32 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Pupil Facilities/Other - 1999 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00L - R0001 - General Storeroom (9.79 m2)

No Asbestos

B00L - R0002 - Movement (6.84 m2)

No Asbestos

B00L - R0003 - Movement (83.09 m2)

No Asbestos

B00L - R1001 - Movement (81.34 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Storage - 2014 - Metal Shed (Metal Shed)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00M - R0001 - Sport Equipment Store (25.6 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 758 - D11475 - Darkroom : Placement Date - 23/01/1998

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		5.76 m2

Interior

R1 - Darkroom Space

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		34 m2

R2 - Store

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		2 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017