


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Panania Public School (1809)
Region : South Western Sydney
State Electorate : East Hills
Local Government Area : Bankstown

Initial Survey : Noel Arnold & Associates : 29 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 28 - Aug - 2015

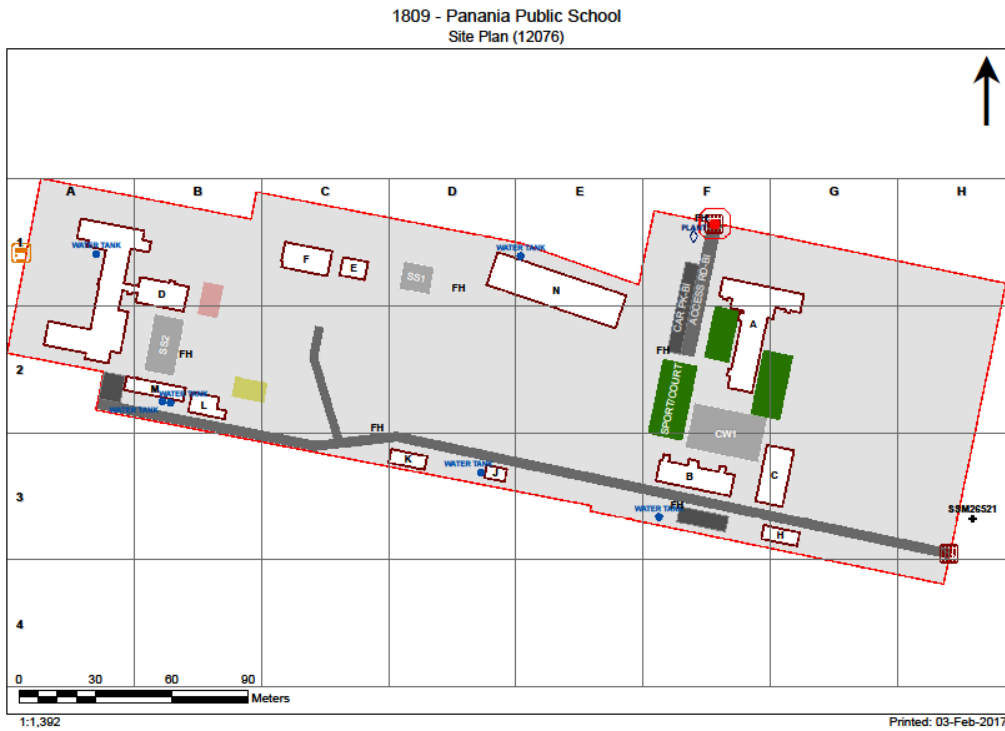

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - Administration/General Learning - 1953 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 1809/B00B/Eaves Linings/S27	60m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris 1809/B00A/Underfloor Voids/S32	1m2	West	Poor Condition - Extensive Damage (4)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	
Gable Verge Lining	Flat AC Sheeting 1809/B00B/Gable Verge Lining/S28	20m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	

Interior**B00A - R0005 - Distribution Board (0.75 m2)**

Note: No inspection of live electrical installation.

No Asbestos

B00A - R0006 - Movement (1.38 m2)

No Asbestos

B00A - R0008 - Principal (15.54 m2)

No Asbestos

B00A - R0010 - Raised Platform (19.05 m2)

No Asbestos

B00A - R0011 - Movement (1.41 m2)

No Asbestos

B00A - R0014 - Movement (1.78 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1809/B00A/R0014/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)	

B00A - R0015 - Home Base (47.47 m2)

No Asbestos

B00A - R0016 - Home Base (47.47 m2)

No Asbestos

B00A - R0017 - Home Base (47.47 m2)

No Asbestos

B00A - R0018 - Security Store (36.72 m2)

Floor Coverings Res/Textile	Vinyl Tiles	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1809/B00A/R0018/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)	

B00A - R0019 - Cleaning Distributed Store (8.95 m2)

No Asbestos

B00A - R0020 - Movement (1.98 m2)

No Asbestos

B00A - R0021 - Movement (55.02 m2)

No Asbestos

B00A - R0022 - Movement (1.62 m2)

No Asbestos

B00A - R0023 - Movement (11.43 m2)

No Asbestos

B00A - R0024 - Sick Bay (6.74 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
No Asbestos						
B00A - R0025 - Staff Toilet (6.04 m2)						
No Asbestos						
B00A - R0026 - Staff Shower/Change (10.27 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet					
1809/B00A/R0026/Partition Walls (Cubicles)/S2						No Asbestos Detected
B00A - R0027 - Movement (18.61 m2)						
No Asbestos						
B00A - R0028 - Cleaning Distributed Store (1.74 m2)						
No Asbestos						
B00A - R0029 - Interview (11.54 m2)						
No Asbestos						
B00A - R0030 - Clerical Office (17.69 m2)						
No Asbestos						
B00A - R0031 - Duplicating Workroom (22.15 m2)						
No Asbestos						
B00A - R0032 - Movement (24.07 m2)						
No Asbestos						
B00A - R0033 - Movement (3.29 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1809/B00A/R0014/Ceiling Structures/Linings/S3						Chrysotile (white asbestos)
B00A - R0034 - Distribution Board (0.27 m2)						
						Note: No inspection of live electrical installation.
No Asbestos						
B00A - R0035 - Communal Space (76.73 m2)						
No Asbestos						
B00A - R0036 - Movement (8.46 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1809/B00A/R0014/Ceiling Structures/Linings/S3						Chrysotile (white asbestos)
B00A - R0037 - Stairs (5.01 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
1809/B00A/R0037/Floor Coverings Res/Textile/S38						Chrysotile (white asbestos)
B00A - R0038 - Stairs (8.5 m2)						
No Asbestos						
B00A - R1001 - K.L.A. Store (13.24 m2)						
No Asbestos						
B00A - R1002 - Staff Toilet (6.59 m2)						
No Asbestos						
B00A - R1004 - Reading Area (75.66 m2)						
No Asbestos						
B00A - R1005 - Home Base (48.49 m2)						
No Asbestos						
B00A - R1006 - Home Base (48.42 m2)						
No Asbestos						
B00A - R1007 - Home Base (49.35 m2)						
No Asbestos						
B00A - R1008 - Staff Room (37.72 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1809/B00A/R0018/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00A - R1009 - Movement (95.11 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Corridor outside staff room 1008	Good Condition (1)	Low (1)	Low Priority (2-3)
1809/B00A/R0018/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
B00A - R1010 - Stairs (15.52 m2)						
No Asbestos						
B00A - R1011 - Stairs (13.48 m2)						
No Asbestos						
B00A - R1012 - Store - Coolroom (9.05 m2)						
No Asbestos						
B00A - R1013 - Staff Kitchen (9.16 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1953 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	1809/B00B/Eaves Linings/S27				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Gable Verge Lining	Flat AC Sheeting	20m2	East & West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1809/B00B/Gable Verge Lining/S28				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris	4m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Low Priority (2-3)
	1809/B00B/Underfloor Voids/S33				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Interior**B00B - R0001 - Staff Toilet (3.06 m2)**

No Asbestos

B00B - R0002 - General Storeroom (2.58 m2)

No Asbestos

B00B - R0003 - Interview (16.23 m2)

No Asbestos

B00B - R0004 - General Storeroom (21.53 m2)

No Asbestos

B00B - R0005 - Movement (11.96 m2)

No Asbestos

B00B - R0006 - Movement (4.95 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	1809/B00B/R0006/Ceiling Structures/Linings/S5				No Asbestos Detected	

B00B - R0007 - Home Base (57.13 m2)

Heater Surround	Flat AC Sheeting	2Unit(s)	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	1809/B00B/R0007/Electrical Backing Board/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00B - R0008 - Home Base Store (6.7 m2)

No Asbestos

B00B - R0009 - Personal Effects Storage (6.96 m2)

No Asbestos

B00B - R0010 - Movement (6.82 m2)

No Asbestos

B00B - R0011 - Movement (8.47 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	1809/B00B/R0006/Ceiling Structures/Linings/S5				No Asbestos Detected	

B00B - R0012 - Home Base Store (6.7 m2)

No Asbestos

B00B - R0013 - Home Base (57.13 m2)

Electrical Backing Board	Resinous Board	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1809/B00B/R0007/Electrical Backing Board/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00B - R0014 - General Storeroom (2.8 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0015 - Staff Room Annexe (15.22 m2)						
No Asbestos						
B00B - R0016 - Movement (9.19 m2)						
No Asbestos						
B00B - R0017 - Movement (4.83 m2)						
Ceiling Structures/Linings	Flat AC Sheeting		1809/B00B/R0006/Ceiling Structures/Linings/S5			No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00C - General Learning - 1953 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1809/B00B/Eaves Linings/S27				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Gable Verge Lining	Flat AC Sheeting	20m2	North & South	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	1809/B00B/Gable Verge Lining/S28				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00C - R0001 - Home Base (56.47 m2)**

Ceiling Structures/Linings	Vermiculite					
	1809/B00C/R0003/Ceiling Structures/Linings/S8				Limited Samples Taken	
					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00C - R0002 - Home Base Store (7.31 m2)

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1809/B00C/R0003/Floor Coverings Res/Textile/S7				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
	1809/B00C/R0003/Ceiling Structures/Linings/S8				Limited Samples Taken	
					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00C - R0003 - Personal Effects Storage (7.06 m2)

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1809/B00C/R0003/Floor Coverings Res/Textile/S7				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
	1809/B00C/R0003/Ceiling Structures/Linings/S8				Limited Samples Taken	
					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00C - R0004 - Sports Store (12.73 m2)

No Asbestos

B00C - R0005 - Personal Effects Storage (6.35 m2)

Ceiling Structures/Linings	Vermiculite					
	1809/B00C/R0003/Ceiling Structures/Linings/S8				Limited Samples Taken	
					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1809/B00C/R0003/Floor Coverings Res/Textile/S7				Chrysotile (white asbestos)	

B00C - R0006 - Distribution Board (0.65 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00C - R0007 - Craft Store (7.22 m2)

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1809/B00C/R0003/Floor Coverings Res/Textile/S7				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
	1809/B00C/R0003/Ceiling Structures/Linings/S8				Limited Samples Taken	
					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00C - R0008 - Special Programs Room (56.32 m2)

Ceiling Structures/Linings	Vermiculite					
	1809/B00C/R0003/Ceiling Structures/Linings/S8				Limited Samples Taken	
					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00C - R0009 - Movement (6.73 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00C - R0010 - Movement (40.77 m2)						
In-fill-panel	Flat AC Sheeting	10m	West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
1809/B00C/R0010/In-fill-panel/S6					Chrysotile (white asbestos)	
B00C - R0011 - Stairs (5.95 m2)						
No Asbestos						
B00C - R1001 - Home Base (56.47 m2)						
No Asbestos						
B00C - R1002 - Home Base Store (7.31 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
1809/B00C/R1005/Floor Coverings Res/Textile/S9					No Asbestos Detected	
B00C - R1003 - Personal Effects Storage (7.05 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
1809/B00C/R1003/Floor Coverings Res/Textile/S10					No Asbestos Detected	
B00C - R1004 - Craft Store (7.86 m2)						
No Asbestos						
B00C - R1005 - Personal Effects Storage (6.35 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
1809/B00C/R1005/Floor Coverings Res/Textile/S9					No Asbestos Detected	
B00C - R1006 - Distribution Board (0.65 m2)						
					Note: No inspection of live electrical installation.	
Floor Coverings Res/Textile	Vinyl Tiles					
1809/B00C/R1005/Floor Coverings Res/Textile/S9					No Asbestos Detected	
B00C - R1007 - Home Base Store (7.22 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
1809/B00C/R1005/Floor Coverings Res/Textile/S9					No Asbestos Detected	
B00C - R1008 - Home Base (56.32 m2)						
No Asbestos						
B00C - R1009 - Movement (54.38 m2)						
In-fill-panel	Compressed AC Sheet	8m	West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
1809/B00C/R0010/In-fill-panel/S6					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1809/B00C/R1009/Ceiling Structures/Linings/S37					Chrysotile (white asbestos)	
B00C - R1010 - Stairs (8.59 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1953 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 1809/B00B/Eaves Linings/S27	140m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids	Compressed AC Sheet 1809/B00D/Underfloor Voids/S35					No Asbestos Detected
Underfloor Voids	AC Fragments/Debris 1809/B00D/Underfloor Voids/S35					No Asbestos Detected
Ceiling Voids	No Asbestos Found					

Interior**B00D - R0001 - Raised Platform (29.35 m2)**

No Asbestos

B00D - R0002 - Communal Space (138.11 m2)

No Asbestos

B00D - R0003 - Movement (1.48 m2)

No Asbestos

B00D - R0004 - Interview (13.29 m2)

No Asbestos

B00D - R0005 - Staff Room (18.85 m2)

Floor Coverings Res/Textile	Vinyl Tiles 1809/B00D/R0005/Floor Coverings Res/Textile/S22					No Asbestos Detected
--------------------------------	--	--	--	--	--	-----------------------------

B00D - R0006 - Withdrawal Space - 1hb (8.86 m2)

No Asbestos

B00D - R0007 - Movement (1.73 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1809/B00D/R0021/Ceiling Structures/Linings/S20	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	--	-----	------------	--------------------	---------	---

B00D - R0008 - Home Base (65.62 m2)

No Asbestos

B00D - R0009 - Home Base (52.34 m2)

No Asbestos

B00D - R0010 - Home Base (57.5 m2)

Heater Surround	Flat AC Sheeting 1809/B00D/R0010/Heater Bank/S23					No Asbestos Detected
-----------------	---	--	--	--	--	-----------------------------

B00D - R0011 - Craft Store (5.19 m2)

No Asbestos

B00D - R0012 - Cleaning Supplies (4.92 m2)

No Asbestos

B00D - R0013 - Staff Toilet (4.98 m2)

Floor Coverings Res/Textile	Vinyl Tiles 1809/B00D/R0014/Floor Coverings Res/Textile/S21	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
--------------------------------	--	-----	------------	--------------------	---------	--

B00D - R0014 - Staff Toilet (4.79 m2)

Floor Coverings Res/Textile	Vinyl Tiles 1809/B00D/R0014/Floor Coverings Res/Textile/S21	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
--------------------------------	--	-----	------------	--------------------	---------	--

B00D - R0015 - Security Store (9.63 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R0016 - Movement (0.96 m2)						
No Asbestos						
B00D - R0017 - Home Base (50.89 m2)						
No Asbestos						
B00D - R0018 - Home Base (51.29 m2)						
No Asbestos						
B00D - R0019 - Home Base (51.42 m2)						
No Asbestos						
B00D - R0020 - Movement (57.48 m2)						
No Asbestos						
B00D - R0021 - Movement (1.54 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1809/B00D/R0021/Ceiling Structures/Linings/S20				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R0022 - K.L.A. Store (9.45 m2)						
No Asbestos						
B00D - R0023 - General Storeroom (8.3 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
1809/B00D/R0023/Floor Coverings Res/Textile/S19				No Asbestos Detected		
B00D - R0024 - Home Base (51.54 m2)						
No Asbestos						
B00D - R0025 - Home Base (51.67 m2)						
No Asbestos						
B00D - R0026 - Toilets - Boys/Girls (2.36 m2)						
No Asbestos						
B00D - R0027 - Movement (190.4 m2)						
No Asbestos						
B00D - R0028 - Movement (2.5 m2)						
No Asbestos						
B00D - R0029 - Home Base Store (2.83 m2)						
No Asbestos						
B00D - R0030 - Toilets - Boys/Girls (4.97 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
1809/B00D/R0014/Floor Coverings Res/Textile/S21				Chrysotile (white asbestos)		
B00D - R0031 - Movement (1.48 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1945 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 1809/B00B/Eaves Linings/S27	20m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00E - R0001 - Canteen Office/Store (5.5 m2)**

No Asbestos

B00E - R0002 - Movement (1.92 m2)

No Asbestos

B00E - R0003 - Staff Toilet (3.85 m2)

No Asbestos

B00E - R0004 - Canteen (24.89 m2)

No Asbestos

B00E - R0005 - Movement (23.08 m2)

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1809/B00E/R0005/Ceiling Structures/Linings/S36					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1953 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting 1809/B00F/Eaves Linings/S29	20m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris 1809/B00F/Underfloor Voids/S34	1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	

Interior**B00F - R0001 - Out Of School Hours Care Centre (53.29 m2)**

Heater Surround	Flat AC Sheeting 1809/B00F/R0001/Heater Bank/S26	2Unit(s)	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting 1809/B00F/R0007/Ceiling Structures/Linings/S25				No Asbestos Detected	

B00F - R0002 - Home Base (53.44 m2)

Heater Surround	Flat AC Sheeting 1809/B00F/R0001/Heater Bank/S26	2Unit(s)	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting 1809/B00F/R0007/Ceiling Structures/Linings/S25				No Asbestos Detected	

B00F - R0003 - Movement (3.15 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1809/B00F/R0007/Ceiling Structures/Linings/S25				No Asbestos Detected	
----------------------------	--	--	--	--	-----------------------------	--

B00F - R0004 - Community Clinic (13.36 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1809/B00F/R0007/Ceiling Structures/Linings/S25				No Asbestos Detected	
----------------------------	--	--	--	--	-----------------------------	--

B00F - R0005 - General Storeroom (9.17 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1809/B00F/R0007/Ceiling Structures/Linings/S25				No Asbestos Detected	
----------------------------	--	--	--	--	-----------------------------	--

B00F - R0006 - General Storeroom (5.97 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1809/B00F/R0007/Ceiling Structures/Linings/S25				No Asbestos Detected	
----------------------------	--	--	--	--	-----------------------------	--

B00F - R0007 - Movement (34.37 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1809/B00F/R0007/Ceiling Structures/Linings/S25				No Asbestos Detected	
----------------------------	--	--	--	--	-----------------------------	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Pupil Facilities - 1953 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 1809/B00H/Eaves Linings/S30					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00H - R0001 - Handwashing Facilities (13.25 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 1809/B00H/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00H - R0002 - Garden Store (52.36 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1809/B00H/R0001/Ceiling Structures/Linings/S11					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Pupil Facilities - 1953 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	4m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	1809/B00B/Eaves Linings/S27					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00J - R0001 - Toilets - Girls (32.36 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1809/B00J/R0001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)
Partition Walls (Cubicles)	Flat AC Sheeting					No Asbestos Detected
	1809/B00J/R0001/Partition Walls (Cubicles)/S14					

B00J - R0002 - Cleaning Distributed Store (1.34 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1809/B00J/R0001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Pupil Facilities - 1956 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 1809/B00B/Eaves Linings/S27	20m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00K - R0001 - Handwashing Facilities (13.28 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1809/B00K/R0001/Ceiling Structures/Linings/S15					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00K - R0002 - General Storeroom (38.06 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1809/B00K/R0001/Ceiling Structures/Linings/S15					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00K - R0003 - General Storeroom (14.89 m2)

Ceiling Structures/Linings	Flat AC Sheeting 1809/B00K/R0001/Ceiling Structures/Linings/S15					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Pupil Facilities - 1953 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 1809/B00M/Eaves Linings/S31					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00L - R0001 - Toilets - Girls (28.14 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1809/B00L/R0001/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)

B00L - R0002 - Toilets - Boys (39.2 m2)

Ceiling Structures/Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1809/B00L/R0001/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)

B00L - R0003 - General Storeroom (16.44 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Pupil Facilities - 1953 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 1809/B00M/Eaves Linings/S31					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00M - R0001 - Handwashing Facilities (13.21 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1809/B00M/R0004/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)

B00M - R0002 - Garden Store (44.58 m2)

Ceiling Structures/Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1809/B00M/R0004/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)

B00M - R0003 - P.E. Store (22.9 m2)

Wall Linings Internal	Flat AC Sheeting	14m2	All internal partitions in middle of room	Good Condition (1)	Low (1)	Low Priority (2-3)
	1809/B00M/R0004/Wall Linings Internal/S17					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1809/B00M/R0004/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)

B00M - R0004 - No Access (13.7 m2)

Wall Linings Internal	Flat AC Sheeting	6m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	1809/B00M/R0004/Wall Linings Internal/S17					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1809/B00M/R0004/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)

B00M - R0005 - Handwashing Facilities (13.26 m2)

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	1809/B00M/R0004/Ceiling Structures/Linings/S18					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00N - Library/General Learning - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids No Asbestos Found

Underfloor Voids No Asbestos Found

Interior**B00N - R0001 - External Movement (165.76 m2)**

No Asbestos

B00N - R0002 - Practical Activities/Movement - 1hb (19.21 m2)

No Asbestos

B00N - R0003 - Home Base Store (6.08 m2)

No Asbestos

B00N - R0004 - Home Base (61.35 m2)

No Asbestos

B00N - R0005 - Withdrawal Space - 2hb (11.74 m2)

No Asbestos

B00N - R0006 - Home Base (61.02 m2)

No Asbestos

B00N - R0007 - Home Base Store (6.08 m2)

No Asbestos

B00N - R0008 - Practical Activities/Movement - 1hb (18.75 m2)

No Asbestos

B00N - R0009 - Distribution Board (0.45 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00N - R0010 - Movement (5.09 m2)

No Asbestos

B00N - R0011 - Special Programs Room (33.22 m2)

No Asbestos

B00N - R0012 - Special Programs Store (10.74 m2)

No Asbestos

B00N - R0013 - Toilet - Lobby (2.5 m2)

No Asbestos

B00N - R0014 - Staff Toilet (4.78 m2)

No Asbestos

B00N - R0015 - Cleaning Distributed Store (3.72 m2)

No Asbestos

B00N - R0016 - Distribution Board (0.68 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00N - R0017 - K.L.A. Store (14.8 m2)

No Asbestos

B00N - R0018 - Communications Room (8.04 m2)

No Asbestos

B00N - R0019 - Library Office/Workroom (23.01 m2)

No Asbestos

B00N - R0020 - Reading Area (168.97 m2)

No Asbestos

B00N - R0021 - Toilets - Boys (17.39 m2)

No Asbestos

B00N - R0022 - Toilets - Girls (24.53 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017