


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Pallamallawa Public School (2827)  
**Region :** New England  
**State Electorate :** Northern Tablelands  
**Local Government Area :** Moree Plains

**Initial Survey :** Noel Arnold & Associates : 21 - May - 2008  
**Reviewed By :** Grencap-NAA : 04 - May - 2016

2827 - Pallamallawa Public School  
Site Plan (All Sites)

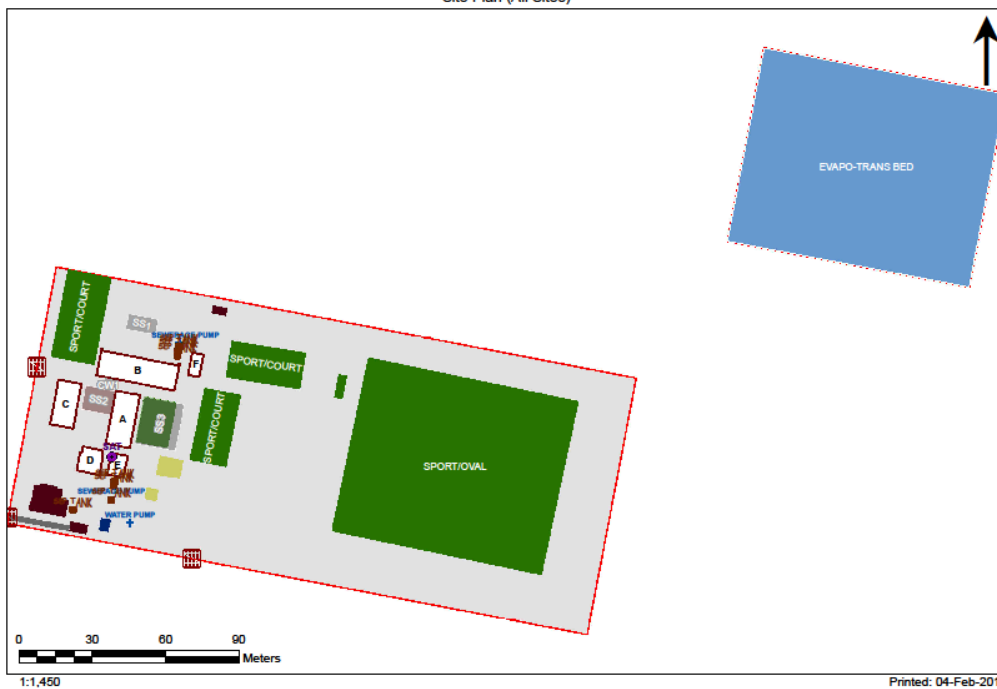

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning/Administration - 1950 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00A/Eaves Linings/S3				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					

**Interior****B00A - R0001 - Clerical Office**

No Asbestos

**B00A - R0002 - Principal**

No Asbestos

**B00A - R0003 - General Storeroom**

No Asbestos

**B00A - R0006 - Home Base Store**

No Asbestos

**B00A - R0007 - General Storeroom**

No Asbestos

**B00A - R0008 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00A/R0008/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting	4m2	North, South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00A/R0008/Wall Linings Internal/S2				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Electrical Backing Board	Resinous Board	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00A/R0008/Electrical Backing Board/S9				<b>Chrysotile (white asbestos)</b>	

**B00A - R0009 - Staff Room**

No Asbestos

**B00A - R0010 - Special Programs Room**

No Asbestos

**B00A - R0011 - Home Base**

Wall Linings Internal	Flat AC Sheeting	3m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00A/R0011/Wall Linings Internal/S10				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00B - General Learning - 1972 - Brick/Veneer (Brick/Veneer)****Exterior**

Eaves Linings	Flat AC Sheeting	30m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00A/Eaves Linings/S3			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
In-fill-panel	Flat AC Sheeting	20m2	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00B/R0004/Panels Under Windows/S7			<b>Chrysotile (white asbestos)</b>		
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	5m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00B/Gable Verge Lining/S11			<b>Chrysotile (white asbestos)</b>		
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					

**Interior****B00B - R0001 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00A/R0008/Ceiling Structures/Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00B/R0003/Partition Walls (Cubicles)/S12			<b>Chrysotile (white asbestos)</b>		

**B00B - R0002 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00A/R0008/Ceiling Structures/Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
In-fill-panel	Flat AC Sheeting	2m	South. Above Door to Room 004	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00A/R0008/Wall Linings Internal/S2			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00B - R0003 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00A/R0008/Ceiling Structures/Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00B/R0003/Partition Walls (Cubicles)/S12			<b>Chrysotile (white asbestos)</b>		

**B00B - R0004 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00A/R0008/Ceiling Structures/Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
In-fill-panel	Flat AC Sheeting	16m	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00B/R0004/Panels Under Windows/S7			<b>Chrysotile (white asbestos)</b>		
In-fill-panel	Flat AC Sheeting	2m	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00A/R0008/Wall Linings Internal/S2			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00B - R0005 - Personal Effects Storage**

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00B/R0005/Floor Coverings Res/Textile/S8			<b>Chrysotile (white asbestos)</b>		

**B00B - R0006 - Home Base Store**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00B/R0005/Floor Coverings Res/Textile/S8				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Adhesive					
	2827/B00B/R0010/Floor Coverings Res/Textile/S14				<b>No Asbestos Detected</b>	
<b>B00B - R0007 - Toilets - Boys/Girls</b>						
No Asbestos						
<b>B00B - R0008 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B00B - R0009 - Home Base</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	81.55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00B/R0010/Floor Coverings Res/Textile/S13				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Adhesive					
	2827/B00B/R0010/Floor Coverings Res/Textile/S14				<b>No Asbestos Detected</b>	
<b>B00B - R0010 - Home Base</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00B/R0010/Floor Coverings Res/Textile/S13				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Adhesive					
	2827/B00B/R0010/Floor Coverings Res/Textile/S14				<b>No Asbestos Detected</b>	
Floor Coverings Res/Textile	Adhesive					
	2827/B00B/R0010/Floor Coverings Res/Textile/S19				<b>No Asbestos Detected</b>	
<b>B00B - R0011 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B00B - R0012 - Home Base Store</b>						
Floor Coverings Res/Textile	Vinyl Tiles	5.15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00B/R0012/Floor Coverings Res/Textile/S15				<b>Chrysotile (white asbestos)</b>	
<b>B00B - R0013 - Personal Effects Storage</b>						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00B/R0005/Floor Coverings Res/Textile/S8				<b>Chrysotile (white asbestos)</b>	
<b>B00B - R0014 - Staff Room</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	27.94m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00B/R0010/Floor Coverings Res/Textile/S13				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Adhesive					
	2827/B00B/R0010/Floor Coverings Res/Textile/S14				<b>No Asbestos Detected</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning - 1950 - Timber (Timber)**

**Exterior**

Electrical Backing Board	Resinous Board	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00A/R0008/Electrical Backing Board/S9				Chrysotile (white asbestos)	
Ceiling Voids - Raked Ceiling	Non Accessible Area - height - 4 meters					
Underfloor Voids - Packing to Floor Joists	Packing	1m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2827/B00C/Underfloor Voids - Packing to Floor Joists/S16				Chrysotile (white asbestos)	

**Interior**

**B00C - R0001 - Craft Store**

No Asbestos

**B00C - R0002 - Reading Area**

No Asbestos

**B00C - R0003 - K.L.A. Store**

No Asbestos

**B00C - R0004 - Practical Activities - 1hb**

No Asbestos

**B00C - R0005 - Movement**

No Asbestos

**B00C - R0006 - Home Base Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Library - 1950 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting	10m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00D/Eaves Linings/S17				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- height - 3.6 meters					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					

**Interior****B00D - R0001 - Movement**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	2827/B00D/R0001/Wall Linings Internal/S6					
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00A/R0008/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00D/R0001/Electrical Backing Board/S18				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00D - R0002 - Home Base**

Heater Surround	Compressed AC Sheet	1Unit(s)	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00A/R0005/Panels Behind Heater/S4				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00D - R0003 - Home Base Store**

No Asbestos

**B00D - R0004 - Cleaning Distributed Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00E - Pupil Facilities - 1950 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	15m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00A/Eaves Linings/S3			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior****B00E - R0001 - Drinking Facilities**

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00A/R0008/Ceiling Structures/Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00E - R0002 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00A/R0008/Ceiling Structures/Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00E/R0004/Partition Walls (Cubicles)/S5			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00E - R0003 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00A/R0008/Ceiling Structures/Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00E - R0004 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00A/R0008/Ceiling Structures/Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00E/R0004/Partition Walls (Cubicles)/S5			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00E - R0005 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2827/B00A/R0008/Ceiling Structures/Linings/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Pupil Facilities - 1950 - Timber (Timber)**

**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

**Interior**

**B00F - R0001 - Canteen**

No Asbestos

**B00F - R0002 - Sports Store**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017