


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Parramatta Public School (2840)
Region : Western Sydney
State Electorate : Parramatta
Local Government Area : Parramatta

Initial Survey : Noel Arnold & Associates : 05 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 28 - Feb - 2017

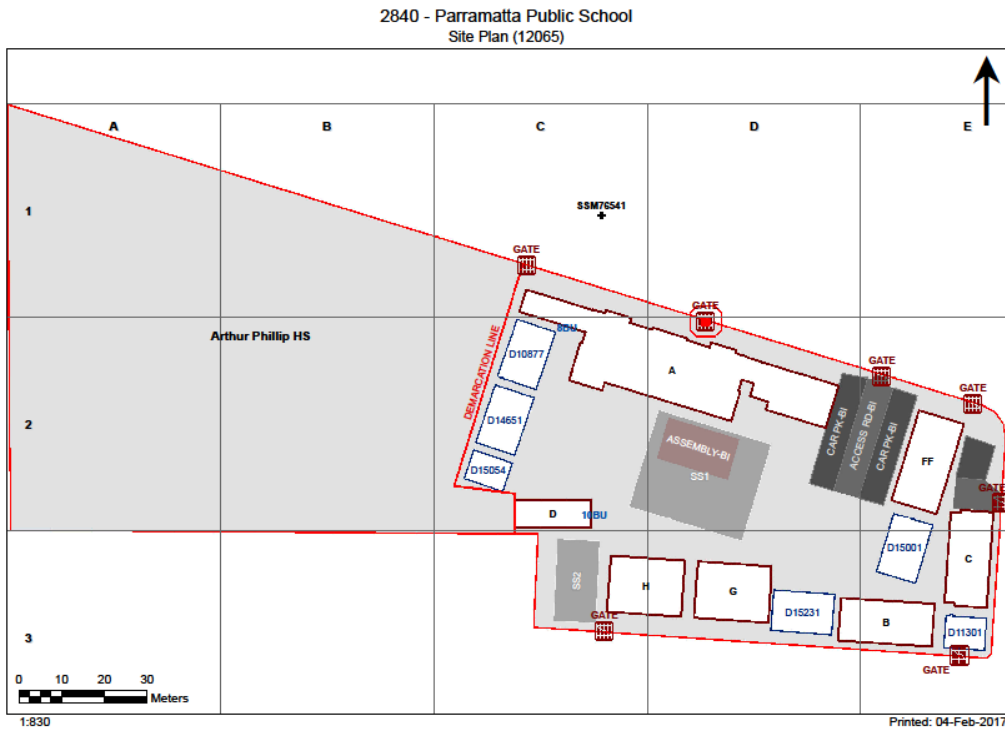

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1923 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00A - R0001 - Utility Space (11.21 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken	
	2840/B00A/R0001/Ceiling Structures/Linings/S8						
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
	2840/B00A/R0001/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	

B00A - R0002 - Interview (20.57 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken	
	2840/B00A/R0001/Ceiling Structures/Linings/S8						
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R0003 - Staff Room Annexe (15.85 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken	
	2840/B00A/R0001/Ceiling Structures/Linings/S8						
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R0004 - Principal (21.25 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken	
	2840/B00A/R0001/Ceiling Structures/Linings/S8						
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R0005 - Distribution Board (0.9 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken	
	2840/B00A/R0001/Ceiling Structures/Linings/S8						
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
	2840/B00A/R0001/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)	

B00A - R0006 - Clerical Office/Workroom (24.25 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken	
	2840/B00A/R0001/Ceiling Structures/Linings/S8						
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R0007 - External Movement (3.43 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
	2840/B00A/R0034/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00A - R0008 - Home Base (43.46 m2)

Chalk Board	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
	2840/B00A/R0008/Chalk Board/S13					Chrysotile (white asbestos)	

B00A - R0009 - Practical Activities - 1hb (3.93 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected	
	2840/B00A/R0009/Floor Coverings Res/Textile/S14						

B00A - R0010 - Home Base (48.06 m2)

Chalk Board	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
	2840/B00A/R0008/Chalk Board/S13					Chrysotile (white asbestos)	

B00A - R0013 - Home Base (46.86 m2)

Chalk Board	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
	2840/B00A/R0008/Chalk Board/S13					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00A - R0014 - Home Base (57.55 m2)						
Chalk Board	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00A/R0008/Chalk Board/S13				Chrysotile (white asbestos)		
B00A - R0015 - Practical Activities - 1hb (4.32 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
2840/B00A/R0009/Floor Coverings Res/Textile/S14				No Asbestos Detected		
B00A - R0016 - External Movement (3 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00A/R0034/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)		
B00A - R0018 - Toilets - Boys (28.9 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00A/R0021/Partition Walls (Cubicles)/S5				Chrysotile (white asbestos)		
B00A - R0019 - Cleaning Distributed Store (1.61 m2)						
No Asbestos						
B00A - R0022 - Cleaning Distributed Store (1.6 m2)						
No Asbestos						
B00A - R0023 - External Movement (3.02 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00A/R0034/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)		
B00A - R0024 - Cleaning Distributed Store (1.37 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00A/R0045/Ceiling Structures/Linings/S11				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00A/R0031/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00A - R0025 - General Storeroom (5.15 m2)						
Non Accessible						
B00A - R0026 - Movement (52.36 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00A/R0045/Ceiling Structures/Linings/S11				Chrysotile (white asbestos)		
B00A - R0027 - General Storeroom (12.6 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00A/R0045/Ceiling Structures/Linings/S11				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00A/R0031/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00A - R0028 - Deputy Principal (13.63 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00A/R0045/Ceiling Structures/Linings/S11				Chrysotile (white asbestos)		
B00A - R0031 - General Storeroom (12.75 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00A/R0045/Ceiling Structures/Linings/S11				Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00A/R0031/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)		
B00A - R0032 - Uniform Shop (5.11 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00A - R0035 - Entry Vestibule (21.67 m2)						
Ceiling Structures/Linings	Vermiculite 2840/B00A/R0001/Ceiling Structures/Linings/S8					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Ceiling Structures/Linings	Flat AC Sheeting 2840/B00A/R0034/Ceiling Structures/Linings/S9	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0036 - Interview (7.29 m2)						
Ceiling Structures/Linings	Vermiculite 2840/B00A/R0001/Ceiling Structures/Linings/S8					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00A - R0040 - Movement (14.98 m2)						
Ceiling Structures/Linings	Vermiculite 2840/B00A/R0001/Ceiling Structures/Linings/S8					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 2840/B00A/R0001/Floor Coverings Res/Textile/S7	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0041 - Staff Kitchen (23.34 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 2840/B00A/R0045/Ceiling Structures/Linings/S11	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0042 - Staff Room (30.7 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 2840/B00A/R0045/Ceiling Structures/Linings/S11	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0043 - Security Store (7.95 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 2840/B00A/R0045/Ceiling Structures/Linings/S11	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0044 - Sick Bay (6.56 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 2840/B00A/R0045/Ceiling Structures/Linings/S11	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0045 - Movement (90.84 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 2840/B00A/R0045/Ceiling Structures/Linings/S11	91m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0048 - Toilets - Girls (26.99 m2)						
No Asbestos						
B00A - R0049 - Toilets - Girls (1.65 m2)						
No Asbestos						
B00A - R0050 - Toilet - Lobby (1.62 m2)						
No Asbestos						
B00A - R0051 - Staff Toilet (1.46 m2)						
No Asbestos						
B00A - R0052 - Toilet - Lobby (1.58 m2)						
No Asbestos						
B00A - R0053 - Staff Toilet (1.49 m2)						
No Asbestos						
B00A - R0054 - Toilet - Lobby (1.63 m2)						
No Asbestos						
B00A - R0055 - Staff Toilet (1.49 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
No Asbestos						
B00A - R0056 - Stairs (8.67 m2)						
No Asbestos						
B00A - R0057 - Stairs (7.94 m2)						
No Asbestos						
B00A - R0058 - External Movement (3.69 m2)						
No Asbestos						
B00A - R0059 - Home Base (47.83 m2)						
No Asbestos						
B00A - R1001 - Cleaning Distributed Store (4 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00A/R1001/Ceiling Structures/Linings/S17				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1002 - Special Programs Room (12.92 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00A/R1001/Ceiling Structures/Linings/S17				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1003 - Music Store (8.6 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00A/R1001/Ceiling Structures/Linings/S17				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1004 - Home Base (50.55 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00A/R1001/Ceiling Structures/Linings/S17				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1005 - Home Base (49.73 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00A/R1001/Ceiling Structures/Linings/S17				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1006 - Home Base (49.73 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00A/R1001/Ceiling Structures/Linings/S17				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1007 - Home Base (49.8 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00A/R1001/Ceiling Structures/Linings/S17				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1008 - Home Base (64.8 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00A/R1001/Ceiling Structures/Linings/S17				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1009 - Staff Room Annexe (12.17 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00A/R1001/Ceiling Structures/Linings/S17				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Compressed AC Sheet	4m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00A/R1012/Wall Linings Internal/S20				Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R1010 - General Storeroom (4 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00A/R1001/Ceiling Structures/Linings/S17				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1011 - General Storeroom (8.44 m2)						
Non Accessible						
B00A - R1016 - Craft Store (2.32 m2)						
Non Accessible						
B00A - R1019 - Stairs (11.67 m2)						
No Asbestos						
B00A - R1020 - Stairs (11.67 m2)						
No Asbestos						
B00A - R1021 - Movement (82.72 m2)						
No Asbestos						
B00A - R1022 - Home Base (41.25 m2)						
No Asbestos						
B00A - R1023 - Withdrawal - M (12.79 m2)						
No Asbestos						
B00A - R1024 - Home Base (41.91 m2)						
No Asbestos						
B00A - R9001 - K.L.A. Store (4.87 m2)						
Ceiling Structures/Linings	Vermiculite					
2840/B00A/R0001/Ceiling Structures/Linings/S8				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00A/R9004/Floor Coverings Res/Textile/S23				Chrysotile (white asbestos)		
B00A - R9002 - Canteen Office/Store (3.35 m2)						
Ceiling Structures/Linings	Vermiculite					
2840/B00A/R0001/Ceiling Structures/Linings/S8				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00A/R9004/Floor Coverings Res/Textile/S23				Chrysotile (white asbestos)		
B00A - R9003 - Canteen Office/Store (3.21 m2)						
Ceiling Structures/Linings	Vermiculite					
2840/B00A/R0001/Ceiling Structures/Linings/S8				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00A/R9004/Floor Coverings Res/Textile/S23				Chrysotile (white asbestos)		
B00A - R9004 - Canteen (18.07 m2)						
Ceiling Structures/Linings	Vermiculite					
2840/B00A/R0001/Ceiling Structures/Linings/S8				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00A/R9004/Floor Coverings Res/Textile/S23				Chrysotile (white asbestos)		
B00A - R9006 - Reading Area (57.72 m2)						
Wall Linings Internal	Flat AC Sheeting					
2840/B00A/R9009/Wall Linings Internal/S21				No Asbestos Detected		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	2840/B00A/R0001/Ceiling Structures/Linings/S8				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R9007 - Movement (25.92 m2)						
No Asbestos						
B00A - R9008 - Security Store (7.52 m2)						
Ceiling Structures/Linings	Vermiculite	2840/B00A/R0001/Ceiling Structures/Linings/S8				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R9009 - Movement (16.62 m2)						
Wall Linings Internal	Flat AC Sheeting	2840/B00A/R9009/Wall Linings Internal/S21				No Asbestos Detected
Ceiling Structures/Linings	Vermiculite	2840/B00A/R0001/Ceiling Structures/Linings/S8				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library/General Learning - 1910 - Timber (Timber)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00B - R0001 - General Storeroom (12.73 m2)**

No Asbestos

B00B - R0002 - Practical Activities (10.57 m2)

No Asbestos

B00B - R0003 - Withdrawal Space - 1hb (10.86 m2)

No Asbestos

B00B - R0004 - Home Base (83.48 m2)

No Asbestos

B00B - R0005 - Home Base (52.58 m2)

No Asbestos

B00B - R0006 - Home Base Store (9.68 m2)

No Asbestos

B00B - R0007 - Distribution Board (0.68 m2)

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	8m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00B/R0008/Wall Linings Internal/S27					Chrysotile (white asbestos)	

B00B - R0008 - External Movement (9.82 m2)

Wall Linings Internal	Flat AC Sheeting	10m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
2840/B00B/R0008/Wall Linings Internal/S27					Chrysotile (white asbestos)	

B00B - R0009 - Home Base Store (13.51 m2)

No Asbestos

B00B - R0010 - Movement (2.8 m2)

No Asbestos

B00B - R9001 - Cleaning Supplies (35.12 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Support Unit - 1955 - Timber (Timber)**Exterior**

Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2840/B00C/Eaves Linings/S24					Chrysotile (white asbestos)

Interior**B00C - R0001 - Home Base (53.74 m2)**

No Asbestos

B00C - R0002 - Home Base Store (11.82 m2)

No Asbestos

B00C - R0003 - Home Base - M (53.54 m2)

No Asbestos

B00C - R0004 - Home Base (53.32 m2)

No Asbestos

B00C - R0005 - Home Base Store (8.22 m2)

Floor Coverings Res/Textile	Vinyl Tiles				
	2840/B00C/R0005/Floor Coverings Res/Textile/S26				

No Asbestos Detected**B00C - R0006 - External Movement (28.39 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2840/B00C/R0006/Ceiling Structures/Linings/S25					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities/Communal Facilities - 1967 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2840/B00D/Eaves Linings/S2					Chrysotile (white asbestos)

Interior

B00D - R0002 - Garden Store (4.69 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2840/B00D/R0001/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)

B00D - R0003 - Toilets - Girls (36.52 m2)

Ceiling Structures/Linings	Flat AC Sheeting	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2840/B00D/R0001/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)

Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2840/B00D/R0001/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)

B00D - R0004 - General Assistant/Bulk Store (4.69 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2840/B00D/R0001/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)

B00D - R0005 - Sports Store (15.71 m2)

Ceiling Structures/Linings	Vermiculite					
	2840/B00D/R0005/Ceiling Structures/Linings/S28					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0006 - Toilets - Boys (29.98 m2)

No Asbestos

B00D - R0007 - Sports Store (3.16 m2)

No Asbestos

B00D - R0008 - Cleaning Distributed Store (3.14 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 2011 - Fibre Cement Clad (Fibre Cement Clad)**Exterior**

Underfloor Voids - Packing to Floor Joists No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00G - R0001 - Practical Activities (19.77 m2)**

No Asbestos

B00G - R0002 - Practical Activities (19.7 m2)

No Asbestos

B00G - R0003 - Home Base Store (6.98 m2)

No Asbestos

B00G - R0004 - Withdrawal Space - 2hb (10.96 m2)

No Asbestos

B00G - R0005 - Home Base (58.02 m2)

No Asbestos

B00G - R0006 - Home Base (58.02 m2)

No Asbestos

B00G - R0007 - Home Base Store (6.98 m2)

No Asbestos

B00G - R0008 - External Movement (37.69 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 2011 - Fibre Cement Clad (Fibre Cement Clad)**Exterior**

Underfloor Voids - Packing to Floor Joists No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00H - R0001 - Practical Activities (19.7 m2)**

No Asbestos

B00H - R0002 - Practical Activities (19.7 m2)

No Asbestos

B00H - R0003 - Home Base Store (6.98 m2)

No Asbestos

B00H - R0004 - Withdrawal Space - 2hb (10.96 m2)

No Asbestos

B00H - R0005 - Home Base (58.02 m2)

No Asbestos

B00H - R0006 - Home Base (58.02 m2)

No Asbestos

B00H - R0007 - Home Base Store (6.98 m2)

No Asbestos

B00H - R0008 - External Movement (37.5 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0FF - Library - 2011 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Underfloor Voids - Packing to Floor Joists No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B0FF - R0001 - Reading Area (166.24 m2)

No Asbestos

B0FF - R0002 - Library Office/Workroom (23.68 m2)

No Asbestos

B0FF - R0003 - Communications Room (8.3 m2)

No Asbestos

B0FF - R0004 - Security Store (16 m2)

No Asbestos

B0FF - R0005 - Access Shower/Toilet/Change (6.8 m2)

No Asbestos

B0FF - R0006 - External Movement (11.08 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

NS 111 - D10877 - Learning Unit - Double Secondary/Secure : Placement Date - 23/04/2014

Exterior

No Asbestos Found.

Interior

R1 - General Learning Space

No Asbestos Found.

R2 - General Learning Space

No Asbestos Found.

R3 - Entry

No Asbestos Found.

R4 - Secure Storeroom

No Asbestos Found.

R5 - Secure Storeroom

No Asbestos Found.

R6 - Entry

No Asbestos Found.

OS 602 - D11301 - Learning Unit - Standard With P.A.A. : Placement Date - 9/01/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

NS 111 - D14651 - Learning Unit - Double Secondary/Secure : Placement Date - 23/04/2014

Exterior

No Asbestos Found.

Interior

R1 - General Learning Space

No Asbestos Found.

R2 - General Learning Space

No Asbestos Found.

R3 - Entry

No Asbestos Found.

R4 - Secure Storeroom

No Asbestos Found.

R5 - Secure Storeroom

No Asbestos Found.

R6 - Entry

No Asbestos Found.

NS 111 - D15001 - Learning Unit - Double Secondary/Secure : Placement Date - 23/01/2013

Exterior

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result
No Asbestos Found.						
Interior						
R1 - General Learning Space						
No Asbestos Found.						
R2 - General Learning Space						
No Asbestos Found.						
R3 - Entry						
No Asbestos Found.						
R4 - Secure Storeroom						
No Asbestos Found.						
R5 - Secure Storeroom						
No Asbestos Found.						
R6 - Entry						
No Asbestos Found.						
NS 110 - D15054 - Learning Unit - Single Secondary/Secure : Placement Date - 24/04/2014						
Exterior						
No Asbestos Found.						
Interior						
R1 - General Learning Space						
No Asbestos Found.						
R2 - Entry						
No Asbestos Found.						
R3 - Secure Storeroom						
No Asbestos Found.						
NS 111 - D15231 - Learning Unit - Double Secondary/Secure : Placement Date - 15/01/2013						
Exterior						
No Asbestos Found.						
Interior						
R1 - General Learning Space						
No Asbestos Found.						
R2 - General Learning Space						
No Asbestos Found.						
R3 - Entry						
No Asbestos Found.						
R4 - Secure Storeroom						
No Asbestos Found.						
R5 - Secure Storeroom						
No Asbestos Found.						
R6 - Entry						
No Asbestos Found.						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017