


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Peak Hill Central School (2848)  
**Region :** Western NSW  
**State Electorate :** Orange  
**Local Government Area :** Parkes

**Initial Survey :** Noel Arnold & Associates : 23 - Apr - 2008  
**Reviewed By :** Parsons Brinckerhoff : 25 - Aug - 2016

2848 - Peak Hill Central School  
Site Plan (All Sites)

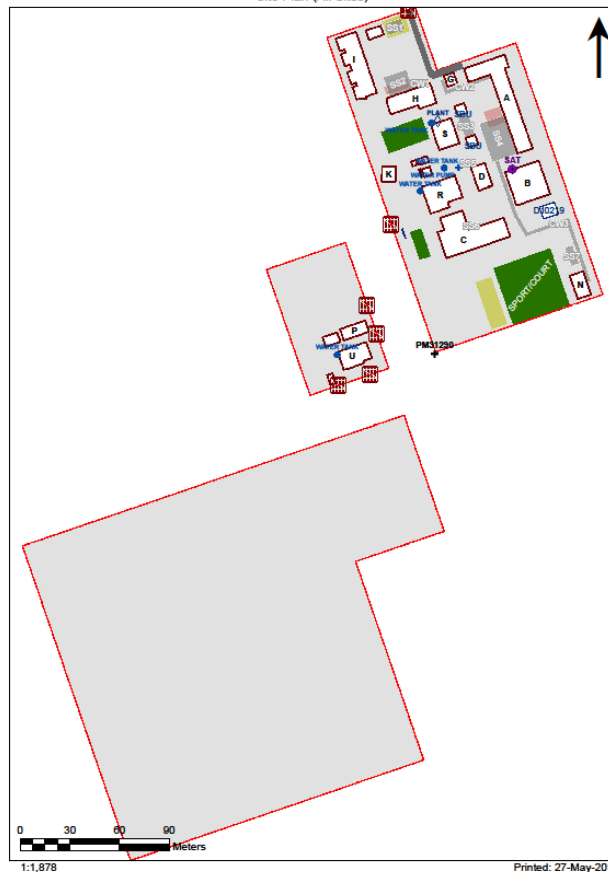

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration/General Learning - 1965 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2848/B00A/Eaves Linings/S10			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
Gable Verge Lining	Flat AC Sheeting	20m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2848/B00A/Gable Verge Lining/S13			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
Ceiling Void	No Asbestos Found					

**Interior****B00A - R0001 - Principal (18.57 m2)**

No Asbestos

**B00A - R0002 - Movement (4.32 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2848/B00A/R0014/Ceiling Structures/Linings/S2			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00A - R0003 - General Storeroom (3.59 m2)**

No Asbestos

**B00A - R0004 - General Storeroom (6.13 m2)**

No Asbestos

**B00A - R0005 - Staff Toilet (1.76 m2)**

No Asbestos

**B00A - R0006 - Staff Toilet (1.47 m2)**

No Asbestos

**B00A - R0007 - Interview (14.3 m2)**

No Asbestos

**B00A - R0008 - Movement (23.43 m2)**

No Asbestos

**B00A - R0009 - Cleaning Supplies (2.64 m2)**

No Asbestos

**B00A - R0010 - Staff Room Annexe (25 m2)**

No Asbestos

**B00A - R0011 - Staff Toilet (3.04 m2)**

No Asbestos

**B00A - R0012 - Canteen Office/Store (3.54 m2)**

No Asbestos

**B00A - R0013 - Canteen (37.43 m2)**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	2848/B00A/R0014/Wall Linings Internal/S1					
Ceiling Structures/Linings	Flat AC Sheeting	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2848/B00A/R0014/Ceiling Structures/Linings/S2			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00A - R0014 - Movement (19.79 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2848/B00A/R0014/Ceiling Structures/Linings/S2			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
Wall Linings Internal	Flat AC Sheeting 2848/B00A/R0014/Wall Linings Internal/S1					No Asbestos Detected
<b>B00A - R0015 - External Movement (17.98 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 2848/B00A/R0014/Ceiling Structures/Linings/S2	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00A - R0016 - Clerical Office (14.16 m2)</b>						
No Asbestos						
<b>B00A - R0017 - Clerical Office/Workroom (17.98 m2)</b>						
No Asbestos						
<b>B00A - R0018 - Duplicating Workroom (15.04 m2)</b>						
No Asbestos						
<b>B00A - R0019 - Disabled Toilet (3.21 m2)</b>						
No Asbestos						
<b>B00A - R0020 - Sick Bay (12.12 m2)</b>						
No Asbestos						
<b>B00A - R0021 - Staff Room (65.18 m2)</b>						
No Asbestos						
<b>B00A - R0023 - Apparatus Store (10.14 m2)</b>						
No Asbestos						
<b>B00A - R0024 - Preparation (26.27 m2)</b>						
Fume Cupboard	Flat AC Sheeting 2848/B00A/R0024/Fume Cupboard/S4	4Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00A - R0025 - General Storeroom (1.16 m2)</b>						
No Asbestos						
<b>B00A - R0026 - Distribution Board (0.35 m2)</b>						
No Asbestos						Note: No inspection of live electrical installation.
<b>B00A - R0027 - Darkroom Space (12.25 m2)</b>						
No Asbestos						
<b>B00A - R0028 - Art Learning Space (74.87 m2)</b>						
No Asbestos						
<b>B00A - R0029 - Kiln Room (9.61 m2)</b>						
No Asbestos						
<b>B00A - R0030 - Craft Store (5.78 m2)</b>						
No Asbestos						
<b>B00A - R0031 - External Movement (88.12 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 2848/B00A/R0014/Ceiling Structures/Linings/S2	89m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00A - R0032 - Clerical Office (25.55 m2)</b>						
Recently Modified Space	Requires Inspection					
<b>B00A - R0033 - Senior Study (65.25 m2)</b>						
Recently Modified Space	Requires Inspection					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Library - 1971 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2848/B00B/Eaves Linings/S11					<b>Chrysotile (white asbestos)</b>
Ceiling Void	No Asbestos Found					

**Interior****B00B - R0002 - Distribution Board (0.66 m2)**

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board	3Unit	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2848/B00B/R0002/Electrical Backing Board/S18					<b>Chrysotile (white asbestos)</b>

**B00B - R0003 - Cleaning Distributed Store (1.58 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2848/B00B/R0001/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00B - R0005 - Resources Space (12.83 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2848/B00B/R0001/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00B - R0006 - Communications Room (12.83 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2848/B00B/R0001/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00B - R0007 - Seminar/Study (12.83 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2848/B00B/R0001/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00B - R0008 - Seminar/Study (12.83 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2848/B00B/R0001/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00B - R0009 - Reading Area (190.68 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2848/B00B/R0001/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00B - R0010 - Seminar/Study (52.76 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2848/B00B/R0001/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00B - R0011 - Resources Store (5.81 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2848/B00B/R0001/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00B - R0012 - Library Office/Workroom (19.85 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	2848/B00B/R0001/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>

**B00B - R0013 - Movement (91.52 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2848/B00B/Eaves Linings/S11					<b>Chrysotile (white asbestos)</b>

**B00B - R0014 - Toilet - Lobby (1.72 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings Vermiculite  
 2848/B00B/R0015/Ceiling Structures/Linings/S17 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00B - R0015 - Toilets-Girls (1.72 m2)**

Ceiling Structures/Linings Vermiculite  
 2848/B00B/R0015/Ceiling Structures/Linings/S17 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00B - R0016 - Toilets-Boys (1.41 m2)**

Ceiling Structures/Linings Vermiculite  
 2848/B00B/R0015/Ceiling Structures/Linings/S17 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00B - R0017 - Toilet - Lobby (1.41 m2)**

Ceiling Structures/Linings Vermiculite  
 2848/B00B/R0015/Ceiling Structures/Linings/S17 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

### B00C - Technological & Applied Studies - 1950 - Brick/Block (Brick/Block)

#### Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Void No Asbestos Found

#### Interior

##### B00C - R0001 - Main Switch Board (9.25 m2)

No Asbestos

##### B00C - R0002 - Cleaning Supplies (10.04 m2)

No Asbestos

##### B00C - R0009 - Movement (96.57 m2)

No Asbestos

##### B00C - R0013 - T.A.S. Outdoor Area (42.94 m2)

No Asbestos

##### B00C - R0014 - Preparation - Materials (17 m2)

No Asbestos

##### B00C - R0015 - Pantry (8.99 m2)

No Asbestos

##### B00C - R0016 - Kitchen - Type 1 (106.96 m2)

No Asbestos

##### B00C - R0017 - Store (14.72 m2)

No Asbestos

##### B00C - R0018 - Food Technology L.S. (30.75 m2)

No Asbestos

##### B00C - R0019 - Welding Area (3.78 m2)

No Asbestos

##### B00C - R0020 - Welding Area (3.78 m2)

No Asbestos

##### B00C - R0021 - Welding Area (3.78 m2)

No Asbestos

##### B00C - R0022 - Materials Technology L.S. (178.02 m2)

No Asbestos

##### B00C - R0023 - Plant (3.77 m2)

No Asbestos

##### B00C - R0024 - Store (20.5 m2)

No Asbestos

##### B00C - R0025 - Store (15.19 m2)

No Asbestos

##### B00C - R0026 - Store (70.36 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning - 1985 - Timber (Timber)**

**Exterior**

Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	5m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
2848/B00D/Eaves Linings/S12					<b>Chrysotile (white asbestos)</b>	

**Interior**

**B00D - R0001 - Movement (29.12 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2848/B00D/R0001/Ceiling Structures/Linings/S14					<b>Chrysotile (white asbestos)</b>	

**B00D - R0002 - Cleaning Distributed Store (1.18 m2)**

No Asbestos

**B00D - R0003 - Main Switch Board (2.79 m2)**

No Asbestos

**B00D - R0006 - Special Programs Room (23.2 m2)**

No Asbestos

**B00D - R0008 - Store (15.28 m2)**

No Asbestos

**B00D - R0009 - Commonroom (49.11 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Pupil Facilities - 1950 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Void      No Asbestos Found

**Interior**

**B00E - R0001 - Toilets - Boys (32.46 m2)**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Pupil Facilities - 1950 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Void      No Asbestos Found

**Interior**

**B00F - R0001 - Toilets - Girls (32.29 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Pupil Facilities - 1913 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Void      No Asbestos Found

**Interior**

**B00G - R0001 - Toilets - Boys (17.98 m2)**

No Asbestos

**B00G - R0002 - Toilets - Girls (17.97 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Administration/General Learning - 1913 - Timber (Timber)****Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior****B00H - R0001 - Plant (5.36 m2)**

No Asbestos

**B00H - R0002 - Clerical Office/Workroom (12.17 m2)**

No Asbestos

**B00H - R0003 - Staff Room Annexe (15.73 m2)**

No Asbestos

**B00H - R0004 - Staff Room Annexe (15.06 m2)**

No Asbestos

**B00H - R0005 - Staff Toilet (3.41 m2)**

No Asbestos

**B00H - R0006 - Staff Room (42.46 m2)**

No Asbestos

**B00H - R0007 - Movement (11.15 m2)**

No Asbestos

**B00H - R0008 - Movement (57.24 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 2848/B00H/R0008/Ceiling Structures/Linings/S8	No Asbestos Detected
----------------------------	-------------------------------------------------------------------	----------------------

**B00H - R0009 - Withdrawal Space - 1hb (10.62 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 2848/B00H/R0008/Ceiling Structures/Linings/S8	No Asbestos Detected
----------------------------	-------------------------------------------------------------------	----------------------

**B00H - R0010 - Home Base Store (10.65 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 2848/B00H/R0008/Ceiling Structures/Linings/S8	No Asbestos Detected
----------------------------	-------------------------------------------------------------------	----------------------

**B00H - R0011 - Home Base (63.62 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 2848/B00H/R0008/Ceiling Structures/Linings/S8	No Asbestos Detected
----------------------------	-------------------------------------------------------------------	----------------------

**B00H - R0012 - Practical Activities - 1hb (21.67 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 2848/B00H/R0008/Ceiling Structures/Linings/S8	No Asbestos Detected
----------------------------	-------------------------------------------------------------------	----------------------

**B00H - R0014 - Toilet - P (5.69 m2)**

No Asbestos

**B00H - R0015 - Home Base Store (12.04 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00I - General Learning - 1965 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Wall Cladding	Flat AC Sheeting 2848/B00I/Wall Cladding/S7					<b>No Asbestos Detected</b>
Ceiling Void	No Asbestos Found					

**Interior****B00I - R0001 - External Movement (3.08 m2)**

No Asbestos

**B00I - R0002 - Home Base (46.74 m2)**

No Asbestos

**B00I - R0003 - Home Base (48.4 m2)**

No Asbestos

**B00I - R0004 - Home Base (53.11 m2)**

No Asbestos

**B00I - R0005 - Home Base (46.83 m2)**

No Asbestos

**B00I - R0006 - Home Base (46.74 m2)**

No Asbestos

**B00I - R0007 - External Movement (2.14 m2)**

No Asbestos

**B00I - R0008 - Staff Toilet (4.62 m2)**

No Asbestos

**B00I - R0009 - Staff Toilet (3.33 m2)**

No Asbestos

**B00I - R0011 - General Storeroom (10.77 m2)**

No Asbestos

**B00I - R0012 - Distribution Board (0.53 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00I - R0017 - Practical Activities - 1hb (20.05 m2)**

No Asbestos

**B00I - R0019 - General Storeroom (9.83 m2)**

No Asbestos

**B00I - R0020 - General Storeroom (10.07 m2)**

No Asbestos

**B00I - R0022 - Movement (27.01 m2)**

No Asbestos

**B00I - R0023 - General Learning Space (36.59 m2)**

No Asbestos

**B00I - R0024 - Movement (53.08 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Special Purpose - 1913 - Timber (Timber)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Wall Cladding	Flat AC Sheeting 2848/B00J/Wall Cladding/S6					<b>No Asbestos Detected</b>
Ceiling Void	No Asbestos Found					

**Interior**

**B00J - R0001 - General Storeroom (4.03 m2)**

No Asbestos

**B00J - R0002 - Movement (5.24 m2)**

No Asbestos

**B00J - R0003 - Interview (40.41 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - General Learning - 1965 - Timber (Timber)**

**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior**

**B00K - R0001 - Movement (12.79 m2)**

No Asbestos

**B00K - R0002 - General Learning Space (35.58 m2)**

No Asbestos

**B00K - R0003 - Sports Store (20.17 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Shed - 1913 - Timber (Timber)**

**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior**

**B00L - R0001 - Movement (16.88 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - Communal Facilities - 1950 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Wall Cladding	Flat AC Sheeting 2848/B00M/Wall Cladding/S9					<b>No Asbestos Detected</b>
Ceiling Void	No Asbestos Found					

**Interior**

**B00M - R0001 - Sports Store (22.2 m2)**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00N - General Learning - 1965 - Timber (Timber)**

**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	Non Accessible Area - Manhole not accessible - Bolted up entry point

**Interior**

**B00N - R0001 - Movement (26.5 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2848/B00N/R0001/Ceiling Structures/Linings/S15					<b>Chrysotile (white asbestos)</b>	

**B00N - R0002 - General Learning Space (47.31 m2)**

No Asbestos

**B00N - R0003 - General Learning Space (47.05 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00P - Agricultural Science - 1965 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Void No Asbestos Found

**Interior****B00P - R0001 - Movement (35.01 m2)**

Ceiling Structures/Linings Flat AC Sheeting 35m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

2848/B00P/R0001/Ceiling Structures/Linings/S16

**Chrysotile (white asbestos)**

**B00P - R0002 - Staff Toilet (8.19 m2)**

Ceiling Structures/Linings Flat AC Sheeting 9m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

2848/B00P/R0001/Ceiling Structures/Linings/S16

**Chrysotile (white asbestos)**

**B00P - R0003 - General Assistant/Bulk Store (12.45 m2)**

Ceiling Structures/Linings Flat AC Sheeting 13m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

2848/B00P/R0001/Ceiling Structures/Linings/S16

**Chrysotile (white asbestos)**

**B00P - R0004 - Garden Store (42.27 m2)**

Ceiling Structures/Linings Flat AC Sheeting 43m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

2848/B00P/R0001/Ceiling Structures/Linings/S16

**Chrysotile (white asbestos)**

**B00P - R0005 - Staff Toilet (8.26 m2)**

Ceiling Structures/Linings Flat AC Sheeting 9m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

2848/B00P/R0001/Ceiling Structures/Linings/S16

**Chrysotile (white asbestos)**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00Q - Agricultural Science - 2007 - Steel (Steel)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids      No Asbestos Found

**Interior**

**B00Q - R0001 - Class Tools Storage (30.31 m2)**

No Asbestos

**B00Q - R0002 - Agriculture Covered Area (24.92 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00R - Science Learning - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids      No Asbestos Found

**Interior**

**B00R - R0001 - General Learning Space - Type 10 (60.15 m2)**

No Asbestos

**B00R - R0002 - Science Laboratory (59.48 m2)**

No Asbestos

**B00R - R0003 - Preparation - Science (30.42 m2)**

No Asbestos

**B00R - R0004 - Staff Room (21.09 m2)**

No Asbestos

**B00R - R0005 - Seminar - Type 2 (21.05 m2)**

No Asbestos

**B00R - R0006 - Chemical Store (12.18 m2)**

No Asbestos

**B00R - R0007 - Apparatus Storage (13.93 m2)**

No Asbestos

**B00R - R0008 - Movement (6.12 m2)**

No Asbestos

**B00R - R0009 - Main Switch Board (0.47 m2)**

No Asbestos

**B00R - R0010 - Outdoor Learning Space - Type 4 (41.04 m2)**

No Asbestos

**B00R - R0011 - External Movement (44.61 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00S - Multi Purpose Facilities - 2011 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids      No Asbestos Found

**Interior**

**B00S - R0001 - Communal Space (113.56 m2)**

No Asbestos

**B00S - R0002 - P.E. Store (12.63 m2)**

No Asbestos

**B00S - R0003 - Sound Cupboard (0.81 m2)**

No Asbestos

**B00S - R0004 - Distribution Board (1.74 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00S - R0005 - Covered Area (51.01 m2)**

No Asbestos

**B00S - R0006 - External Movement (11.51 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00T - Storage - 2016 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior**

**B00T - R0001 - Sport Equipment Store (8.86 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 601 - D10219 - Learning Unit - Standard/Withdrawal : Placement Date - 9/11/2001**

**Exterior**

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

**Interior**

**R1 - Entry**

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

**R2 - General Learning Space**

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

**R3 - Store**

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

**OS 601 - D10425 - Learning Unit - Standard/Withdrawal : Placement Date - 2/07/2014**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Entry**

No Asbestos Found.

**R2 - General Learning Space**

No Asbestos Found.

**R3 - Store**

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017