


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Peats Ridge Public School (2852)
Region : Hunter/Central Coast
State Electorate : Gosford
Local Government Area : Gosford

Initial Survey : Noel Arnold & Associates : 29 - Mar - 2008
Register Issue Date : 22 - Mar - 2017

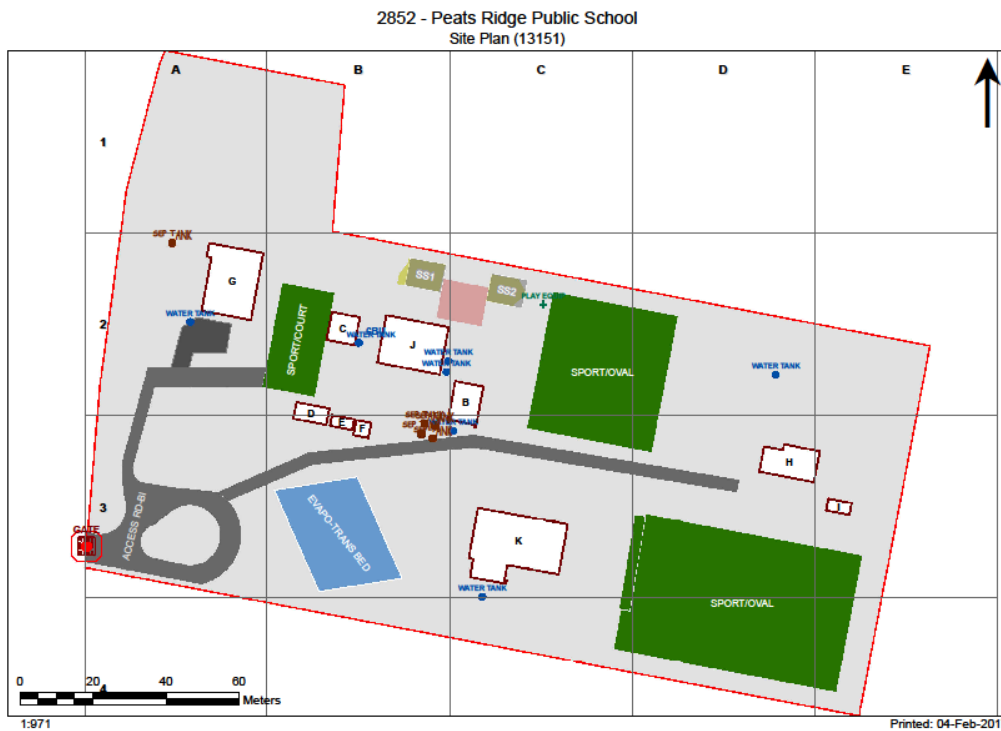

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities - 1973 - Brick/Block (Brick/Block)

Exterior

Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos						
Eaves Linings	Flat AC Sheeting	6m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos						
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior

B00B - R0001 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
2852/B00B/R0003/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

B00B - R0002 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
2852/B00B/R0003/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

B00B - R0003 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
2852/B00B/R0003/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

B00B - R0004 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
2852/B00B/R0003/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

B00B - R0005 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
2852/B00B/R0003/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

B00B - R0006 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
2852/B00B/R0003/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1935 - Timber (Timber)

Exterior

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

Interior

B00C - R0001 - Withdrawal Space - 1hb

No Asbestos

B00C - R0002 - Movement

No Asbestos

B00C - R0003 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1960 - Timber (Timber)

Exterior

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

Interior

B00D - R0001 - Canteen Covered Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Building Services - 1990 - Timber Shed (Timber Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00E - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Communal Facilities - 1960 - Sandstone (Sandstone)

Exterior

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

Interior

B00F - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Library/Administration - 1996 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00G - R0001 - Reading Area

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00G - R0002 - General Storeroom

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00G - R0003 - Main Switch Board

No Asbestos

B00G - R0004 - External Movement

No Asbestos

B00G - R0005 - Staff Room

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00G - R0006 - Principal

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00G - R0007 - Staff Toilet

No Asbestos

B00G - R0008 - Sick Bay

No Asbestos

B00G - R0009 - Movement

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00G - R0010 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00G - R0011 - Security Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00G - R0012 - Clerical Office

No Asbestos

B00G - R0013 - Entry Vestibule

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00G - R0014 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Other-Vacant - 1960 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2852/B00H/Eaves Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior**B00H - R0001 - Staff Room**

No Asbestos

B00H - R0002 - Staff Room

No Asbestos

B00H - R0003 - Staff Room

No Asbestos

B00H - R0004 - Staff Room

No Asbestos

B00H - R0005 - Cleaning Supplies

Floor Coverings Res/Textile	Vinyl Tiles					
	2852/B00H/R0007/Floor Coverings Res/Textile/S5				No Asbestos Detected	
Wall Linings Internal	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2852/B00H/R0007/Wall Linings Internal/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2852/B00H/R0005/Ceiling Structures/Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00H - R0006 - Movement

Floor Coverings Res/Textile	Vinyl Tiles					
	2852/B00H/R0007/Floor Coverings Res/Textile/S5				No Asbestos Detected	
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2852/B00H/R0007/Wall Linings Internal/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2852/B00H/R0005/Ceiling Structures/Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00H - R0007 - Staff Kitchen

Floor Coverings Res/Textile	Vinyl Tiles					
	2852/B00H/R0007/Floor Coverings Res/Textile/S5				No Asbestos Detected	
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2852/B00H/R0007/Wall Linings Internal/S6				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00H - R0008 - Staff Room

Thermacon Heater	Rope Seal to Heater Door					
	2852/B00H/R0008/Thermacon Heater/S7				No Asbestos Detected	

B00H - R0009 - Movement

No Asbestos

B00H - R0010 - Staff Shower/Change

No Asbestos

B00H - R0011 - External Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
2852/B00H/R0011/Ceiling Structures/Linings/S3				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Other-Vacant - 2003 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2852/B001/Eaves Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Requires Inspection					

Interior

B001 - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning - 2003 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00J - R0001 - Movement

No Asbestos

B00J - R0002 - Practical Activities - 1hb

No Asbestos

B00J - R0003 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0004 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0005 - Withdrawal Space - 2hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0006 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0007 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0008 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Communal Facilities - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00K - R0001 - Communal Space

No Asbestos

B00K - R0002 - Movement

No Asbestos

B00K - R0003 - Toilets-Unisex

No Asbestos

B00K - R0004 - Toilets - Boys

No Asbestos

B00K - R0005 - Movement

No Asbestos

B00K - R0006 - Cleaning Distributed Store

No Asbestos

B00K - R0007 - Toilets - Girls

No Asbestos

B00K - R0008 - Plant

No Asbestos

B00K - R0009 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017