


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Pelaw Main Public School (2855)
Region : Hunter/Central Coast
State Electorate : Cessnock
Local Government Area : Cessnock

Initial Survey : Noel Arnold & Associates : 26 - May - 2008
Reviewed By : Greencap-NAA : 16 - Jun - 2015

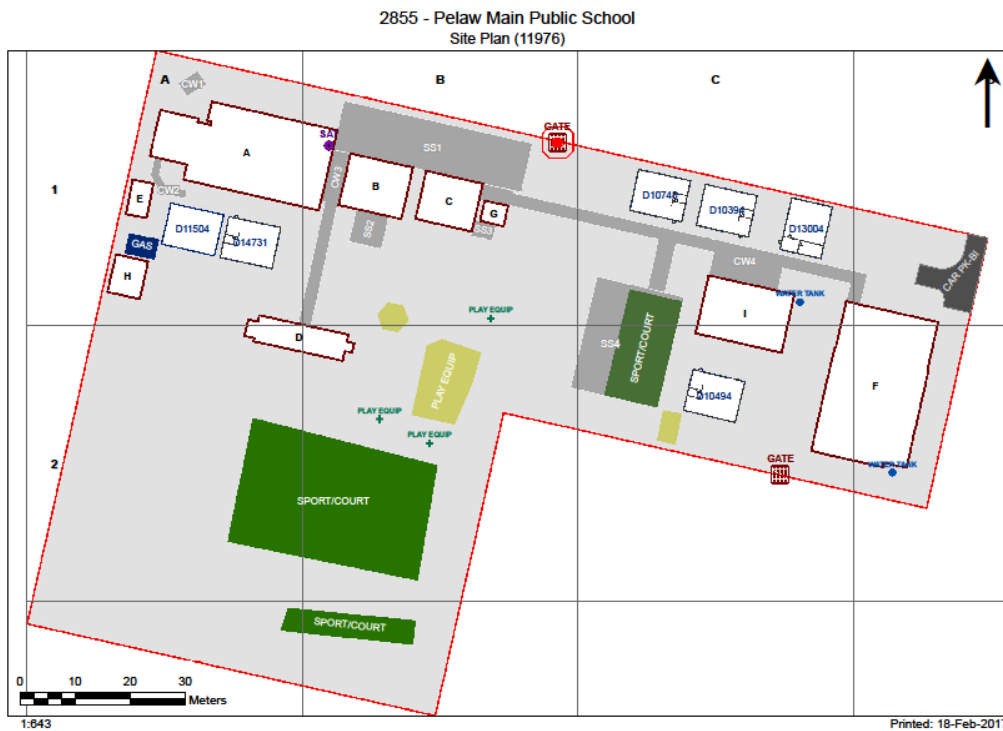

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1913 - Timber (Timber)**Exterior**

Ceiling Voids	Non Accessible Area - Access Hatch in Middle of Room - Obstructed.					
Eaves Linings	Flat AC Sheeting 2855/B00A/Eaves Linings/S5					No Asbestos Detected
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	1m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2855/B00A/Underfloor Voids - Packing to Floor Joists/S9					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids	Corrugated AC Sheeting	0.1m2	Variable positions	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	2855/B00A/Underfloor Voids/S10					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction - Access Hatch in Middle of Room - Obstructed.					

Interior**B00A - R0001 - General Storeroom**

No Asbestos

B00A - R0002 - Home Base

No Asbestos

B00A - R0003 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	24.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2855/B00A/R0003/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)

B00A - R0004 - Home Base

No Asbestos

B00A - R0005 - Movement

Floor Coverings Res/Textile	Flat AC Sheeting					
	2855/B00A/R0005/Floor Coverings Res/Textile/S7					No Asbestos Detected

B00A - R0006 - Home Base

No Asbestos

B00A - R0007 - Entry Vestibule

No Asbestos

B00A - R0008 - Clerical Office

No Asbestos

B00A - R0009 - Movement

No Asbestos

B00A - R0010 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2855/B00A/R0010/Wall Linings Internal/S1					Chrysotile (white asbestos)

B00A - R0011 - Principal

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	2855/B00A/R0011/Floor Coverings Res/Textile/S6					No Asbestos Detected

B00A - R0012 - Duplicating Workroom

No Asbestos

B00A - R0014 - External Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Communal Facilities - 1913 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 2855/B00B/Eaves Linings/S11					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Wall Cladding	Flat AC Sheeting 2855/B00B/Wall Cladding/S12					No Asbestos Detected
Underfloor Voids	No Asbestos Found					

Interior

B00B - R0001 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 2855/B00B/Eaves Linings/S11					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00B - R0002 - Home Base

No Asbestos

B00B - R0003 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00C - Pupil Facilities/Staff Facilities - 1913 - Timber (Timber)						
Exterior						
Eaves Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2855/B00C/R0006/Ceiling Structures/Linings/S13			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Interior						
B00C - R0001 - Cleaning Distributed Store						
Floor Coverings Res/Textile	Vinyl Tiles					
	2855/B00C/R0001/Floor Coverings Res/Textile/S17			No Asbestos Detected		
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2855/B00C/R0006/Wall Linings Internal/S3			Chrysotile (white asbestos)		
B00C - R0002 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2855/B00C/R0006/Ceiling Structures/Linings/S13			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0003 - Canteen Office/Store						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	2855/B00C/R0003/Floor Coverings Res/Textile/S15			No Asbestos Detected		
B00C - R0004 - Staff Toilet						
Floor Coverings Res/Textile	Vinyl Tiles					
	2855/B00C/R0003/Floor Coverings Res/Textile/S15			No Asbestos Detected		
B00C - R0005 - Canteen						
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2855/B00C/R0006/Wall Linings Internal/S3			Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2855/B00C/R0006/Ceiling Structures/Linings/S13			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2855/B00C/R0005/Floor Coverings Res/Textile/S4			Chrysotile (white asbestos)		
B00C - R0006 - Seminar/Study						
Wall Linings Internal	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2855/B00C/R0006/Wall Linings Internal/S3			Chrysotile (white asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2855/B00C/R0006/Ceiling Structures/Linings/S13			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R0007 - Craft Store						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2855/B00C/R0006/Wall Linings Internal/S3			Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2855/B00C/R0007/Floor Coverings Res/Textile/S16			Chrysotile (white asbestos)		
B00C - R0008 - General Storeroom						
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2855/B00C/R0008/Wall Linings Internal/S14			Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2855/B00C/R0006/Ceiling Structures/Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities/Administration - 1913 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 2855/B00D/Eaves Linings/S18					No Asbestos Detected
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00D - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 2855/B00D/R0007/Ceiling Structures/Linings/S19					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B00D - R0002 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting 2855/B00D/R0007/Ceiling Structures/Linings/S19					No Asbestos Detected
In-fill-panel	Flat AC Sheeting 2855/B00D/R0008/In-fill-panel/S20					No Asbestos Detected

B00D - R0003 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting 2855/B00D/R0007/Ceiling Structures/Linings/S19					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B00D - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 2855/B00D/R0007/Ceiling Structures/Linings/S19					No Asbestos Detected
In-fill-panel	Flat AC Sheeting 2855/B00D/R0008/In-fill-panel/S20					No Asbestos Detected

B00D - R0005 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting 2855/B00D/R0007/Ceiling Structures/Linings/S19					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B00D - R0006 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting 2855/B00D/R0008/In-fill-panel/S20					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00D - R0007 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 2855/B00D/R0007/Ceiling Structures/Linings/S19					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B00D - R0008 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting 2855/B00D/R0007/Ceiling Structures/Linings/S19					No Asbestos Detected
In-fill-panel	Flat AC Sheeting 2855/B00D/R0008/In-fill-panel/S20					No Asbestos Detected

B00D - R0009 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting 2855/B00D/R0007/Ceiling Structures/Linings/S19					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B00D - R0010 - General Storeroom

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Special Purpose - 1913 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 2855/B00E/Eaves Linings/S21					No Asbestos Detected
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Underfloor Voids	No Asbestos Found					

Interior

B00E - R0001 - Special Programs Room

Wall Linings Internal	Flat AC Sheeting 2855/B00E/R0001/Wall Linings Internal/S2					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00F - R0001 - Covered Outdoor Learning Area

No Asbestos

B00F - R0002 - Communal Space

No Asbestos

B00F - R0003 - Movement

No Asbestos

B00F - R0004 - Raised Platform

No Asbestos

B00F - R0005 - Ramp

No Asbestos

B00F - R0006 - Movement

No Asbestos

B00F - R0007 - Hall Chair Store

No Asbestos

B00F - R0008 - Communal/Performance Store

No Asbestos

B00F - R0009 - P.E. Store

No Asbestos

B00F - R0010 - Toilet - Lobby

No Asbestos

B00F - R0011 - Toilets - Girls

No Asbestos

B00F - R0012 - Sound Cupboard

No Asbestos

B00F - R0013 - Toilet - Lobby

No Asbestos

B00F - R0014 - Toilets - Boys

No Asbestos

B00F - R0015 - Cleaning Distributed Store

No Asbestos

B00F - R0016 - General Storeroom

No Asbestos

B00F - R0017 - Main Switch Board

No Asbestos

B00F - R0018 - Access Shower/Toilet

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Pupil Facilities/Staff Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids	Non Accessible Area - Area inaccessible
Eaves Linings	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00G - R0001 - Access Shower/Toilet/Change

No Asbestos

B00G - R0002 - Toilet - Lobby

No Asbestos

B00G - R0003 - Staff Toilet

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Storage - 2010 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids - Flat Roof No Asbestos Found

Interior

B00H - R0001 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Library - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00I - R0001 - External Movement

Floor Coverings Res/Textile	No Asbestos Found
-----------------------------	-------------------

B00I - R0002 - Reading Area

No Asbestos

B00I - R0003 - Library Office/Workroom

No Asbestos

B00I - R0004 - Communications Room

No Asbestos

B00I - R0005 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D10394 - Learning Unit - Standard With P.A.A. : Placement Date - 22/06/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D10494 - Learning Unit - Standard With P.A.A. : Placement Date - 22/06/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D10748 - Learning Unit - Standard With P.A.A. : Placement Date - 22/06/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 521 - D11504 - Staff Study : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Interior**R1 - Staff Room**

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2

R2 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos				6 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				4 m2

R3 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos				6 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				4 m2

R4 - Lobby

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2

OS 602 - D12487 - Learning Unit - Standard With P.A.A. : Placement Date - 29/10/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 601 - D13004 - Learning Unit - Standard/Withdrawal : Placement Date - 3/05/2005**Exterior**

Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2

Interior**R1 - Entry**

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
---------	---------------	------------------	--	--	--	-------

OS 602 - D14731 - Learning Unit - Standard With P.A.A. : Placement Date - 30/04/2010

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017