


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Pennant Hills Public School (2857)
Region : Northern Sydney
State Electorate : Hornsby
Local Government Area : Hornsby

Initial Survey : Noel Arnold & Associates : 17 - Jan - 2008
Reviewed By : AECOM : 28 - Jun - 2016

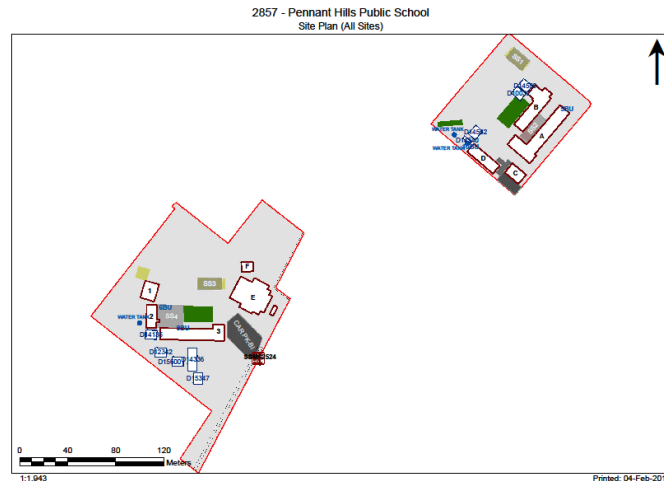

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Other-After School Care - 1955 - Timber (Timber)**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Height Restriction, 3.3m					
Underfloor Voids	Packing 2857/B001/Underfloor Voids/S19					No Asbestos Detected

Interior**B001 - R0001 - Movement (1.1 m2)**

No Asbestos

B001 - R0002 - Clerical Office/Workroom (9.05 m2)

No Asbestos

B001 - R0003 - Personal Effects Storage (10.88 m2)

Wall Linings Internal	Flat AC Sheeting 2857/B001/R0003/Wall Linings Internal/S12					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

B001 - R0004 - Seminar/Study (6.36 m2)

No Asbestos

B001 - R0005 - Toilets - Boys/Girls (2.02 m2)

No Asbestos

B001 - R0006 - General Storeroom (2.98 m2)

No Asbestos

B001 - R0007 - Staff Kitchen (23.65 m2)

No Asbestos

B001 - R0008 - Practical Activities - 1hb (65.43 m2)

No Asbestos

B001 - R0009 - Other-After School Care (44.13 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B002 - General Learning - 1970 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2857/B004/R0001/Ceiling Structures/Linings/S9			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B002 - R0001 - Staff Toilet (3.06 m2)

Partition Walls (Cubicles)	Flat AC Sheeting	4m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2857/B002/R0001/Partition Walls (Cubicles)/S11			Chrysotile (white asbestos)		

B002 - R0002 - Special Programs Room (21.7 m2)

No Asbestos

B002 - R0003 - Cleaning Distributed Store (3.26 m2)

Partition Walls (Cubicles)	Flat AC Sheeting	1m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2857/B002/R0001/Partition Walls (Cubicles)/S11			Chrysotile (white asbestos)		

B002 - R0004 - Home Base Store (7.18 m2)

Partition Walls (Cubicles)	Flat AC Sheeting	1m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2857/B002/R0001/Partition Walls (Cubicles)/S11			Chrysotile (white asbestos)		

B002 - R0005 - Movement (9.15 m2)

No Asbestos

B002 - R0006 - Personal Effects Storage (10.44 m2)

No Asbestos

B002 - R0007 - Home Base (85.91 m2)

No Asbestos

B002 - R0008 - Movement (5.22 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2857/B004/R0001/Ceiling Structures/Linings/S9			Chrysotile (white asbestos) , Amosite (brown asbestos)		
panel above door	Flat AC Sheeting	1m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2857/B004/R0001/Ceiling Structures/Linings/S9			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B003 - Administration/General Learning - 1970 - Concrete (Concrete)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	30m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2857/B003/Eaves Linings/S21				Chrysotile (white asbestos)	
Underfloor Voids	Packing	4Unit	Variable positions	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	2857/B003/Underfloor Voids/S20				Chrysotile (white asbestos)	

Interior

B003 - R0001 - Home Base (53.58 m2)

No Asbestos

B003 - R0002 - Home Base (53.58 m2)

No Asbestos

B003 - R0003 - Movement (6.62 m2)

No Asbestos

B003 - R0004 - Deputy Principal (10.34 m2)

No Asbestos

B003 - R0005 - General Storeroom (11.06 m2)

No Asbestos

B003 - R0006 - Movement (6.62 m2)

No Asbestos

B003 - R0007 - Clerical Office/Workroom (13.63 m2)

No Asbestos

B003 - R0008 - Home Base (53.58 m2)

No Asbestos

B003 - R0009 - Home Base (53.58 m2)

No Asbestos

B003 - R0010 - Home Base (53.58 m2)

No Asbestos

B003 - R0011 - Home Base (66.25 m2)

No Asbestos

B003 - R0012 - Toilets - Boys/Girls (5.19 m2)

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2857/B003/R0012/Wall Linings Internal/S10					


Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	2857/B003/R0012/Wall Linings Internal/S10					

B003 - R0013 - Movement (91.4 m2)

No Asbestos

B003 - R0014 - Movement (32.2 m2)

No Asbestos

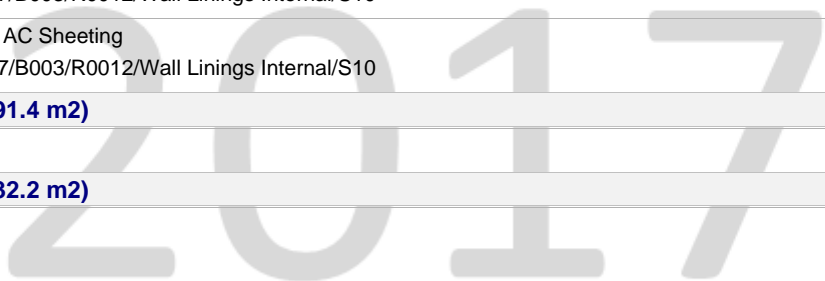

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B006 - Communal Facilities - 1955 - Concrete (Concrete)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible, slab to ground / no access points.					

Interior

B006 - R0001 - Sports Store (12.02 m2)

Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2857/B004/R0001/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B006 - R0002 - Sports Store (11.96 m2)

Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2857/B004/R0001/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - Administration/General Learning - 1955 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	50m2	South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2857/B00A/R0004/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Window panels	Flat AC Sheeting 2857/B00A/R0004/Wall Linings Internal/S5				No Asbestos Detected	
Underfloor Voids - Packing to Floor Joists	AC Fragments/Debris 2857/B00A/Underfloor Voids - Packing to Floor Joists/S14				No Asbestos Detected	
Underfloor Voids - Packing to Floor Joists	Packing	7Unit	Variable positions	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	2857/B00A/Underfloor Voids - Packing to Floor Joists/S15			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Interior

B00A - R0001 - Communications Room (5.16 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	2857/B00A/R0001/Floor Coverings Res/Textile/S3			No Asbestos Detected		

B00A - R0003 - K.L.A. Store (8.06 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	2857/B00A/R0001/Floor Coverings Res/Textile/S3			No Asbestos Detected		

B00A - R0004 - Library Office/Workroom (10.56 m2)

Window panels	Flat AC Sheeting 2857/B00A/R0004/Wall Linings Internal/S5					
	No Asbestos Detected					
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2857/B00A/R0004/Ceiling Structures/Linings/S4			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0005 - Library Office/Workroom (9.9 m2)

No Asbestos

B00A - R0006 - Reading Area (163.41 m2)

No Asbestos

B00A - R0010 - Duplicating Workroom (7.38 m2)

Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2857/B00A/R0010/Floor Coverings Res/Textile/S1			Chrysotile (white asbestos)		

B00A - R0013 - Personal Effects Storage (7.14 m2)

No Asbestos

B00A - R0014 - Staff Toilet (2.77 m2)

No Asbestos

B00A - R0015 - Home Base Store (3.34 m2)

No Asbestos

B00A - R0017 - Personal Effects Storage (7.2 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	2857/B00A/R0001/Floor Coverings Res/Textile/S3			No Asbestos Detected		

B00A - R0018 - Home Base Store (6.26 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	2857/B00A/R0001/Floor Coverings Res/Textile/S3			No Asbestos Detected		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
B00A - R0019 - Home Base (56.88 m2)						
No Asbestos						
B00A - R0020 - Personal Effects Storage (7.27 m2)						
No Asbestos						
B00A - R0022 - Home Base Store (6.23 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
2857/B00A/R0001/Floor Coverings Res/Textile/S3						No Asbestos Detected
B00A - R0023 - Home Base (58.3 m2)						
No Asbestos						
B00A - R0024 - Personal Effects Storage (6.67 m2)						
No Asbestos						
B00A - R0025 - Home Base Store (7.08 m2)						
No Asbestos						
B00A - R0026 - Home Base (57.67 m2)						
No Asbestos						
B00A - R0027 - Movement (97.08 m2)						
Window Panels	Flat AC Sheeting					
2857/B00A/R0004/Wall Linings Internal/S5						No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	98m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2857/B00A/R0004/Ceiling Structures/Linings/S4						Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0028 - Entry Vestibule (28.36 m2)						
Wall Linings Internal	Flat AC Sheeting					
2857/B00A/R0028/Wall Linings Internal/S2						No Asbestos Detected
B00A - R0029 - Movement (3.99 m2)						
No Asbestos						
B00A - R0030 - Clerical Office/Workroom (15.77 m2)						
No Asbestos						
B00A - R0031 - Clerical/Printing (21.96 m2)						
No Asbestos						
B00A - R0032 - Principal (20.47 m2)						
No Asbestos						
B00A - R0033 - Deputy Principal (13.36 m2)						
No Asbestos						
B00A - R9001 - Movement (13.4 m2)						
Ceiling Structures/Linings	Vermiculite					
2857/B00A/R9001/Ceiling Structures/Linings/S8						Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R9002 - General Storeroom (12.84 m2)						
Ceiling Structures/Linings	Vermiculite					
2857/B00A/R9001/Ceiling Structures/Linings/S8						Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2857/B00D/R0012/Partition Walls (Cubicles)/S7						Chrysotile (white asbestos)
B00A - R9003 - General Storeroom (3.07 m2)						
Ceiling Structures/Linings	Vermiculite					
2857/B00A/R9001/Ceiling Structures/Linings/S8						Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R9004 - General Storeroom (14.3 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings	Vermiculite 2857/B00A/R9001/Ceiling Structures/Linings/S8					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	--

Partition Walls (Cubicles)	Compressed AC Sheet 2857/B00D/R0012/Partition Walls (Cubicles)/S7	4m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-----	-------------	--------------------	---------	--

B00A - R9005 - General Storeroom (37.82 m2)

No Asbestos

B00A - R9006 - Kiln Room (2.28 m2)

No Asbestos

B00A - R9007 - Sports Store (40.5 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2857/B00A/R0004/Ceiling Structures/Linings/S4	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	---	------	--------------	--------------------	---------	---

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1955 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Flat Roof	Non Accessible Area - Height Restriction, 3.98m					

Interior

B00B - R0001 - Staff Room (31.39 m2)

No Asbestos

B00B - R0002 - Staff Toilet (4.66 m2)

Wall Linings Internal	Flat AC Sheeting	37m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2857/B00B/R0002/Wall Linings Internal/S6					Chrysotile (white asbestos)	

B00B - R0003 - Movement (4.41 m2)

No Asbestos

B00B - R0004 - Staff Toilet (6.35 m2)

Wall Linings Internal	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2857/B00B/R0002/Wall Linings Internal/S6					Chrysotile (white asbestos)	

B00B - R0005 - Cleaning Supplies (7.31 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
2857/B00A/R0001/Floor Coverings Res/Textile/S3					No Asbestos Detected	

B00B - R0006 - General Storeroom (15.01 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
2857/B00A/R0001/Floor Coverings Res/Textile/S3					No Asbestos Detected	

B00B - R0007 - Home Base (47.66 m2)

No Asbestos

B00B - R0008 - Home Base (47.66 m2)

No Asbestos

B00B - R0009 - Special Programs Room (47.79 m2)

No Asbestos

B00B - R0010 - Movement (2.2 m2)

No Asbestos

B00B - R0011 - Withdrawal Space - 1hb (13.74 m2)

Electrical Mounting Board	Resinous Board	1Unit	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					Assumed Asbestos - Electrical Hazard	

B00B - R0013 - Home Base (47.58 m2)

No Asbestos

B00B - R0014 - Movement (1.94 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2857/B00A/R0004/Ceiling Structures/Linings/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00B - R0015 - Movement (99.53 m2)

No Asbestos

B00B - R0016 - Movement (2.18 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2857/B00A/R0004/Ceiling Structures/Linings/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - R0017 - Movement (12.77 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1960 - Steel (Steel)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction, 4.45m						
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Flat Roof	Non Accessible Area - Height Restriction, 4.6m					

Interior

B00C - R0001 - Practical Activities - 1hb (2.96 m2)

Wall Linings Internal	Flat AC Sheeting	8m2	North facing, South facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2857/B00C/R0002/Wall Linings Internal/S13					Chrysotile (white asbestos)	

B00C - R0002 - Movement (28.68 m2)

Wall Linings Internal	Flat AC Sheeting	20m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2857/B00C/R0002/Wall Linings Internal/S13					Chrysotile (white asbestos)	

B00C - R0003 - Practical Activities - 1hb (2.96 m2)

Wall Linings Internal	Flat AC Sheeting	8m2	North facing, South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2857/B00C/R0002/Wall Linings Internal/S13					Chrysotile (white asbestos)	

B00C - R0004 - Home Base (54.24 m2)

No Asbestos

B00C - R0005 - Home Base (54.24 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities/Building Services - 1955 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible, slab to ground, no access points.					
Ceiling Voids - Flat Roof	Non Accessible Area - Height Restriction, 3.2m					
Eaves Linings	Flat AC Sheeting 2857/B00D/Eaves Linings/S18	20m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting 2857/B00D/Gable Verge Lining/S17	12m	East, west	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Interior

B00D - R0001 - Garden Store (18.05 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2857/B00D/R0001/Ceiling Structures/Linings/S16	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	------	--------------	--------------------	---------	--

B00D - R0002 - General Assistant/Bulk Store (14.88 m2)

No Asbestos

B00D - R0004 - Uniform Shop (3.72 m2)

No Asbestos

B00D - R0005 - Uniform Shop (3.04 m2)

No Asbestos

B00D - R0006 - Staff Toilet (2.47 m2)

No Asbestos

B00D - R0007 - Canteen (25.78 m2)

No Asbestos

B00D - R0008 - Movement (13.97 m2)

No Asbestos

B00D - R0009 - Communal Space (59.67 m2)

No Asbestos

B00D - R0010 - General Storeroom (4.85 m2)

No Asbestos

B00D - R0011 - Toilets - Girls (24.76 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 2857/B00D/R0012/Partition Walls (Cubicles)/S7	12m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	------	-------------	--------------------	---------	--

B00D - R0012 - Toilets - Boys (24.76 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 2857/B00D/R0012/Partition Walls (Cubicles)/S7	4m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-----	-------------	--------------------	---------	--

B00D - R0013 - Movement (18.7 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible, slab to ground / no access points.
Ceiling Voids	No Asbestos Found

Interior

B00E - R0001 - Communal Space (204.31 m2)

No Asbestos

B00E - R0002 - Toilet - Lobby (1.87 m2)

No Asbestos

B00E - R0003 - Toilets - Boys (7.42 m2)

No Asbestos

B00E - R0004 - P.E. Store (15.92 m2)

No Asbestos

B00E - R0005 - Communal/Performance Store (10.04 m2)

No Asbestos

B00E - R0006 - Movement (13.04 m2)

No Asbestos

B00E - R0007 - Movement (12.79 m2)

No Asbestos

B00E - R0008 - Raised Platform (62.91 m2)

No Asbestos

B00E - R0009 - Movement (1.87 m2)

No Asbestos

B00E - R0010 - Movement (5.77 m2)

No Asbestos

B00E - R0011 - Chair Storeroom (10.3 m2)

No Asbestos

B00E - R0012 - Movement (2.75 m2)

No Asbestos

B00E - R0013 - Main Switch Board (0.8 m2)

No Asbestos

B00E - R0014 - Plant (0.86 m2)

No Asbestos

B00E - R0015 - Cleaning Distributed Store (10.68 m2)

No Asbestos

B00E - R0016 - Toilets - Girls (10.08 m2)

No Asbestos

B00E - R0017 - Toilet - Lobby (3.77 m2)

No Asbestos

B00E - R0018 - Sound Cupboard (2.69 m2)

No Asbestos

B00E - R0019 - Access Shower/Toilet/Change (7.02 m2)

No Asbestos

B00E - R0020 - Covered Outdoor Learning Area (215.67 m2)

No Asbestos

B00E - R0021 - External Movement (70.47 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00E - R0022 - External Movement (7.43 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible, slab to ground / no access points.

Ceiling Voids No Asbestos Found

Interior

B00F - R0001 - Toilets - Boys (23.26 m2)

No Asbestos

B00F - R0002 - Toilets - Girls (28.46 m2)

No Asbestos

B00F - R0003 - General Storeroom (7.66 m2)

No Asbestos

B00F - R0004 - External Movement (8.81 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D10032 - Learning Unit - Standard With P.A.A. : Placement Date - 24/07/2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D12342 - Learning Unit - Standard With P.A.A. : Placement Date - 7/02/2007

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D14135 - Learning Unit - Standard With P.A.A. : Placement Date - 31/12/2009

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 503 - D14336 - Admin Lib Staff/Principal/Clerk/Store : Placement Date - 2/06/2006

Exterior

Eave Lining	Flat AC Sheet	Assumed Asbestos	23.04 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Interior

R1 - Clerical Office

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				24 m2

R2 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2
---------	---------------	------------------	--	--	--	-------

R3 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos				2 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2

R4 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos				2 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2

R5 - Reading Area

Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
---------	---------------	------------------	--	--	--	-------

R6 - Security Store

Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
---------	---------------	------------------	--	--	--	------

R7 - Staff Room

Ceiling	Flat AC Sheet	Assumed Asbestos				27 m2
---------	---------------	------------------	--	--	--	-------

R8 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				6 m2

OS 840 - D14540 - Girls Toilet : Placement Date - 26/04/2006

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				2.88 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2

Interior

R1 - Toilets-Girls

Toilet partitions	Compressed AC Sheet	Assumed Asbestos				4 m2
End wall panel	Flat AC Sheet	Assumed Asbestos				36 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				18 m2

OS 601 - D14562 - Learning Unit - Standard/Withdrawal : Placement Date - 14/02/2003

Exterior

Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
---------	---------------	------------------	--	--	--	-------

OS 602 - D14589 - Learning Unit - Standard With P.A.A. : Placement Date - 20/12/2004

Exterior

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Interior						
R1 - Learning space/withdrawal/entry						
Ceiling	Flat AC Sheet	Assumed Asbestos				70 m2
R2 - Home Base Store						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				3 m2
OS 602 - D15347 - Learning Unit - Standard With P.A.A. : Placement Date - 20/01/2012						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 601 - D15600 - Learning Unit - Standard/Withdrawal : Placement Date - 22/02/2006						
Exterior						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

2857_ASB_010313_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017