


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Penrith Public School (2859)
Region : Western Sydney
State Electorate : Penrith
Local Government Area : Penrith

Initial Survey : Noel Arnold & Associates : 13 - May - 2008
Reviewed By : Parsons Brinckerhoff : 25 - Nov - 2016

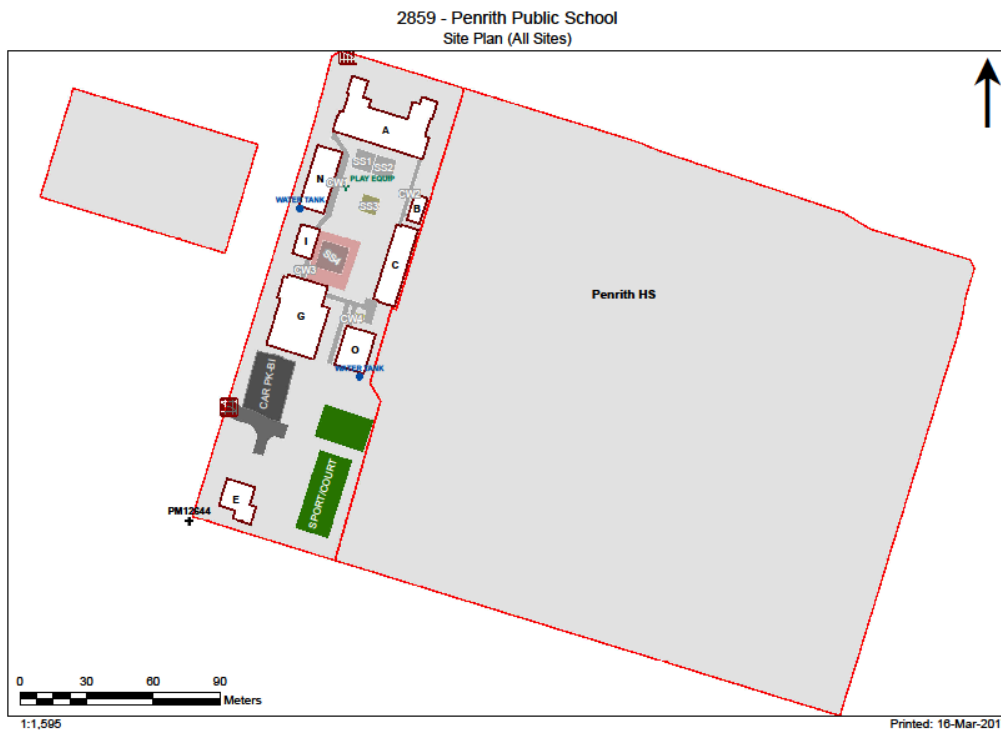

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1917 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids	Flat AC Sheeting 2859/B00A/Underfloor Voids/S17					No Asbestos Detected
Ceiling Void, Packing material	Flat AC Sheeting 2859/B00A/Ceiling Void, Packing material/S18	1m2	Variable positions	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
Underfloor Voids	AC Fragments/Debris 2859/B00A/Underfloor Voids/S19	1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
Underfloor Voids	Vinyl Tiles Debris 2859/B00A/Underfloor Voids/S20	1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior**B00A - R0001 - Home Base**

Electrical Mounting Board	Resinous Board 2859/B00A/R0021/Electrical Mounting Board/S1					No Asbestos Detected
Electrical Backing Board	Resinous Board 2859/B00A/R0021/Electrical Backing Board/S6	1m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00A - R0002 - Duplicating Workroom

Electrical Mounting Board	Resinous Board 2859/B00A/R0021/Electrical Mounting Board/S1					No Asbestos Detected
Electrical Backing Board	Resinous Board 2859/B00A/R0021/Electrical Backing Board/S6	1m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 2859/B00A/R0020/Ceiling Structures/Linings/S23	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00A - R0003 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting 2859/B00A/R0020/Ceiling Structures/Linings/S23	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--------------------------------------------------------------------	-----	------------	--------------------	---------	----------------------------------------------------------

B00A - R0004 - Cleaning Distributed Store

No Asbestos

B00A - R0006 - Movement

No Asbestos

B00A - R0007 - Interview

No Asbestos

B00A - R0009 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 2859/B00A/R0020/Ceiling Structures/Linings/S23	138m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 2859/B00A/R0020/Wall Linings Internal/S2					No Asbestos Detected

B00A - R0010 - Home Base

Electrical Mounting Board	Resinous Board 2859/B00A/R0021/Electrical Mounting Board/S1					No Asbestos Detected
Electrical Backing Board	Resinous Board 2859/B00A/R0021/Electrical Backing Board/S6	1m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00A - R0011 - Home Base

Electrical Mounting Board	Resinous Board 2859/B00A/R0021/Electrical Mounting Board/S1					No Asbestos Detected
---------------------------	----------------------------------------------------------------	--	--	--	--	-----------------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Electrical Backing Board	Resinous Board	1m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
2859/B00A/R0021/Electrical Backing Board/S6					Chrysotile (white asbestos)	
B00A - R0012 - Practical Activities - 1hb						
Electrical Mounting Board	Resinous Board					No Asbestos Detected
2859/B00A/R0021/Electrical Mounting Board/S1						
Electrical Backing Board	Resinous Board	1m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
2859/B00A/R0021/Electrical Backing Board/S6					Chrysotile (white asbestos)	
B00A - R0013 - Home Base						
Electrical Mounting Board	Resinous Board					No Asbestos Detected
2859/B00A/R0021/Electrical Mounting Board/S1						
Electrical Backing Board	Resinous Board	1m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
2859/B00A/R0021/Electrical Backing Board/S6					Chrysotile (white asbestos)	
B00A - R0014 - Home Base						
Electrical Mounting Board	Resinous Board					No Asbestos Detected
2859/B00A/R0021/Electrical Mounting Board/S1						
Electrical Backing Board	Resinous Board	1m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
2859/B00A/R0021/Electrical Backing Board/S6					Chrysotile (white asbestos)	
B00A - R0016 - Staff Toilet						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
2859/B00A/R0016/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
2859/B00A/R0020/Wall Linings Internal/S2						
B00A - R0017 - Staff Toilet						
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
2859/B00A/R0016/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
2859/B00A/R0020/Wall Linings Internal/S2						
B00A - R0019 - General Storeroom						
No Asbestos						
B00A - R0020 - General Storeroom						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
2859/B00A/R0020/Wall Linings Internal/S2						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2859/B00A/R0020/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2859/B00A/R0020/Ceiling Structures/Linings/S23					Chrysotile (white asbestos)	
B00A - R0021 - Home Base						
Electrical Mounting Board	Resinous Board					No Asbestos Detected
2859/B00A/R0021/Electrical Mounting Board/S1						
Electrical Backing Board	Resinous Board	1m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
2859/B00A/R0021/Electrical Backing Board/S6					Chrysotile (white asbestos)	
B00A - R0022 - Movement						
No Asbestos						
B00A - R0025 - Sick Bay						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
2859/B00A/R0020/Wall Linings Internal/S2						
B00A - R0026 - Toilets - Boys/Girls						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting 2859/B00A/R0020/Wall Linings Internal/S2					No Asbestos Detected
B00A - R0027 - Principal						
Electrical Backing Board	Resinous Board 2859/B00A/R0021/Electrical Backing Board/S6	1m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0028 - Staff Room						
Wall Linings Internal	Flat AC Sheeting 2859/B00A/R0020/Wall Linings Internal/S2					No Asbestos Detected
B00A - R0029 - Stairs						
No Asbestos						
B00A - R0030 - Stairs						
No Asbestos						
B00A - R0031 - Movement						
No Asbestos						
B00A - R0032 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting 2859/B00A/R0032/Ceiling Structures/Linings/S5	3m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0033 - Clerical Office						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2859/B00A/R0033/Floor Coverings Res/Textile/S24	34m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1001 - Home Base						
Electrical Mounting Board	Resinous Board 2859/B00A/R0021/Electrical Mounting Board/S1					No Asbestos Detected
Electrical Backing Board	Resinous Board 2859/B00A/R0021/Electrical Backing Board/S6	1m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1002 - Cleaning Distributed Store						
No Asbestos						
B00A - R1003 - Security Store						
Electrical Mounting Board	Resinous Board 2859/B00A/R0021/Electrical Mounting Board/S1					No Asbestos Detected
Electrical Backing Board	Resinous Board 2859/B00A/R0021/Electrical Backing Board/S6	1m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1004 - General Storeroom						
No Asbestos						
B00A - R1005 - Movement						
No Asbestos						
B00A - R1006 - Home Base						
Electrical Mounting Board	Resinous Board 2859/B00A/R0021/Electrical Mounting Board/S1					No Asbestos Detected
Electrical Backing Board	Resinous Board 2859/B00A/R0021/Electrical Backing Board/S6	1m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1007 - Home Base						
Electrical Mounting Board	Resinous Board 2859/B00A/R0021/Electrical Mounting Board/S1					No Asbestos Detected
Electrical Backing Board	Resinous Board 2859/B00A/R0021/Electrical Backing Board/S6	1m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1008 - Home Base						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Electrical Mounting Board	Resinous Board 2859/B00A/R0021/Electrical Mounting Board/S1					No Asbestos Detected
---------------------------	----------------------------------------------------------------	--	--	--	--	-----------------------------

Electrical Backing Board	Resinous Board 2859/B00A/R0021/Electrical Backing Board/S6	1m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
--------------------------	---------------------------------------------------------------	-----	-------------	--------------------	---------	----------------------------------------------------------

B00A - R1009 - Home Base

Electrical Mounting Board	Resinous Board 2859/B00A/R0021/Electrical Mounting Board/S1					No Asbestos Detected
---------------------------	----------------------------------------------------------------	--	--	--	--	-----------------------------

Electrical Backing Board	Resinous Board 2859/B00A/R0021/Electrical Backing Board/S6	1m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
--------------------------	---------------------------------------------------------------	-----	-------------	--------------------	---------	----------------------------------------------------------

B00A - R1010 - Home Base

Electrical Mounting Board	Resinous Board 2859/B00A/R0021/Electrical Mounting Board/S1					No Asbestos Detected
---------------------------	----------------------------------------------------------------	--	--	--	--	-----------------------------

Electrical Backing Board	Resinous Board 2859/B00A/R0021/Electrical Backing Board/S6	1m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
--------------------------	---------------------------------------------------------------	-----	-------------	--------------------	---------	----------------------------------------------------------

B00A - R1011 - Home Base

Electrical Mounting Board	Resinous Board 2859/B00A/R0021/Electrical Mounting Board/S1					No Asbestos Detected
---------------------------	----------------------------------------------------------------	--	--	--	--	-----------------------------

Electrical Backing Board	Resinous Board 2859/B00A/R0021/Electrical Backing Board/S6	1m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
--------------------------	---------------------------------------------------------------	-----	-------------	--------------------	---------	----------------------------------------------------------

B00A - R1012 - General Storeroom

No Asbestos

B00A - R1013 - Movement

No Asbestos

B00A - R1014 - Withdrawal Space - 1hb

No Asbestos

B00A - R1015 - Raised Platform

No Asbestos

B00A - R1016 - Communal Space

No Asbestos

B00A - R1017 - Practical Activities - 1hb

No Asbestos

B00A - R1018 - Stairs

No Asbestos

B00A - R1019 - Stairs

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Support Unit - 1950 - Timber (Timber)**Exterior**

Wall Lining External	Flat AC Sheeting 2859/B00B/Wall Lining External/S9					No Asbestos Detected
Ceiling Void	AC Fragments/Debris 2859/B00B/Ceiling Void/S21	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids	Fibre Cement Pipe Debris 2859/B00B/Underfloor Voids/S22	1m	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	No Asbestos Found					

Interior**B00B - R0001 - Home Base Store - P**

Wall Linings Internal	Flat AC Sheeting 2859/B00B/R0001/Wall Linings Internal/S8	12m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------	--------------------------------------------------------------	------	-------------	--------------------	---------	----------------------------------------------------------

B00B - R0002 - Home Base - P

Electrical Backing Board	Resinous Board 2859/B00A/R0021/Electrical Backing Board/S6	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
--------------------------	---------------------------------------------------------------	-----	------	--------------------	---------	----------------------------------------------------------

Floor Coverings Res/Textile	Vinyl Tiles 2859/B00B/R0004/Floor Coverings Res/Textile/S7					No Asbestos Detected
-----------------------------	---------------------------------------------------------------	--	--	--	--	-----------------------------

B00B - R0003 - Withdrawal - P

No Asbestos

B00B - R0004 - Practical Activities - P - 1hb

Floor Coverings Res/Textile	Vinyl Tiles 2859/B00B/R0004/Floor Coverings Res/Textile/S7					No Asbestos Detected
-----------------------------	---------------------------------------------------------------	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Support Unit - 1917 - Timber (Timber)**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00C - R0001 - Practical Activities - P - 1hb**

Wall Linings Internal	Flat AC Sheeting					
	2859/B00C/R0009/Wall Linings Internal/S12					No Asbestos Detected

B00C - R0002 - Toilet - P

Wall Linings Internal	Flat AC Sheeting					
	2859/B00C/R0009/Wall Linings Internal/S12					No Asbestos Detected

B00C - R0003 - Home Base - P

Electrical Backing Board	Resinous Board	1m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2859/B00C/R0006/Electrical Backing Board/S14					Chrysotile (white asbestos) , Amosite (brown Asbestos)

B00C - R0004 - Special Programs Room

Electrical Backing Board	Resinous Board	1m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2859/B00C/R0006/Electrical Backing Board/S14					Chrysotile (white asbestos) , Amosite (brown Asbestos)

B00C - R0005 - Home Base

Electrical Backing Board	Resinous Board	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2859/B00C/R0006/Electrical Backing Board/S14					Chrysotile (white asbestos) , Amosite (brown Asbestos)

B00C - R0006 - Home Base

Electrical Backing Board	Resinous Board	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2859/B00C/R0006/Electrical Backing Board/S14					Chrysotile (white asbestos) , Amosite (brown Asbestos)

Floor Coverings Res/Textile	Vinyl Tiles					
	2859/B00C/R0006/Floor Coverings Res/Textile/S15					No Asbestos Detected

B00C - R0007 - General Assistant/Bulk Store

No Asbestos

B00C - R0008 - General Assistant/Bulk Store

No Asbestos

B00C - R0009 - Movement

Wall Linings Internal	Flat AC Sheeting					
	2859/B00C/R0009/Wall Linings Internal/S12					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	79m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2859/B00C/R0009/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Staff Facilities - 1950 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2859/B00E/Eaves Linings/S16					Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00E - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2859/B00E/R0003/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)

B00E - R0002 - Seminar/Study

No Asbestos

B00E - R0003 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2859/B00E/R0003/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)

B00E - R0004 - Staff Toilet

No Asbestos

B00E - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2859/B00E/R0003/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)

B00E - R0006 - Laundry - Type 2

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2859/B00E/R0003/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)

Wall Linings Internal	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2859/B00E/R0006/Wall Linings Internal/S11					Chrysotile (white asbestos)

B00E - R0007 - Staff Kitchen

No Asbestos

B00E - R0008 - Movement

No Asbestos

B00E - R0009 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2859/B00E/R0003/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)

Wall Linings Internal	Flat AC Sheeting	26m2	North, West, Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2859/B00E/R0006/Wall Linings Internal/S11					Chrysotile (white asbestos)

B00E - R0010 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00G - Communal Facilities/Pupil Facilities - 2003 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00G - R0001 - Covered Outdoor Learning Area

No Asbestos

B00G - R0002 - Toilets - Girls

No Asbestos

B00G - R0003 - Communications Cupboard

No Asbestos

B00G - R0004 - Cleaning Supplies

No Asbestos

B00G - R0005 - Sports Store

No Asbestos

B00G - R0006 - Movement

No Asbestos

B00G - R0007 - Communal/Performance Store

No Asbestos

B00G - R0008 - Movement

No Asbestos

B00G - R0009 - Raised Platform

No Asbestos

B00G - R0010 - Movement

No Asbestos

B00G - R0011 - Garden Store

No Asbestos

B00G - R0012 - Hall Chair Store

No Asbestos

B00G - R0013 - Main Switch Board

No Asbestos

B00G - R0014 - Movement

No Asbestos

B00G - R0015 - P.E. Store

No Asbestos

B00G - R0016 - Toilets - Boys

No Asbestos

B00G - R0017 - Access Shower/Toilet

No Asbestos

B00G - R0018 - Cleaning Distributed Store

No Asbestos

B00G - R0019 - Communal Space

No Asbestos

B00G - R0020 - Canteen

No Asbestos

B00G - R0021 - Canteen Office/Store

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Pupil Facilities - 2003 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B001 - R0001 - Movement

No Asbestos

B001 - R0002 - Toilets - Boys

No Asbestos

B001 - R0003 - Toilets - Girls

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Library/Various - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00N - R0001 - Reading Area

No Asbestos

B00N - R0002 - Library Office/Workroom

No Asbestos

B00N - R0003 - Communications Room

No Asbestos

B00N - R0004 - K.L.A. Store

No Asbestos

B00N - R0005 - Cleaning Distributed Store

No Asbestos

B00N - R0006 - Staff Toilet

No Asbestos

B00N - R0007 - Toilet - Lobby

No Asbestos

B00N - R0008 - Special Programs Store

No Asbestos

B00N - R0009 - Special Programs Room

No Asbestos

B00N - R0010 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00N - R0011 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B000 - R0001 - External Movement

No Asbestos

B000 - R0002 - Practical Activities/Movement - 1hb

No Asbestos

B000 - R0003 - Home Base Store

No Asbestos

B000 - R0004 - Home Base

No Asbestos

B000 - R0005 - Withdrawal Space - 2hb

No Asbestos

B000 - R0006 - Home Base

No Asbestos

B000 - R0007 - Home Base Store

No Asbestos

B000 - R0008 - Practical Activities/Movement - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

2859_ASB_221112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017