


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Penrose Public School (2860)
Region : Illawarra and South East
State Electorate : Goulburn
Local Government Area : Wingecarribee

Initial Survey : Noel Arnold & Associates : 07 - May - 2008
Register Issue Date : 22 - Mar - 2017

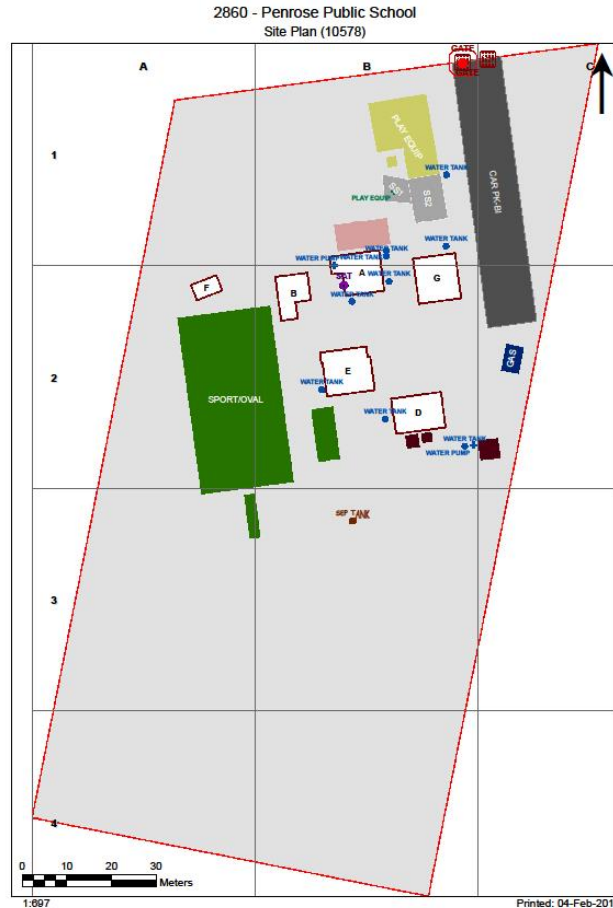

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Library/Administration - 1923 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	18m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2860/B00A/Eaves Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior

B00A - R0001 - Movement

No Asbestos

B00A - R0002 - Clerical Office/Workroom

No Asbestos

B00A - R0003 - Reading Area

No Asbestos

B00A - R0004 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles					
	2860/B00A/R0004/Floor Coverings Res/Textile/S1				No Asbestos Detected	

B00A - R0005 - Principal

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Staff Facilities - 1991 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00B - R0001 - Staff Room

No Asbestos

B00B - R0002 - External Movement

No Asbestos

B00B - R0003 - Staff Room Annexe

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1991 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 2860/B00D/R0002/Ceiling Structures/Linings/S3					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Requires Inspection					

Interior

B00D - R0001 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet 2860/B00D/R0003/Partition Walls (Cubicles)/S4					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 2860/B00D/R0002/Ceiling Structures/Linings/S3					No Asbestos Detected

B00D - R0002 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting 2860/B00D/R0002/Ceiling Structures/Linings/S3					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

B00D - R0003 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet 2860/B00D/R0003/Partition Walls (Cubicles)/S4					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 2860/B00D/R0002/Ceiling Structures/Linings/S3					No Asbestos Detected

B00D - R0004 - General Assistant/Bulk Store

No Asbestos

B00D - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 2860/B00D/R0002/Ceiling Structures/Linings/S3					No Asbestos Detected
----------------------------	---	--	--	--	--	----------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Library - 1999 - Timber (Timber)

Exterior

Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
Eaves Linings	Flat AC Sheeting	10m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2860/B00A/Eaves Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Requires Inspection					

Interior

B00E - R0001 - Movement

No Asbestos

B00E - R0002 - Reading Area

No Asbestos

B00E - R0003 - General Storeroom

No Asbestos

B00E - R0004 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Communal Facilities - 1999 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	6m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2860/B00A/Eaves Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Requires Inspection					

Interior

B00F - R0001 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 2010 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00G - R0001 - Home Base

No Asbestos

B00G - R0002 - Practical Activities/Movement - 1hb

No Asbestos

B00G - R0003 - Home Base Store

No Asbestos

B00G - R0004 - Personal Effects Storage

No Asbestos

B00G - R0005 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017