


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Penshurst Public School (2861)
Region : Sydney
State Electorate : Oatley
Local Government Area : Hurstville

Initial Survey : Noel Arnold & Associates : 30 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 01 - Nov - 2016

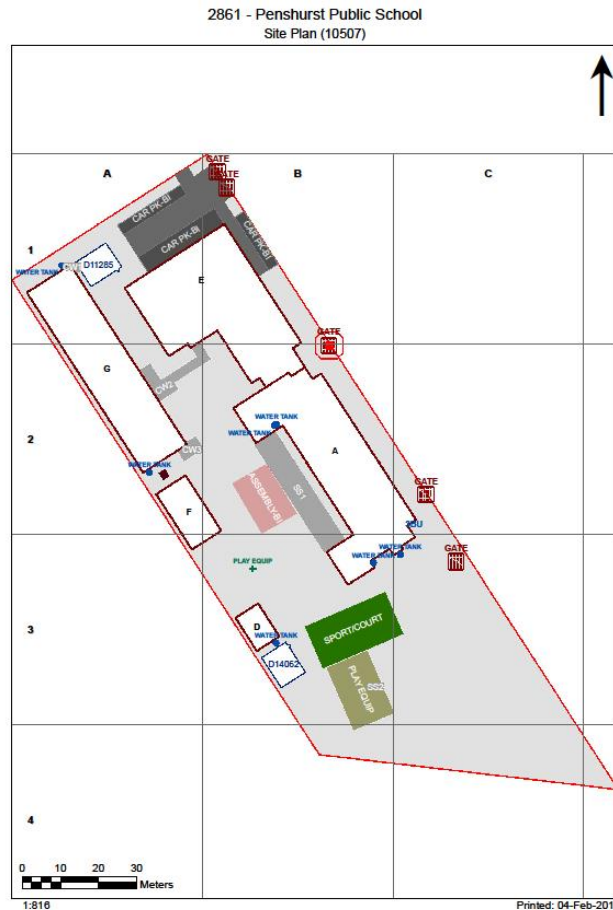

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00A - General Learning/Library - 1924 - Brick/Block (Brick/Block)**Exterior**

| | | | | | | |
|------------------|----------------------------|-----|--------------------|---------------------------------------|---------|---|
| Underfloor Voids | No Asbestos Found | | | | | |
| Ceiling Void | AC Fragments/Debris | 1m2 | Variable positions | Poor Condition - Extensive Damage (4) | Low (1) | Medium Priority (4-5) |
| | 2861/B00A/Ceiling Void/S12 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) |

Interior**B00A - R0001 - Withdrawal Space - 1hb**

| | | | | | | |
|----------------------------|---|------|--------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 14m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2861/B00A/R1021/Ceiling Structures/Linings/S5 | | | | | Chrysotile (white asbestos) |

B00A - R0002 - Home Base

No Asbestos

B00A - R0003 - Home Base

No Asbestos

B00A - R0006 - Home Base

| | | | | | | |
|-------------|--------------------------------|------|---------------------------|--------------------|---------|------------------------------------|
| Chalk Board | Flat AC Sheeting | 11m2 | North facing, West facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2861/B00A/R0007/Chalk Board/S6 | | | | | Chrysotile (white asbestos) |

B00A - R0007 - Home Base

| | | | | | | |
|-------------|--------------------------------|------|---------------------------|--------------------|---------|------------------------------------|
| Chalk Board | Flat AC Sheeting | 11m2 | North facing, West facing | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2861/B00A/R0007/Chalk Board/S6 | | | | | Chrysotile (white asbestos) |

B00A - R0008 - Practical Activities - 1hb

| | | | | | | |
|----------------------------|---|------|--------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 14m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2861/B00A/R1021/Ceiling Structures/Linings/S5 | | | | | Chrysotile (white asbestos) |

B00A - R0009 - Movement

| | | | | | | |
|----------------------------|--|--|--|--|--|-----------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | | | | | No Asbestos Detected |
| | 2861/B00A/R0034/Wall Linings Internal/S1 | | | | | |

| | | | | | | |
|-----------------------|--|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting | | | | | No Asbestos Detected |
| | 2861/B00A/R0034/Wall Linings Internal/S1 | | | | | |

B00A - R0011 - Movement

No Asbestos

B00A - R0012 - General Assistant/Bulk Store

No Asbestos

B00A - R0013 - Toilets - Girls

| | | | | | | |
|-----------------------|--|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting | | | | | No Asbestos Detected |
| | 2861/B00A/R0026/Wall Linings Internal/S2 | | | | | |

B00A - R0014 - Toilets - Boys

| | | | | | | |
|-----------------------|--|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting | | | | | No Asbestos Detected |
| | 2861/B00A/R0026/Wall Linings Internal/S2 | | | | | |

B00A - R0015 - Movement

No Asbestos

B00A - R0016 - Home Base Store

| | | | | | | |
|----------------------------|---|------|--------------|--------------------|---------|------------------------------------|
| Ceiling Structures/Linings | Flat AC Sheeting | 12m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2861/B00A/R1021/Ceiling Structures/Linings/S5 | | | | | Chrysotile (white asbestos) |

| | | | | | | |
|-----------------------|--|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting | | | | | No Asbestos Detected |
| | 2861/B00A/R0034/Wall Linings Internal/S1 | | | | | |

B00A - R0023 - Security Store

No Asbestos

B00A - R0024 - Staff Toilet

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|--|--|--------|--------------------|--------------------|-------------|--|
| Sample No | | | | | Test Result | |
| No Asbestos | | | | | | |
| B00A - R0025 - Toilets - Girls | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | | | | | No Asbestos Detected |
| | 2861/B00A/R0026/Wall Linings Internal/S2 | | | | | |
| B00A - R0026 - Toilets - Boys | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | | | | | No Asbestos Detected |
| | 2861/B00A/R0026/Wall Linings Internal/S2 | | | | | |
| B00A - R0027 - Movement | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0028 - Staff Toilet | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 2m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2861/B00A/R1021/Ceiling Structures/Linings/S5 | | | | | Chrysotile (white asbestos) |
| B00A - R0030 - Movement | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | | | | | No Asbestos Detected |
| | 2861/B00A/R0034/Wall Linings Internal/S1 | | | | | |
| B00A - R0031 - Stairs | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0032 - Special Programs Room | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 34m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2861/B00A/R1021/Ceiling Structures/Linings/S5 | | | | | Chrysotile (white asbestos) |
| Wall Linings Internal | Flat AC Sheeting | | | | | No Asbestos Detected |
| | 2861/B00A/R0034/Wall Linings Internal/S1 | | | | | |
| B00A - R0033 - Practical Activities - 1hb | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0034 - Withdrawal Space - 1hb | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | | | | | No Asbestos Detected |
| | 2861/B00A/R0034/Wall Linings Internal/S1 | | | | | |
| B00A - R0035 - Library Office/Workroom | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0036 - Communications Room | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0037 - Practical Activities - 1hb | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0038 - Withdrawal Space - 1hb | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0040 - Home Base | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0041 - Movement | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0042 - Movement | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0043 - Stairs | | | | | | |
| No Asbestos | | | | | | |
| B00A - R0044 - Home Base | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 58m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| | 2861/B00A/R0045/Ceiling Structures/Linings/S10 | | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) |
| B00A - R0045 - Reading Area | | | | | | |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|--|----------------------|--------|--------------------|---|-------------|-----------------------------|
| Sample No | | | | Test Result | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 115m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2861/B00A/R0045/Ceiling Structures/Linings/S10 | | | | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) | | |
| B00A - R1001 - Withdrawal Space - 1hb | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 14m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2861/B00A/R1021/Ceiling Structures/Linings/S5 | | | | Chrysotile (white asbestos) | | |
| B00A - R1004 - Home Base | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 49m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2861/B00A/R1021/Ceiling Structures/Linings/S5 | | | | Chrysotile (white asbestos) | | |
| B00A - R1007 - Home Base | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 48m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2861/B00A/R1021/Ceiling Structures/Linings/S5 | | | | Chrysotile (white asbestos) | | |
| B00A - R1008 - Home Base | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 49m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2861/B00A/R1021/Ceiling Structures/Linings/S5 | | | | Chrysotile (white asbestos) | | |
| B00A - R1009 - Practical Activities - 1hb | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 14m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2861/B00A/R1021/Ceiling Structures/Linings/S5 | | | | Chrysotile (white asbestos) | | |
| B00A - R1011 - Uniform Shop | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 6m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2861/B00A/R1021/Ceiling Structures/Linings/S5 | | | | Chrysotile (white asbestos) | | |
| B00A - R1012 - Home Base Store | | | | | | |
| No Asbestos | | | | | | |
| B00A - R1019 - Home Base Store | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | | | | | No Asbestos Detected |
| 2861/B00A/R0034/Wall Linings Internal/S1 | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 9m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2861/B00A/R1021/Ceiling Structures/Linings/S5 | | | | Chrysotile (white asbestos) | | |
| B00A - R1020 - Home Base Store | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 14m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2861/B00A/R1021/Ceiling Structures/Linings/S5 | | | | Chrysotile (white asbestos) | | |
| B00A - R1021 - Movement | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 124m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2861/B00A/R1021/Ceiling Structures/Linings/S5 | | | | Chrysotile (white asbestos) | | |
| B00A - R1022 - Withdrawal Space - 1hb | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | | | | | No Asbestos Detected |
| 2861/B00A/R0034/Wall Linings Internal/S1 | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 7m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2861/B00A/R1021/Ceiling Structures/Linings/S5 | | | | Chrysotile (white asbestos) | | |
| B00A - R1023 - Practical Activities - 1hb | | | | | | |
| No Asbestos | | | | | | |
| B00A - R1024 - Home Base Store | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 17m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2861/B00A/R1021/Ceiling Structures/Linings/S5 | | | | Chrysotile (white asbestos) | | |
| B00A - R1025 - Home Base Store | | | | | | |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|--|----------------------|--------|--------------------|--------------------|------------------------------------|-----------------------------|
| Sample No | | | | | Test Result | |
| Ceiling Structures/Linings | Flat AC Sheeting | 14m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2861/B00A/R1021/Ceiling Structures/Linings/S5 | | | | | Chrysotile (white asbestos) | |
| B00A - R1026 - Withdrawal Space - 1hb | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 11m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2861/B00A/R1021/Ceiling Structures/Linings/S5 | | | | | Chrysotile (white asbestos) | |
| B00A - R1027 - Practical Activities - 1hb | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 24m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2861/B00A/R1021/Ceiling Structures/Linings/S5 | | | | | Chrysotile (white asbestos) | |
| B00A - R1028 - Home Base | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 49m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2861/B00A/R1021/Ceiling Structures/Linings/S5 | | | | | Chrysotile (white asbestos) | |
| B00A - R1029 - Stairs | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 11m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2861/B00A/R1021/Ceiling Structures/Linings/S5 | | | | | Chrysotile (white asbestos) | |
| B00A - R1030 - Withdrawal Space - 1hb | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | | | | | No Asbestos Detected |
| 2861/B00A/R0034/Wall Linings Internal/S1 | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 8m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2861/B00A/R1021/Ceiling Structures/Linings/S5 | | | | | Chrysotile (white asbestos) | |
| B00A - R1031 - Practical Activities - 1hb | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | | | | | No Asbestos Detected |
| 2861/B00A/R0034/Wall Linings Internal/S1 | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 13m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2861/B00A/R1021/Ceiling Structures/Linings/S5 | | | | | Chrysotile (white asbestos) | |
| B00A - R1032 - Home Base | | | | | | |
| No Asbestos | | | | | | |
| B00A - R1033 - Home Base | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | | | | | No Asbestos Detected |
| 2861/B00A/R0034/Wall Linings Internal/S1 | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 68m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2861/B00A/R1021/Ceiling Structures/Linings/S5 | | | | | Chrysotile (white asbestos) | |
| B00A - R1034 - Withdrawal Space - 1hb | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | | | | | No Asbestos Detected |
| 2861/B00A/R0034/Wall Linings Internal/S1 | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 10m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2861/B00A/R1021/Ceiling Structures/Linings/S5 | | | | | Chrysotile (white asbestos) | |
| B00A - R1035 - Practical Activities - 1hb | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | | | | | No Asbestos Detected |
| 2861/B00A/R0034/Wall Linings Internal/S1 | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 13m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2861/B00A/R1021/Ceiling Structures/Linings/S5 | | | | | Chrysotile (white asbestos) | |
| B00A - R1036 - Special Programs Room | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | | | | | No Asbestos Detected |
| 2861/B00A/R0034/Wall Linings Internal/S1 | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 41m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) |
| 2861/B00A/R1021/Ceiling Structures/Linings/S5 | | | | | Chrysotile (white asbestos) | |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------------------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |
| B00A - R1037 - Stairs | | | | | | |

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00D - Pre-School Facilities - 1924 - Brick/Block (Brick/Block)

Exterior

| | | | | | | |
|-----------------|---|-----|-------|---|---------|---|
| Wall Cladding | Flat AC Sheeting 2861/B00D/Wall Cladding/S4 | | | | | No Asbestos Detected |
| Underfloor Void | Non Accessible Area - No Manhole to access underfloor void | | | | | |
| Ceiling Void | AC Fragments/Debris 2861/B00D/Ceiling Void/S11 | 2m2 | North | Poor Condition - Extensive Damage (4) | Low (1) | Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) |

Interior

B00D - R0001 - General Storeroom

| | | | | | | |
|-----------------------|--|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting 2861/B00D/R0005/Wall Linings Internal/S3 | | | | | No Asbestos Detected |
|-----------------------|--|--|--|--|--|-----------------------------|

B00D - R0002 - Home Base - Pre

| | | | | | | |
|----------------------------|---|------|--------------|--------------------|---------|---|
| Ceiling Structures/Linings | Flat AC Sheeting 2861/B00D/R0002/Ceiling Structures/Linings/S9 | 46m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) |
|----------------------------|---|------|--------------|--------------------|---------|---|

B00D - R0005 - Access Shower/Toilet

| | | | | | | |
|-----------------------|--|--|--|--|--|-----------------------------|
| Wall Linings Internal | Flat AC Sheeting 2861/B00D/R0005/Wall Linings Internal/S3 | | | | | No Asbestos Detected |
|-----------------------|--|--|--|--|--|-----------------------------|

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00E - Administration - 1999 - Brick/Veneer (Brick/Veneer)

Exterior

| | |
|------------------|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

Interior

B00E - R0001 - Disabled Toilet

No Asbestos

B00E - R0002 - Sports Store

No Asbestos

B00E - R0003 - General Assistant/Bulk Store

No Asbestos

B00E - R0004 - Hall Chair Store

No Asbestos

B00E - R0005 - Staff Toilet

No Asbestos

B00E - R0006 - Communal Space

No Asbestos

B00E - R0007 - Raised Platform

No Asbestos

B00E - R0008 - Staff Toilet

No Asbestos

B00E - R0009 - Cleaning Supplies

No Asbestos

B00E - R0010 - Movement

No Asbestos

B00E - R0011 - P.E. Store

No Asbestos

B00E - R0012 - Movement

No Asbestos

B00E - R0013 - Movement

No Asbestos

B00E - R0014 - Cleaning Supplies

No Asbestos

B00E - R0015 - Canteen

No Asbestos

B00E - R0016 - Canteen Office/Store

No Asbestos

B00E - R0017 - Main Switch Board

No Asbestos

B00E - R0018 - Communications Room

No Asbestos

B00E - R0019 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00E - R0020 - Movement

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0021 - Interview

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0022 - Security Store

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|--|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |
| Vinyl Tiles (Under Floor Covering/Carpet) | No Asbestos Found | | | | | |
| B00E - R0023 - Staff Toilet | | | | | | |
| No Asbestos | | | | | | |
| B00E - R0024 - Staff Toilet | | | | | | |
| No Asbestos | | | | | | |
| B00E - R0025 - Staff Toilet | | | | | | |
| No Asbestos | | | | | | |
| B00E - R0026 - Staff Toilet | | | | | | |
| No Asbestos | | | | | | |
| B00E - R0027 - Clerical Office | | | | | | |
| Vinyl Tiles (Under Floor Covering/Carpet) | No Asbestos Found | | | | | |
| B00E - R0028 - Duplicating Workroom | | | | | | |
| No Asbestos | | | | | | |
| B00E - R0029 - Disabled Toilet | | | | | | |
| No Asbestos | | | | | | |
| B00E - R0030 - Sick Bay | | | | | | |
| Vinyl Tiles (Under Floor Covering/Carpet) | No Asbestos Found | | | | | |
| B00E - R0031 - Staff Room | | | | | | |
| Vinyl Tiles (Under Floor Covering/Carpet) | No Asbestos Found | | | | | |
| B00E - R0032 - Staff Room Annexe | | | | | | |
| Vinyl Tiles (Under Floor Covering/Carpet) | No Asbestos Found | | | | | |
| B00E - R0033 - Deputy Principal | | | | | | |
| Vinyl Tiles (Under Floor Covering/Carpet) | No Asbestos Found | | | | | |
| B00E - R0034 - Principal | | | | | | |
| Vinyl Tiles (Under Floor Covering/Carpet) | No Asbestos Found | | | | | |
| B00E - R0035 - Movement | | | | | | |
| No Asbestos | | | | | | |
| B00E - R0036 - Movement | | | | | | |
| No Asbestos | | | | | | |
| B00E - R0037 - Movement | | | | | | |
| No Asbestos | | | | | | |

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

B00F - General Learning - 1918 - Timber (Timber)

Exterior

| | |
|------------------|--|
| Underfloor Voids | No Asbestos Found |
| Ceiling Void | Non Accessible Area - No Access - Projector and wires make access to manhole impossible |

Interior

B00F - R0001 - Home Base

| | | | | | | |
|-----------------------------|--|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles | | | | | |
| | 2861/B00F/R0001/Floor Coverings Res/Textile/S7 | | | | | No Asbestos Detected |

B00F - R0002 - Home Base

No Asbestos

B00F - R0003 - Home Base Store

| | | | | | | |
|-----------------------------|--|--|--|--|--|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles | | | | | |
| | 2861/B00F/R0003/Floor Coverings Res/Textile/S8 | | | | | No Asbestos Detected |

B00F - R0004 - Movement

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| | Sample No | | | | | Test Result |

B00G - General Learning/Special Purpose Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

| | |
|------------------|-------------------|
| Ceiling Voids | No Asbestos Found |
| Underfloor Voids | No Asbestos Found |

Interior

| | |
|--|-------------|
| B00G - R0001 - Special Programs Room - Type 2 | No Asbestos |
| B00G - R0002 - Home Base Store | No Asbestos |
| B00G - R0003 - Home Base | No Asbestos |
| B00G - R0004 - Home Base Store | No Asbestos |
| B00G - R0005 - Practical Activities | No Asbestos |
| B00G - R0006 - Withdrawal Space - 2hb | No Asbestos |
| B00G - R0007 - Home Base | No Asbestos |
| B00G - R0008 - Home Base Store | No Asbestos |
| B00G - R0009 - Practical Activities | No Asbestos |
| B00G - R0010 - Home Base | No Asbestos |
| B00G - R0011 - Home Base Store | No Asbestos |
| B00G - R0012 - Practical Activities | No Asbestos |
| B00G - R0013 - Withdrawal Space - 2hb | No Asbestos |
| B00G - R0014 - Home Base | No Asbestos |
| B00G - R0015 - Home Base Store | No Asbestos |
| B00G - R0016 - Practical Activities - 1hb | No Asbestos |
| B00G - R0017 - Home Base | No Asbestos |
| B00G - R0018 - Home Base Store | No Asbestos |
| B00G - R0019 - Withdrawal Space - 1hb | No Asbestos |
| B00G - R0020 - Practical Activities - 1hb | No Asbestos |
| B00G - R0021 - Special Programs Room | No Asbestos |
| B00G - R0022 - Special Programs Store | No Asbestos |
| B00G - R0023 - External Movement | |

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|---------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| | Sample No | | | | | Test Result |

No Asbestos

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D11285 - Learning Unit - Standard With P.A.A. : Placement Date - 25/07/2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D14062 - Learning Unit - Standard With P.A.A. : Placement Date - 23/11/2012

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

| Product | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No | | | | | Test Result | |

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017