


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Perthville Public School (2862)
Region : Western NSW
State Electorate : Bathurst
Local Government Area : Bathurst

Initial Survey : Noel Arnold & Associates : 21 - May - 2008
Reviewed By : Greencap-NAA : 08 - Dec - 2016

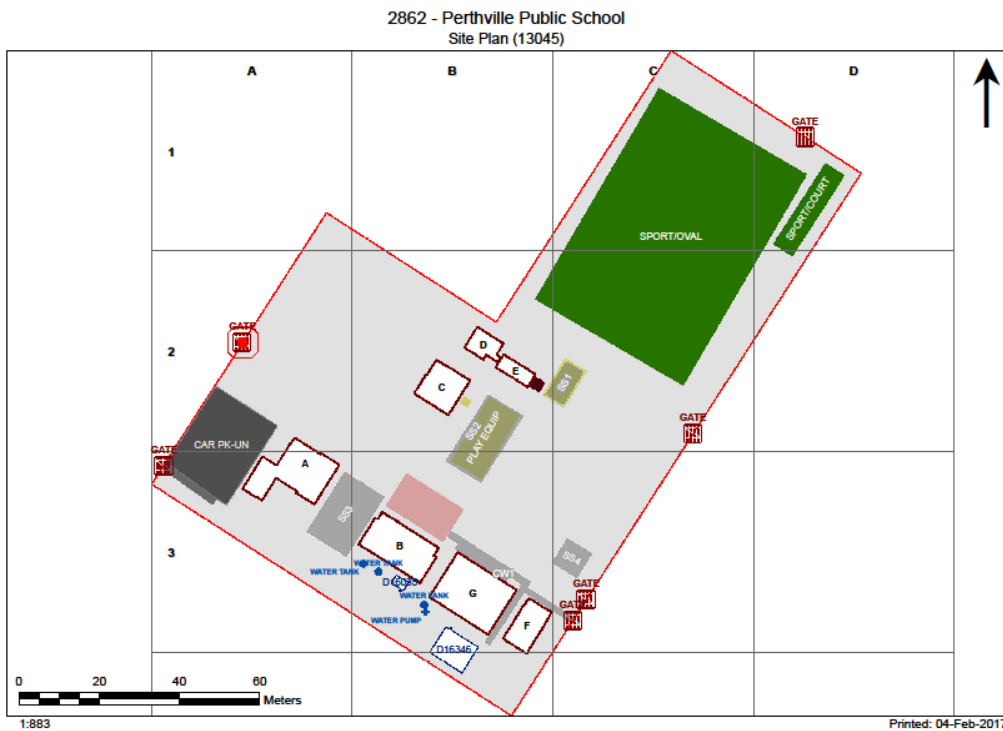

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Special Purpose - 1873 - Brick/Block (Brick/Block)**Exterior**

In-fill-panel	Flat AC Sheeting 2862/B00A/In-fill-panel/S3	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found					
Pitched Roof - Flat Ceiling -Void	No Asbestos Found					
Window Beading	Caulking Material 2862/B00A/Window Beading/S4					No Asbestos Detected

Interior**B00A - R0001 - Clerical Office**

No Asbestos

B00A - R0002 - Principal

No Asbestos

B00A - R0003 - General Storeroom

Wall Linings Internal	Flat AC Sheeting 2862/B00A/R0003/Wall Linings Internal/S1					No Asbestos Detected
-----------------------	--------------------------------------------------------------	--	--	--	--	-----------------------------

B00A - R0004 - General Storeroom

No Asbestos

B00A - R0005 - External Movement

Wall Linings Internal	Flat AC Sheeting 2862/B00A/R0005/Wall Linings Internal/S2	3m2	West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------	--------------------------------------------------------------	-----	------	--------------------	---------	----------------------------------------------------------

B00A - R0006 - Movement

Window Beading	Caulking Material 2862/B00A/Window Beading/S4					No Asbestos Detected
----------------	--------------------------------------------------	--	--	--	--	-----------------------------

B00A - R0007 - External Movement

Wall Linings Internal	Flat AC Sheeting 2862/B00A/R0005/Wall Linings Internal/S2	3m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------	--------------------------------------------------------------	-----	------	--------------------	---------	----------------------------------------------------------

B00A - R0008 - General Storeroom

No Asbestos

B00A - R0009 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting 2862/B00A/R0005/Wall Linings Internal/S2	6.46m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--------------------------------------------------------------	--------	------------	--------------------	------------	----------------------------------------------------------

B00A - R0010 - Staff Kitchen

No Asbestos

B00A - R0011 - Staff Toilet

No Asbestos

B00A - R0012 - Canteen Office/Store

No Asbestos

B00A - R0013 - Staff Room

No Asbestos

B00A - R0014 - Interview

No Asbestos

B00A - R0015 - External Movement

No Asbestos

B00A - R0016 - Duplicating Workroom

No Asbestos

B00A - R0017 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Library - 1978 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 2862/B00B/R0001/Ceiling Structures/Linings/S5					No Asbestos Detected
Pitched Roof - Flat Ceiling - Void	Non Accessible Area - Height Restricted approx 4m					
Underfloor Voids - Packing to Floor Joists	Non Accessible Area - No opening & very low headspace					
Window Beading	Caulking Material 2862/B00A/Window Beading/S4					No Asbestos Detected
Expansion Joint	Bituman 2862/B00B/Expansion Joint/S8					No Asbestos Detected

Interior

B00B - R0001 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting 2862/B00B/R0001/Ceiling Structures/Linings/S5					No Asbestos Detected
Window Beading	Caulking Material 2862/B00A/Window Beading/S4					No Asbestos Detected

B00B - R0002 - Home Base Store

Floor Coverings Res/Textile	Green vinyl sheet under carpet 2862/B00B/R0002/Floor Coverings Res/Textile/S6					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive under green vinyl sheet under carpet 2862/B00B/R0002/Floor Coverings Res/Textile/S7	11.93m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00B - R0003 - Home Base Store

No Asbestos

B00B - R0004 - Home Base

Floor Coverings Res/Textile	Adhesive under green vinyl sheet under carpet 2862/B00B/R0002/Floor Coverings Res/Textile/S7	53.36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Green vinyl sheet under carpet 2862/B00B/R0002/Floor Coverings Res/Textile/S6					No Asbestos Detected

B00B - R0005 - Reading Area

Floor Coverings Res/Textile	Adhesive under green vinyl sheet under carpet 2862/B00B/R0002/Floor Coverings Res/Textile/S7	53.69m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Green vinyl sheet under carpet 2862/B00B/R0002/Floor Coverings Res/Textile/S6					No Asbestos Detected



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1927 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 2862/B00C/Eaves Linings/S9					No Asbestos Detected
Sub-Floor Void -Floating Slab	Non Accessible Area - No entry hatch					
Pitched Roof - Flat Ceiling	Non Accessible Area - 5m high no manhole.					
Window Beading	Caulking Material 2862/B00A/Window Beading/S4					No Asbestos Detected

Interior

B00C - R0001 - Home Base

No Asbestos

B00C - R0002 - Withdrawal Space - 1hb

No Asbestos

B00C - R0003 - External Movement

Electrical Backing Board	Resinous Board	1m2	East, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-----	----------------------	--------------------	---------	--------------------

Assumed Asbestos - Cannot sample -Live

Ceiling Structures/Linings	No Asbestos Found
----------------------------	-------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities/Staff Facilities - 1974 - Brick/Block (Brick/Block)**Exterior**

Electrical Backing Board	Resinous Board	1m2	East, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard - Live						
Ceiling Voids - Flat Roof	Non Accessible Area - No manhole 2.5m ceiling					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Window Beading	Caulking Material 2862/B00A/Window Beading/S4					No Asbestos Detected

Interior**B00D - R0003 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2862/B00D/R0003/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00D - R0005 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2862/B00D/R0005/Ceiling Structures/Linings/S11				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		

B00D - R0007 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	14.18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2862/B00D/R0005/Ceiling Structures/Linings/S11				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		

B00D - R0008 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	16.86m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2862/B00D/R0003/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00D - R0009 - Drinking Facilities

Ceiling Structures/Linings	Flat AC Sheeting 2862/B00D/R0009/Ceiling Structures/Linings/S12					No Asbestos Detected
----------------------------	--------------------------------------------------------------------	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1950 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists No Asbestos Found

Ceiling Voids - Flat Roof No Asbestos Found

Interior

B00E - R0001 - Sports Store

Non Accessible

B00E - R0002 - Canteen Covered Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 2007 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

Interior

B00F - R0001 - Practical Activity Area

No Asbestos

B00F - R0002 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Pupil Facilities - 2010 - Fibre Cement Clad (Fibre Cement Clad)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

Interior**B00G - R0001 - External Movement**

No Asbestos

B00G - R0002 - Practical Activities - 1hb

No Asbestos

B00G - R0003 - Home Base Store

No Asbestos

B00G - R0004 - Home Base

No Asbestos

B00G - R0005 - Withdrawal Space - 2hb

No Asbestos

B00G - R0006 - Home Base

No Asbestos

B00G - R0007 - Home Base Store

No Asbestos

B00G - R0008 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Disabled Toilet

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

Interior

B001 - R0001 - Toilet Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D14128 - Learning Unit - Standard/Withdrawal : Placement Date - 30/07/2002

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Entry

No Asbestos Found.

R2 - General Learning Space

No Asbestos Found.

R3 - Store

No Asbestos Found.

OS 837 - D16035 - Hcap Shower/Change/Toilet : Placement Date - 5/08/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Disabled Shower/Toilet

No Asbestos Found.

OS 602 - D16346 - Learning Unit - Standard With P.A.A. : Placement Date - 2/03/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017