


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Pilliga Public School (2870)
Region : New England
State Electorate : Barwon
Local Government Area : Narrabri

Initial Survey : Noel Arnold & Associates : 20 - May - 2008
Reviewed By : AECOM : 29 - Apr - 2016

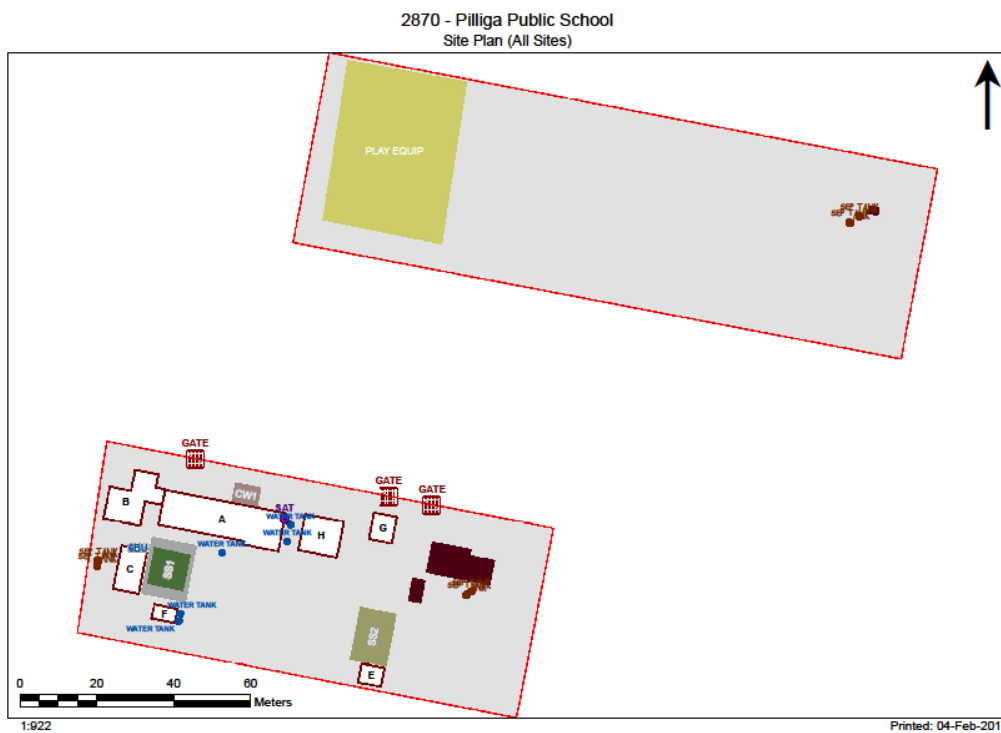

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Library - 1963 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Height Restriction 3.6M					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 2870/B00A/Eaves Linings/S4					No Asbestos Detected

Interior

B00A - R0001 - External Movement

No Asbestos

B00A - R0002 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles 2870/B00A/R0002/Floor Coverings Res/Textile/S7					No Asbestos Detected
-----------------------------	---	--	--	--	--	-----------------------------

B00A - R0003 - Craft Store

No Asbestos

B00A - R0004 - Darkroom Space

No Asbestos

B00A - R0005 - General Storeroom

No Asbestos

B00A - R0006 - K.L.A. Store

No Asbestos

B00A - R0007 - General Storeroom

No Asbestos

B00A - R0008 - General Storeroom

Wall Linings Internal	Flat AC Sheeting 2870/B00A/R0008/Wall Linings Internal/S6					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00A - R0009 - Reading Area

No Asbestos

B00A - R0010 - Home Base

No Asbestos

B00A - R0011 - Principal

Floor Coverings Res/Textile	Vinyl Tiles 2870/B00A/R0011/Floor Coverings Res/Textile/S5					No Asbestos Detected
-----------------------------	---	--	--	--	--	-----------------------------

B00A - R0012 - Duplicating Workroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Staff Facilities/General Learning - 1963 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 2870/B00B/Eaves Linings/S10	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	
Gable Verge Lining	Flat AC Sheeting 2870/B00B/Gable Verge Lining/S9	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting 2870/B00B/In-fill-panel/S2	9m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (White asbestos)	
Underfloor Voids	Fibre Cement Pipe 2870/B00B/Underfloor Voids/S8	7m	East	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
					Chrysotile (white asbestos)	

Interior

B00B - R0001 - External Movement

In-fill-panel	Flat AC Sheeting 2870/B00B/In-fill-panel/S2	1m	West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (White asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting 2870/B00B/R0001/Ceiling Structures/Linings/S3	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (White asbestos)	

B00B - R0002 - Staff Room

No Asbestos

B00B - R0004 - Home Base Store

No Asbestos

B00B - R0006 - Principal

No Asbestos

B00B - R0007 - Staff Room Annexe

No Asbestos

B00B - R0008 - Movement

No Asbestos

B00B - R0009 - Movement

No Asbestos

B00B - R0010 - Staff Toilet

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1969 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2870/B00C/Eaves Linings/S11					Chrysotile (white asbestos)

Interior

B00C - R0001 - Movement

No Asbestos

B00C - R0002 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	25m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2870/B00C/R0002/Partition Walls (Cubicles)/S1					Chrysotile (White asbestos)

B00C - R0003 - Movement

No Asbestos

B00C - R0004 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	30m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2870/B00C/R0002/Partition Walls (Cubicles)/S1					Chrysotile (White asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Shed - 1963 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B00E - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Other-Community Use - 2007 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00F - R0001 - Other-Community Use

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Administration - 2008 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00G - R0001 - Garage/Carport

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00H - R0001 - Reading Area

No Asbestos

B00H - R0002 - Resource/Toy Space

No Asbestos

B00H - R0003 - Staff Kitchen

No Asbestos

B00H - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017