


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Pleasant Hills Public School (2886)
Region : Riverina
State Electorate : Wagga Wagga
Local Government Area : Lockhart

Initial Survey : Noel Arnold & Associates : 23 - Feb - 2008
Reviewed By : Grencap-NAA : 07 - Jul - 2016

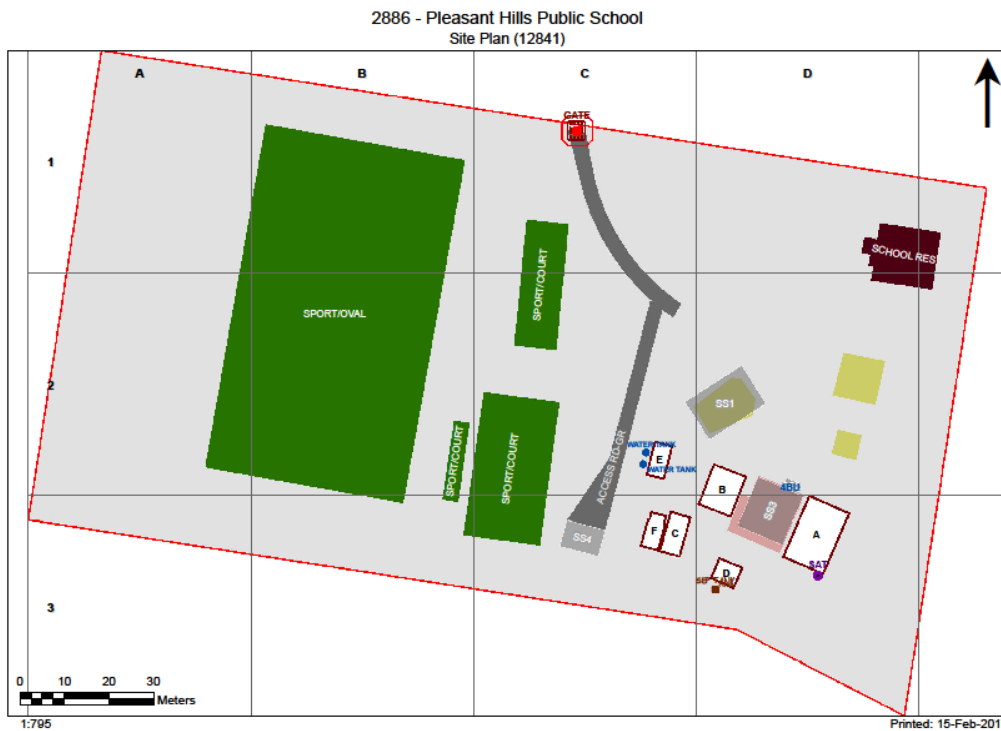

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1898 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 2886/B00B/Eaves Linings/S4	10m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

Interior

B00A - R0002 - Home Base

Wall lining to former heater space	Flat AC Sheeting 2886/B00A/R0001/Wall lining to former heater space/S3	2m2	North facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Adhesive 2886/B00B/R0002/Floor Coverings Res/Textile/S6					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2886/B00B/R0002/Floor Coverings Res/Textile/S5	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00A - R0003 - Clerical Office

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2886/B00B/R0002/Floor Coverings Res/Textile/S5	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 2886/B00B/R0002/Floor Coverings Res/Textile/S6					No Asbestos Detected

B00A - R0004 - Movement

Floor Coverings Res/Textile	Compressed AC Sheet 2886/B00C/R0002/Floor Coverings Res/Textile/S1					No Asbestos Detected
Switchboard panel	Resinous Board	1Unit(s)	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Electrical Hazard

B00A - R0005 - General Storeroom

No Asbestos

B00A - R0006 - Home Base Store

No Asbestos

B00A - R0007 - Home Base

Wall lining to former heater space	Flat AC Sheeting 2886/B00A/R0001/Wall lining to former heater space/S3	2m2	South east corner	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2886/B00B/R0002/Floor Coverings Res/Textile/S5	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 2886/B00B/R0002/Floor Coverings Res/Textile/S6					No Asbestos Detected

B00A - R0008 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2886/B00B/R0002/Floor Coverings Res/Textile/S5	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 2886/B00B/R0002/Floor Coverings Res/Textile/S6					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Staff Facilities/Library - 1970 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	15m2	North facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2886/B00B/Eaves Linings/S4					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

Interior

B00B - R0002 - Reading Area

Wall lining to former heater space	Flat AC Sheeting	2m2	North facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2886/B00A/R0001/Wall lining to former heater space/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2886/B00B/R0002/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	2886/B00B/R0002/Floor Coverings Res/Textile/S6					

B00B - R0004 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2886/B00B/Eaves Linings/S4					Chrysotile (white asbestos)

B00B - R0005 - Staff Kitchen

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Shed - 1919 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00C - R0003 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1971 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2886/B00B/Eaves Linings/S4					Chrysotile (white asbestos)

Interior

B00D - R0001 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2886/B00D/R0003/Wall Linings Internal/S2					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2886/B00D/R0003/Wall Linings Internal/S2					Chrysotile (white asbestos)

B00D - R0002 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2886/B00D/R0003/Wall Linings Internal/S2					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2886/B00D/R0003/Wall Linings Internal/S2					Chrysotile (white asbestos)

B00D - R0003 - Toilets - Boys

Wall Linings Internal	Flat AC Sheeting	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2886/B00D/R0003/Wall Linings Internal/S2					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2886/B00D/R0003/Wall Linings Internal/S2					Chrysotile (white asbestos)

B00D - R0004 - Cleaning Supplies

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2886/B00D/R0003/Wall Linings Internal/S2					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2886/B00D/R0003/Wall Linings Internal/S2					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Building Services - 1950 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00E - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Building Services - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00F - R0001 - External Movement

No Asbestos

B00F - R0002 - General Storeroom

No Asbestos

B00F - R0003 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017