


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Pomona Public School (2893)
Region : Western NSW
State Electorate : Murray
Local Government Area : Wentworth

Initial Survey : Noel Arnold & Associates : 13 - May - 2008
Reviewed By : Greencap-NAA : 17 - Jun - 2016

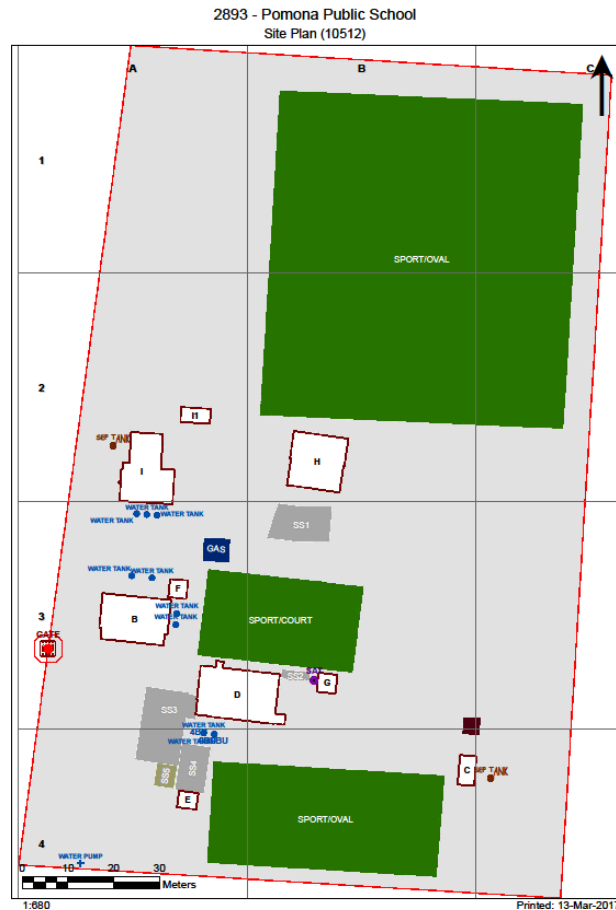

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library/General Learning - 1921 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2893/B00B/R0003/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling void	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					

Interior

B00B - R0001 - Home Base

Wall Linings Internal	Tilux	3m2	North facing, East facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2893/B00B/R0004/Wall Linings Internal/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2893/B00B/R0001/Floor Coverings Res/Textile/S5			Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	2893/B00B/R0001/Floor Coverings Res/Textile/S6					

B00B - R0002 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2893/B00B/R0003/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0003 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2893/B00B/R0003/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0005 - Reading Area

No Asbestos

B00B - R0006 - Special Programs Room

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1992 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2893/B00C/R0001/Ceiling Structures/Linings/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					

Interior

B00C - R0001 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2893/B00C/R0001/Ceiling Structures/Linings/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0002 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2893/B00C/R0001/Ceiling Structures/Linings/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0003 - Cleaning Supplies

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2893/B00C/R0001/Ceiling Structures/Linings/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00C - R0004 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2893/B00C/R0001/Ceiling Structures/Linings/S3			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Administration - 2005 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 2893/B00D/Exterior/Eaves Linings/S4					No Asbestos Detected
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					

Interior

B00D - R0001 - Principal	No Asbestos					
B00D - R0003 - External Movement	No Asbestos					
B00D - R0004 - Staff Kitchen	No Asbestos					
B00D - R0005 - Clerical Office	No Asbestos					
B00D - R0006 - Clerical Office	No Asbestos					
B00D - R0007 - External Movement	No Asbestos					
B00D - R0008 - General Storeroom	No Asbestos					
B00D - R0009 - Home Base	No Asbestos					
B00D - R0010 - External Movement	No Asbestos					
B00D - R0011 - Reading Area	No Asbestos					
B00D - R0012 - Special Programs Room	No Asbestos					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 2005 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00E - R0001 - Personal Effects Storage

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Building Services - 2005 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00F - R0001 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Pupil Facilities - 2005 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00G - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Building Services - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00H - R0001 - Sports Store

No Asbestos

B00H - R0002 - Covered Outdoor Learning Area

No Asbestos

B00H - R0003 - General Storeroom

No Asbestos

B00H - R0004 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017