


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Premier Public School (2900)
Region : New England
State Electorate : Upper Hunter
Local Government Area : Liverpool Plains

Initial Survey : Noel Arnold & Associates : 05 - Apr - 2008
Reviewed By : Greencap-NAA : 14 - Apr - 2016

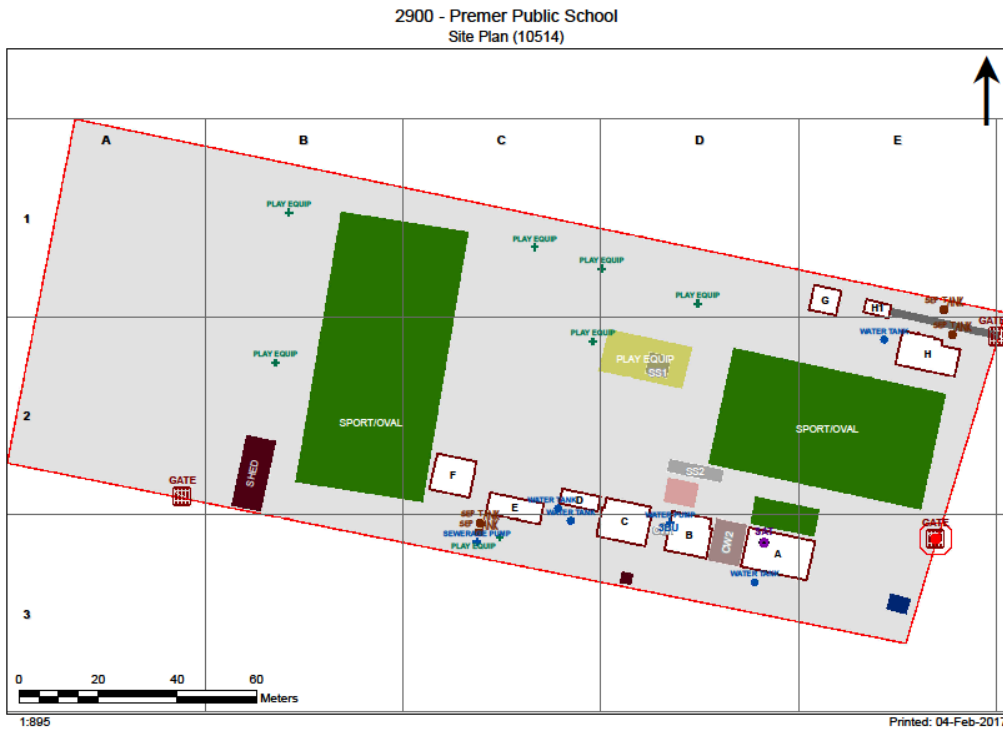

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - General Learning/Administration - 1946 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Void -Flat ceiling, pitched roof	Non Accessible Area - No manhole. Ceiling height approx. 3.5m					

Interior

B00A - R0001 - Movement

No Asbestos

B00A - R0003 - Home Base

Wall Linings Internal	Flat AC Sheeting	3m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)
2900/B00C/R0001/Wall Linings Internal/S3				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	61m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
2900/B00B/R0001/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0004 - Withdrawal Space - 1hb

No Asbestos

B00A - R0005 - Movement

No Asbestos

B00A - R0006 - Entry Vestibule

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2900/B00B/R0001/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	12m2	North & East	Good Condition (1)	Low (1)	Low Priority (2-3)
2900/B00A/R0006/Wall Linings Internal/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0007 - Principal

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2900/B00B/R0001/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	6m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
2900/B00A/R0006/Wall Linings Internal/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library/Staff Facilities - 1947 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	8m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2900/B00B/R0001/Ceiling Structures/Linings/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Void - Flat ceiling, pitched roof	Non Accessible Area					
	- No manhole and height restricted (approx 4m)					

Interior**B00B - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2900/B00B/R0001/Ceiling Structures/Linings/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)
In-fill Panel	Flat AC Sheeting	1.5m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2900/B00B/R0001/Ceiling Structures/Linings/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0002 - Reading Area

Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2900/B00B/R0001/Ceiling Structures/Linings/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0003 - Staff Room

Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2900/B00B/R0001/Ceiling Structures/Linings/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0004 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2900/B00B/R0001/Ceiling Structures/Linings/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2900/B00D/R0001/Wall Linings Internal/S2					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1955 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	12m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2900/B00C/R0001/Wall Linings Internal/S3				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling void - flat ceiling pitched roof -no access height 4 metres	No Asbestos Found					

Interior

B00C - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2900/B00C/R0001/Wall Linings Internal/S3				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Linings Internal	Flat AC Sheeting	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2900/B00C/R0001/Wall Linings Internal/S3				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
					Assumed Asbestos - Electrical Hazard	
In-Fill Panel	Flat AC Sheeting	3m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2900/B00C/R0001/Wall Linings Internal/S3				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00C - R0002 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Sheet					
	2900/B00C/R0005/Floor Coverings Res/Textile/S6				No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive					
	2900/B00C/R0005/Floor Coverings Res/Textile/S7				No Asbestos Detected	

B00C - R0003 - Home Base

heater Infill Panel	Compressed AC Sheet	2Unit(s)	South, West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
					Assumed Asbestos - Avoid damage.	

B00C - R0004 - General Storeroom

No Asbestos

B00C - R0005 - General Storeroom

Floor Coverings Res/Textile	Vinyl Sheet					
	2900/B00C/R0005/Floor Coverings Res/Textile/S6				No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive					
	2900/B00C/R0005/Floor Coverings Res/Textile/S7				No Asbestos Detected	



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Communal Facilities/Building Services - 1962 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	4m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2900/B00D/R0001/Wall Linings Internal/S2					Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Void - Flat Ceiling, Pitched Roof	Non Accessible Area - No manhole, height approx 3.5m					

Interior**B00D - R0001 - General Storeroom**

Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2900/B00D/R0001/Wall Linings Internal/S2					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2900/B00D/R0001/Wall Linings Internal/S2					Chrysotile (white asbestos)

B00D - R0002 - Sports Store

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2900/B00D/R0001/Wall Linings Internal/S2					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2900/B00D/R0001/Wall Linings Internal/S2					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1970 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	No Asbestos Found					
Ceiling Voids - Flat Roof	Non Accessible Area - No manhole approximately 3.5m high ceiling.					

Interior

B00E - R0001 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2900/B00E/R0005/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)	

Ceiling Structures/Linings	No Asbestos Found					
----------------------------	-------------------	--	--	--	--	--

B00E - R0002 - Staff Toilet

Ceiling Structures/Linings	No Asbestos Found					
----------------------------	-------------------	--	--	--	--	--

B00E - R0003 - Movement

Ceiling Structures/Linings	No Asbestos Found					
----------------------------	-------------------	--	--	--	--	--

B00E - R0004 - Cleaning Distributed Store

Ceiling Structures/Linings	No Asbestos Found					
----------------------------	-------------------	--	--	--	--	--

B00E - R0005 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2900/B00E/R0005/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)	

Ceiling Structures/Linings	No Asbestos Found					
----------------------------	-------------------	--	--	--	--	--

B00E - R0006 - Cleaning Supplies

No Asbestos						
-------------	--	--	--	--	--	--

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Multi Purpose Facilities - 2009 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

Interior

B00F - R0001 - Communal Space

No Asbestos

B00F - R0002 - General Storeroom

No Asbestos

B00F - R0003 - Practical Activities

No Asbestos

B00F - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Building Services - 2012 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
No Ceiling Void	No Asbestos Found

Interior

B00G - R0001 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Residential Facilities - 1970 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Void	Requires Inspection
Underfloor Void	Requires Inspection

Interior

B00H - R0001 - Residence - Laundry

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00H - R0002 - Residence - Pantry

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00H - R0003 - Residence - Kitchen

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00H - R0004 - Residence - Living

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00H - R0005 - Residence - Bedroom

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00H - R0006 - Residence - Movement

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00H - R0007 - Residence - Bathroom

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00H - R0008 - Residence - Bedroom

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00H - R0009 - Residence - Toilet

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00H - R0010 - Residence - Living

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00H - R0011 - Residence - Bedroom

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00H - R0012 - Residence - Movement

Recently Modified Space	Requires Inspection
-------------------------	---------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0H1 - Residential Facilities - - Brick Shed (Brick Shed)

Exterior

Ceiling Void	Requires Inspection
Underfloor Void	Requires Inspection

Interior

B0H1 - R0001 - Residence - Garage

Recently Modified Space	Requires Inspection
-------------------------	---------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017