


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Pretty Beach Public School (2902)  
**Region :** Hunter/Central Coast  
**State Electorate :** Terrigal  
**Local Government Area :** Gosford

**Initial Survey :** Noel Arnold & Associates : 21 - Mar - 2008  
**Reviewed By :** AECOM : 22 - Jun - 2016

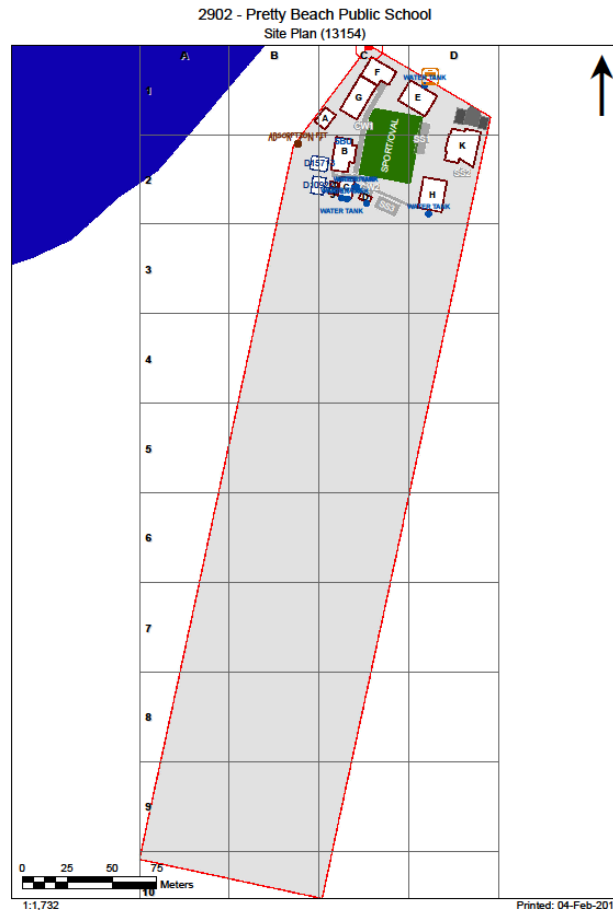

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning - 1930 - Timber (Timber)**

**Exterior**

Underfloor Voids - Packing to Floor Joists No Asbestos Found

Ceiling Voids - Flat Roof No Asbestos Found

**Interior**

**B00A - R0001 - Practical Activities - 1hb**

Wall Linings Internal	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2902/B00A/R0001/Wall Linings Internal/S2					<b>Chrysotile (white asbestos)</b>	

**B00A - R0003 - External Movement**

No Asbestos

**B00A - R0004 - Special Programs Room**

No Asbestos

**B00A - R0005 - Home Base Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Library/Pupil Facilities - 1926 - Timber (Timber)**

**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids - Flat Roof	Non Accessible Area - Height Restriction 3.6M BR0012

**Interior**

**B00B - R0004 - Library Office/Workroom**

No Asbestos

**B00B - R0005 - External Movement**

No Asbestos

**B00B - R0008 - Home Base**

No Asbestos

**B00B - R0009 - Home Base Store**

No Asbestos

**B00B - R0010 - Practical Activities - 1hb**

No Asbestos

**B00B - R0011 - Home Base Store**

No Asbestos

**B00B - R0012 - Home Base**

No Asbestos

**B00B - R0013 - Practical Activities - 1hb**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Pupil Facilities - 1930 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	10m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2902/B00C/Eaves Linings/S4					<b>Chrysotile (white asbestos)</b>

**Interior**

**B00C - R0001 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2902/B00C/R0005/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>

**B00C - R0002 - Cleaning Supplies**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2902/B00C/R0005/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>

**B00C - R0003 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2902/B00C/R0005/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>

**B00C - R0004 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2902/B00C/R0004/Ceiling Structures/Linings/S6					<b>Chrysotile (white asbestos)</b>

**B00C - R0005 - General Storeroom**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2902/B00C/R0005/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>

**B00C - R0006 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2902/B00C/R0005/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Pupil Facilities - 1930 - Timber (Timber)**

**Exterior**

Underfloor Voids - Packing to Floor Joists      No Asbestos Found

Ceiling Voids - Raked Ceiling      No Asbestos Found

**Interior**

**B00D - R0001 - Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning - 2008 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	No Asbestos Found

**Interior**

**B00E - R0001 - External Movement**

No Asbestos

**B00E - R0002 - Practical Activities - 1hb**

No Asbestos

**B00E - R0003 - Home Base Store**

No Asbestos

**B00E - R0004 - Home Base**

No Asbestos

**B00E - R0005 - Withdrawal Space - 2hb**

No Asbestos

**B00E - R0006 - Home Base**

No Asbestos

**B00E - R0007 - Home Base Store**

No Asbestos

**B00E - R0008 - Practical Activities - 1hb**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Library - 2009 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

**Interior**

**B00F - R0001 - Reading Area**

No Asbestos

**B00F - R0002 - Library Office/Workroom**

No Asbestos

**B00F - R0003 - Communications Room**

No Asbestos

**B00F - R0004 - K.L.A. Store**

No Asbestos

**B00F - R0005 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Administration - 2009 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

**Interior**

**B00G - R0001 - Entry Vestibule**

No Asbestos

**B00G - R0002 - Interview**

No Asbestos

**B00G - R0003 - Staff Room**

No Asbestos

**B00G - R0004 - Staff Toilet**

No Asbestos

**B00G - R0005 - Staff Toilet**

No Asbestos

**B00G - R0006 - Main Switch Board**

No Asbestos

**B00G - R0007 - Cleaning Distributed Store**

No Asbestos

**B00G - R0008 - Movement**

No Asbestos

**B00G - R0009 - General Storeroom**

No Asbestos

**B00G - R0010 - Principal**

No Asbestos

**B00G - R0011 - Toilets-Unisex**

No Asbestos

**B00G - R0012 - Access Shower/Toilet**

No Asbestos

**B00G - R0013 - Sick Bay**

No Asbestos

**B00G - R0014 - Clerical Office/Workroom**

No Asbestos

**B00G - R0015 - External Movement**

No Asbestos

**B00G - R0016 - External Movement**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

**Interior**

**B00H - R0001 - External Movement**

No Asbestos

**B00H - R0002 - Practical Activities - 1hb**

No Asbestos

**B00H - R0003 - Home Base Store**

No Asbestos

**B00H - R0004 - Home Base**

No Asbestos

**B00H - R0005 - Withdrawal Space - 2hb**

No Asbestos

**B00H - R0006 - Home Base**

No Asbestos

**B00H - R0007 - Home Base Store**

No Asbestos

**B00H - R0008 - Practical Activities - 1hb**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00I - Storage - 2010 - Metal Shed (Metal Shed)**

**Exterior**

Underfloor Voids - Slab on Ground      Non Accessible Area  
 - Area inaccessible

Ceiling Voids      No Asbestos Found

**Interior**

**B00I - R0001 - P.E. Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Building Services - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground      Non Accessible Area  
 - Area inaccessible

Ceiling Voids      No Asbestos Found

**Interior**

**B00J - R0001 - Garden Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Pre-School Facilities/Building Services - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

**Interior**

**B00K - R0001 - External Movement**

No Asbestos

**B00K - R0002 - Movement**

No Asbestos

**B00K - R0003 - Clerical Office - Pre**

No Asbestos

**B00K - R0004 - Staff Toilet - Pre**

No Asbestos

**B00K - R0005 - Laundry - Pre**

No Asbestos

**B00K - R0006 - Movement**

No Asbestos

**B00K - R0007 - Stairs**

No Asbestos

**B00K - R0008 - Kitchen - Pre**

No Asbestos

**B00K - R0009 - Other-Community Use**

No Asbestos

**B00K - R0010 - Toilets - Boys/Girls - Pre**

No Asbestos

**B00K - R0011 - Other-Community Use**

No Asbestos

**B00K - R0012 - Toilets - Boys/Girls - Pre**

No Asbestos

**B00K - R0013 - General Storeroom - Pre**

No Asbestos

**B00K - R0014 - Stairs**

No Asbestos

**B00K - R1001 - Stairs**

No Asbestos

**B00K - R1002 - Movement**

No Asbestos

**B00K - R1003 - Staff Room**

No Asbestos

**B00K - R1004 - Movement**

No Asbestos

**B00K - R1005 - Staff Toilet - Pre**

No Asbestos

**B00K - R1006 - Staff Shower/Change**

No Asbestos

**B00K - R1007 - General Storeroom - Pre**

No Asbestos

**B00K - R1008 - Other**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00K - R9001 - Other</b>						
No Asbestos						
<b>B00K - R9002 - Staff Toilet</b>						
No Asbestos						
<b>B00K - R9003 - General Storeroom</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**NS 300 - D10922 - FSU /Bulk Store/Toilet : Placement Date - 16/06/2004**

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Canteen**

No Asbestos Found.

**R2 - Bulk Store**

No Asbestos Found.

**R3 - Cleaning Supplies**

No Asbestos Found.

**R4 - Toilets-Boys/Girls**

No Asbestos Found.

**OS 602 - D15713 - Learning Unit - Standard With P.A.A. : Placement Date - 11/02/2016**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017