


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Punchbowl Public School (2910)
Region : South Western Sydney
State Electorate : Lakemba
Local Government Area : Canterbury

Initial Survey : Noel Arnold & Associates : 04 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 11 - Sep - 2015

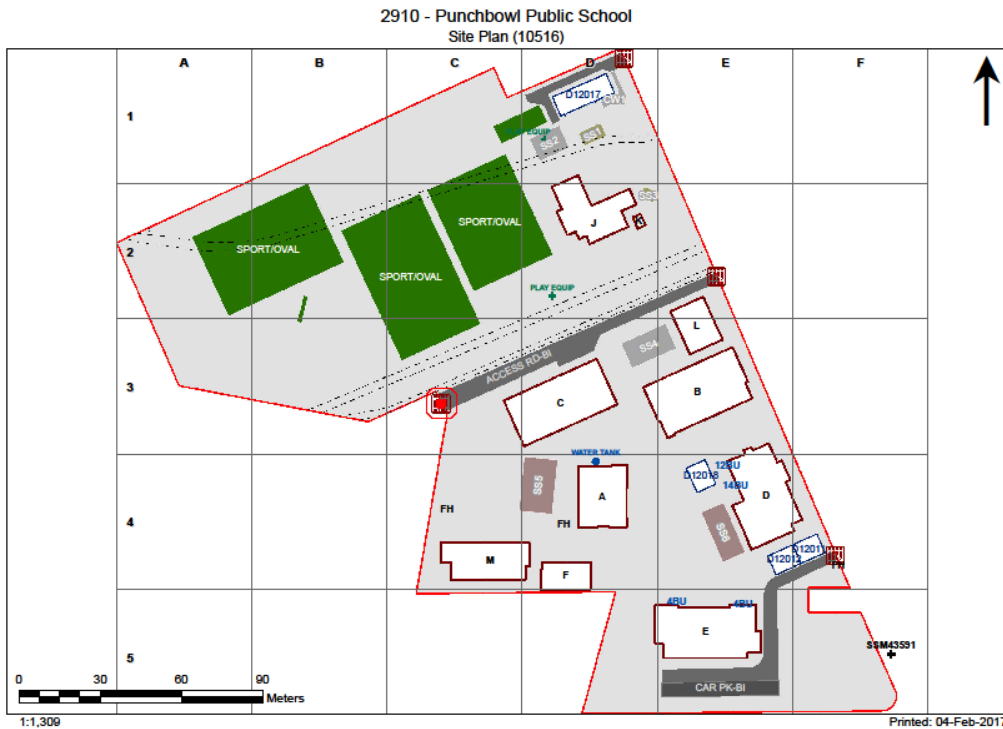

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result
B00A - Administration/Library - 1974 - Brick/Block (Brick/Block)						
Exterior						
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Interior						
B00A - R0001 - Clerical Office (12.93 m2)						
Ceiling Structures/Linings	Vermiculite					
	2910/B00A/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0002 - Movement (1.95 m2)						
No Asbestos						
B00A - R0003 - Entry Vestibule (21.19 m2)						
Ceiling Structures/Linings	Vermiculite					
	2910/B00A/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0004 - Deputy Principal (13.06 m2)						
Ceiling Structures/Linings	Vermiculite					
	2910/B00A/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0005 - Principal (22.77 m2)						
Ceiling Structures/Linings	Vermiculite					
	2910/B00A/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0006 - Deputy Principal (13.32 m2)						
Ceiling Structures/Linings	Vermiculite					
	2910/B00A/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0007 - Movement (0.52 m2)						
No Asbestos						
B00A - R0008 - Movement (20.01 m2)						
Ceiling Structures/Linings	Vermiculite					
	2910/B00A/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0009 - Distribution Board (0.58 m2)						
						Note: No inspection of live electrical installation.
No Asbestos						
B00A - R0010 - General Storeroom (5.16 m2)						
Ceiling Structures/Linings	Vermiculite					
	2910/B00A/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	2910/B00A/R0023/Floor Coverings Res/Textile/S4					No Asbestos Detected
B00A - R0011 - Movement (6.98 m2)						
Ceiling Structures/Linings	Vermiculite					
	2910/B00A/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	2910/B00A/R0023/Floor Coverings Res/Textile/S4					No Asbestos Detected
B00A - R0012 - Staff Toilet (8.35 m2)						
Ceiling Structures/Linings	Vermiculite					
	2910/B00A/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0013 - Staff Toilet (8.33 m2)						
Ceiling Structures/Linings	Vermiculite		2910/B00A/R0003/Ceiling Structures/Linings/S3			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0015 - General Storeroom (12.28 m2)						
Ceiling Structures/Linings	Vermiculite		2910/B00A/R0003/Ceiling Structures/Linings/S3			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles		2910/B00A/R0023/Floor Coverings Res/Textile/S4			No Asbestos Detected
B00A - R0016 - Movement (18.99 m2)						
Ceiling Structures/Linings	Vermiculite		2910/B00A/R0003/Ceiling Structures/Linings/S3			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0017 - Cleaning Distributed Store (5.35 m2)						
Ceiling Structures/Linings	Vermiculite		2910/B00A/R0003/Ceiling Structures/Linings/S3			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0018 - Clerical Office (12.22 m2)						
Ceiling Structures/Linings	Vermiculite		2910/B00A/R0003/Ceiling Structures/Linings/S3			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0019 - Interview (15.02 m2)						
Ceiling Structures/Linings	Vermiculite		2910/B00A/R0003/Ceiling Structures/Linings/S3			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0020 - Staff Toilet (5.46 m2)						
Ceiling Structures/Linings	Vermiculite		2910/B00A/R0003/Ceiling Structures/Linings/S3			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0021 - Staff Toilet (3.81 m2)						
Ceiling Structures/Linings	Vermiculite		2910/B00A/R0003/Ceiling Structures/Linings/S3			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0022 - Sick Bay (8.61 m2)						
Ceiling Structures/Linings	Vermiculite		2910/B00A/R0003/Ceiling Structures/Linings/S3			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles		2910/B00A/R0023/Floor Coverings Res/Textile/S4			No Asbestos Detected
B00A - R0023 - Duplicating Workroom (12.67 m2)						
Ceiling Structures/Linings	Vermiculite		2910/B00A/R0003/Ceiling Structures/Linings/S3			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles		2910/B00A/R0023/Floor Coverings Res/Textile/S4			No Asbestos Detected
B00A - R0024 - Staff Kitchen (17.98 m2)						
Ceiling Structures/Linings	Vermiculite		2910/B00A/R0003/Ceiling Structures/Linings/S3			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	2910/B00A/R0023/Floor Coverings Res/Textile/S4					No Asbestos Detected
B00A - R0025 - Staff Room (66.88 m2)						
Ceiling Structures/Linings	Vermiculite					
	2910/B00A/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0026 - Stairs (4.96 m2)						
Ceiling Structures/Linings	Vermiculite					
	2910/B00A/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	2910/B00A/R0023/Floor Coverings Res/Textile/S4					No Asbestos Detected
B00A - R0027 - Cleaning Distributed Store (5.75 m2)						
No Asbestos						
B00A - R1002 - Library Office/Workroom (7.07 m2)						
Ceiling Structures/Linings	Vermiculite					
	2910/B00A/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1003 - Communications Room (14.4 m2)						
Ceiling Structures/Linings	Vermiculite					
	2910/B00A/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1004 - Library Office/Workroom (22.56 m2)						
Ceiling Structures/Linings	Vermiculite					
	2910/B00A/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1005 - Movement (5.21 m2)						
Ceiling Structures/Linings	Vermiculite					
	2910/B00A/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1006 - Distribution Board (0.48 m2)						
					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Vermiculite					
	2910/B00A/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1007 - Movement (7.14 m2)						
Ceiling Structures/Linings	Vermiculite					
	2910/B00A/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	2910/B00A/R0023/Floor Coverings Res/Textile/S4					No Asbestos Detected
B00A - R1008 - K.L.A. Store (13.07 m2)						
Ceiling Structures/Linings	Vermiculite					
	2910/B00A/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1009 - K.L.A. Store (13.2 m2)						
Ceiling Structures/Linings	Vermiculite					
	2910/B00A/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1010 - Reading Area (239.33 m2)						
Ceiling Structures/Linings	Vermiculite					
	2910/B00A/R0003/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R1011 - Special Programs Room (35.8 m2)						
Ceiling Structures/Linings	Vermiculite		2910/B00A/R0003/Ceiling Structures/Linings/S3			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1012 - Stairs (17.08 m2)						
Ceiling Structures/Linings	Vermiculite		2910/B00A/R0003/Ceiling Structures/Linings/S3			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles		2910/B00A/R0023/Floor Coverings Res/Textile/S4			No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Pupil Facilities - 1974 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00B - R0001 - Movement (120.88 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2910/B00B/R0001/Ceiling Structures/Linings/S17					Chrysotile (white asbestos)	

B00B - R0002 - Home Base (71.86 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2910/B00B/R0010/Wall Linings Internal/S20					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00B - R0003 - Practical Activities - 1hb (14.04 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
2910/B00B/R0019/Floor Coverings Res/Textile/S18						

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
2910/B00B/R0010/Wall Linings Internal/S20					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00B - R0004 - Movement (3 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2910/B00E/R0013/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	

B00B - R0005 - Toilets - Girls (16.97 m2)

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2910/B00E/R0013/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	

Partition Walls (Cubicles)	Compressed AC Sheet	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2910/B00B/R0015/Partition Walls (Cubicles)/S19					Chrysotile (white asbestos)	

B00B - R0006 - Personal Effects Storage (8.97 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
2910/B00B/R0019/Floor Coverings Res/Textile/S18						

B00B - R0007 - General Storeroom (15.08 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
2910/B00B/R0019/Floor Coverings Res/Textile/S18						

B00B - R0008 - Toilets - Boys/Girls (4.14 m2)

No Asbestos

B00B - R0009 - Withdrawal Space - 1hb (17.32 m2)

No Asbestos

B00B - R0010 - Outdoor Learning Area (34.03 m2)

Wall Linings Internal	Vermiculite					Limited Samples Taken
2910/B00B/R0010/Wall Linings Internal/S20					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00B - R0011 - Outdoor Learning Area (33.91 m2)

Wall Linings Internal	Vermiculite					Limited Samples Taken
2910/B00B/R0010/Wall Linings Internal/S20					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00B - R0012 - Toilets - Boys/Girls (4.09 m2)

No Asbestos

B00B - R0013 - Staff Toilet (4.41 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00B - R0014 - Cleaning Distributed Store (5.68 m2)						
No Asbestos						
B00B - R0015 - Toilets - Boys (14.14 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2910/B00E/R0013/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2910/B00B/R0015/Partition Walls (Cubicles)/S19				Chrysotile (white asbestos)	
B00B - R0016 - Distribution Board (4.89 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B00B - R0017 - Sports Store (5.76 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2910/B00E/R0013/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)	
B00B - R0018 - Movement (2.9 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2910/B00E/R0013/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)	
B00B - R0019 - Personal Effects Storage (9.03 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	2910/B00B/R0019/Floor Coverings Res/Textile/S18				No Asbestos Detected	
B00B - R0020 - Withdrawal Space - 1hb (17.37 m2)						
No Asbestos						
B00B - R0021 - Practical Activities - 1hb (14.14 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	2910/B00B/R0019/Floor Coverings Res/Textile/S18				No Asbestos Detected	
Ceiling Structures/Linings	Vermiculite					
	2910/B00B/R0010/Wall Linings Internal/S20				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B00B - R0022 - Home Base (72.16 m2)						
Ceiling Structures/Linings	Vermiculite					
	2910/B00B/R0010/Wall Linings Internal/S20				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B00B - R0023 - Home Base (71.1 m2)						
Ceiling Structures/Linings	Vermiculite					
	2910/B00B/R0010/Wall Linings Internal/S20				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B00B - R0024 - Practical Activities - 1hb (12.69 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	2910/B00B/R0019/Floor Coverings Res/Textile/S18				No Asbestos Detected	
Ceiling Structures/Linings	Vermiculite					
	2910/B00B/R0010/Wall Linings Internal/S20				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B00B - R0025 - Home Base (75.25 m2)						
Ceiling Structures/Linings	Vermiculite					
	2910/B00B/R0010/Wall Linings Internal/S20				Limited Samples Taken	
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					
B00B - R0026 - Practical Activities - 1hb (13.02 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	2910/B00B/R0019/Floor Coverings Res/Textile/S18					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite					
	2910/B00B/R0010/Wall Linings Internal/S20					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00C - Communal Facilities/Pupil Facilities - 1950 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00C - R0001 - Movement (201.77 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	2910/B00E/R1002/Wall Linings Internal/S9					
Upstand Panel	Flat AC Sheeting	6m2	West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2910/B00E/R1014/Heater Floor Panel/S10					Chrysotile (white asbestos)

B00C - R0002 - Canteen Office/Store (10.83 m2)

Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2910/B00C/R0011/Floor Coverings Res/Textile/S21					Chrysotile (white asbestos)

B00C - R0003 - Canteen (39.78 m2)

Floor Coverings Res/Textile	Vinyl Tiles	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2910/B00C/R0011/Floor Coverings Res/Textile/S21					Chrysotile (white asbestos)

B00C - R0004 - Canteen Office/Store (3.91 m2)

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2910/B00C/R0011/Floor Coverings Res/Textile/S21					Chrysotile (white asbestos)

B00C - R0005 - Staff Toilet (3.5 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00C - R0006 - Distribution Board (0.28 m2) Note: No inspection of live electrical installation.

No Asbestos						
-------------	--	--	--	--	--	--

B00C - R0007 - Cleaning Supplies (12.81 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00C - R0008 - Garden Store (5.61 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00C - R0009 - P.E. Store (11.79 m2)

Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2910/B00C/R0011/Floor Coverings Res/Textile/S21					Chrysotile (white asbestos)

B00C - R0010 - Distribution Board (0.59 m2) Note: No inspection of live electrical installation.

No Asbestos						
-------------	--	--	--	--	--	--

B00C - R0011 - Movement (46.35 m2)

Floor Coverings Res/Textile	Vinyl Tiles	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2910/B00C/R0011/Floor Coverings Res/Textile/S21					Chrysotile (white asbestos)

B00C - R0012 - Cleaning Distributed Store (8.49 m2)

Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2910/B00C/R0011/Floor Coverings Res/Textile/S21					Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2910/B00E/R0013/Partition Walls (Cubicles)/S6					Chrysotile (white asbestos)

B00C - R0013 - Raised Platform (25.41 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00C - R0014 - Hall Chair Store (4.35 m2)

No Asbestos						
-------------	--	--	--	--	--	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2910/B00E/R0013/Partition Walls (Cubicles)/S6				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2910/B00E/R0022/Floor Coverings Res/Textile/S7					
Expansion Gap	Mastic					No Asbestos Detected
	2910/B00E/R1002/Ceiling Structures/Linings/S8					

B00C - R0015 - Communal Space (244.66 m2)

No Asbestos

B00C - R0016 - Hall Chair Store (4.35 m2)

No Asbestos

B00C - R0017 - Toilets - Girls (8.49 m2)

No Asbestos

B00C - R0018 - Toilets - Boys (8.76 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning/Communal Facilities - 1928 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids No Asbestos Found

Interior

B00D - R0001 - Home Base (47.55 m2)

No Asbestos

B00D - R0002 - Home Base (61.42 m2)

No Asbestos

B00D - R0003 - Home Base (46.97 m2)

No Asbestos

B00D - R0004 - Home Base (46.51 m2)

No Asbestos

B00D - R0005 - Movement (41.65 m2)

No Asbestos

B00D - R0006 - Toilets - Boys (17.89 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
2910/B00D/R0006/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
2910/B00D/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

B00D - R0007 - Movement (26.59 m2)

No Asbestos

B00D - R0008 - Community Clinic (11.81 m2)

No Asbestos

B00D - R0009 - Staff Room Annexe (5.1 m2)

No Asbestos

B00D - R0010 - Home Base Store (26.95 m2)

No Asbestos

B00D - R0011 - General Storeroom (16.03 m2)

No Asbestos

B00D - R0012 - Staff Toilet (3.76 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
2910/B00D/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

B00D - R0013 - Toilets - Girls (17.18 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2910/B00D/R0006/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2910/B00D/R0006/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

B00D - R0014 - Movement (11.13 m2)

No Asbestos

B00D - R0015 - Practical Activity Area (148.59 m2)

No Asbestos

B00D - R0016 - Practical Activities - 1hb (11.39 m2)

No Asbestos

B00D - R0017 - Movement (12.23 m2)

No Asbestos

B00D - R0018 - Movement (3.27 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00D - R0019 - Cleaning Distributed Store (4.79 m2)

No Asbestos

B00D - R0020 - Stairs (1.26 m2)

No Asbestos

B00D - R1001 - Home Base (49.07 m2)

No Asbestos

B00D - R1002 - Home Base (47.1 m2)

No Asbestos

B00D - R1003 - Home Base (48.85 m2)

No Asbestos

B00D - R1004 - Home Base (49.26 m2)

No Asbestos

B00D - R1005 - Practical Activities - 1hb (3.68 m2)

No Asbestos

B00D - R1006 - Movement (72.91 m2)

No Asbestos

B00D - R1007 - Home Base Store (32.34 m2)

No Asbestos

B00D - R1008 - Stairs (13.27 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1926 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	Corrugated AC Sheeting	4m2	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	Medium Priority (4-5)
	2910/B00E/Underfloor Voids/S25					Chrysotile (white asbestos)

Interior

B00E - R0001 - Movement (15.78 m2)

No Asbestos

B00E - R0002 - Movement (22.63 m2)

No Asbestos

B00E - R0003 - Movement (1.51 m2)

No Asbestos

B00E - R0004 - Distribution Board (0.66 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00E - R0005 - Interview (15.15 m2)

No Asbestos

B00E - R0006 - Home Base (47.69 m2)

No Asbestos

B00E - R0007 - Home Base (46.45 m2)

No Asbestos

B00E - R0008 - Home Base (48.4 m2)

No Asbestos

B00E - R0009 - Home Base - M (48.12 m2)

No Asbestos

B00E - R0010 - Movement (3.85 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2910/B00E/R0010/Ceiling Structures/Linings/S26					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00E - R0011 - Movement (19.8 m2)

Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2910/B00E/R0011/Ceiling Structures/Linings/S27					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00E - R0012 - Movement (7.45 m2)

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2910/B00E/R0012/Ceiling Structures/Linings/S28					Chrysotile (white asbestos)

B00E - R0013 - Toilets - Girls (17.87 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2910/B00E/R0013/Partition Walls (Cubicles)/S6					Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2910/B00E/R0013/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)

B00E - R0014 - Staff Toilet (3.03 m2)

No Asbestos

B00E - R0015 - General Storeroom (13.21 m2)

No Asbestos

B00E - R0016 - General Storeroom (21.9 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
No Asbestos						
B00E - R0017 - Movement (20.77 m2)						
No Asbestos						
B00E - R0018 - Movement (49.55 m2)						
No Asbestos						
B00E - R0019 - Practical Activity Area (101.92 m2)						
No Asbestos						
B00E - R0020 - Practical Activities - 1hb (16.76 m2)						
No Asbestos						
B00E - R0021 - Movement (11.02 m2)						
No Asbestos						
B00E - R0022 - General Storeroom (12.43 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	2910/B00E/R0022/Floor Coverings Res/Textile/S7					No Asbestos Detected
B00E - R0023 - General Storeroom (3.03 m2)						
No Asbestos						
B00E - R0024 - Toilets - Boys (21.78 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2910/B00E/R0013/Partition Walls (Cubicles)/S6					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2910/B00E/R0013/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)
B00E - R0025 - Staff Toilet (1.6 m2)						
No Asbestos						
B00E - R0026 - Stairs (10.59 m2)						
No Asbestos						
B00E - R0027 - Stairs (10.96 m2)						
No Asbestos						
B00E - R1001 - General Storeroom (8.97 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2910/B00E/R1003/Ceiling Structures/Linings/S29					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					
	2910/B00E/R0022/Floor Coverings Res/Textile/S7					No Asbestos Detected
B00E - R1002 - Plant (33 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	2910/B00E/R1002/Ceiling Structures/Linings/S8					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting					
	2910/B00E/R1002/Wall Linings Internal/S9					No Asbestos Detected
B00E - R1003 - General Storeroom (7.09 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	2910/B00E/R0022/Floor Coverings Res/Textile/S7					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2910/B00E/R1003/Ceiling Structures/Linings/S29					Chrysotile (white asbestos)
B00E - R1004 - Home Base (50.88 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2910/B00E/R1003/Ceiling Structures/Linings/S29					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00E - R1005 - Special Programs Room (50.98 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2910/B00E/R1003/Ceiling Structures/Linings/S29					Chrysotile (white asbestos)	
B00E - R1006 - Home Base (50.88 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2910/B00E/R1003/Ceiling Structures/Linings/S29					Chrysotile (white asbestos)	
B00E - R1007 - Home Base (49.88 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2910/B00E/R1003/Ceiling Structures/Linings/S29					Chrysotile (white asbestos)	
B00E - R1008 - General Storeroom (6.08 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
2910/B00E/R0022/Floor Coverings Res/Textile/S7					No Asbestos Detected	
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2910/B00E/R1003/Ceiling Structures/Linings/S29					Chrysotile (white asbestos)	
B00E - R1009 - General Storeroom (8.88 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
2910/B00E/R0022/Floor Coverings Res/Textile/S7					No Asbestos Detected	
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2910/B00E/R1003/Ceiling Structures/Linings/S29					Chrysotile (white asbestos)	
B00E - R1010 - Staff Toilet (2.31 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2910/B00E/R1003/Ceiling Structures/Linings/S29					Chrysotile (white asbestos)	
B00E - R1011 - Movement (5.44 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2910/B00E/R1003/Ceiling Structures/Linings/S29					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					
2910/B00E/R0022/Floor Coverings Res/Textile/S7					No Asbestos Detected	
B00E - R1012 - Movement (11.95 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2910/B00E/R1003/Ceiling Structures/Linings/S29					Chrysotile (white asbestos)	
B00E - R1013 - Home Base Store (17.3 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2910/B00E/R1003/Ceiling Structures/Linings/S29					Chrysotile (white asbestos)	
B00E - R1014 - Practical Activity Area (100.32 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	101m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2910/B00E/R1003/Ceiling Structures/Linings/S29					Chrysotile (white asbestos)	
Heater Floor Panel	Flat AC Sheeting	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
2910/B00E/R1014/Heater Floor Panel/S10					Chrysotile (white asbestos)	
B00E - R1015 - Practical Activities - 1hb (7.74 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2910/B00E/R1003/Ceiling Structures/Linings/S29					Chrysotile (white asbestos)	
B00E - R1016 - Withdrawal Space - 1hb (17.34 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2910/B00E/R1003/Ceiling Structures/Linings/S29					Chrysotile (white asbestos)	
B00E - R1017 - Movement (12.58 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2910/B00E/R1003/Ceiling Structures/Linings/S29					Chrysotile (white asbestos)	
B00E - R1018 - Movement (7.55 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
2910/B00E/R0022/Floor Coverings Res/Textile/S7					No Asbestos Detected	
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2910/B00E/R1003/Ceiling Structures/Linings/S29					Chrysotile (white asbestos)	
B00E - R1019 - Stairs (12.25 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2910/B00E/R1003/Ceiling Structures/Linings/S29					Chrysotile (white asbestos)	
B00E - R1020 - Stairs (12.25 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2910/B00E/R1003/Ceiling Structures/Linings/S29					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Other-Community Use - 1950 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	18m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	2910/B00F/Eaves Linings/S31				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris	NA	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	Medium Priority (4-5)
	2910/B00F/Underfloor Voids/S30				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Interior

B00F - R0001 - Kiln Room (5.03 m2)

Kiln Floor Panel	Flat AC Sheeting					No Asbestos Detected
	2910/B00F/R0001/Kiln Floor Panel/S24					

B00F - R0002 - Craft Store (26.09 m2)

No Asbestos

B00F - R0005 - External Movement (35.56 m2)

Ceiling Structures/Linings	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2910/B00F/R0005/Ceiling Structures/Linings/S11				Chrysotile (white asbestos) , Amosite (brown asbestos)	
In-fill-panel	Flat AC Sheeting	2m	West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	2910/B00F/R0005/In-fill-panel/S12				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00F - R0006 - Schools As Community Centres Program (7.33 m2)

No Asbestos

B00F - R0007 - Schools As Community Centres Program (6.86 m2)

No Asbestos

B00F - R0008 - Schools As Community Centres Program (92.56 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Pre-School Facilities - 1975 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Infill panels to perimeter of roofspace 2910/B00J/Ceiling Voids/S32					No Asbestos Detected
Underfloor Voids	No Asbestos Found					

Interior

B00J - R0001 - Movement (70.17 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2910/B00J/R0010/Ceiling Structures/Linings/S22					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B00J - R0002 - General Storeroom - Pre (10.53 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2910/B00J/R0010/Ceiling Structures/Linings/S22					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B00J - R0003 - Toilets - Boys/Girls - Pre (10.79 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2910/B00J/R0010/Ceiling Structures/Linings/S22					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

Wall Linings Internal	Flat AC Sheeting 2910/B00J/R0016/Wall Linings Internal/S23					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

B00J - R0004 - Home Base - Pre (64.8 m2)

Wall Linings Internal	Flat AC Sheeting 2910/B00J/R0016/Wall Linings Internal/S23					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

B00J - R0005 - Withdrawal - Pre (6.2 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2910/B00J/R0010/Ceiling Structures/Linings/S22					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B00J - R0006 - General Storeroom - Pre (7.42 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2910/B00J/R0010/Ceiling Structures/Linings/S22					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B00J - R0007 - Distribution Board (0.4 m2) Note: No inspection of live electrical installation.

No Asbestos

B00J - R0008 - Staff Toilet - Pre (4.18 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2910/B00J/R0010/Ceiling Structures/Linings/S22					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B00J - R0009 - Kitchen - Pre (8.78 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2910/B00J/R0010/Ceiling Structures/Linings/S22					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B00J - R0010 - Movement (8.12 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2910/B00J/R0010/Ceiling Structures/Linings/S22					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B00J - R0012 - Clerical Office - Pre (13.68 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2910/B00J/R0010/Ceiling Structures/Linings/S22					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B00J - R0013 - General Storeroom - Pre (5.81 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2910/B00J/R0010/Ceiling Structures/Linings/S22					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B00J - R0014 - Withdrawal - Pre (6.39 m2)

Ceiling Structures/Linings	Flat AC Sheeting 2910/B00J/R0010/Ceiling Structures/Linings/S22					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B00J - R0015 - Home Base - Pre (70.09 m2)

Wall Linings Internal	Flat AC Sheeting 2910/B00J/R0016/Wall Linings Internal/S23					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

B00J - R0016 - Toilets - Boys/Girls - Pre (10.32 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting		2910/B00J/R0010/Ceiling Structures/Linings/S22			No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting		2910/B00J/R0016/Wall Linings Internal/S23			No Asbestos Detected
B00J - R0017 - Staff Room - Pre (23.18 m2)						
No Asbestos						
B00J - R0018 - Movement (11.68 m2)						
Ceiling Structures/Linings	Flat AC Sheeting		2910/B00J/R0010/Ceiling Structures/Linings/S22			No Asbestos Detected
B00J - R0019 - Movement (35.34 m2)						
No Asbestos						
B00J - R0020 - General Storeroom - Pre (2.23 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Shed - 1972 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00K - R0001 - General Storeroom - Pre (11.81 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - General Learning - 2006 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00L - R0001 - Movement (38.49 m2)

No Asbestos

B00L - R0002 - Practical Activities - 1hb (19.4 m2)

No Asbestos

B00L - R0003 - Home Base Store (6.02 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0004 - Home Base (59.2 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0005 - Withdrawal Space - 2hb (11.36 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0006 - Home Base (59.19 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0007 - Home Base Store (6.02 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0008 - Practical Activities - 1hb (19.41 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00M - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00M - R0001 - External Movement (91.36 m2)

No Asbestos

B00M - R0002 - Practical Activities/Movement - 1hb (19.02 m2)

No Asbestos

B00M - R0003 - Home Base Store (6.22 m2)

No Asbestos

B00M - R0004 - Home Base (60.27 m2)

No Asbestos

B00M - R0005 - Withdrawal Space - 2hb (11.52 m2)

No Asbestos

B00M - R0006 - Home Base (60.64 m2)

No Asbestos

B00M - R0007 - Home Base Store (6.26 m2)

No Asbestos

B00M - R0008 - Practical Activities/Movement - 1hb (18.33 m2)

No Asbestos

B00M - R0009 - No Access (0.6 m2)

No Asbestos

B00M - R0010 - Withdrawal Space - 1hb (7.62 m2)

No Asbestos

B00M - R0011 - Home Base Store (6.07 m2)

No Asbestos

B00M - R0012 - Home Base (58.61 m2)

No Asbestos

B00M - R0013 - Practical Activities/Movement - 1hb (18.7 m2)

No Asbestos

B00M - R0014 - External Stairs (18.97 m2)

No Asbestos

B00M - R1001 - External Movement (76.83 m2)

No Asbestos

B00M - R1002 - Practical Activities/Movement - 1hb (19.03 m2)

No Asbestos

B00M - R1003 - Home Base Store (6.09 m2)

No Asbestos

B00M - R1004 - Home Base (60.62 m2)

No Asbestos

B00M - R1005 - Withdrawal Space - 2hb (11.77 m2)

No Asbestos

B00M - R1006 - Home Base (60.51 m2)

No Asbestos

B00M - R1007 - Home Base Store (6.12 m2)

No Asbestos

B00M - R1008 - Practical Activities/Movement - 1hb (18.97 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00M - R1009 - Withdrawal Space - 1hb (7.62 m2)

No Asbestos

B00M - R1010 - Home Base Store (6.07 m2)

No Asbestos

B00M - R1011 - Home Base (58.63 m2)

No Asbestos

B00M - R1012 - Practical Activities/Movement - 1hb (19.45 m2)

No Asbestos

B00M - R1013 - External Stairs (19.38 m2)

No Asbestos

B00M - R9001 - Movement (8.54 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D12011 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 601 - D12012 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2


R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 611 - D12017 - Learning Unit - Double With Toilets : Placement Date - 5/11/2008

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	25.92 m2

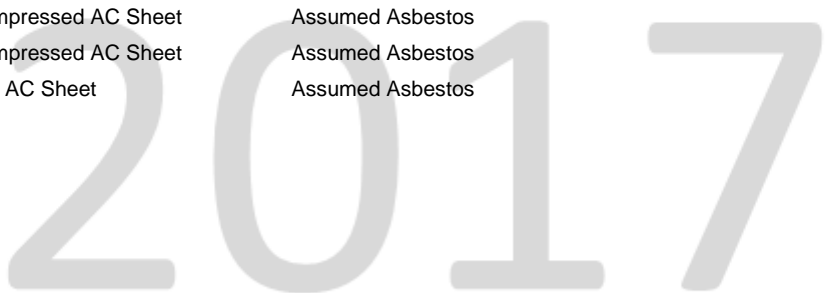

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - Office						
Ceiling	Flat AC Sheet	Assumed Asbestos				9 m2
R3 - Home Base Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				1 m2
R4 - Classroom						
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R5 - Entry						
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R6 - Home Base/activity area						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				20 m2
R7 - Toilets-Boys						
Ceiling	Flat AC Sheet	Assumed Asbestos				4 m2
R8 - Toilets-Girls						
Toilet partitions	Compressed AC Sheet	Assumed Asbestos				6 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				4 m2
R9 - Classroom						
Toilet partitions	Compressed AC Sheet	Assumed Asbestos				4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
OS 751 - D12018 - Learning Unit - ESL : Placement Date - 30/06/1995						
Exterior						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Interior						
R1 - Esl						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				36 m2
R2 - Esl						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				36 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

2910_ASB_030113_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017