


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Putney Public School (2913)  
**Region :** Northern Sydney  
**State Electorate :** Lane Cove  
**Local Government Area :** Ryde

**Initial Survey :** Noel Arnold & Associates : 12 - Feb - 2008  
**Reviewed By :** Parsons Brinckerhoff : 16 - Sep - 2016

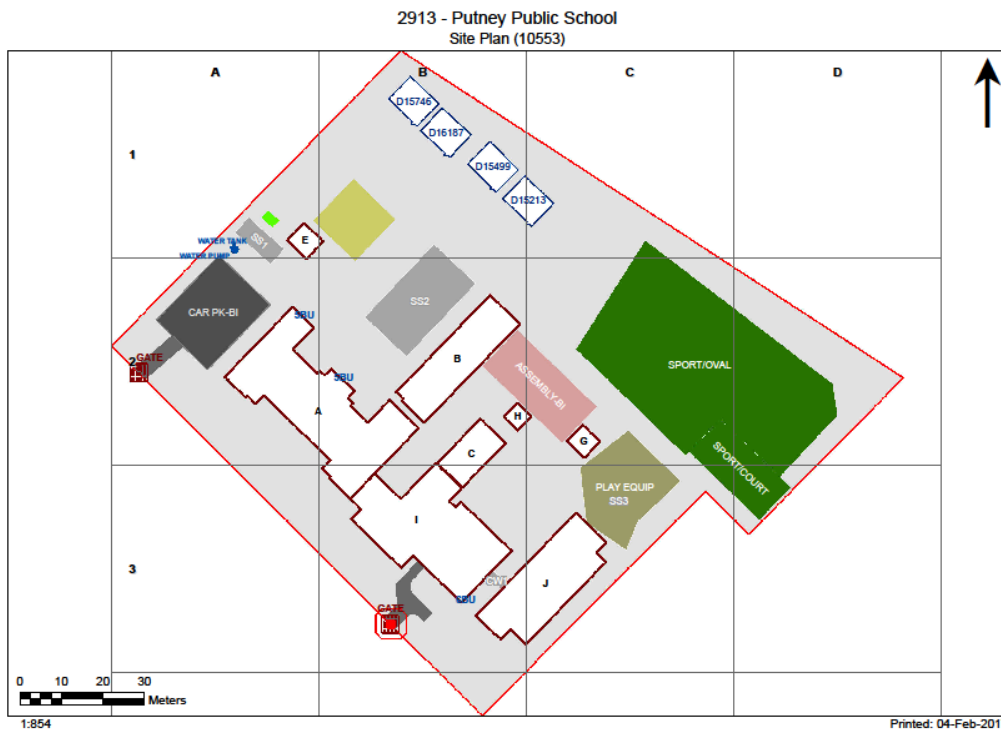

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00A - General Learning/Administration - 1921 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction >3m.					
Eaves Linings	Flat AC Sheeting	60m2	North facing, South facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction &gt;3m.</b>						
Gable Verge Lining	Flat AC Sheeting 2913/B00C/Eaves Linings/S10	30m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>						
Underfloor Voids	Packing 2913/B00A/Underfloor Voids/S12	NA	Throughout	Minimal Damage (2)	Medium (2)	Medium Priority (4-5)
<b>Chrysotile (white asbestos)</b>						
Underfloor Voids	Flat AC Sheeting 2913/B00A/Underfloor Voids/S13					<b>No Asbestos Detected</b>

**Interior**

**B00A - R0001 - Toilets - Boys/Girls**

No Asbestos

**B00A - R0002 - Practical Activities - 1hb**

No Asbestos

**B00A - R0003 - Home Base**

No Asbestos

**B00A - R0004 - Withdrawal Space - 1hb**

No Asbestos

**B00A - R0005 - Withdrawal Space - 1hb**

No Asbestos

**B00A - R0006 - Home Base**

No Asbestos

**B00A - R0007 - Practical Activities - 1hb**

Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2913/B00A/R0018/Floor Coverings Res/Textile/S6						<b>Chrysotile (white asbestos)</b>

**B00A - R0008 - Toilets - Boys/Girls**

No Asbestos

**B00A - R0009 - Home Base**

No Asbestos

**B00A - R0010 - Practical Activities - 1hb**

Floor Coverings Res/Textile	Vinyl Tiles	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2913/B00A/R0018/Floor Coverings Res/Textile/S6						<b>Chrysotile (white asbestos)</b>

**B00A - R0011 - Home Base**

No Asbestos

**B00A - R0012 - Practical Activities - 1hb**

Floor Coverings Res/Textile	Vinyl Tiles	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2913/B00A/R0018/Floor Coverings Res/Textile/S6						<b>Chrysotile (white asbestos)</b>

**B00A - R0013 - Home Base**

No Asbestos

**B00A - R0014 - Practical Activities - 1hb**

Floor Coverings Res/Textile	Vinyl Tiles	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2913/B00A/R0018/Floor Coverings Res/Textile/S6						<b>Chrysotile (white asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R0015 - Home Base</b>						
No Asbestos						
<b>B00A - R0016 - Practical Activities - 1hb</b>						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2913/B001/R0024/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0017 - Principal</b>						
No Asbestos						
<b>B00A - R0018 - Cleaning Supplies</b>						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2913/B00A/R0018/Floor Coverings Res/Textile/S6					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0019 - Sports Store</b>						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2913/B00A/R0018/Floor Coverings Res/Textile/S6					<b>Chrysotile (white asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting	5m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2913/B00A/R0019/Wall Linings Internal/S7					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0020 - Staff Room</b>						
No Asbestos						
<b>B00A - R0022 - Special Programs Room</b>						
No Asbestos						
<b>B00A - R0023 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction &gt;3m.</b>						
<b>B00A - R0024 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction &gt;3m.</b>						
<b>B00A - R0025 - Movement</b>						
No Asbestos						
<b>B00A - R0026 - Movement</b>						
No Asbestos						
<b>B00A - R0027 - Uniform Shop</b>						
No Asbestos						
<b>B00A - R0028 - Other</b>						
No Asbestos						
<b>B00A - R0029 - Other</b>						
No Asbestos						
<b>B00A - R0030 - Movement</b>						
No Asbestos						
<b>B00A - R9001 - Garden Store</b>						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2913/B00A/R9001/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R9002 - Garden Store</b>						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2913/B00A/R9001/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00B - General Learning - 1921 - Timber (Timber)**

**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction >3m.					
Awnings	Flat AC Sheeting	13m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2913/B00B/Awnings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

**Interior**

**B00B - R0001 - Home Base**

Heater Backing on wall	Flat AC Sheeting	2m2	South facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2913/B00B/R0003/Heater Backing on wall/S9			Chrysotile (white asbestos) , Amosite (brown asbestos)		

**B00B - R0002 - Home Base**

Heater Backing on wall	Flat AC Sheeting	2m2	South facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2913/B00B/R0003/Heater Backing on wall/S9			Chrysotile (white asbestos) , Amosite (brown asbestos)		

**B00B - R0003 - Home Base**

Heater Backing on wall	Flat AC Sheeting	2m2	South facing	Some Damage / Unsealed (3)	Medium (2)	Low Priority (2-3)
	2913/B00B/R0003/Heater Backing on wall/S9			Chrysotile (white asbestos) , Amosite (brown asbestos)		

**B00B - R0004 - Home Base**

Heater Backing on wall	Flat AC Sheeting	2m2	South facing	Some Damage / Unsealed (3)	Medium (2)	Low Priority (2-3)
	2913/B00B/R0003/Heater Backing on wall/S9			Chrysotile (white asbestos) , Amosite (brown asbestos)		

**B00B - R0005 - Special Programs Room**

No Asbestos

**B00B - R0006 - General Storeroom**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2913/B00B/Awnings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

**B00B - R0007 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	70m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2913/B00B/Awnings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00C - General Learning - 1950 - Concrete (Concrete)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	15m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2913/B00C/Eaves Linings/S10			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Gable Ends	Flat AC Sheeting	12m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2913/B00C/Eaves Linings/S10			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Gable Verge Lining	Flat AC Sheeting	20m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2913/B00C/Eaves Linings/S10			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**Interior**

**B00C - R0001 - Special Programs Room**

Ceiling Structures/Linings	Flat AC Sheeting	47m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2913/B00C/Eaves Linings/S10			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00C - R0002 - Special Programs Room**

Ceiling Structures/Linings	Flat AC Sheeting	47m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2913/B00C/Eaves Linings/S10			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00C - R0003 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	25m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2913/B00C/Eaves Linings/S10			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Wall Linings Internal	Flat AC Sheeting	10m2	North facing, South facing, East facing, Upper portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2913/B00C/Eaves Linings/S10			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Pupil Facilities - 1970 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids - Raked Ceiling      No Asbestos Found

**Interior**

**B00E - R0001 - Toilets - Girls**

No Asbestos

**B00E - R0002 - Movement**

No Asbestos

**B00E - R0003 - Cleaning Distributed Store**

No Asbestos

**B00E - R0004 - Toilets - Boys**

No Asbestos

**B00E - R0005 - Toilets - Boys**

No Asbestos

**B00E - R0006 - Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Pupil Facilities - 1921 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids - Raked Ceiling      No Asbestos Found

**Interior**

**B00G - R0001 - Toilets - Girls**

No Asbestos

**B00G - R0002 - Cleaning Distributed Store**

No Asbestos

**B00G - R0003 - Movement**

No Asbestos

**B00G - R0004 - Toilets - Girls**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Pupil Facilities - 1921 - Timber (Timber)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Raked Ceiling	No Asbestos Found					

**Interior**

**B00H - R0001 - Drinking Facilities**

Sink Backing	Compressed AC Sheet 2913/B00H/R0001/Sink Backing/S11					<b>No Asbestos Detected</b>
--------------	---	--	--	--	--	-----------------------------

**B00H - R0002 - Drinking Facilities**

Sink Backing	Compressed AC Sheet 2913/B00H/R0001/Sink Backing/S11					<b>No Asbestos Detected</b>
--------------	---	--	--	--	--	-----------------------------

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00I - Administration/Library - 1921 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Awnings	Flat AC Sheeting	80m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2913/B00I/Awnings/S5					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**Interior**

**B00I - R0001 - Withdrawal Space - 1hb**

Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2913/B00I/R0024/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>

**B00I - R0002 - Clerical Office/Workroom**

No Asbestos

**B00I - R0003 - Principal**

No Asbestos

**B00I - R0004 - Clerical Office**

No Asbestos

**B00I - R0005 - Movement**

No Asbestos

**B00I - R0006 - Entry Vestibule**

No Asbestos

**B00I - R0007 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2913/B00I/R1032/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00I - R0008 - Movement**

No Asbestos

**B00I - R0009 - Deputy Principal**

No Asbestos

**B00I - R0010 - Sick Bay**

Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2913/B00I/R0024/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>

**B00I - R0011 - Staff Toilet**

No Asbestos

**B00I - R0012 - Staff Toilet**

No Asbestos

**B00I - R0013 - Movement**

No Asbestos

**B00I - R0014 - Movement**

No Asbestos

**B00I - R0015 - Movement**

No Asbestos

**B00I - R0016 - Canteen**

Floor Coverings Res/Textile	Vinyl Tiles	28m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2913/B00I/R0024/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>

**B00I - R0017 - Canteen Office/Store**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00I - R0018 - Staff Toilet</b>						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2913/B00I/R0024/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>	
<b>B00I - R0019 - Movement</b>						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2913/B00I/R0024/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>	
<b>B00I - R0020 - Canteen Office/Store</b>						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2913/B00I/R0024/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>	
<b>B00I - R0021 - Movement</b>						
No Asbestos						
<b>B00I - R0022 - Main Switch Board</b>						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2913/B00I/R1032/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2913/B00I/R0024/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>	
<b>B00I - R0023 - Toilets - Boys</b>						
No Asbestos						
<b>B00I - R0024 - Cleaning Supplies</b>						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2913/B00I/R0024/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>	
<b>B00I - R0025 - Toilets - Girls</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2913/B00I/R0025/Partition Walls (Cubicles)/S1					<b>Chrysotile (white asbestos)</b>	
<b>B00I - R0026 - Communal Space</b>						
No Asbestos						
<b>B00I - R0027 - Raised Platform</b>						
No Asbestos						
<b>B00I - R0028 - Sports Store</b>						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2913/B00I/R0024/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>	
<b>B00I - R0029 - Movement</b>						
No Asbestos						
<b>B00I - R0030 - General Storeroom</b>						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2913/B00I/R0024/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>	
<b>B00I - R1031 - Movement</b>						
No Asbestos						
<b>B00I - R1032 - Distribution Board</b>						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2913/B00I/R1032/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting	2m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2913/B00I/R1032/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2913/B001/R0024/Floor Coverings Res/Textile/S2				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R1033 - Movement</b>						
No Asbestos						
<b>B001 - R1034 - Toilets - Boys</b>						
No Asbestos						
<b>B001 - R1035 - Toilets - Girls</b>						
No Asbestos						
<b>B001 - R1036 - Cleaning Distributed Store</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2913/B001/R1032/Ceiling Structures/Linings/S3				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Wall Linings Internal	Flat AC Sheeting	2m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
2913/B001/R1032/Ceiling Structures/Linings/S3				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2913/B001/R0024/Floor Coverings Res/Textile/S2				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R1038 - Library Office/Workroom</b>						
No Asbestos						
<b>B001 - R1039 - K.L.A. Store</b>						
No Asbestos						
<b>B001 - R1040 - Library Office/Workroom</b>						
No Asbestos						
<b>B001 - R1041 - Library Office/Workroom</b>						
No Asbestos						
<b>B001 - R1042 - Communications Room</b>						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2913/B001/R0024/Floor Coverings Res/Textile/S2				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R1043 - Movement</b>						
No Asbestos						
<b>B001 - R1044 - Reading Area</b>						
No Asbestos						
<b>B001 - R1045 - Special Programs Room</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - General Learning - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

**Interior**

**B00J - R0001 - Home Base**

No Asbestos

**B00J - R0002 - Home Base**

No Asbestos

**B00J - R0003 - Home Base**

No Asbestos

**B00J - R0004 - Practical Activities - 1hb**

No Asbestos

**B00J - R0005 - Withdrawal Space - 1hb**

No Asbestos

**B00J - R0006 - Home Base Store**

No Asbestos

**B00J - R0007 - Home Base Store**

No Asbestos

**B00J - R0008 - Practical Activities - 1hb**

No Asbestos

**B00J - R0009 - Withdrawal Space - 2hb**

No Asbestos

**B00J - R0010 - Practical Activities - 1hb**

No Asbestos

**B00J - R0011 - Home Base Store**

No Asbestos

**B00J - R0012 - External Movement**

No Asbestos

**B00J - R0013 - General Storeroom**

No Asbestos

**B00J - R0014 - General Storeroom**

No Asbestos

**B00J - R0015 - External Stairs**

No Asbestos

**B00J - R0016 - External Stairs**

No Asbestos

**B00J - R1001 - Home Base**

No Asbestos

**B00J - R1002 - Home Base**

No Asbestos

**B00J - R1003 - Home Base**

No Asbestos

**B00J - R1004 - Practical Activities - 1hb**

No Asbestos

**B00J - R1005 - Withdrawal Space - 1hb**

No Asbestos

**B00J - R1006 - Home Base Store**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00J - R1007 - Home Base Store</b>						
No Asbestos						
<b>B00J - R1008 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B00J - R1009 - Withdrawal Space - 2hb</b>						
No Asbestos						
<b>B00J - R1010 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B00J - R1011 - Home Base Store</b>						
No Asbestos						
<b>B00J - R1012 - External Movement</b>						
No Asbestos						
<b>B00J - R1013 - External Movement</b>						
No Asbestos						
<b>B00J - R1014 - External Movement</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 603 - D15213 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 8/04/2010**

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 603 - D15499 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 17/12/2008**

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 602 - D15746 - Learning Unit - Standard With P.A.A. : Placement Date - 17/01/2013**

**Exterior**

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

**Interior**

**R1 - Learning space/withdrawal/entry**

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

**R2 - Home Base Store**

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

**OS 602 - D16187 - Learning Unit - Standard With P.A.A. : Placement Date - 6/10/2015**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Listing of Electronic Attachments as of 22/03/2017***

**Available Asbestos Related Electronic Files**

2913\_ASB\_150514\_AMP.pdf

\* Note : Refer to AMS for details of the attachment(s).

2017