


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Pagewood Public School (3905)  
**Region :** Sydney  
**State Electorate :** Maroubra  
**Local Government Area :** Botany Bay

**Initial Survey :** Noel Arnold & Associates : 10 - Mar - 2008  
**Reviewed By :** Parsons Brinckerhoff : 01 - Nov - 2016

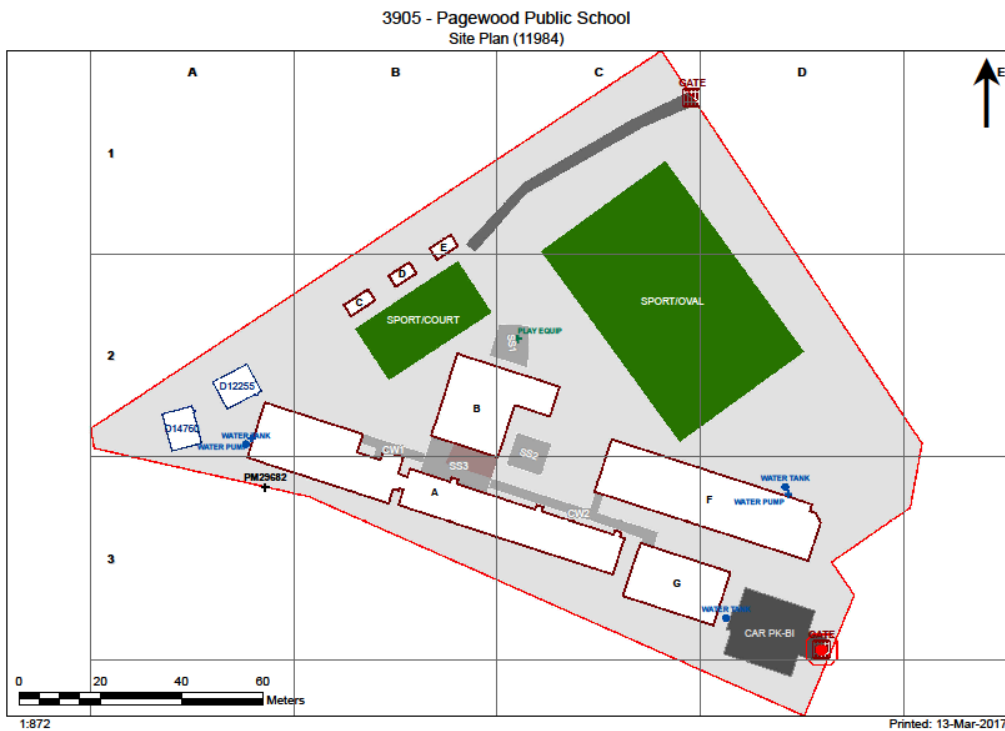

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning/Pupil Facilities - 1956 - Brick/Block (Brick/Block)**

**Exterior**

Gable Ends	Flat AC Sheeting	10m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3905/B00A/Gable Ends/S5					<b>Chrysotile (white asbestos)</b>
Eaves Linings	Flat AC Sheeting	80m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3905/B00A/Eaves Linings/S4					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Void	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	3905/B00A/Underfloor Voids - Packing to Floor Joists/S6					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**Interior**

**B00A - R0001 - General Storeroom**

Infill Panel	Compressed AC Sheet					
	3905/B00A/R0001/Infill Panel/S8					<b>No Asbestos Detected</b>

**B00A - R0006 - External Movement**

No Asbestos

**B00A - R0007 - Home Base**

No Asbestos

**B00A - R0008 - Withdrawal Space - 1hb**

No Asbestos

**B00A - R0009 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3905/B00A/R0009/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>

**B00A - R0010 - Movement**

No Asbestos

**B00A - R0013 - Personal Effects Storage**

No Asbestos

**B00A - R0014 - Home Base**

No Asbestos

**B00A - R0016 - Staff Toilet**

No Asbestos

**B00A - R0017 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3905/B00A/R0009/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>

**B00A - R0018 - Movement**

No Asbestos

**B00A - R0020 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	45m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3905/B00A/R0020/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00A - R0021 - Staff Toilet**

No Asbestos

**B00A - R0022 - Cleaning Distributed Store**

No Asbestos

**B00A - R0023 - Canteen Office/Store**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R0024 - Staff Toilet</b>						
No Asbestos						
<b>B00A - R0025 - Canteen Office/Store</b>						
No Asbestos						
<b>B00A - R0026 - Canteen</b>						
No Asbestos						
<b>B00A - R0027 - General Storeroom</b>						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3905/B00A/R0009/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0028 - Security Store</b>						
No Asbestos						
<b>B00A - R0029 - Communications Room</b>						
No Asbestos						
<b>B00A - R0030 - Movement</b>						
No Asbestos						
<b>B00A - R0031 - Movement</b>						
No Asbestos						
<b>B00A - R0032 - External Movement</b>						
No Asbestos						
<b>B00A - R0033 - K.L.A. Store</b>						
No Asbestos						
<b>B00A - R0034 - Library Office/Workroom</b>						
No Asbestos						
<b>B00A - R0035 - Home Base</b>						
No Asbestos						
<b>B00A - R0036 - Home Base</b>						
No Asbestos						
<b>B00A - R0037 - Home Base Store</b>						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3905/B00A/R0009/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0038 - General Storeroom</b>						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3905/B00A/R0009/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0039 - Movement</b>						
No Asbestos						
<b>B00A - R0040 - External Movement</b>						
No Asbestos						
<b>B00A - R0041 - Staff Room Annexe</b>						
Floor Coverings Res/Textile	Vinyl Tiles	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3905/B00A/R0009/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0042 - General Storeroom</b>						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3905/B00A/R0009/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0043 - General Storeroom</b>						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3905/B00A/R0009/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0044 - Home Base Store</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3905/B00A/R0009/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
<b>B00A - R0045 - Home Base</b>						
No Asbestos						
<b>B00A - R0046 - Home Base</b>						
No Asbestos						
<b>B00A - R0047 - Home Base Store</b>						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3905/B00A/R0009/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
<b>B00A - R0048 - General Storeroom</b>						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3905/B00A/R0009/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
<b>B00A - R0049 - General Storeroom</b>						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3905/B00A/R0009/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
<b>B00A - R0050 - Movement</b>						
No Asbestos						
<b>B00A - R0051 - External Movement</b>						
No Asbestos						
<b>B00A - R0052 - Home Base</b>						
No Asbestos						
<b>B00A - R0053 - External Movement</b>						
No Asbestos						
<b>B00A - R0054 - Home Base</b>						
No Asbestos						
<b>B00A - R0055 - Sports Store</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Communal Facilities - 1963 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	8m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3905/B00A/Eaves Linings/S4			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Void	Non Accessible Area - No Access - No Manhole in Building					

**Interior**

**B00B - R0001 - Hall Chair Store**

No Asbestos

**B00B - R0002 - Movement**

No Asbestos

**B00B - R0003 - Communal Space**

No Asbestos

**B00B - R0004 - External Movement**

No Asbestos

**B00B - R0005 - Movement**

No Asbestos

**B00B - R0006 - Music Store**

No Asbestos

**B00B - R0007 - Movement**

No Asbestos

**B00B - R0008 - Raised Platform**

No Asbestos

**B00B - R0009 - Movement**

No Asbestos

**B00B - R0010 - General Assistant/Bulk Store**

No Asbestos

**B00B - R0011 - General Storeroom**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Pupil Facilities - 1956 - Concrete (Concrete)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids - Flat Roof	No Asbestos Found

**Interior**

**B00C - R0001 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3905/B00E/R0001/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
3905/B00E/R0001/Partition Walls (Cubicles)/S2				<b>Insufficient Sample</b>		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Pupil Facilities - 1956 - Concrete (Concrete)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids - Flat Roof	No Asbestos Found

**Interior**

**B00D - R0001 - Handwashing Facilities**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3905/B00E/R0001/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00D - R0002 - Handwashing Facilities**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3905/B00E/R0001/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Pupil Facilities - 1956 - Concrete (Concrete)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids - Flat Roof	No Asbestos Found

**Interior**

**B00E - R0001 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3905/B00E/R0001/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Partition Walls (Cubicles)	Compressed AC Sheet	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3905/B00E/R0001/Partition Walls (Cubicles)/S2				<b>Insufficient Sample</b>		

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Administration/Library - 2011 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

**Interior**

<b>B00F - R0001 - External Movement</b>	No Asbestos
<b>B00F - R0002 - Entry Vestibule</b>	No Asbestos
<b>B00F - R0003 - Clerical Office</b>	No Asbestos
<b>B00F - R0004 - Duplicating Workroom</b>	No Asbestos
<b>B00F - R0005 - Sick Bay</b>	No Asbestos
<b>B00F - R0006 - Access Shower/Toilet</b>	No Asbestos
<b>B00F - R0007 - Staff Toilet</b>	No Asbestos
<b>B00F - R0008 - Main Switch Board</b>	No Asbestos
<b>B00F - R0009 - Cleaning Distributed Store</b>	No Asbestos
<b>B00F - R0010 - Movement</b>	No Asbestos
<b>B00F - R0011 - Interview/Office - Type 3</b>	No Asbestos
<b>B00F - R0012 - Security Store</b>	No Asbestos
<b>B00F - R0013 - Interview</b>	No Asbestos
<b>B00F - R0014 - Principal</b>	No Asbestos
<b>B00F - R0015 - Deputy Principal - Type 1</b>	No Asbestos
<b>B00F - R0016 - Staff Toilet</b>	No Asbestos
<b>B00F - R0017 - Staff Toilet</b>	No Asbestos
<b>B00F - R0018 - Staff Kitchen</b>	No Asbestos
<b>B00F - R0019 - Staff Room</b>	No Asbestos
<b>B00F - R0020 - Staff Room Annexe</b>	No Asbestos
<b>B00F - R0021 - Reading Area</b>	No Asbestos
<b>B00F - R0022 - Library Office/Workroom</b>	No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00F - R0023 - Communications Room</b>						
No Asbestos						
<b>B00F - R0024 - K.L.A. Store</b>						
No Asbestos						
<b>B00F - R0025 - Cleaning Distributed Store</b>						
No Asbestos						
<b>B00F - R0026 - Distribution Board</b>				Note: No inspection of live electrical installation.		
No Asbestos						
<b>B00F - R0027 - Movement</b>						
No Asbestos						
<b>B00F - R0028 - Staff Toilet</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - General Learning - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

**Interior**

**B00G - R0001 - Home Base**

No Asbestos

**B00G - R0002 - Home Base Store**

No Asbestos

**B00G - R0003 - Practical Activities - 1hb**

No Asbestos

**B00G - R0004 - Withdrawal Space - 2hb**

No Asbestos

**B00G - R0005 - Home Base**

No Asbestos

**B00G - R0006 - Home Base Store**

No Asbestos

**B00G - R0007 - Practical Activities - 1hb**

No Asbestos

**B00G - R0008 - Special Programs Room - Type 1**

No Asbestos

**B00G - R0009 - Special Programs Store**

No Asbestos

**B00G - R0010 - Cleaning Distributed Store**

No Asbestos

**B00G - R0011 - Movement**

No Asbestos

**B00G - R0012 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 602 - D12255 - Learning Unit - Standard With P.A.A. : Placement Date - 20/10/2015**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 602 - D14760 - Learning Unit - Standard With P.A.A. : Placement Date - 24/04/2014**

**Exterior**

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

**Interior**

**R1 - Learning space/withdrawal/entry**

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

**R2 - Home Base Store**

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Listing of Electronic Attachments as of 22/03/2017***

**Available Asbestos Related Electronic Files**

3905\_ASB\_100913\_AMP.pdf

\* Note : Refer to AMS for details of the attachment(s).

2017