


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Palinyewah Public School (3912)
Region : Western NSW
State Electorate : Murray
Local Government Area : Wentworth

Initial Survey : Noel Arnold & Associates : 13 - May - 2008
Reviewed By : Parsons Brinckerhoff : 01 - Nov - 2016

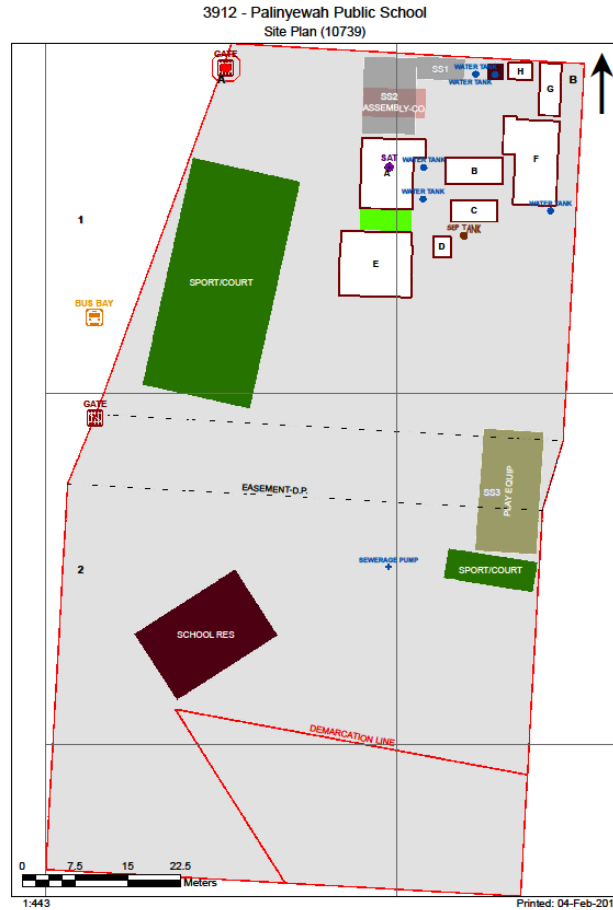

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - Library - 1954 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3912/B00A/Wall Cladding/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Cladding	Flat AC Sheeting	20m2	North facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3912/B00A/Wall Cladding/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3912/B00A/Eaves Linings/S7			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00A - R0005 - Covered Outdoor Learning Area

No Asbestos

B00A - R0006 - Clerical Office/Workroom

No Asbestos

B00A - R0007 - Principal

No Asbestos

B00A - R0008 - General Storeroom

No Asbestos

B00A - R0009 - Clerical Office

No Asbestos

B00A - R0010 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3912/B00A/R0011/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0011 - Staff Room

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3912/B00A/R0011/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0012 - Staff Kitchen

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Shed - 1954 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	6m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3912/B00B/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
Underfloor Voids	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	3912/B00B/Underfloor Voids/S9				Chrysotile (white asbestos)	
Underfloor Voids	Compressed AC Sheet					No Asbestos Detected
	3912/B00B/Underfloor Voids/S10					
Ceiling Voids - Flat Roof	No Asbestos Found					

Interior

B00B - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3912/B00B/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	45m2	South facing, East facing, West facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3912/B00B/R0001/Wall Linings Internal/S2				Chrysotile (white asbestos)	
Flooring	Compressed AC Sheet					No Asbestos Detected
	3912/B00B/R0001/Floor Coverings Res/Textile/S3					

B00B - R0002 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3912/B00B/R0001/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	5m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3912/B00B/R0001/Wall Linings Internal/S2				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1974 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Wall Cladding	Flat AC Sheeting	4m2	North facing, South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3912/B00C/Wall Cladding/S4				Chrysotile (white asbestos)	

Interior

B00C - R0001 - Toilets - Boys

No Asbestos

B00C - R0002 - Toilets - Girls

No Asbestos

B00C - R0003 - Movement

No Asbestos

B00C - R0004 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Staff Facilities - 2002 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00D - R0001 - Staff Toilet

No Asbestos

B00D - R0002 - Staff Toilet

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00E - R0001 - Home Base

No Asbestos

B00E - R0002 - Home Base Store

No Asbestos

B00E - R0003 - Practical Activities

No Asbestos

B00E - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Library - 2009 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00F - R0001 - External Movement

No Asbestos

B00F - R0002 - Library Office/Workroom

No Asbestos

B00F - R0003 - Special Programs Room

No Asbestos

B00F - R0004 - Reading Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Building Services - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00G - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Pupil Facilities - 2009 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00H - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017