


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Pendle Hill Public School (3993)  
**Region :** Western Sydney  
**State Electorate :** Prospect  
**Local Government Area :** Holroyd

**Initial Survey :** Noel Arnold & Associates : 15 - Apr - 2008  
**Reviewed By :** Parsons Brinckerhoff : 25 - Nov - 2016

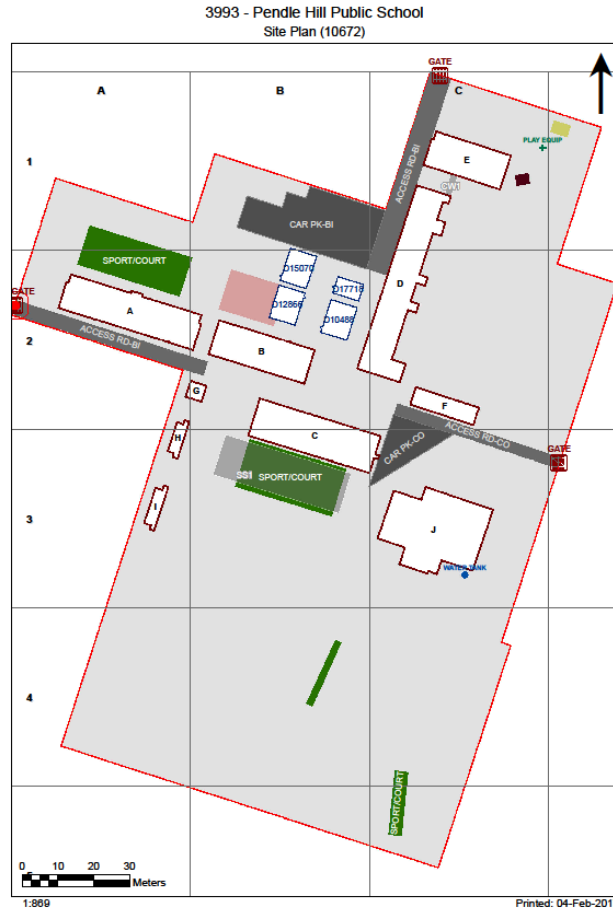

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00A - Communal Facilities/General Learning - 1962 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	50m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3993/B00A/Eaves Linings/S23			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00A - R0001 - General Storeroom (38 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	16m2	North section only	Good Condition (1)	Low (1)	Low Priority (2-3)
	3993/B00A/Eaves Linings/S23			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00A - R0002 - Raised Platform (25.05 m2)**

No Asbestos

**B00A - R0003 - Communal Space (80.34 m2)**

No Asbestos

**B00A - R0004 - Interview (12.65 m2)**

No Asbestos

**B00A - R0005 - General Storeroom (9.34 m2)**

No Asbestos

**B00A - R0006 - Home Base (53.31 m2)**

No Asbestos

**B00A - R0007 - Home Base (53.61 m2)**

No Asbestos

**B00A - R0008 - Cleaning Distributed Store (5.52 m2)**

No Asbestos

**B00A - R0009 - General Storeroom (23.54 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	North section only	Good Condition (1)	Low (1)	Low Priority (2-3)
	3993/B00A/Eaves Linings/S23			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00A - R0010 - Movement (66.31 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	67m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3993/B00A/Eaves Linings/S23			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Administration/Staff Facilities - 1955 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting 3993/B00B/Eaves Linings/S26	40m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Gable verge lining	Flat AC Sheeting 3993/B00B/Gable verge lining/S29	45m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B00B - R0018 - Staff Room (51.81 m2)**

Recently Modified Space Requires Inspection

**B00B - R0019 - Movement (1.4 m2)**

Recently Modified Space Requires Inspection

**B00B - R0020 - Interview (13.24 m2)**

Recently Modified Space Requires Inspection

**B00B - R0021 - Principal (15.98 m2)**

Recently Modified Space Requires Inspection

**B00B - R0022 - Sick Bay (7.96 m2)**

Recently Modified Space Requires Inspection

**B00B - R0023 - Clerical Office (27.02 m2)**

Recently Modified Space Requires Inspection

**B00B - R0024 - Duplicating Workroom (18.16 m2)**

Recently Modified Space Requires Inspection

**B00B - R0025 - Security Store (6.71 m2)**

Recently Modified Space Requires Inspection

**B00B - R0026 - Entry Vestibule (20.58 m2)**

Recently Modified Space Requires Inspection

**B00B - R0027 - Main Switch Board (0.9 m2)**

Recently Modified Space Requires Inspection

**B00B - R0028 - Movement (1.76 m2)**

Recently Modified Space Requires Inspection

**B00B - R0029 - General Storeroom (0.75 m2)**

Recently Modified Space Requires Inspection

**B00B - R0030 - Disabled Shower/Toilet (6.69 m2)**

Recently Modified Space Requires Inspection

**B00B - R0031 - Cleaning Supplies (0.88 m2)**

Recently Modified Space Requires Inspection

**B00B - R0032 - Communications Cupboard (1.44 m2)**

Recently Modified Space Requires Inspection

**B00B - R0033 - Movement (1.79 m2)**

Recently Modified Space Requires Inspection

**B00B - R0034 - Staff Toilet (2.16 m2)**

Recently Modified Space Requires Inspection

**B00B - R0035 - Movement (1.68 m2)**

Recently Modified Space Requires Inspection

**B00B - R0036 - Staff Toilet (1.67 m2)**

Recently Modified Space Requires Inspection

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - R0037 - Staff Toilet (2.9 m2)</b>						
Recently Modified Space Requires Inspection						
<b>B00B - R0038 - Staff Kitchen (7.61 m2)</b>						
Recently Modified Space Requires Inspection						
<b>B00B - R0039 - Movement (15.38 m2)</b>						
Recently Modified Space Requires Inspection						
<b>B00B - R0040 - External Movement (41.17 m2)</b>						
Recently Modified Space Requires Inspection						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning/Library - 1955 - Brick/Block (Brick/Block)****Exterior**

Gable verge lining	Flat AC Sheeting 3993/B00B/Gable verge lining/S29	50m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Infill panels below window	Flat AC Sheeting 3993/B00C/Infill panels below window/S6					<b>No Asbestos Detected</b>
Eaves Linings	Flat AC Sheeting 3993/B00C/R1001/Ceiling Structures/Linings/S8	30m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B00C - R0001 - Movement (34.91 m2)**

Ceiling Structures/Linings	Vermiculite 3993/B00C/R0001/Ceiling Structures/Linings/S7					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	---

**B00C - R0002 - Movement (1.11 m2)**

No Asbestos

**B00C - R0003 - Canteen Office/Store (3.46 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 3993/B00C/R1005/Floor Coverings Res/Textile/S9	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
-----------------------------	---	-----	--------------	--------------------	---------	--

**B00C - R0004 - Canteen Office/Store (2.8 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 3993/B00C/R1005/Floor Coverings Res/Textile/S9	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
-----------------------------	---	-----	--------------	--------------------	---------	--

**B00C - R0005 - Canteen (21.26 m2)**

Ceiling Structures/Linings	Vermiculite 3993/B00C/R0001/Ceiling Structures/Linings/S7					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 3993/B00C/R1005/Floor Coverings Res/Textile/S9	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**B00C - R0006 - Reading Area (86.79 m2)**

Ceiling Structures/Linings	Vermiculite 3993/B00C/R0001/Ceiling Structures/Linings/S7					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	---

**B00C - R0007 - Library Office/Workroom (11.87 m2)**

Ceiling Structures/Linings	Vermiculite 3993/B00C/R0001/Ceiling Structures/Linings/S7					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	---

**B00C - R0008 - K.L.A. Store (14.57 m2)**

Ceiling Structures/Linings	Vermiculite 3993/B00C/R0001/Ceiling Structures/Linings/S7					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	---

**B00C - R0009 - Home Base (56.59 m2)**

Ceiling Structures/Linings	Vermiculite 3993/B00C/R0001/Ceiling Structures/Linings/S7					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	---

**B00C - R0010 - Home Base Store (10.74 m2)**

Ceiling Structures/Linings	Vermiculite 3993/B00C/R0001/Ceiling Structures/Linings/S7					<b>Limited Samples Taken</b> <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
----------------------------	--	--	--	--	--	---

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3993/B00C/R1005/Floor Coverings Res/Textile/S9				<b>Chrysotile (white asbestos)</b>		
<b>B00C - R0011 - Main Switch Board (3.13 m2)</b>						
No Asbestos						
<b>B00C - R0012 - Personal Effects Storage (6.68 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
3993/B00C/R0001/Ceiling Structures/Linings/S7				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00C - R0013 - Movement (27.94 m2)</b>						
No Asbestos						
<b>B00C - R0014 - Movement (39.81 m2)</b>						
Infill panels below windows	Flat AC Sheeting					
3993/B00C/R0014/Infill panels below windows/S5				<b>No Asbestos Detected</b>		
<b>B00C - R0015 - Stairs (6.63 m2)</b>						
No Asbestos						
<b>B00C - R0016 - Stairs (3.06 m2)</b>						
No Asbestos						
<b>B00C - R1001 - Movement (88.19 m2)</b>						
Infill panels below windows	Flat AC Sheeting					
3993/B00C/R0014/Infill panels below windows/S5				<b>No Asbestos Detected</b>		
Ceiling Structures/Linings	Flat AC Sheeting	85m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3993/B00C/R1001/Ceiling Structures/Linings/S8				<b>Chrysotile (white asbestos)</b>		
<b>B00C - R1002 - Craft Store (11.69 m2)</b>						
No Asbestos						
<b>B00C - R1003 - Home Base (56.91 m2)</b>						
No Asbestos						
<b>B00C - R1004 - Home Base Store (6.76 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3993/B00C/R1004/Floor Coverings Res/Textile/S31				<b>Chrysotile (white asbestos)</b>		
<b>B00C - R1005 - Movement (13.23 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3993/B00C/R1005/Floor Coverings Res/Textile/S9				<b>Chrysotile (white asbestos)</b>		
<b>B00C - R1006 - Home Base Store (6.8 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3993/B00C/R1004/Floor Coverings Res/Textile/S31				<b>Chrysotile (white asbestos)</b>		
<b>B00C - R1007 - Home Base (56.67 m2)</b>						
No Asbestos						
<b>B00C - R1008 - Home Base (56.9 m2)</b>						
No Asbestos						
<b>B00C - R1009 - Home Base Store (11.04 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3993/B00C/R1004/Floor Coverings Res/Textile/S31				<b>Chrysotile (white asbestos)</b>		
<b>B00C - R1010 - Distribution Board (3.12 m2)</b>						Note: No inspection of live electrical installation.
No Asbestos						
<b>B00C - R1011 - Movement (6.63 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3993/B00C/R1005/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
<b>B00C - R1012 - Stairs (4.71 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3993/B00C/R1001/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
<b>B00C - R1013 - Stairs (3.45 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3993/B00C/R1001/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning/Support Unit - 1955 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	60m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3993/B00D/R0021/Ceiling Structures/Linings/S11				<b>Chrysotile (white asbestos)</b>	
Gable verge lining	Flat AC Sheeting	40m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3993/B00D/Gable verge lining/S30				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00D - R0006 - Movement (8.2 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3993/B00D/R0021/Ceiling Structures/Linings/S11				<b>Chrysotile (white asbestos)</b>	

**B00D - R0007 - Personal Effects Storage (10.46 m2)**

No Asbestos

**B00D - R0008 - Home Base (57.24 m2)**

No Asbestos

**B00D - R0009 - General Storeroom (16.46 m2)**

No Asbestos

**B00D - R0010 - Movement (4.7 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3993/B00D/R0021/Ceiling Structures/Linings/S11				<b>Chrysotile (white asbestos)</b>	

**B00D - R0011 - Movement (29.43 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	29m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3993/B00D/R0011/Floor Coverings Res/Textile/S13				<b>Chrysotile (white asbestos)</b>	

**B00D - R0012 - General Storeroom (7.15 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3993/B00D/R0011/Floor Coverings Res/Textile/S13				<b>Chrysotile (white asbestos)</b>	

**B00D - R0013 - Cleaning Distributed Store (1.7 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3993/B00D/R0011/Floor Coverings Res/Textile/S13				<b>Chrysotile (white asbestos)</b>	

**B00D - R0014 - Community Clinic (17.69 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	18m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3993/B00D/R0011/Floor Coverings Res/Textile/S13				<b>Chrysotile (white asbestos)</b>	

**B00D - R0015 - Staff Toilet (4.39 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3993/B00D/R0011/Floor Coverings Res/Textile/S13				<b>Chrysotile (white asbestos)</b>	

Wall Linings Internal	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3993/B00D/R0015/Wall Linings Internal/S14				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00D - R0016 - Movement (4.74 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3993/B00D/R0021/Ceiling Structures/Linings/S11				<b>Chrysotile (white asbestos)</b>	

**B00D - R0017 - Movement (3.01 m2)**



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00D - R0018 - Personal Effects Storage (10.38 m2)</b>						
No Asbestos						
<b>B00D - R0019 - Home Base (56.83 m2)</b>						
No Asbestos						
<b>B00D - R0020 - Home Base (85.99 m2)</b>						
No Asbestos						
<b>B00D - R0021 - Movement (8.58 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3993/B00D/R0021/Ceiling Structures/Linings/S11					<b>Chrysotile (white asbestos)</b>	
<b>B00D - R0022 - Staff Toilet (4.15 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3993/B00D/R0023/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B00D - R0023 - Movement (4.25 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3993/B00D/R0023/Ceiling Structures/Linings/S12					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B00D - R0024 - Movement (2.99 m2)</b>						
No Asbestos						
<b>B00D - R0025 - Personal Effects Storage (10.72 m2)</b>						
No Asbestos						
<b>B00D - R0026 - Interview (19.76 m2)</b>						
No Asbestos						
<b>B00D - R0027 - Movement (2.93 m2)</b>						
No Asbestos						
<b>B00D - R0028 - Practical Activities - E (10.23 m2)</b>						
No Asbestos						
<b>B00D - R0029 - Home Base - E (41.29 m2)</b>						
No Asbestos						
<b>B00D - R0030 - Toilet - E (8.77 m2)</b>						
No Asbestos						
<b>B00D - R0031 - Home Base Store - E (8.57 m2)</b>						
No Asbestos						
<b>B00D - R0032 - Movement (4.69 m2)</b>						
No Asbestos						
<b>B00D - R9001 - General Storeroom (57.32 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	58m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3993/B00D/R9001/Ceiling Structures/Linings/S10					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Pre-School Facilities - 1962 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	25m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3993/B00E/Eaves Linings/S15				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	12m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3993/B00E/Eaves Linings/S27				Chrysotile (white asbestos)	
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00E - R0001 - General Storeroom - Pre (8.19 m2)**

Wall Linings Internal	Flat AC Sheeting	8m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3993/B00E/R0001/Wall Linings Internal/S18				Chrysotile (white asbestos)	

**B00E - R0002 - Staff Toilet - Pre (3.77 m2)**

Wall Linings Internal	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3993/B00E/R0002/Wall Linings Internal/S17				Chrysotile (white asbestos)	

**B00E - R0003 - Kitchen - Pre (10.31 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	3993/B00E/R0003/Floor Coverings Res/Textile/S16				No Asbestos Detected	

**B00E - R0004 - General Storeroom - Pre (6.29 m2)**

No Asbestos

**B00E - R0005 - Withdrawal - Pre (7.01 m2)**

No Asbestos

**B00E - R0006 - General Assistant/Bulk Store (7.55 m2)**

Wall Linings Internal	Flat AC Sheeting	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3993/B00E/R0001/Wall Linings Internal/S18				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3993/B00E/Eaves Linings/S15				Chrysotile (white asbestos)	

**B00E - R0007 - Home Base - Pre (108.83 m2)**

No Asbestos

**B00E - R0008 - Toilets - Boys/Girls - Pre (8.32 m2)**

No Asbestos

**B00E - R0009 - Staff Room - Pre (7.05 m2)**

No Asbestos

**B00E - R0010 - Movement (40.88 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	41m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3993/B00E/R0010/Ceiling Structures/Linings/S19				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Pupil Facilities - 1955 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	5m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3993/B00F/Eaves Linings/S28			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
Ceiling Void	No Asbestos Found					

**Interior**

**B00F - R0001 - Toilets - Boys (28.39 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3993/B00F/R0001/Partition Walls (Cubicles)/S25			<b>Chrysotile (white asbestos)</b>		

**B00F - R0002 - Drinking Facilities (13.49 m2)**

No Asbestos

**B00F - R0003 - Drinking Facilities (13.49 m2)**

No Asbestos

**B00F - R0004 - Toilets - Girls (24.66 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3993/B00F/R0001/Partition Walls (Cubicles)/S25			<b>Chrysotile (white asbestos)</b>		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Pupil Facilities - 1955 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Void      No Asbestos Found

**Interior**

**B00G - R0001 - Drinking Facilities (9.27 m2)**

No Asbestos

**B00G - R0002 - Drinking Facilities (9.27 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Pupil Facilities - 1955 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - No Access - No manhole in building					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3993/B00H/Eaves Linings/S1					<b>Chrysotile (white asbestos)</b>

**Interior**

**B00H - R0001 - Toilets - Girls (25.54 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet 3993/B00H/R0001/Partition Walls (Cubicles)/S2					<b>No Asbestos Detected</b>
Wall Linings Internal	Flat AC Sheeting 3993/B00H/R0001/Wall Linings Internal/S3					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3993/B00H/R0001/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - Pupil Facilities - 1955 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	Non Accessible Area - No Access - No manhole in building					
Eaves Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3993/B00H/Eaves Linings/S1					<b>Chrysotile (white asbestos)</b>

**Interior**

**B001 - R0001 - Toilets - Boys (31.68 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	32m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3993/B00H/R0001/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>
Partition Walls (Cubicles)	Compressed AC Sheet 3993/B00H/R0001/Partition Walls (Cubicles)/S2					<b>No Asbestos Detected</b>
Wall Linings Internal	Flat AC Sheeting 3993/B00H/R0001/Wall Linings Internal/S3					<b>No Asbestos Detected</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00J - Pupil Facilities/Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00J - R0001 - Communal Space (148.78 m2)**

No Asbestos

**B00J - R0002 - Raised Platform (55.19 m2)**

No Asbestos

**B00J - R0003 - Movement (12.9 m2)**

No Asbestos

**B00J - R0004 - Movement (7.45 m2)**

No Asbestos

**B00J - R0005 - Toilet - Lobby (1.87 m2)**

No Asbestos

**B00J - R0006 - Toilets - Boys (11.39 m2)**

No Asbestos

**B00J - R0007 - P.E. Store (17.02 m2)**

No Asbestos

**B00J - R0008 - Movement (6.84 m2)**

No Asbestos

**B00J - R0009 - Hall Chair Store (10.87 m2)**

No Asbestos

**B00J - R0010 - Communal/Performance Store (10.96 m2)**

No Asbestos

**B00J - R0011 - Cleaning Distributed Store (5.5 m2)**

No Asbestos

**B00J - R0012 - Main Switch Board (3.28 m2)**

No Asbestos

**B00J - R0013 - Toilet - Lobby (3.47 m2)**

No Asbestos

**B00J - R0014 - Toilets - Girls (10.49 m2)**

No Asbestos

**B00J - R0015 - Toilet - P (7.55 m2)**

No Asbestos

**B00J - R0016 - Sound Cupboard (2.73 m2)**

No Asbestos

**B00J - R0017 - Covered Outdoor Learning Area (164.78 m2)**

No Asbestos

**B00J - R0018 - Ramp (12.28 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 602 - D10488 - Learning Unit - Standard With P.A.A. : Placement Date - 17/12/2009**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 602 - D12866 - Learning Unit - Standard With P.A.A. : Placement Date - 27/11/2015**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 602 - D15070 - Learning Unit - Standard With P.A.A. : Placement Date - 19/02/2015**

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 750 - D17718 - Learning Unit - ESL : Placement Date - 18/01/2011**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Esl**

No Asbestos Found.





Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Listing of Electronic Attachments as of 22/03/2017***

**Available Asbestos Related Electronic Files**

3993\_ASB\_221112\_AMP.pdf

\* Note : Refer to AMS for details of the attachment(s).

2017