


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Panania North Public School (4012)
Region : South Western Sydney
State Electorate : East Hills
Local Government Area : Bankstown

Initial Survey : Noel Arnold & Associates : 29 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 25 - Nov - 2016

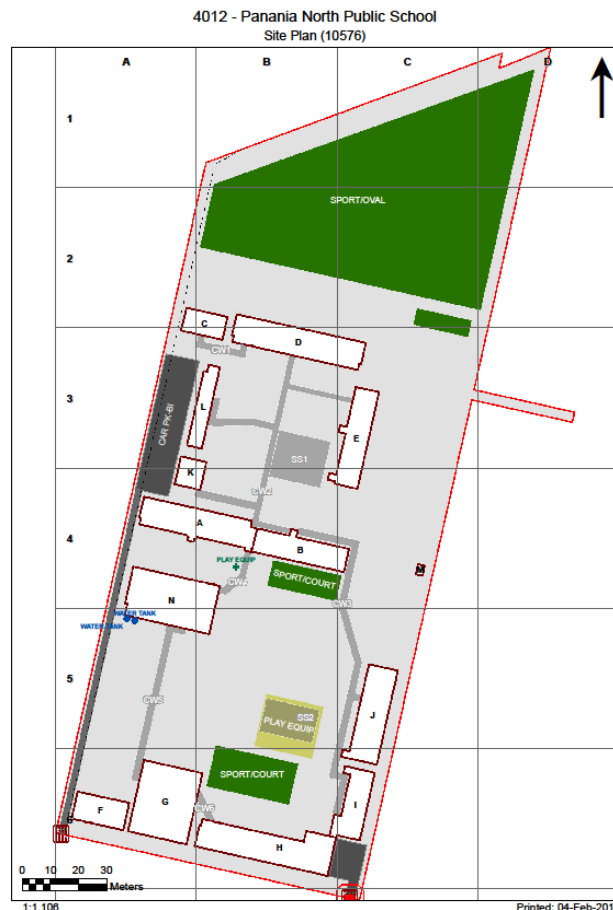

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - General Learning - 1955 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 4012/B00A/Eaves Linings/S27					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00A - R0001 - General Assistant/Bulk Store

No Asbestos

B00A - R0002 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting 4012/B00A/R0014/Ceiling Structures/Linings/S10	46m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
In-fill-panel	Compressed AC Sheet 4012/B00A/R0002/In-fill-panel/S11	2m	North, East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0003 - Teachers Aide Special Ed

Ceiling Structures/Linings	Flat AC Sheeting 4012/B00A/R0014/Ceiling Structures/Linings/S10	46m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
In-fill-panel	Compressed AC Sheet 4012/B00A/R0002/In-fill-panel/S11	2m	North, East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4012/B00A/R0014/Ceiling Structures/Linings/S10	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	------	------------	--------------------	---------	--

B00A - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4012/B00A/R0014/Ceiling Structures/Linings/S10	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-----	------------	--------------------	---------	--

B00A - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4012/B00A/R0014/Ceiling Structures/Linings/S10	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	------	------------	--------------------	---------	--

B00A - R0007 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting 4012/B00A/R0014/Ceiling Structures/Linings/S10	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	------	------------	--------------------	---------	--

B00A - R0008 - Staff Room

Ceiling Structures/Linings	Flat AC Sheeting 4012/B00A/R0014/Ceiling Structures/Linings/S10	46m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
In-fill-panel	Compressed AC Sheet 4012/B00A/R0002/In-fill-panel/S11	2m	North, East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0009 - Staff Kitchen

Ceiling Structures/Linings	Flat AC Sheeting 4012/B00A/R0014/Ceiling Structures/Linings/S10	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	------	------------	--------------------	---------	--

B00A - R0010 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting 4012/B00A/R0014/Ceiling Structures/Linings/S10	46m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	------	----------------	--------------------	---------	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
In-fill-panel	Compressed AC Sheet	2m	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)
4012/B00A/R0002/In-fill-panel/S11				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R0011 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4012/B00A/R0014/Ceiling Structures/Linings/S10				Chrysotile (white asbestos)		
B00A - R0012 - Staff Toilet						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4012/B00A/R0014/Ceiling Structures/Linings/S10				Chrysotile (white asbestos)		
B00A - R0013 - Cleaning Distributed Store						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4012/B00A/R0014/Ceiling Structures/Linings/S10				Chrysotile (white asbestos)		
B00A - R0014 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4012/B00A/R0014/Ceiling Structures/Linings/S10				Chrysotile (white asbestos)		
B00A - R0015 - Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library - 1955 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 4012/B00B/Eaves Linings/S28					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00B - R0001 - Reading Area

No Asbestos

B00B - R0002 - Library Office/Workroom

No Asbestos

B00B - R0003 - Movement

No Asbestos

B00B - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4012/B00B/R0004/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00B - R0005 - Reading Area

No Asbestos

B00B - R0006 - General Storeroom

No Asbestos

B00B - R0007 - Personal Effects Storage

No Asbestos

B00B - R0008 - General Storeroom

No Asbestos

B00B - R0009 - Movement

No Asbestos

B00B - R0010 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4012/B00B/R0004/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00B - R0011 - Reading Area

No Asbestos

B00B - R0012 - General Storeroom

No Asbestos

B00B - R0013 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Other-Community Use - 1955 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 4012/B00C/Eaves Linings/S29					No Asbestos Detected
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

Interior

B00C - R0001 - Movement

No Asbestos

B00C - R0002 - Communal Space

Floor Coverings Res/Textile	Vinyl Tiles 4012/B00C/R0002/Floor Coverings Res/Textile/S5	30m2	West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting 4012/B00C/R0002/In-fill-panel/S6					No Asbestos Detected
Ceiling Structures/Linings	No Asbestos Found					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1955 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 4012/B00D/Eaves Linings/S33					No Asbestos Detected
Underfloor Voids	No Asbestos Found					
Ceiling Voids	Fibre Cement Pipe 4012/B00D/Ceiling Voids/S34	2Unit	Above R0001 & R0005	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

Interior

B00D - R0001 - Home Base

In-fill-panel	Compressed AC Sheet 4012/B00D/R0001/In-fill-panel/S4	1m	West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
---------------	---	----	------	--------------------	---------	--

B00D - R0002 - Home Base Store

No Asbestos

B00D - R0003 - Personal Effects Storage

No Asbestos

B00D - R0004 - Personal Effects Storage

No Asbestos

B00D - R0005 - Home Base Store

No Asbestos

B00D - R0006 - Home Base

In-fill-panel	Compressed AC Sheet 4012/B00D/R0001/In-fill-panel/S4	1m	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
---------------	---	----	------	--------------------	---------	--

B00D - R0007 - Home Base

In-fill-panel	Flat AC Sheeting 4012/B00D/R0001/In-fill-panel/S4	2m	West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
---------------	--	----	------	--------------------	---------	--

B00D - R0008 - Home Base Store

No Asbestos

B00D - R0009 - Cleaning Supplies

No Asbestos

B00D - R0010 - Deputy Principal

No Asbestos

B00D - R0011 - Communal/Performance Store

No Asbestos

B00D - R0012 - Hall Chair Store

No Asbestos

B00D - R0013 - Movement

No Asbestos

B00D - R0014 - Cleaning Distributed Store

No Asbestos

B00D - R0015 - General Storeroom

No Asbestos

B00D - R0016 - Computer Store

No Asbestos

B00D - R0017 - Practical Activities - 1hb

In-fill-panel	Compressed AC Sheet 4012/B00D/R0001/In-fill-panel/S4	2m	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
---------------	---	----	----------------------	--------------------	---------	--

B00D - R0018 - Home Base

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
In-fill-panel	Compressed AC Sheet	1m	East	Good Condition (1)	Low (1)	Low Priority (2-3)
4012/B00D/R0001/In-fill-panel/S4					Chrysotile (white asbestos)	

B00D - R0019 - Home Base Store

No Asbestos

B00D - R0020 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	103m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4012/B00D/R0020/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00E - General Learning/Administration - 1955 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 4012/B00E/Eaves Linings/S35					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting 4012/B00E/Gable Verge Lining/S36	30m	North & South ends	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Crocidolite (blue asbestos)
Underfloor Voids	No Asbestos Found					

Interior

B00E - R0001 - Home Base

No Asbestos

B00E - R0002 - Home Base

No Asbestos

B00E - R0003 - Home Base Store

No Asbestos

B00E - R0004 - Music Store

No Asbestos

B00E - R0005 - Personal Effects Storage

No Asbestos

B00E - R0006 - Movement

No Asbestos

B00E - R0007 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4012/B00E/R0024/Ceiling Structures/Linings/S2	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	-----	------------	--------------------	---------	--

B00E - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4012/B00E/R0024/Ceiling Structures/Linings/S2	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	-----	------------	--------------------	---------	--

B00E - R0009 - Personal Effects Storage

No Asbestos

B00E - R0010 - Sick Bay

No Asbestos

B00E - R0011 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting 4012/B00E/R0022/Wall Linings Internal/S1	20m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
-----------------------	--	------	--------------------------	--------------------	---------	---

B00E - R0012 - Cleaning Distributed Store

No Asbestos

B00E - R0013 - General Storeroom

No Asbestos

B00E - R0014 - Duplicating Workroom

No Asbestos

B00E - R0015 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting 4012/B00E/R0022/Wall Linings Internal/S1	20m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
-----------------------	--	------	--------------------------	--------------------	---------	---

B00E - R0016 - Movement

No Asbestos

B00E - R0017 - Entry Vestibule

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00E - R0018 - Plant

No Asbestos

B00E - R0019 - Distribution Board Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	3m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
4012/B00E/R0022/Wall Linings Internal/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)		

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4012/B00E/R0024/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)		

B00E - R0020 - Clerical Office/Workroom

No Asbestos

B00E - R0021 - Principal

No Asbestos

B00E - R0022 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	20m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
4012/B00E/R0022/Wall Linings Internal/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0023 - General Storeroom

No Asbestos

B00E - R0024 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4012/B00E/R0024/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)		

B00E - R0025 - Home Base Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1955 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting 4012/B00F/Eaves Linings/S39					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00F - R0001 - Teachers Aide Special Ed**

In-fill-panel	Compressed AC Sheet 4012/B00F/R0001/In-fill-panel/S24	2m	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 4012/B00F/R0001/Ceiling Structures/Linings/S25	48m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0002 - Home Base - Pre

In-fill-panel	Compressed AC Sheet 4012/B00F/R0001/In-fill-panel/S24	2m	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 4012/B00F/R0001/Ceiling Structures/Linings/S25	48m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0003 - Distribution Board

Note: No inspection of live electrical installation.

In-fill-panel	Compressed AC Sheet 4012/B00F/R0003/In-fill-panel/S26	6m	North, South, West	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4012/B00F/R0001/Ceiling Structures/Linings/S25	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0005 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting 4012/B00F/R0001/Ceiling Structures/Linings/S25	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4012/B00F/R0001/Ceiling Structures/Linings/S25	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0007 - Kitchen - Pre

Ceiling Structures/Linings	Flat AC Sheeting 4012/B00F/R0001/Ceiling Structures/Linings/S25	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0008 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting 4012/B00F/R0001/Ceiling Structures/Linings/S25	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Other-After School Care - 1955 - Timber (Timber)

Exterior

Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

Interior

B00G - R0001 - Out Of School Hours Care Centre

No Asbestos

B00G - R0002 - Out Of School Hours Care Centre

No Asbestos

B00G - R0003 - Out Of School Hours Care Centre

In-fill-panel	Compressed AC Sheet 4012/B00G/R0003/In-fill-panel/S22					No Asbestos Detected
In-fill-panel	Compressed AC Sheet 4012/B00G/R0003/In-fill-panel/S23	2m	South, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0004 - Out Of School Hours Care Centre

In-fill-panel	Compressed AC Sheet 4012/B00G/R0003/In-fill-panel/S22					No Asbestos Detected
In-fill-panel	Compressed AC Sheet 4012/B00G/R0003/In-fill-panel/S23	2m	South, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0005 - Out Of School Hours Care Centre

No Asbestos

B00G - R0007 - Other-After School Care

In-fill-panel	Compressed AC Sheet 4012/B00G/R0003/In-fill-panel/S22					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 4012/B00G/R0007/Ceiling Structures/Linings/S40					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 1955 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 4012/B00H/Eaves Linings/S42					No Asbestos Detected
Underfloor Voids	Flat AC Sheeting 4012/B00H/Underfloor Voids/S41	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					

Interior

B00H - R0001 - Home Base

In-fill-panel	Compressed AC Sheet 4012/B00H/R0009/In-fill-panel/S21	2m	South, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
---------------	--	----	-------------	--------------------	---------	--

B00H - R0002 - Home Base

In-fill-panel	Compressed AC Sheet 4012/B00H/R0009/In-fill-panel/S21	2m	South, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
---------------	--	----	-------------	--------------------	---------	--

B00H - R0003 - Home Base

In-fill-panel	Compressed AC Sheet 4012/B00H/R0009/In-fill-panel/S21	2m	South, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
---------------	--	----	-------------	--------------------	---------	--

B00H - R0004 - Home Base

In-fill-panel	Compressed AC Sheet 4012/B00H/R0009/In-fill-panel/S21	2m	South, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
---------------	--	----	-------------	--------------------	---------	--

B00H - R0005 - Staff Room

No Asbestos

B00H - R0006 - Staff Toilet

Wall Linings Internal	Compressed AC Sheet 4012/B00H/R0008/Wall Linings Internal/S19	12m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles 4012/B00H/R0008/Floor Coverings Res/Textile/S20	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00H - R0007 - General Storeroom

No Asbestos

B00H - R0008 - Staff Toilet

Wall Linings Internal	Compressed AC Sheet 4012/B00H/R0008/Wall Linings Internal/S19	12m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles 4012/B00H/R0008/Floor Coverings Res/Textile/S20	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00H - R0009 - Communal Space

In-fill-panel	Compressed AC Sheet 4012/B00H/R0009/In-fill-panel/S21	1m	West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
---------------	--	----	------	--------------------	---------	--

B00H - R0010 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4012/B00H/R0012/Ceiling Structures/Linings/S18					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00H - R0011 - Movement

No Asbestos

B00H - R0012 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4012/B00H/R0012/Ceiling Structures/Linings/S18					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - General Learning - 1955 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 4012/B00I/Eaves Linings/S43					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00I - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4012/B00I/R0001/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)

B00I - R0002 - Movement

No Asbestos

B00I - R0003 - Home Base

In-fill-panel	Compressed AC Sheet	1m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4012/B00I/R0003/In-fill-panel/S17					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00I - R0004 - Home Base Store

No Asbestos

B00I - R0005 - Home Base

In-fill-panel	Compressed AC Sheet	1m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4012/B00I/R0003/In-fill-panel/S17					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00I - R0006 - Personal Effects Storage

No Asbestos

B00I - R0007 - Movement

No Asbestos

B00I - R0008 - Deputy Principal

No Asbestos

B00I - R0009 - General Storeroom

No Asbestos

B00I - R0010 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4012/B00I/R0001/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Pupil Facilities - 1955 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	50m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4012/B00J/Eaves Linings/S45					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	20m	North & South ends	Good Condition (1)	Low (1)	Low Priority (2-3)
	4012/B00J/Gable Verge Lining/S44					Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found					

Interior

B00J - R0001 - Personal Effects Storage

No Asbestos

B00J - R0002 - General Storeroom

No Asbestos

B00J - R0003 - Home Base

No Asbestos

B00J - R0004 - Toilets - Boys/Girls

Wall Linings Internal	Compressed AC Sheet	12m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4012/B00J/R0004/Wall Linings Internal/S12					Chrysotile (white asbestos)

B00J - R0005 - Movement

In-fill-panel	Compressed AC Sheet	12m	Above and below window panes of room 3.	Good Condition (1)	Low (1)	Low Priority (2-3)
	4012/B00J/R0005/In-fill-panel/S13					Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	83m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4012/B00J/R0005/Ceiling Structures/Linings/S14					Chrysotile (white asbestos)

B00J - R0006 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4012/B00J/R0005/Ceiling Structures/Linings/S14					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4012/B00J/R0006/Partition Walls (Cubicles)/S15					Chrysotile (white asbestos)

B00J - R0007 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4012/B00J/R0005/Ceiling Structures/Linings/S14					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4012/B00J/R0006/Partition Walls (Cubicles)/S15					Chrysotile (white asbestos)

B00J - R0008 - Sports Store

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4012/B00J/R0005/Ceiling Structures/Linings/S14					Chrysotile (white asbestos)

B00J - R0009 - Sports Store

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4012/B00J/R0005/Ceiling Structures/Linings/S14					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Pupil Facilities - 1955 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible No Voids					
Ceiling Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 4012/B00K/Eaves Linings/S46	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Interior

B00K - R0001 - Canteen

Ceiling Structures/Linings	Flat AC Sheeting 4012/B00K/R0001/Ceiling Structures/Linings/S8	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	------	------------	--------------------	---------	--

B00K - R0002 - Canteen Office/Store

Ceiling Structures/Linings	Flat AC Sheeting 4012/B00K/R0001/Ceiling Structures/Linings/S8	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	-----	------------	--------------------	---------	--

B00K - R0003 - Canteen Office/Store

Ceiling Structures/Linings	Flat AC Sheeting 4012/B00K/R0001/Ceiling Structures/Linings/S8	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	-----	------------	--------------------	---------	--

B00K - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4012/B00K/R0001/Ceiling Structures/Linings/S8	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	------	------------	--------------------	---------	--

B00K - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4012/B00K/R0001/Ceiling Structures/Linings/S8	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	------	------------	--------------------	---------	--

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00L - Pupil Facilities - 1955 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4012/B00L/Eaves Linings/S47					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible No access door or floor hatch found					
Gable Verge Lining	Flat AC Sheeting	20m	North & South ends	Good Condition (1)	Low (1)	Low Priority (2-3)
	4012/B00L/Gable Verge Lining/S50					Chrysotile (white asbestos)

Interior**B00L - R0001 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	24m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4012/B00L/R0001/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4012/B00L/R0006/Ceiling Structures/Linings/S48					Chrysotile (white asbestos)

B00L - R0002 - No Access

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4012/B00L/R0006/Ceiling Structures/Linings/S48					Chrysotile (white asbestos)

B00L - R0003 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	24m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4012/B00L/R0001/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4012/B00L/R0006/Ceiling Structures/Linings/S48					Chrysotile (white asbestos)

Infill Panel	Flat AC Sheeting					No Asbestos Detected
	4012/B00L/R0003/Infill Panel/S49					

B00L - R0004 - Disabled Toilet

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4012/B00L/R0006/Ceiling Structures/Linings/S48					Chrysotile (white asbestos)

B00L - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4012/B00L/R0006/Ceiling Structures/Linings/S48					Chrysotile (white asbestos)

B00L - R0006 - Garden Store

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4012/B00L/R0006/Ceiling Structures/Linings/S48					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Building Services - 1955 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible No Voids					
Ceiling Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 4012/B00M/Eaves Linings/S51					No Asbestos Detected

Interior

B00M - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Communal Facilities/Pupil Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible No Voids
Ceiling Voids	No Asbestos Found

Interior

B00N - R0001 - Communal Space

No Asbestos

B00N - R0002 - Raised Platform

No Asbestos

B00N - R0003 - Hall Chair Store

No Asbestos

B00N - R0004 - Communal/Performance Store

No Asbestos

B00N - R0005 - P.E. Store

No Asbestos

B00N - R0006 - Toilet - Lobby

No Asbestos

B00N - R0007 - Toilets - Girls

No Asbestos

B00N - R0008 - Sound Cupboard

No Asbestos

B00N - R0009 - Toilet - Lobby

No Asbestos

B00N - R0010 - Toilets - Boys

No Asbestos

B00N - R0011 - Cleaning Distributed Store

No Asbestos

B00N - R0012 - General Storeroom

No Asbestos

B00N - R0013 - Main Switch Board

No Asbestos

B00N - R0014 - Access Shower/Toilet/Change

No Asbestos

B00N - R0015 - Covered Outdoor Learning Area

No Asbestos

B00N - R0016 - Movement

No Asbestos

B00N - R0017 - Ramp

No Asbestos

B00N - R0018 - Movement

No Asbestos

B00N - R0019 - Canteen

No Asbestos

B00N - R0020 - Canteen Office/Store

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017