


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Peakhurst West Public School (4013)  
**Region :** Sydney  
**State Electorate :** Oatley  
**Local Government Area :** Hurstville

**Initial Survey :** Noel Arnold & Associates : 15 - Apr - 2008  
**Reviewed By :** Parsons Brinckerhoff : 28 - Aug - 2015

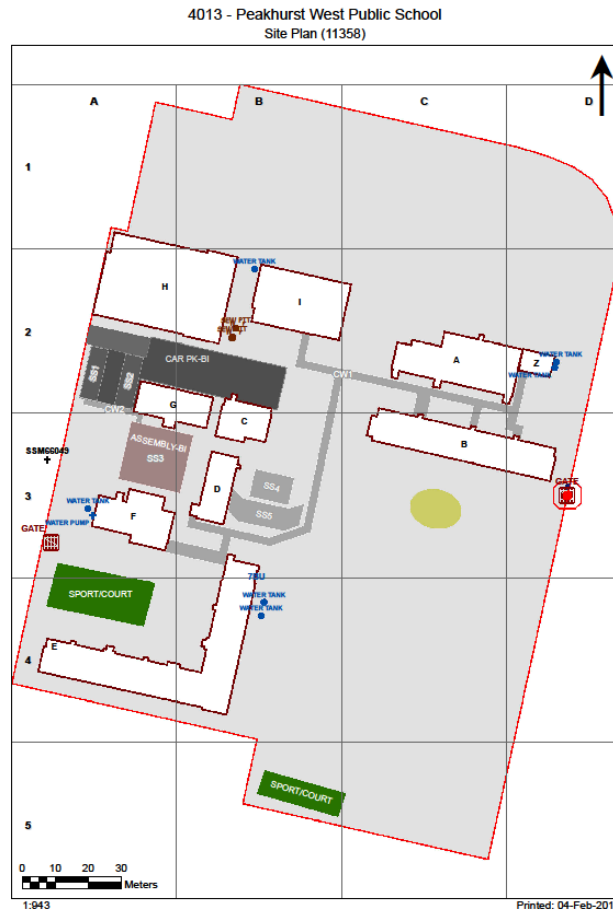

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00A - General Learning - 1958 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4013/B00A/Eaves Linings/S14			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
Gable Verge Lining	Flat AC Sheeting	20m2	East & West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4013/B00A/Gable Verge Lining/S15			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00A - R0001 - Personal Effects Storage**

No Asbestos

**B00A - R0002 - Movement**

No Asbestos

**B00A - R0003 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4013/B00A/R0003/Ceiling Structures/Linings/S3			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00A - R0004 - Home Base**

Heater Backing Board	Flat AC Sheeting	2m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4013/B00A/R0004/Heater Backing Board/S4			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00A - R0005 - Home Base**

Heater Backing Board	Flat AC Sheeting	2m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4013/B00A/R0004/Heater Backing Board/S4			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00A - R0006 - Toilets - Boys/Girls**

No Asbestos

**B00A - R0007 - Movement**

No Asbestos

**B00A - R0008 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4013/B00A/R0003/Ceiling Structures/Linings/S3			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00A - R0009 - Personal Effects Storage**

No Asbestos

**B00A - R0012 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4013/B00A/R0003/Ceiling Structures/Linings/S3			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00A - R0013 - Personal Effects Storage**

No Asbestos

**B00A - R0014 - Home Base Store**

No Asbestos

**B00A - R0016 - External Movement**

No Asbestos

**B00A - R0017 - Home Base**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R0018 - Toilets-Unisex</b>						
Wall Linings Internal	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00A/R0018/Wall Linings Internal/S5					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0019 - Movement</b>						
Wall Linings Internal	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00A/R0018/Wall Linings Internal/S5					<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning - 1958 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting 4013/B00B/Eaves Linings/S16					<b>No Asbestos Detected</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B00B - R0001 - External Movement**

No Asbestos

**B00B - R0002 - Staff Toilet**

Wall Linings Internal	Flat AC Sheeting 4013/B00B/R0002/Wall Linings Internal/S7					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting 4013/B00B/R0021/Ceiling Structures/Linings/S25	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00B - R0003 - Community Clinic**

No Asbestos

**B00B - R0004 - Clerical Office**

No Asbestos

**B00B - R0005 - General Storeroom**

No Asbestos

**B00B - R0006 - Withdrawal Space - 1hb**

No Asbestos

**B00B - R0007 - Staff Room Annexe**

No Asbestos

**B00B - R0008 - Home Base**

Heater Backing Board	Flat AC Sheeting 4013/B00B/R0012/Heater Backing Board/S6	3m2	South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
----------------------	---	-----	------------------------------	--------------------	---------	---

**B00B - R0009 - Home Base**

Heater Backing Board	Flat AC Sheeting 4013/B00B/R0012/Heater Backing Board/S6	3m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
----------------------	---	-----	--------------	--------------------	---------	---

**B00B - R0010 - Home Base**

Heater Backing Board	Flat AC Sheeting 4013/B00B/R0012/Heater Backing Board/S6	3m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
----------------------	---	-----	--------------	--------------------	---------	---

**B00B - R0011 - Home Base**

Heater Backing Board	Flat AC Sheeting 4013/B00B/R0012/Heater Backing Board/S6	3m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
----------------------	---	-----	--------------	--------------------	---------	---

**B00B - R0012 - Practical Activities - 1hb**

Heater Backing Board	Flat AC Sheeting 4013/B00B/R0012/Heater Backing Board/S6	3m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
----------------------	---	-----	--------------	--------------------	---------	---

**B00B - R0013 - Security Store**

No Asbestos

**B00B - R0014 - Movement**

No Asbestos

**B00B - R0015 - Sports Store**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00B - R0016 - Cleaning Distributed Store**

No Asbestos

**B00B - R0017 - Sports Store**

No Asbestos

**B00B - R0018 - Garden Store**

No Asbestos

**B00B - R0019 - External Movement**

No Asbestos

**B00B - R0020 - External Movement**

No Asbestos

**B00B - R0021 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	106m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-------	--------------	--------------------	---------	--------------------

4013/B00B/R0021/Ceiling Structures/Linings/S25

**Chrysotile (white asbestos) , Amosite (brown asbestos)**

**B00B - R0022 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Pupil Facilities/Communal Facilities - 1958 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting 4013/B00G/Eaves Linings/S19					<b>No Asbestos Detected</b>
Gable Verge Lining	Flat AC Sheeting 4013/B00C/Gable Verge Lining/S18	30m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00C - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4013/B00C/R0001/Ceiling Structures/Linings/S26	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
----------------------------	--	------	--------------	--------------------	---------	---

**B00C - R0002 - Home Base**

No Asbestos

**B00C - R0004 - Canteen**

No Asbestos

**B00C - R0005 - Canteen Office/Store**

No Asbestos

**B00C - R0006 - External Movement**

No Asbestos

**B00C - R0007 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Administration/Staff Facilities - 1958 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting 4013/B00G/Eaves Linings/S19					<b>No Asbestos Detected</b>
Gable Verge Lining	Flat AC Sheeting 4013/B00C/Gable Verge Lining/S18	30m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00D - R0001 - External Movement**

No Asbestos

**B00D - R0002 - Staff Room**

No Asbestos

**B00D - R0003 - General Storeroom**

No Asbestos

**B00D - R0004 - Cleaning Distributed Store**

No Asbestos

**B00D - R0005 - Security Store**

Wall Linings Internal	Compressed AC Sheet 4013/B00D/R0005/Wall Linings Internal/S9	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
-----------------------	---	------	--------------	--------------------	---------	--

**B00D - R0006 - Staff Toilet**

Wall Linings Internal	Flat AC Sheeting 4013/B00D/R0006/Wall Linings Internal/S8	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
-----------------------	--	------	--------------	--------------------	---------	--

**B00D - R0007 - Clerical Office/Workroom**

No Asbestos

**B00D - R0008 - Principal**

No Asbestos

**B00D - R0009 - General Storeroom**

No Asbestos

**B00D - R0010 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4013/B00C/R0001/Ceiling Structures/Linings/S26	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
----------------------------	--	-----	--------------	--------------------	---------	---

**B00D - R0011 - Entry Vestibule**

No Asbestos

**B00D - R0012 - Sick Bay**

No Asbestos

**B00D - R0013 - Movement**

No Asbestos

**B00D - R0014 - Staff Toilet**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00E - General Learning - 1958 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting 4013/B00E/Eaves Linings/S17	50m2	East facing, West facing	Good Condition (1) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	Low (1)	Low Priority (2-3)
Ceiling Voids	Flat AC Sheeting 4013/B00E/Ceiling Voids/S22	30m2	Above Rooms R0014 & R0017	Poor Condition - Extensive Damage (4) <b>Chrysotile (white asbestos)</b>	Low (1)	Medium Priority (4-5)
Ceiling Voids	AC Fragments/Debris 4013/B00E/Ceiling Voids/S22	3m2	Above Rooms R0014 & R0017	Poor Condition - Extensive Damage (4) <b>Chrysotile (white asbestos)</b>	Low (1)	Medium Priority (4-5)
Underfloor Voids	AC Fragments/Debris 4013/B00E/Underfloor Voids/S24	1m2	Throughout	Poor Condition - Extensive Damage (4) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	Low (1)	Low Priority (2-3)

**Interior**

**B00E - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4013/B00E/R0001/Ceiling Structures/Linings/S28	20m2	All surfaces	Good Condition (1) <b>Chrysotile (white asbestos)</b>	Low (1)	Low Priority (2-3)
----------------------------	--	------	--------------	--	---------	--------------------

**B00E - R0002 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet 4013/B00E/R0002/Partition Walls (Cubicles)/S1	20m2	All surfaces	Good Condition (1) <b>Chrysotile (white asbestos)</b>	Low (1)	Low Priority (2-3)
----------------------------	--	------	--------------	--	---------	--------------------

**B00E - R0003 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet 4013/B00E/R0002/Partition Walls (Cubicles)/S1	20m2	All surfaces	Good Condition (1) <b>Chrysotile (white asbestos)</b>	Low (1)	Low Priority (2-3)
----------------------------	--	------	--------------	--	---------	--------------------

Ceiling Structures/Linings	Flat AC Sheeting 4013/B00E/R0003/Ceiling Structures/Linings/S27	21m2	All surfaces	Good Condition (1) <b>Chrysotile (white asbestos)</b>	Low (1)	Low Priority (2-3)
----------------------------	--	------	--------------	--	---------	--------------------

**B00E - R0004 - Cleaning Supplies**

Floor Coverings Res/Textile	Vinyl Tiles 4013/B00E/R0004/Floor Coverings Res/Textile/S10	23m2	All surfaces	Good Condition (1) <b>Chrysotile (white asbestos)</b>	Low (1)	Low Priority (2-3)
--------------------------------	--	------	--------------	--	---------	--------------------

**B00E - R0005 - Practical Activities - 1hb**

Floor Coverings Res/Textile	Vinyl Tiles 4013/B00E/R0004/Floor Coverings Res/Textile/S10	54m2	All surfaces	Good Condition (1) <b>Chrysotile (white asbestos)</b>	Low (1)	Low Priority (2-3)
--------------------------------	--	------	--------------	--	---------	--------------------

Heater Backing Board	Flat AC Sheeting 4013/B00E/R0005/Heater Backing Board/S11	3m2	East facing	Good Condition (1) <b>Chrysotile (white asbestos)</b>	Low (1)	Low Priority (2-3)
----------------------	--	-----	-------------	--	---------	--------------------

**B00E - R0006 - Home Base**

Heater Backing Board	Flat AC Sheeting 4013/B00E/R0005/Heater Backing Board/S11	3m2	East facing	Good Condition (1) <b>Chrysotile (white asbestos)</b>	Low (1)	Low Priority (2-3)
----------------------	--	-----	-------------	--	---------	--------------------

**B00E - R0007 - Home Base Store**

No Asbestos

**B00E - R0008 - Staff Room Annexe**

No Asbestos

**B00E - R0009 - Practical Activities - 1hb**

Heater Backing Board	Flat AC Sheeting 4013/B00E/R0005/Heater Backing Board/S11	3m2	East facing	Good Condition (1) <b>Chrysotile (white asbestos)</b>	Low (1)	Low Priority (2-3)
----------------------	--	-----	-------------	--	---------	--------------------

**B00E - R0010 - Home Base**



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Heater Backing Board	Flat AC Sheeting	3m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00E/R0005/Heater Backing Board/S11					Chrysotile (white asbestos)	
<b>B00E - R0011 - Home Base Store</b>						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00E/R0004/Floor Coverings Res/Textile/S10					Chrysotile (white asbestos)	
<b>B00E - R0012 - Home Base Store</b>						
Floor Coverings Res/Textile	Vinyl Tiles	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00E/R0004/Floor Coverings Res/Textile/S10					Chrysotile (white asbestos)	
<b>B00E - R0013 - Home Base</b>						
Heater Backing Board	Flat AC Sheeting	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00E/R0005/Heater Backing Board/S11					Chrysotile (white asbestos)	
<b>B00E - R0014 - Toilets - Girls</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00E/R0002/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00E/R0014/Wall Linings Internal/S12					Chrysotile (white asbestos)	
<b>B00E - R0015 - Cleaning Distributed Store</b>						
Wall Linings Internal	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00E/R0014/Wall Linings Internal/S12					Chrysotile (white asbestos)	
<b>B00E - R0016 - Cleaning Distributed Store</b>						
Wall Linings Internal	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00E/R0014/Wall Linings Internal/S12					Chrysotile (white asbestos)	
<b>B00E - R0017 - Toilets - Boys</b>						
Wall Linings Internal	Flat AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00E/R0014/Wall Linings Internal/S12					Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00E/R0002/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)	
<b>B00E - R0018 - Home Base</b>						
Heater Backing Board	Flat AC Sheeting	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00E/R0005/Heater Backing Board/S11					Chrysotile (white asbestos)	
<b>B00E - R0019 - Home Base</b>						
Heater Backing Board	Flat AC Sheeting	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00E/R0005/Heater Backing Board/S11					Chrysotile (white asbestos)	
<b>B00E - R0020 - General Storeroom</b>						
Floor Coverings Res/Textile	Vinyl Tiles	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00E/R0004/Floor Coverings Res/Textile/S10					Chrysotile (white asbestos)	
<b>B00E - R0021 - Home Base</b>						
Heater Backing Board	Flat AC Sheeting	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00E/R0005/Heater Backing Board/S11					Chrysotile (white asbestos)	
<b>B00E - R0022 - Home Base</b>						
Heater Backing Board	Flat AC Sheeting	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00E/R0005/Heater Backing Board/S11					Chrysotile (white asbestos)	
<b>B00E - R0023 - General Storeroom</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No		Test Result				
Floor Coverings Res/Textile	Vinyl Tiles	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00E/R0004/Floor Coverings Res/Textile/S10		<b>Chrysotile (white asbestos)</b>				
<b>B00E - R0024 - General Storeroom</b>						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00E/R0004/Floor Coverings Res/Textile/S10		<b>Chrysotile (white asbestos)</b>				
<b>B00E - R0025 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00E/R0001/Ceiling Structures/Linings/S28		<b>Chrysotile (white asbestos)</b>				
<b>B00E - R0026 - External Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00C/R0001/Ceiling Structures/Linings/S26		<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>				
<b>B00E - R0027 - External Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00C/R0001/Ceiling Structures/Linings/S26		<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>				
<b>B00E - R0028 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00E/R0001/Ceiling Structures/Linings/S28		<b>Chrysotile (white asbestos)</b>				
<b>B00E - R0029 - External Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00C/R0001/Ceiling Structures/Linings/S26		<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>				
<b>B00E - R0030 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	33m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00E/R0001/Ceiling Structures/Linings/S28		<b>Chrysotile (white asbestos)</b>				
<b>B00E - R0031 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00E/R0001/Ceiling Structures/Linings/S28		<b>Chrysotile (white asbestos)</b>				
<b>B00E - R0032 - External Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00C/R0001/Ceiling Structures/Linings/S26		<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>				
<b>B00E - R0033 - External Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00C/R0001/Ceiling Structures/Linings/S26		<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>				
<b>B00E - R0034 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	36m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00E/R0001/Ceiling Structures/Linings/S28		<b>Chrysotile (white asbestos)</b>				
<b>B00E - R0035 - External Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00C/R0001/Ceiling Structures/Linings/S26		<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>				
<b>B00E - R0036 - Movement</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00E/R0001/Ceiling Structures/Linings/S28					<b>Chrysotile (white asbestos)</b>	
<b>B00E - R0037 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	36m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00E/R0001/Ceiling Structures/Linings/S28					<b>Chrysotile (white asbestos)</b>	
<b>B00E - R0038 - External Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4013/B00C/R0001/Ceiling Structures/Linings/S26					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Library - 1980 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting 4013/B00G/Eaves Linings/S19					<b>No Asbestos Detected</b>
Gable Verge Lining	Flat AC Sheeting 4013/B00C/Gable Verge Lining/S18	40m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
Walkway Ceiling Linings	Flat AC Sheeting 4013/B00F/Walkway Ceiling Linings/S21					<b>No Asbestos Detected</b>
Ceiling Voids	AC Fragments/Debris 4013/B00F/Ceiling Voids/S23	1m2	Above ceiling to Room R0006	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**Interior**

**B00F - R0001 - K.L.A. Store**

No Asbestos

**B00F - R0002 - Library Office/Workroom**

No Asbestos

**B00F - R0003 - K.L.A. Store**

No Asbestos

**B00F - R0004 - Reading Area**

No Asbestos

**B00F - R0005 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4013/B00C/R0001/Ceiling Structures/Linings/S26	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
----------------------------	--	------	--------------	--------------------	---------	---

**B00F - R0006 - Main Switch Board**

Ceiling Structures/Linings	Flat AC Sheeting 4013/B00F/R0006/Ceiling Structures/Linings/S29					<b>No Asbestos Detected</b>
Electrical Backing Board	Resinous Board 4013/B00F/R0006/Electrical Backing Board/S32	1Unit	East	Minimal Damage (2)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**B00F - R0007 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4013/B00C/R0001/Ceiling Structures/Linings/S26	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
----------------------------	--	-----	--------------	--------------------	---------	---

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - General Learning - 1958 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting 4013/B00G/Eaves Linings/S19					<b>No Asbestos Detected</b>
Gable Verge Lining	Flat AC Sheeting 4013/B00C/Gable Verge Lining/S18	30m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00G - R0001 - Home Base**

No Asbestos

**B00G - R0002 - Home Base Store**

No Asbestos

**B00G - R0003 - Personal Effects Storage**

No Asbestos

**B00G - R0004 - Movement**

No Asbestos

**B00G - R0005 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4013/B00C/R0001/Ceiling Structures/Linings/S26	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
----------------------------	--	-----	--------------	--------------------	---------	---

**B00G - R0006 - Cleaning Distributed Store**

No Asbestos

**B00G - R0007 - General Storeroom**

No Asbestos

**B00G - R0008 - Personal Effects Storage**

No Asbestos

**B00G - R0009 - Home Base**

No Asbestos

**B00G - R0010 - Home Base Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Other-Community Use - 1962 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting 4013/B00H/Eaves Linings/S20	60m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Chrysotile (white asbestos) , Amosite (brown asbestos)**

**Interior**

**B00H - R0001 - Other-Community Use**

No Asbestos

**B00H - R0002 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 4013/B00H/R0002/Ceiling Structures/Linings/S30	<b>No Asbestos Detected</b>				
----------------------------	--	-----------------------------	--	--	--	--

**B00H - R0003 - Plant**

No Asbestos

**B00H - R0004 - Plant**

No Asbestos

**B00H - R0005 - Clerical Office/Workroom**

No Asbestos

**B00H - R0006 - Main Switch Board**

No Asbestos

**B00H - R0007 - General Assistant/Bulk Store**

No Asbestos

**B00H - R0008 - Staff Shower/Change**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00I - Pupil Facilities/Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00I - R0001 - Communal Space**

No Asbestos

**B00I - R0002 - Hall Chair Store**

No Asbestos

**B00I - R0003 - Communal/Performance Store**

No Asbestos

**B00I - R0004 - P.E. Store**

No Asbestos

**B00I - R0005 - Toilet - Lobby**

No Asbestos

**B00I - R0006 - Toilets - Girls**

No Asbestos

**B00I - R0007 - Sound Cupboard**

No Asbestos

**B00I - R0008 - Toilet - Lobby**

No Asbestos

**B00I - R0009 - Toilets - Boys**

No Asbestos

**B00I - R0010 - Cleaning Distributed Store**

No Asbestos

**B00I - R0011 - Plant**

No Asbestos

**B00I - R0012 - Toilet - P**

No Asbestos

**B00I - R0013 - Main Switch Board**

No Asbestos

**B00I - R0014 - Covered Outdoor Learning Area**

No Asbestos

**B00I - R0015 - Plant**

No Asbestos

**B00I - R0016 - Ramp**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00Z - Pupil Facilities - 1958 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4013/B00A/Eaves Linings/S14				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Gable Verge Lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4013/B00A/Gable Verge Lining/S15				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior**

**B00Z - R0001 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4013/B00Z/R0001/Partition Walls (Cubicles)/S2				<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4013/B00Z/R0001/Ceiling Structures/Linings/S31				<b>Chrysotile (white asbestos)</b>	

**B00Z - R0002 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4013/B00Z/R0001/Ceiling Structures/Linings/S31				<b>Chrysotile (white asbestos)</b>	

**B00Z - R0003 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4013/B00Z/R0001/Partition Walls (Cubicles)/S2				<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4013/B00Z/R0001/Ceiling Structures/Linings/S31				<b>Chrysotile (white asbestos)</b>	

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Listing of Electronic Attachments as of 22/03/2017***

**Available Asbestos Related Electronic Files**

4013\_ASB\_010713\_AMP.pdf

\* Note : Refer to AMS for details of the attachment(s).

2017