


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Peakhurst South Public School (4323)
Region : Sydney
State Electorate : Oatley
Local Government Area : Hurstville

Initial Survey : Noel Arnold & Associates : 30 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 01 - Nov - 2016

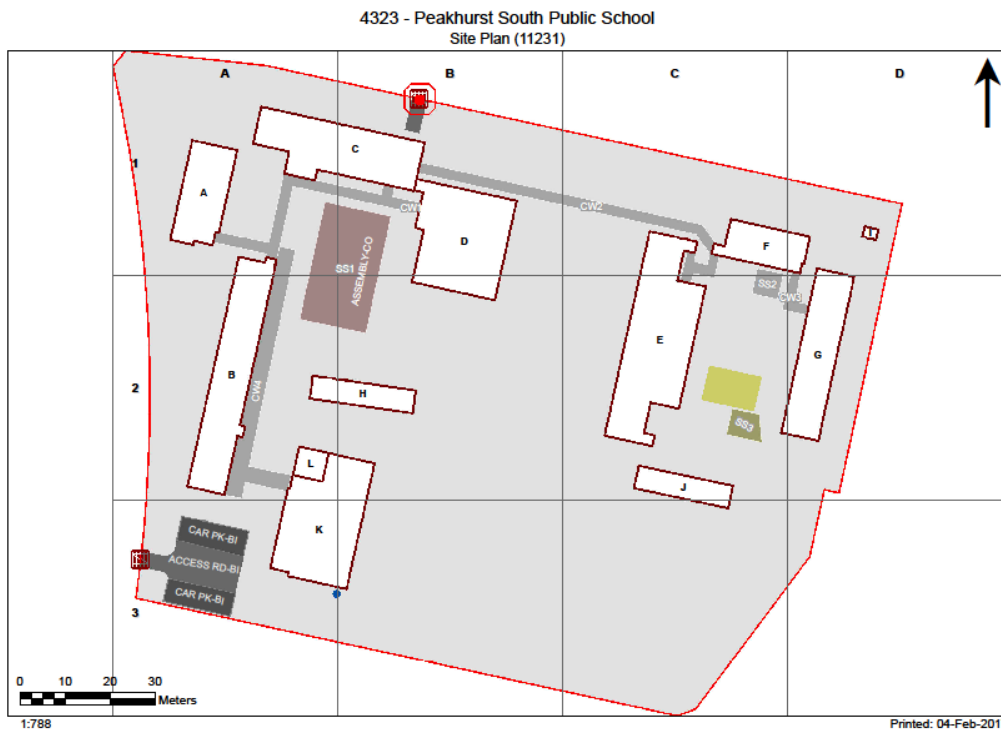

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Staff Facilities - 1963 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting 4323/B00B/Eaves Linings/S16	25m2	East facing, West facing	Good Condition (1) Chrysotile (white asbestos) , Amosite (brown asbestos)	Low (1)	Low Priority (2-3)
Gable Verge Lining	Flat AC Sheeting 4323/B00C/Gable Verge Lining/S26	20m	North facing, South facing	Good Condition (1) Chrysotile (white asbestos)	Low (1)	Low Priority (2-3)
Ceiling Void	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris 4323/B00A/Underfloor Voids/S21	1m2	Variable positions	Poor Condition - Extensive Damage (4) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	Low (1)	Medium Priority (4-5)

Interior**B00A - R0001 - Deputy Principal (17.77 m2)**

No Asbestos

B00A - R0002 - Staff Room (35.99 m2)

No Asbestos

B00A - R0003 - Duplicating Workroom (14.67 m2)

No Asbestos

B00A - R0004 - Principal (18.29 m2)

No Asbestos

B00A - R0005 - Movement (21.15 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4323/B00A/R0016/Ceiling Structures/Linings/S10	22m2	All surfaces	Good Condition (1) Chrysotile (white asbestos)	Low (1)	Low Priority (2-3)
Door In-fill Panel	Flat AC Sheeting 4323/B00A/R0016/Ceiling Structures/Linings/S10	1m2	North facing, Upper portion	Good Condition (1) Chrysotile (white asbestos)	Low (1)	Low Priority (2-3)

B00A - R0006 - Clerical Office (12.42 m2)

No Asbestos

B00A - R0007 - Entry Vestibule (11.94 m2)

No Asbestos

B00A - R0008 - Clerical Office (10.98 m2)

No Asbestos

B00A - R0009 - General Storeroom (12.1 m2)

No Asbestos

B00A - R0010 - Cleaning Distributed Store (2.45 m2)

No Asbestos

B00A - R0011 - Staff Toilet (3.46 m2)

No Asbestos

B00A - R0012 - Staff Toilet (3.44 m2)

No Asbestos

B00A - R0013 - Staff Toilet (3.44 m2)

No Asbestos

B00A - R0014 - Sick Bay (7.53 m2)

No Asbestos

B00A - R0015 - Movement (21.47 m2)

No Asbestos

B00A - R0016 - Movement (0.79 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4323/B00A/R0016/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)	
Door In-fill Panel	Flat AC Sheeting	1m2	South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
4323/B00A/R0016/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)	

B00A - R0017 - General Assistant/Bulk Store (0.78 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1963 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	60m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4323/B00B/Eaves Linings/S16			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Lining	Flat AC Sheeting	10m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4323/B00C/Gable Verge Lining/S26			Chrysotile (white asbestos)		
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00B - R0001 - Movement (2.12 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4323/B00B/R0001/Ceiling Structures/Linings/S1			Chrysotile (white asbestos)		
Door In-fill Panel	Flat AC Sheeting	1m2	South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4323/B00B/R0001/Ceiling Structures/Linings/S1			Chrysotile (white asbestos)		

B00B - R0002 - Movement (3.66 m2)

No Asbestos

B00B - R0003 - Personal Effects Storage (5.26 m2)

No Asbestos

B00B - R0004 - Home Base Store (4.63 m2)

No Asbestos

B00B - R0005 - Home Base (57.13 m2)

No Asbestos

B00B - R0006 - Home Base (57.59 m2)

No Asbestos

B00B - R0007 - Movement (1.42 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4323/B00B/R0001/Ceiling Structures/Linings/S1			Chrysotile (white asbestos)		
Door In-fill Panel	Flat AC Sheeting	1m2	West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4323/B00B/R0001/Ceiling Structures/Linings/S1			Chrysotile (white asbestos)		

B00B - R0008 - Personal Effects Storage (15.64 m2)

No Asbestos

B00B - R0009 - Home Base Store (4.16 m2)

No Asbestos

B00B - R0010 - Home Base Store (4.16 m2)

No Asbestos

B00B - R0011 - Home Base (57.72 m2)

No Asbestos

B00B - R0012 - Home Base (57.13 m2)

No Asbestos

B00B - R0013 - Movement (2.35 m2)

Door In-fill Panel	Flat AC Sheeting	0.5m2	West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4323/B00B/R0001/Ceiling Structures/Linings/S1			Chrysotile (white asbestos)		

B00B - R0014 - Personal Effects Storage (20.13 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0015 - Home Base Store (6.12 m2)						
No Asbestos						
B00B - R0016 - Withdrawal Space - 1hb (10.79 m2)						
No Asbestos						
B00B - R0017 - Home Base (90.7 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Pupil Facilities - 1963 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 4323/B00B/Eaves Linings/S16	40m2	North facing, South facing	Good Condition (1) Chrysotile (white asbestos) , Amosite (brown asbestos)	Low (1)	Low Priority (2-3)
Gable Verge Lining	Flat AC Sheeting 4323/B00C/Gable Verge Lining/S26	10m	East facing, West facing	Good Condition (1) Chrysotile (white asbestos)	Low (1)	Low Priority (2-3)
Ceiling Void	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris 4323/B00C/Underfloor Voids/S19					No Asbestos Detected

Interior**B00C - R0001 - Home Base (57.14 m2)**

No Asbestos

B00C - R0002 - Movement (84.6 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4323/B00C/R0002/Ceiling Structures/Linings/S2	85m2	All surfaces	Minimal Damage (2) Chrysotile (white asbestos)	Low (1)	Low Priority (2-3)
----------------------------	---	------	--------------	--	---------	--------------------

B00C - R0003 - Home Base (57.16 m2)

No Asbestos

B00C - R0004 - Home Base Store (4.77 m2)

No Asbestos

B00C - R0005 - Cleaning Distributed Store (0.65 m2)

No Asbestos

B00C - R0006 - Personal Effects Storage (14.32 m2)

Door In-fill Panel	Flat AC Sheeting 4323/B00C/R0002/Ceiling Structures/Linings/S2	1m2	South facing, Upper portion	Good Condition (1) Chrysotile (white asbestos)	Low (1)	Low Priority (2-3)
--------------------	---	-----	--------------------------------	--	---------	--------------------

B00C - R0007 - P.E. Store (0.67 m2)

No Asbestos

B00C - R0008 - Sports Store (4.8 m2)

No Asbestos

B00C - R0009 - Communal Space (56.53 m2)

No Asbestos

B00C - R0010 - Communal Space (56.15 m2)

No Asbestos

B00C - R0011 - Sports Store (4.74 m2)

No Asbestos

B00C - R0012 - Home Base Store (4.74 m2)

No Asbestos

B00C - R0013 - General Storeroom (5.34 m2)

No Asbestos

B00C - R0014 - Movement (12.18 m2)

Door In-fill Panel	Flat AC Sheeting 4323/B00C/R0002/Ceiling Structures/Linings/S2	1m2	South facing, Upper portion	Good Condition (1) Chrysotile (white asbestos)	Low (1)	Low Priority (2-3)
--------------------	---	-----	--------------------------------	--	---------	--------------------

B00C - R9001 - Staff Toilet (3.06 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4323/B00C/R9005/Ceiling Structures/Linings/S14	4m2	All surfaces	Good Condition (1) Chrysotile (white asbestos) , Amosite (brown asbestos)	Low (1)	Low Priority (2-3)
----------------------------	--	-----	--------------	---	---------	--------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00C - R9002 - Canteen (41.21 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	42m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4323/B00C/R9005/Ceiling Structures/Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R9003 - Canteen Office/Store (2.28 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4323/B00C/R9003/Ceiling Structures/Linings/S27				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00C - R9004 - Movement (27.19 m2)						
Ceiling Structures/Linings	Vermiculite					
4323/B00C/R9004/Ceiling Structures/Linings/S23				Limited Samples Taken		
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R9005 - Movement (35.17 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	36m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4323/B00C/R9005/Ceiling Structures/Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R9006 - General Storeroom (7.75 m2)						
Ceiling Structures/Linings	Vermiculite	8m2	All surfaces	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
4323/B00C/R0002/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)		
B00C - R9007 - General Assistant/Bulk Store (12.83 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4323/B00C/R9005/Ceiling Structures/Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00C - R9008 - P.E. Store (12.93 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4323/B00C/R9005/Ceiling Structures/Linings/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning/Library - 1974 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	22m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4323/B00B/Eaves Linings/S16			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Lining	Flat AC Sheeting	10m	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4323/B00C/Gable Verge Lining/S26			Chrysotile (white asbestos)		
Ceiling Void	No Asbestos Found					

Interior

B00D - R0001 - Movement (62.85 m2)

No Asbestos

B00D - R0002 - Library Office/Workroom (21.14 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4323/B00D/R0002/Ceiling Structures/Linings/S24					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0003 - Communications Room (12.18 m2)

Wall Linings Internal	Vermiculite					Limited Samples Taken
	4323/B00D/R0002/Ceiling Structures/Linings/S24					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4323/B00D/R0003/Ceiling Structures/Linings/S15					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0004 - Library Office/Workroom (8.39 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4323/B00D/R0003/Ceiling Structures/Linings/S15					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0005 - K.L.A. Store (17.51 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4323/B00D/R0003/Ceiling Structures/Linings/S15					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0006 - K.L.A. Store (17.78 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4323/B00D/R0003/Ceiling Structures/Linings/S15					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0007 - Reading Area (248.52 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4323/B00D/R0003/Ceiling Structures/Linings/S15					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0008 - Cleaning Distributed Store (1.93 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4323/B00D/R0002/Ceiling Structures/Linings/S24					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0009 - Toilets - Girls (3.89 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4323/B00D/R0003/Ceiling Structures/Linings/S15					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0010 - Movement (7.83 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4323/B00D/R0003/Ceiling Structures/Linings/S15					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R0011 - Toilets - Boys (3.78 m2)						
Ceiling Structures/Linings	Vermiculite					
	4323/B00D/R0003/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0012 - Distribution Board (1.85 m2)						
					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Vermiculite					
	4323/B00D/R0003/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1001 - Practical Activities - 1hb (16.84 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4323/B00D/R1005/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
B00D - R1002 - Movement (2.75 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	4323/B00D/R1014/Ceiling Structures/Linings/S22					No Asbestos Detected
B00D - R1003 - Movement (57.9 m2)						
No Asbestos						
B00D - R1004 - General Storeroom (15.08 m2)						
No Asbestos						
B00D - R1005 - Practical Activities - 1hb (16.66 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4323/B00D/R1005/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
B00D - R1006 - Home Base (50.68 m2)						
No Asbestos						
B00D - R1007 - Home Base (51.45 m2)						
No Asbestos						
B00D - R1008 - Practical Activities - 1hb (16.69 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4323/B00D/R1005/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
B00D - R1009 - Toilets - Girls (4.73 m2)						
No Asbestos						
B00D - R1010 - Distribution Board (0.7 m2)						
					Note: No inspection of live electrical installation.	
No Asbestos						
B00D - R1011 - Cleaning Distributed Store (3.77 m2)						
No Asbestos						
B00D - R1012 - Toilets - Boys (4.31 m2)						
No Asbestos						
B00D - R1013 - Craft Store (12.09 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4323/B00D/R1005/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
B00D - R1014 - Movement (23.85 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	4323/B00D/R1014/Ceiling Structures/Linings/S22					No Asbestos Detected
B00D - R1015 - Practical Activities - 1hb (17 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4323/B00D/R1005/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
B00D - R1016 - Home Base (51.33 m2)						
No Asbestos						
B00D - R1017 - Home Base (51.8 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1963 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 4323/B00B/Eaves Linings/S16	44m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Lining	Flat AC Sheeting 4323/B00C/Gable Verge Lining/S26	10m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos)		
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00E - R0001 - Movement (4.49 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4323/B00A/R0016/Ceiling Structures/Linings/S10	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos)		

B00E - R0002 - Movement (3.13 m2)

No Asbestos

B00E - R0003 - Personal Effects Storage (10.62 m2)

No Asbestos

B00E - R0004 - Home Base (56.38 m2)

No Asbestos

B00E - R0005 - Home Base (84.76 m2)

No Asbestos

B00E - R0006 - Outdoor Learning Area (168.71 m2)

No Asbestos

B00E - R0007 - Movement (9.81 m2)

No Asbestos

B00E - R0008 - Practical Activities - 1hb (11.14 m2)

No Asbestos

B00E - R0009 - Toilets - Boys/Girls (4.31 m2)

No Asbestos

B00E - R0010 - Toilets - Boys/Girls (4.5 m2)

No Asbestos

B00E - R0011 - Practical Activities - 1hb (11.43 m2)

No Asbestos

B00E - R0012 - Home Base (86.21 m2)

No Asbestos

B00E - R0013 - Home Base (56.88 m2)

No Asbestos

B00E - R0014 - Personal Effects Storage (10.49 m2)

No Asbestos

B00E - R0015 - Movement (3.18 m2)

No Asbestos

B00E - R0016 - Movement (4.57 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4323/B00A/R0016/Ceiling Structures/Linings/S10	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00F - Administration - 1963 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting	14m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4323/B00B/Eaves Linings/S16			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4323/B00F/Gable Verge Lining/S25			Chrysotile (white asbestos)		
Ceiling Void	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	4323/B00F/Underfloor Voids/S20			Chrysotile (white asbestos)		

Interior**B00F - R0001 - Staff Room (37.97 m2)**

No Asbestos

B00F - R0002 - Movement (4.71 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4323/B00A/R0016/Ceiling Structures/Linings/S10			Chrysotile (white asbestos)		

B00F - R0003 - Movement (34.56 m2)

Floor Coverings Res/Textile	Vinyl Tiles	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4323/B00F/R0005/Floor Coverings Res/Textile/S6			Chrysotile (white asbestos)		

B00F - R0004 - Movement (4.46 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4323/B00A/R0016/Ceiling Structures/Linings/S10			Chrysotile (white asbestos)		

B00F - R0005 - Cleaning Distributed Store (4.36 m2)

Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4323/B00F/R0005/Floor Coverings Res/Textile/S6			Chrysotile (white asbestos)		

B00F - R0006 - Staff Toilet (3.2 m2)

Wall Linings Internal	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4323/B00F/R0006/Wall Linings Internal/S5			Chrysotile (white asbestos)		

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4323/B00F/R0006/Wall Linings Internal/S5			Chrysotile (white asbestos)		

B00F - R0007 - P.E. Store (7.44 m2)

Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4323/B00F/R0005/Floor Coverings Res/Textile/S6			Chrysotile (white asbestos)		

B00F - R0008 - Interview (16.69 m2)

No Asbestos

B00F - R0009 - General Storeroom (0.98 m2)

Recently Modified Space Requires Inspection

B00F - R0010 - Staff Room (21.23 m2)

No Asbestos

B00F - R0011 - General Assistant/Bulk Store (0.56 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning/Other-After School Care - 1963 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 4323/B00B/Eaves Linings/S16	36m2	East facing, West facing	Good Condition (1) Chrysotile (white asbestos) , Amosite (brown asbestos)	Low (1)	Low Priority (2-3)
Gable Verge Lining	Flat AC Sheeting 4323/B00C/Gable Verge Lining/S26	20m	North facing, South facing	Good Condition (1) Chrysotile (white asbestos)	Low (1)	Low Priority (2-3)
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00G - R0001 - Out Of School Hours Care Centre (57.99 m2)

No Asbestos

B00G - R0002 - General Storeroom (4.55 m2)

No Asbestos

B00G - R0003 - Home Base Store (4.55 m2)

No Asbestos

B00G - R0004 - Personal Effects Storage (8.65 m2)

No Asbestos

B00G - R0005 - Movement (5.93 m2)

No Asbestos

B00G - R0006 - Movement (1.49 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4323/B00G/R0013/Ceiling Structures/Linings/S7	2m2	All surfaces	Good Condition (1) Chrysotile (white asbestos)	Low (1)	Low Priority (2-3)
----------------------------	---	-----	--------------	--	---------	--------------------

B00G - R0007 - Home Base (56.07 m2)

No Asbestos

B00G - R0008 - Home Base (57.44 m2)

No Asbestos

B00G - R0009 - Home Base Store (4.55 m2)

No Asbestos

B00G - R0010 - Home Base Store (4.55 m2)

No Asbestos

B00G - R0011 - Shower/Change (8.36 m2)

No Asbestos

B00G - R0012 - Laundry - Type 2 (5.91 m2)

No Asbestos

B00G - R0013 - Movement (1.5 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4323/B00G/R0013/Ceiling Structures/Linings/S7	2m2	All surfaces	Good Condition (1) Chrysotile (white asbestos)	Low (1)	Low Priority (2-3)
----------------------------	---	-----	--------------	--	---------	--------------------

B00G - R0014 - Home Base (57.94 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Pupil Facilities - 1963 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 4323/B00H/Eaves Linings/S17	6m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Voids	Non Accessible Area - No Access - No manhole located in Building					

Interior

B00H - R0001 - Toilets - Girls (50.28 m2)

No Asbestos

B00H - R0002 - Toilets - Boys (50.06 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Administration - 1963 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Void No Asbestos Found

Interior

B001 - R0001 - General Storeroom (6.03 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Pupil Facilities - 1963 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	9m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4323/B00J/Eaves Linings/S18					Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00J - R0001 - Toilets - Boys (42.44 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4323/B00J/R0001/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos)

B00J - R0002 - Garden Store (3.71 m2)

No Asbestos

B00J - R0003 - Cleaning Distributed Store (3.71 m2)

No Asbestos

B00J - R0004 - Toilets - Girls (42.54 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	14m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4323/B00J/R0001/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Pupil Facilities - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00K - R0001 - Communal Space (146.52 m2)**

No Asbestos

B00K - R0002 - Raised Platform (59.51 m2)

No Asbestos

B00K - R0003 - Hall Chair Store (9.59 m2)

No Asbestos

B00K - R0004 - Communal/Performance Store (9.55 m2)

No Asbestos

B00K - R0005 - P.E. Store (13.12 m2)

No Asbestos

B00K - R0006 - Toilet - Lobby (2.3 m2)

No Asbestos

B00K - R0007 - Toilets - Girls (7.22 m2)

No Asbestos

B00K - R0008 - Sound Cupboard (2.24 m2)

No Asbestos

B00K - R0009 - Toilets - Boys (5.49 m2)

No Asbestos

B00K - R0010 - Toilet - Lobby (3.23 m2)

No Asbestos

B00K - R0011 - Plant (0.36 m2)

No Asbestos

B00K - R0012 - Cleaning Distributed Store (5.02 m2)

No Asbestos

B00K - R0013 - Toilet - P (6.49 m2)

No Asbestos

B00K - R0014 - Main Switch Board (3.47 m2)

No Asbestos

B00K - R0015 - Covered Outdoor Learning Area (119.45 m2)

No Asbestos

B00K - R0016 - Movement (12.12 m2)

No Asbestos

B00K - R0017 - Movement (6.41 m2)

No Asbestos

B00K - R0018 - Ramp (11.39 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Pupil Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00L - R0001 - Canteen (27.32 m2)

No Asbestos

B00L - R0002 - Canteen Office/Store (8.29 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Metal Shed

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Void No Asbestos Found

Interior

B00M - R0001 - Shed

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

4323_ASB_010713_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017