


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Pleasant Heights Public School (4357)
Region : Illawarra and South East
State Electorate : Keira
Local Government Area : Wollongong

Initial Survey : Noel Arnold & Associates : 12 - May - 2008
Reviewed By : AECOM : 18 - Jun - 2015

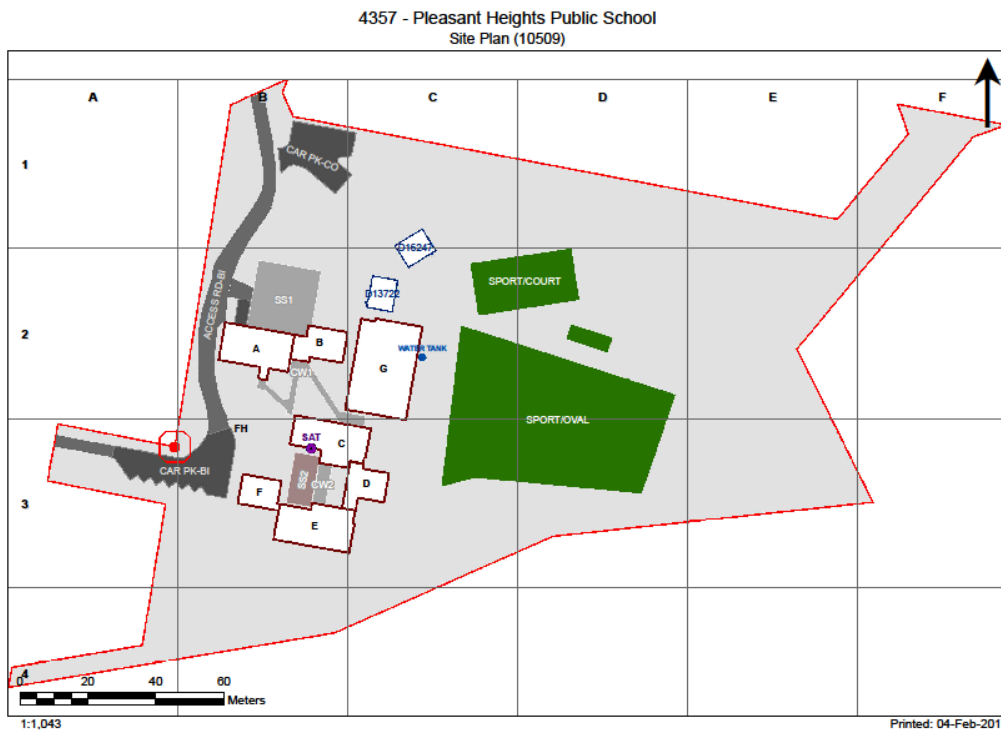

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Communal Facilities - 1969 - Brick/Block (Brick/Block)

Exterior

Gable Verge Lining	Flat AC Sheeting	8m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Wall Cladding	Flat AC Sheeting	3m2	East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00A - R0001 - External Movement (41.22 m2)

No Asbestos

B00A - R0002 - Toilets - Boys (8.28 m2)

Ceiling Structures/Linings	Vermiculite	4357/B00A/R0004/Ceiling Structures/Linings/S11		Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00A - R0003 - Toilets - Girls (9.37 m2)

Ceiling Structures/Linings	Vermiculite	4357/B00A/R0004/Ceiling Structures/Linings/S11		Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00A/R1012/Partition Walls (Cubicles)/S6				Chrysotile (white asbestos)		

B00A - R0004 - Communal Space (97.38 m2)

Ceiling Structures/Linings	Vermiculite	4357/B00A/R0004/Ceiling Structures/Linings/S11		Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

Floor Coverings Res/Textile	Vinyl Tiles	98m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00A/R0004/Floor Coverings Res/Textile/S7				Chrysotile (white asbestos)		

Ceiling Structures/Linings	Compressed AC Sheet	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00A/R0004/Ceiling Structures/Linings/S12				Chrysotile (white asbestos)		

B00A - R0005 - Staff Toilet (3.84 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00A/R1012/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)		

B00A - R0006 - Canteen Office/Store (3.46 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00A/R1012/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)		

B00A - R0007 - Canteen Office/Store (7.95 m2)

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00E/R1004/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		

B00A - R0008 - Canteen (20.38 m2)

Floor Coverings Res/Textile	Vinyl Tiles	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00E/R1004/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		

B00A - R0009 - Raised Platform (11.83 m2)

Recently Modified Space Requires Inspection

B00A - R1001 - Staff Toilet (2.13 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00A - R1002 - General Storeroom (1.36 m2)

Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00E/R1004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B00A - R1003 - Principal (17.5 m2)

No Asbestos

B00A - R1004 - Duplicating Workroom (22.15 m2)

Floor Coverings Res/Textile	Vinyl Tiles	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00E/R1004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B00A - R1005 - General Storeroom (0.64 m2)

Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00E/R1004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B00A - R1006 - Movement (18.65 m2)

No Asbestos

B00A - R1007 - Entry Vestibule (7.45 m2)

No Asbestos

B00A - R1008 - External Movement (8.51 m2)

No Asbestos

B00A - R1009 - Sick Bay (7.96 m2)

No Asbestos

B00A - R1010 - Staff Shower/Change (7.33 m2)

No Asbestos

B00A - R1011 - Cleaning Distributed Store (1.88 m2)

No Asbestos

B00A - R1012 - Staff Shower/Change (6.92 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00A/R1012/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00A/R1012/Partition Walls (Cubicles)/S6					Chrysotile (white asbestos)	

B00A - R1013 - Distribution Board (0.49 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00A - R1014 - Staff Room (39.86 m2)

No Asbestos

B00A - R1015 - Interview (13.39 m2)

No Asbestos

B00A - R1016 - Clerical Office (13.39 m2)

No Asbestos

B00A - R1017 - External Movement (40.16 m2)

Ceiling Structures/Linings	Flat AC Sheeting	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00E/R1010/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1969 - Brick/Block (Brick/Block)

Exterior

Gable Verge Lining	Flat AC Sheeting	8m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Wall Cladding	Flat AC Sheeting	3m2	East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00B - R0001 - Home Base (66.21 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken	
		4357/B00B/R0001/Ceiling Structures/Linings/S8				Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works	

B00B - R0002 - Cleaning Distributed Store (5.25 m2)

No Asbestos

B00B - R0004 - Practical Activities - 1hb (10.88 m2)

No Asbestos

B00B - R0005 - External Stairs (0.99 m2)

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
		4357/B00A/R1012/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)	

B00B - R0006 - External Movement (40.03 m2)

Ceiling Structures/Linings	Flat AC Sheeting	20m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	
		4357/B00A/R1012/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)	

B00B - R1001 - Home Base (67.87 m2)

No Asbestos

B00B - R1002 - External Movement (16.21 m2)


Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
		4357/B00E/R1010/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)	

B00B - R1003 - Practical Activities - 1hb (11.17 m2)

No Asbestos

B00B - R1004 - External Stairs (5.65 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
		4357/B00A/R1012/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)	

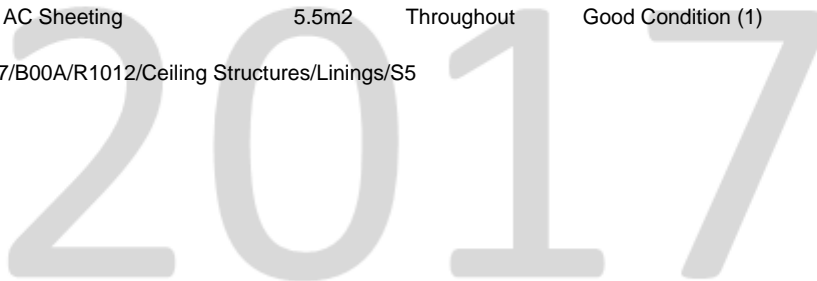

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1969 - Brick/Block (Brick/Block)

Exterior

Gable Verge Lining	Flat AC Sheeting	8m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Wall Cladding	Flat AC Sheeting	3m2	East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00C - R0001 - External Movement (55.03 m2)

No Asbestos

B00C - R0002 - Main Switch Board (8.37 m2)

No Asbestos

B00C - R0003 - Kiln Room (8.61 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
4357/B00C/R0004/Floor Coverings Res/Textile/S4					No Asbestos Detected	

B00C - R0004 - Sports Store (10.26 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
4357/B00C/R0004/Floor Coverings Res/Textile/S4					No Asbestos Detected	

B00C - R0005 - External Stairs (9.76 m2)

No Asbestos

B00C - R1001 - Home Base Store (5.23 m2)

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00E/R1004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B00C - R1002 - Personal Effects Storage (8.16 m2)

Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00E/R1004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B00C - R1003 - Home Base (57.49 m2)

No Asbestos

B00C - R1004 - Movement (25.3 m2)

Floor Coverings Res/Textile	Vinyl Tiles	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00E/R1004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B00C - R1005 - Music Store (5.61 m2)

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00E/R1004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B00C - R1006 - Security Store (39.54 m2)

Floor Coverings Res/Textile	Vinyl Tiles	39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00E/R1004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B00C - R1007 - Distribution Board (0.79 m2)

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00E/R1004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B00C - R1008 - Cleaning Distributed Store (2.13 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00E/R1004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00C - R1009 - Staff Toilet (3.78 m2)						
No Asbestos						
B00C - R1010 - Staff Toilet (4.7 m2)						
No Asbestos						
B00C - R1011 - Home Base Store (16.18 m2)						
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible - material						
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00E/R1004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00C - R1013 - External Movement (29.82 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	29m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00C/R1013/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	
B00C - R1014 - External Stairs (9.76 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00D - General Learning - 1969 - Brick/Block (Brick/Block)

Exterior

Gable Verge Lining	Flat AC Sheeting	8m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Wall Cladding	Flat AC Sheeting	3m2	East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

Interior

B00D - R0001 - Home Base (57.9 m2)

Ceiling Structures/Linings	Vermiculite 4357/B00D/R0004/Ceiling Structures/Linings/S10			Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible						

B00D - R0002 - Personal Effects Storage (7.03 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4357/B00E/R1004/Floor Coverings Res/Textile/S2	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
Ceiling Structures/Linings	Vermiculite 4357/B00D/R0004/Ceiling Structures/Linings/S10			Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0003 - Distribution Board (0.83 m2)

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Tiles 4357/B00E/R1004/Floor Coverings Res/Textile/S2	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
Ceiling Structures/Linings	Vermiculite 4357/B00D/R0004/Ceiling Structures/Linings/S10			Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0004 - Home Base Store (5.17 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4357/B00E/R1004/Floor Coverings Res/Textile/S2	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						
Ceiling Structures/Linings	Vermiculite 4357/B00D/R0004/Ceiling Structures/Linings/S10			Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0005 - External Movement (37.7 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4357/B00E/R1010/Ceiling Structures/Linings/S3	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						

B00D - R1001 - Special Programs Room (58.05 m2)

No Asbestos

B00D - R1002 - Personal Effects Storage (7.11 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4357/B00E/R1004/Floor Coverings Res/Textile/S2	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						

B00D - R1003 - Distribution Board (0.84 m2)

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Tiles 4357/B00E/R1004/Floor Coverings Res/Textile/S2	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos)						

B00D - R1004 - Home Base Store (5.2 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00E/R1004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00D - R1005 - External Movement (33.44 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00E/R1010/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
B00D - R9001 - Garden Store (8.82 m2)						
No Asbestos						
B00D - R9002 - Sports Store (8.32 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1969 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	8m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Wall Cladding	Flat AC Sheeting	3m2	East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00E - R0001 - Toilets - Boys (36.31 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00E/R0001/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)	

B00E - R0002 - Toilets - Girls (36.23 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00E/R0001/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)	

B00E - R0003 - Cleaning Distributed Store (3.4 m2)

No Asbestos

B00E - R0004 - External Movement (21.05 m2)

No Asbestos

B00E - R0005 - External Stairs (9.17 m2)

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00E/R1010/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	

B00E - R1001 - Personal Effects Storage (7.06 m2)

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00E/R1004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B00E - R1002 - Distribution Board (0.83 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00E - R1003 - Home Base (58.22 m2)

No Asbestos

B00E - R1004 - Home Base Store (5.15 m2)

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00E/R1004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B00E - R1005 - Withdrawal Space - 1hb (4.54 m2)

No Asbestos

B00E - R1006 - Home Base (81.42 m2)

No Asbestos

B00E - R1007 - Toilets - Boys/Girls (3.46 m2)

No Asbestos

B00E - R1008 - Home Base Store (2.65 m2)

Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00E/R1004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B00E - R1009 - Personal Effects Storage (7.25 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00E/R1004/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00E - R1010 - External Movement (55.5 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00E/R1010/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
B00E - R1011 - External Stairs (9.17 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00E/R1010/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00F - General Learning - 1969 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	8m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Wall Cladding	Flat AC Sheeting	3m2	East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

Interior**B00F - R0001 - Cleaning Distributed Store (3.82 m2)**

No Asbestos

B00F - R0002 - External Movement (4.19 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)
4357/B00E/R1010/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)		

B00F - R0003 - External Stairs (6.23 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)
4357/B00E/R1010/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)		

B00F - R1001 - Personal Effects Storage (5.54 m2)

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00E/R1004/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		

B00F - R1002 - Distribution Board (0.41 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

B00F - R1003 - Home Base Store (7.26 m2)

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00E/R1004/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)		

B00F - R1004 - Home Base (57.9 m2)

No Asbestos

B00F - R1005 - External Movement (15.85 m2)

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4357/B00E/R1010/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)		

B00F - R1006 - External Movement (2.92 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2.9m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)
4357/B00E/R1010/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00G - Communal Facilities - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

No Asbestos

Interior

B00G - R0001 - Communal Space (238.43 m2)

No Asbestos

B00G - R0002 - Covered Outdoor Learning Area (156.09 m2)

No Asbestos

B00G - R0003 - Hall Chair Store (9.53 m2)

No Asbestos

B00G - R0004 - Communal/Performance Store (9.53 m2)

No Asbestos

B00G - R0005 - P.E. Store (12.92 m2)

No Asbestos

B00G - R0006 - Toilet - Lobby (2.44 m2)

No Asbestos

B00G - R0007 - Toilets - Girls (7.2 m2)

No Asbestos

B00G - R0008 - Sound Cupboard (2.03 m2)

No Asbestos

B00G - R0009 - Toilet - Lobby (3.36 m2)

No Asbestos

B00G - R0010 - Toilets - Boys (5.74 m2)

No Asbestos

B00G - R0011 - Cleaning Distributed Store (3.45 m2)

No Asbestos

B00G - R0012 - General Storeroom (1.61 m2)

No Asbestos

B00G - R0013 - Main Switch Board (3.34 m2)

No Asbestos

B00G - R0014 - Access Shower/Toilet/Change (6.87 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D12846 - Learning Unit - Standard With P.A.A. : Placement Date - 14/02/2013

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

OS 534 - D13663 - Library/Group Study/Office/A V Store : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	23.04 m2

Interior

R1 - Clerical Office

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - Staff Room

Ceiling	Flat AC Sheet	Assumed Asbestos	36 m2
---------	---------------	------------------	-------

R3 - Security Store

Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2
---------	---------------	------------------	------

R4 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos	16 m2
---------	---------------	------------------	-------

R5 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	5 m2

R6 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	5 m2

R7 - Reading Area

Ceiling	Flat AC Sheet	Assumed Asbestos	54 m2
---------	---------------	------------------	-------

R8 - Entry

Ceiling	Flat AC Sheet	Assumed Asbestos	14 m2
---------	---------------	------------------	-------

OS 602 - D13674 - Learning Unit - Standard With P.A.A. : Placement Date - 12/02/2011

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 602 - D13722 - Learning Unit - Standard With P.A.A. : Placement Date - 6/01/2015						
Exterior						
Step Treads	Compressed AC Sheet	Assumed Asbestos			1.08 m2	
Landing	Compressed AC Sheet	Assumed Asbestos			1.2 m2	
Eave Lining	Flat AC Sheet	Assumed Asbestos			11.52 m2	
Interior						
R1 - Learning space/withdrawal/entry						
Ceiling	Flat AC Sheet	Assumed Asbestos			70 m2	
R2 - Home Base Store						
End wall panel	Flat AC Sheet	Assumed Asbestos			18 m2	
Ceiling	Flat AC Sheet	Assumed Asbestos			3 m2	
OS 602 - D16247 - Learning Unit - Standard With P.A.A. : Placement Date - 28/01/2016						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

4357_ASB_010713_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017